



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101505

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 10/03/2021
Reference CC3/FCI18006191/Kea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SHF 614C
Insured Veh. SHD 8595G
Claim No. D18002484MFSH
Policy No. D-18088937MFSH
Accident Date 25/03/2018
Inspection Date 03/04/2018

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC3/FCI18006191/Kea3q2	
			Date: 10/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 8595G	Veh. Inspected	SHF 614C	
Policy No.	D-18088937MFSH	Coverage (\$)	0.00	
Claim No.	D18002484MFSH	Excess (\$)	0.00	
Assign From	MERINA	Assign Date	03/04/2018	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	VF1ABL15AUC278492	Colour	METALLIC WHITE / RED	
Odometer	268912 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	PRIMEWELL	7 mm	
L/H Front Tyre	215/60 R16	PRIMEWELL	7 mm	
R/H Rear Tyre	215/60 R16	ROVELO	6 mm	
L/H Rear Tyre	215/60 R16	ROVELO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION AND FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/03/2018	Inspection Date	03/04/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 614C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	BENT	1,259.42	1,259.42
1	BUMPER SPOILER FRT	DISTORTED	181.75	181.75
1	BUMPER ABSORBER FRT	CRACKED	394.68	394.68
1	BUMPER RETAINER FRT LH	DISTORTED	151.41	151.41
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH	DISTORTED	150.77	150.77
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT	MISSING	472.83	472.83
1	BUMPER GRILLE LOWER FRT	MISSING	266.80	266.80
1	BUMPER FOG LAMP GRILLE LH	MISSING	207.21	207.21
1	BUMPER FOG LAMP GRILLE RH	DENTED	207.21	207.21
1	BUMPER BEAM FRT	BENT	914.08	914.08
1	TOW COVER FRT	DENTED	28.61	28.61
1	RADIATOR GRILLE	CRACKED	1,707.78	1,707.78
1	RADIATOR GRILLE BADGE 'RENAULT'	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	CRACKED	1,353.75	1,353.75
1	FRAME FULL SUPPORT PANEL	CRACKED	615.90	615.90
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	89.79	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	HORN	SERVICEABLE	314.17	-
1	HORN BRACKET	BENT	40.45	40.45
1	HEADLAMP LH	MTG CRACKED	1,184.43	1,184.43
1	HEADLAMP RH	CRACKED	1,184.43	1,184.43
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	152.15	-
1	HEADLAMP PANEL FRT RH	TO REPAIR SEE LABOUR	152.15	-
1	BONNET	BENT	1,941.63	1,941.63
1	BONNET INSULATOR	SERVICEABLE	405.73	-
1	BONNET STRUT LH	SERVICEABLE	88.61	-

Report Ref No. CC3/FCI18006191/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET STRUT RH	SERVICEABLE	88.61	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET LOCK	DISTORTED	305.48	305.48
1	BONNET CABLE	SERVICEABLE	119.19	-
1	BONNET CABLE COVER	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER	SERVICEABLE	92.36	-
1	BONNET SEAL INNER	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH	BENT	783.83	783.83
1	FENDER PANEL FRT RH	TO REPAIR SEE LABOUR	783.83	-
1	WHEELARCH FRT LH	DISTORTED	278.84	278.84
1	WHEELARCH FRT RH	SERVICEABLE	278.84	-
1	FENDER BRACKET LOWER LH	TO REPAIR SEE LABOUR	15.79	-
1	FENDER BRACKET LOWER RH	TO REPAIR SEE LABOUR	15.79	-
1	FENDER INSULATOR LH	SERVICEABLE	130.84	-
1	FENDER INSULATOR RH	SERVICEABLE	130.84	-
1	WIPER RESERVOIR	SERVICEABLE	348.25	-
1	WIPER RESERVOIR NECK	SERVICEABLE	136.11	-
1	WIPER RESERVOIR MOTOR	SERVICEABLE	270.06	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	AIR CLEANER HOSE	SERVICEABLE	76.14	-
1	STEERING PUMP ELECTRIC	SERVICEABLE	2,306.90	-
1	STEERING PINION RACK	SERVICEABLE	4,413.11	-
1	BASE BATTERY TRAY	SERVICEABLE	363.40	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	TURBO DUCT	SERVICEABLE	1,027.80	-
1	A/C HEATER VALVE	SERVICEABLE	484.50	-
1	INJECTION COMPUTER	SERVICEABLE	4,706.30	-
1	SUBFRAME OUTER FRT	SERVICEABLE	2,652.45	-
1	SUBFRAME BRACKET OUTER LH	SERVICEABLE	92.36	-

Report Ref No. CC3/FCI18006191/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SUBFRAME BRACKET OUTER RH	SERVICEABLE	92.36	-
1	ENERGY UNDERTRAY	SERVICEABLE	564.98	-
1	A/C CONDENSER	PUNCTURE	2,020.37	2,020.37
1	A/C CONDENSER GARNISH LH UPPER	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH RH UPPER	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH LH	SERVICEABLE	58.81	-
1	A/C CONDENSER GARNISH RH	SERVICEABLE	59.60	-
1	A/C PIPE CONDENSER TO COMPRESSOR	SERVICEABLE	208.39	-
1	A/C PIPE CONDENSER TO EXPANSION VALVE	SERVICEABLE	658.72	-
1	A/C PIPE COMPRESSOR	SERVICEABLE	334.29	-
1	A/C PIPE	SERVICEABLE	658.72	-
1	A/C COMPRESSOR	SERVICEABLE	2,684.61	-
1	AIR COOLER	PUNCTURE	792.60	792.60
1	AIR INTERCOOLER HOSE (LONG)	SERVICEABLE	1,014.13	-
1	AIR INTERCOOLER HOSE (SHORT)	SERVICEABLE	375.14	-
1	TRANSMISSION COOLER	SERVICEABLE	1,219.30	-
1	TRANSMISSION COOLER PAD	SERVICEABLE	17.96	-
1	RADIATOR	SERVICEABLE	1,202.20	-
2	RADIATOR STUD UPPER	SERVICEABLE	14.41	-
2	RADIATOR BUSH UPPER	SERVICEABLE	50.12	-
2	RADIATOR MTG LOWER	SERVICEABLE	55.85	-
1	RADIATOR FAN COWLING	SERVICEABLE	820.54	-
1	RADIATOR FAN MOTOR LH	SERVICEABLE	967.36	-
1	RADIATOR FAN MOTOR RH	SERVICEABLE	1,479.46	-
1	RADIATOR TANK	SERVICEABLE	324.62	-
1	RADIATOR HOSE UPPER	SERVICEABLE	240.56	-
1	RADIATOR HOSE LOWER	SERVICEABLE	491.18	-
1	RADIATOR TANK HOSE	SERVICEABLE	61.18	-
1	WINDSCREEN FRT	SERVICEABLE	1,364.06	-
1	DOOR PANEL FRT LH	BENT	2,844.66	2,844.66
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	261.28	-
1	DOOR HINGE LOWER LH	BENT	300.55	300.55

Report Ref No. CC3/FCI18006191/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR CHECK FRT LH	SERVICEABLE	194.77	-
1	DOOR CHECK BOLT	SERVICEABLE	22.69	-
1	DOOR LOCK FRT LH	TO REPAIR SEE LABOUR	908.75	-
1	DOOR CATCH FRT LH	SERVICEABLE	131.23	-
1	DOOR HANDLE OUTER FRT LH	SERVICEABLE	477.76	-
1	DOOR HANDLE COVER FRT LH	SERVICEABLE	13.22	-
1	DOOR HANDLE MODULE FRT LH	SERVICEABLE	133.60	-
1	DOOR REGULATOR FRT LH	SERVICEABLE	505.19	-
1	DOOR REGULATOR MOTOR FRT LH	SERVICEABLE	796.46	-
1	DOOR REGULATOR GUIDE FRT LH	SERVICEABLE	120.97	-
1	DOOR MIRROR ASSY LH	CRACKED	1,483.40	1,483.40
	LESS 10% DISCOUNT		-6,187.34	-2,129.82
			55,686.14	19,168.41
	<u>SPECIAL NETT ITEMS</u>			
1	SET BUMPER GRILLE LOWER CLIP (SN)	NECESSARY	69.00	69.00
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	SERVICEABLE	30.00	-
1	SET WHEELARCH CLIP FRT LH (SN)	NOT NECESSARY	30.50	-
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NECESSARY	80.00	60.00
1	FRONT DOOR STICKER 'CHASSIS' (SN)	NECESSARY	50.00	15.00
1	REAR DOOR STICKER '6555-3333' (SN)	NOT NECESSARY	80.00	-
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	52.00	-
1	SET BUMPER CLIP FRT (SN)	NOT NECESSARY	66.00	-
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN)	SERVICEABLE	14.50	-
1	SET RADIATOR GRILLE SCREW (SN)	SERVICEABLE	16.00	-
			623.00	144.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>LABOUR</u>			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF FRAME FULL SUPPORT BRACKET, FRONT BRACE PANEL, HEADLAMP PANEL FRT LH, HEADLAMP PANEL FRT RH, BONNET HINGE LH, BONNET HINGE RH, FENDER PANEL FRT RH, FENDER BRACKET LOWER LH, FENDER BRACKET LOWER RH, DOOR HINGE UPPER LH AND DOOR LOCK FRT LH.		5,250.00	900.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		4,500.00	1,100.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	90.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO TRANSFER OF FRONT FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.		380.00	100.00
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.		170.00	50.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.	NOT NECESSARY	440.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.	NOT NECESSARY	480.00	-
	TO TRANSFER OF BONNET FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			14,040.00	2,370.00
	GRAND TOTAL		70,349.14	21,682.41

Report Ref No. CC3/FCI18006191/Kea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			17,350.00
---	--	--	------------------

Report Ref No. CC3/FCI18006191/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 614C

INSPECTION

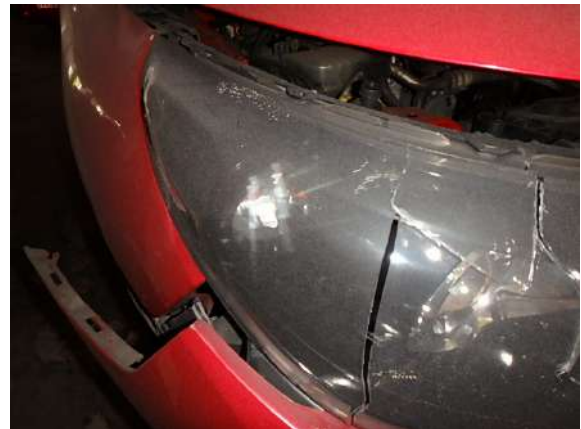



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 614C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

