

Accident Photo

SLB 44583



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Addendum Sheet

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	15/03/2017 12:07
Date Of Accident	14/03/2017 18:20
Exact Location Of Accident	ALONG TPE GOING TOWARDS SLE
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKF9265G
Insured/Policyholder	
Name Of Registered Owner	MOHD YUSOFF BIN ABDULLAH @GORCHARAN SINGH S/O MOHA
NRIC No	S7010386I
Email Address	TURBZUTD@GMAIL.COM
Mobile Phone No	(LOCAL) +65-90264161
Alternative Phone No	OTHERS-90264161

Vehicle Particulars

Manufacturer	AUDI
Model	A3 SB 1.4 TFSI (PANORAMIC ROOF)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	DIRECT ASIA INSURANCE (SINGAPORE) PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	MT/00323942
Cover Note Number	

Driver

Name of Driver	MOHD YUSOFF BIN ABDULLAH @GORCHARAN SINGH S/O MOHA
NRIC No	S7010386I
Date Of Birth	29/03/1970
Occupation	INDOOR
Date Of Driving Pass	18/01/2006
Driving Experience	11 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-90264161
Fax Number	
Contact Number	OTHERS-90264161
Email Address	TURBZUTD@GMAIL.COM

Address	BLK 776 WOODLANDS CRESCENT #06-52
Postcode	730776
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION- HEAD TO REAR (INSURED HIT TP)
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO SKETCH PLAN

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLB4458J
Vehicle Make/Model/Colour	VOLKSWAGEN TIGUAN
Details Of Properties	REAR DAMAGE
Name of Driver	LEONG WAI KIONG
NRIC/Passport Number	S7803570F
Contact Number	96805051
Address	BLK 427 ANG MO KIO AVE 3 #12-2624
Postcode	560427
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Details of Witness

Name	
Phone Number	
Email Address	


Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

Sketch Plan

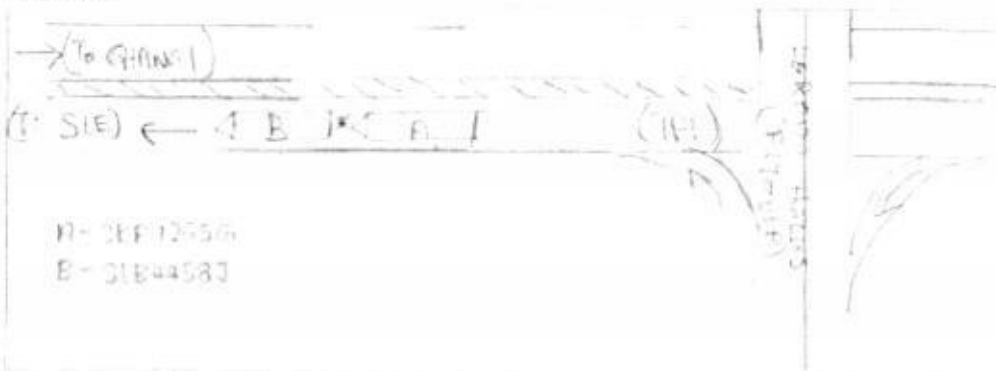

Describe Circumstances of the Accident

AT 12.55 HRS, A2 WAS DRIVING IN THE LEFT LANE. HE WAS
VEHICLE B (31B44583) STOPPED. REPORTER AND I WAS
UNABLE TO STOP IN TIME RESULTING IN MY VEHICLE (A)
CRASHING INTO VEHICLE B. IMMEDIATELY AFTER THE ACCIDENT, THERE
WAS NO PERCEIVED INJURIES TO ALL PERSONS INVOLVED IN
THE ACCIDENT. TRAFFIC FLOW WAS HEAVY AND SLOW AT
THAT PERIOD OF TIME.

Declaration

I/We declare the foregoing particulars are true in every respect.

A. C. 15/03/17
Policyholder's Signature / Date & Time

A. C. 15/03/17
Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Mileage



Accident Photo



Accident Photo



Accident Photo



Accident Photo





ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Leong Wai Kiong
427 Ang Mo Kio Avenue 3 #12-2624
Singapore 560427

Date of report: 15.04.2017
Date of request: 15.03.2017
Date of inspection: 15.03.2017
Date of accident: 14.03.2017
Claim type: Third Party Claim

Report No: AAS/2017/100

Particulars of affected vehicle:

Registration no: SLB4458J
Make/Model: Volkswagen Tiguan TSI (A)
Year of registration: 2015/16
Colour: Pearl White

Odometer: 12623 km
Engine Capacity: 1390 cc
Engine no: CTH239983
Chassis no: WVGZZZ5NZGW065604

Condition of tires:

Front Left: 7mm
Make: Pirelli
Rear Left: 7mm
Make: Pirelli

Front Right: 7mm
Make: Pirelli
Rear Right: 7mm
Make: Pirelli

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

The Assignment

The inspection was conducted at M/s. Chuan Ho Auto Service
Blk 11 Sin Ming Ind Est #01-85
Singapore 575655

(Subsequent inspection was conducted)

Assessment

Repairer's estimate: \$ 23,370.50

Revised estimate: \$ 18,694.60

Recommended reserve: \$ 18,694.60 (Part by Part)

Estimated normal duration of repairs: 14 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SLB4458J

Report No: AAS/2017/100

W/O PREJUDICE

Point of impact

At the rear portion.

General description of damages

The tailgate, rear upper bumper, rear lower bumper, rear panel, rear chassis member, exhaust pipe, rear crossmember, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Chuan Ho Auto Service as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$18,694.60

Conclusion

The repairer has agreed to undertake the repair based on Part by Part of SGD \$18,694.60

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 14 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 144 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SLB4458J

Report No: AAS/2017/100

Appraisal Schedule

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Rear bumper (upper)	1	Dented		\$ 1,343.30	\$ 1,343.30
2	Rear bumper (lower)	1	Dented		\$ 833.20	\$ 833.20
3	Rear bumper lower trim		Dented		\$ 696.80	\$ 696.80
4	Rear bumper reflector LH/RH	2	Grazed/Cracked	\$ 81.00	\$ 162.00	\$ 162.00
5	Rear bumper reverse lamp LH/RH	2	Cracked/Broken	\$ 120.30	\$ 240.60	\$ 240.60
6	Rear bumper reverse sensor	4	2pc Cracked	\$ 194.80	\$ 779.20	\$ 389.60
7	Rear bumper sensor holder	6	Necessary	\$ 41.40	\$ 248.40	\$ 248.40
	Rear bumper sensor harness	1	Serviceable		\$ 225.60	
9	Rear bumper tow hook cover	1	Dented		\$ 55.90	\$ 55.90
10	Rear bumper side moulding LH/RH	2	RH Cut	\$ 541.90	\$ 1,083.80	\$ 541.90
11	Rear bumper bracket LH/RH	2	Cracked	\$ 64.70	\$ 129.40	\$ 129.40
12	Rear bumper reinforcement	1	Dented		\$ 686.20	\$ 686.20
13	Rear end panel (upper)	1	Dented		\$ 799.30	\$ 799.30
14	Rear end panel (lower)	1	Dented		\$ 543.70	\$ 543.70
15	Rear end panel trim	1	Deformed/Cracked		\$ 261.10	\$ 261.10
16	Tailgate weather-strip	1	Necessary		\$ 332.90	\$ 332.90
17	RHR fender arch garnish	1	Cracked		\$ 939.90	\$ 939.90
18	Rear number plate lamp LH/RH	2	Serviceable	\$ 80.30	\$ 160.60	-
19	Tailgate outer handle	1	Serviceable		\$ 164.50	-
20	Tailgate emblem	1	Necessary		\$ 123.70	\$ 123.70
21	Tailgate nameplate 'Tiguan'	1	Necessary		\$ 134.80	\$ 134.80
22	Tailgate nameplate 'TSI'	1	Necessary		\$ 95.60	\$ 95.60
23	Tailgate nameplate 'Bluemotion'	1	Necessary		\$ 88.70	\$ 88.70
24	Exhaust silencer	1	Dented		\$ 1,517.90	\$ 1,517.90
25	Exhaust mid pipe	1	Bent/Repair		\$ 972.50	-
26	Exhaust mounting	2	Torn/Missing	\$ 47.40	\$ 94.80	\$ 94.80
27	Exhaust clamp	1	Necessary		\$ 112.30	\$ 112.30
28	Rear crossmember	1	Dented		\$ 2,162.60	\$ 2,162.60
29	Rear lower arm LH/RH	2	Serviceable	\$ 335.60	\$ 671.20	
List total:					\$ 15,660.50	\$ 12,534.60
1	Rear number plate	1	Dented		\$ 70.00	\$ 70.00
2	Joint sealant	2	Necessary	\$ 60.00	\$ 120.00	\$ 80.00
Special nett total:					\$ 190.00	\$ 150.00
Parts Total:					\$ 15,850.50	\$ 12,684.60



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SLB4458]		Report No: AAS/2017/100	
S/N	Labour Description	Repairer's Est	Revised Est
1	Chassis alignment.	\$ 400.00	\$ 300.00 XNN
2	To remove & refit rear trimmings.	\$ 150.00	\$ 120.00 -
3	To renew reverse sensor.	\$ 100.00	\$ 80.00 40
4	To check rear lighting & wirings.	\$ 80.00	\$ 50.00 30
5	To cut & renew exhaust silencer. Repair mid pipe.	\$ 250.00	\$ 200.00 150
6	Anti rust proofing on rear portion.	\$ 120.00	\$ 80.00 ✓
7	To drop rear undercarriages, renew rear crossmember.	\$ 500.00	\$ 400.00 300
8	Conduct wheel alignment.	\$ 120.00	\$ 80.00 60
9	To dismantle & replace damaged parts. Repair all affected areas.	\$ 2,000.00	\$ 1,500.00 800
10	To putty & respray affected area.	\$ 1,600.00	\$ 1,400.00 800
11	Cquartz Finest Nano-Tech Ceramic Coating.	\$ 2,200.00	\$ 1,800.00 XNN
Labour Total:		\$ 7,520.00	\$ 6,010.00
Grand Total:		\$ 23,370.50	\$ 18,694.60

The final adjusted Part by Part amount is \$18,694.60

Under normal circumstances, the repair should be completed within a reasonable period of 14 working days.

144 Photographs were taken at the time of inspection.

Direct Asia Insurance (Singapore) Pte Ltd
20 Anson Road #08-01
Singapore 079912



VICOM LTD
385 Sin Ming Drive Singapore 575718

Mainline (65) 6458 4555
Facsimile (65) 6458 1040

RE-INSPECTION REPORT

www.vicom.com.sg
Company Registration No. 198100229R

GENERAL INFORMATION			
VAC Ref. No.	: 515553	Claim No.	: 69463/RV
Accident Date	: 14/03/2017	Policy No.	:
Assignment Date	: 18/09/2017		
Resurvey Date	: 30/09/2017		
Report Date	: 08/10/2017	Insured Veh.	: SKF9265G
VEHICLE PARTICULARS			
Vehicle No.	: SLB4458J	Chassis No.	: WVGZZZ5NZGW065604
Registration Date	: 07/04/2016	Engine No.	: CTH239983
Make	: VOLKSWAGEN	Engine Cap.	: 1390CC
Model	: TIGUAN	Transmission	: AUTOMATIC
		Colour	: WHITE
CONDITION OF VEHICLE DURING RESURVEY (VISUAL and STATIC TEST ONLY)			
Foot Brake	: SERVICEABLE	Steering	: SERVICEABLE
Hand Brake	: SERVICEABLE	Modification	: NONE
Mileage	: 18488KM		
TYRES	SIZE	MAKE	BALANCE (mm)
FRONT RH	255/40ZR19	PIRELLI	7
FRONT LH	255/40ZR19	PIRELLI	7
REAR RH	255/40ZR19	PIRELLI	8
REAR LH	255/40ZR19	PIRELLI	8
RESURVEY CONDUCTED AT			
300 SEMBAWANG ROAD			
REMARKS			
[1]Original repair cost : S\$ 18,694.60			
[2]Revised repair cost : S\$ 12,516.28			
[3]Original recommended repair period : 14 days			
[4]Revised recommended repair period : 8 days			

VICOM LTD

SLB4458J @ 14/03/2017

REINSPECTION REPORT
Annex A: Adjustment on Spare Parts

#	Qty	Vehicle Parts Description	Workshop Estimate (S\$)	Absolute Appraisal Services Pte Ltd (per their report) (S\$)	VAC Reinspection (S\$)
1	1	Rear Bumper Upper	1,343.30	1,343.30	1,343.30
2	1	Rear Bumper Lower	833.20	833.20	833.20
3	1	Rear Bumper Lower Trim	696.80	696.80	696.80
4	2	Rear Bumper Reflector Lh/Rh	162.00	162.00	81.00
5	2	Rear Bumper Reverse Lamp Lh/Rh	240.60	240.60	120.30
6	4	Rear Bumper Reverse Sensor	779.20	389.60	389.60
7	6	Rear Bumper Sensor Holder	248.40	248.40	150.40
8	1	Rear Bumper Sensor Harness	225.60	0.00	0.00
9	1	Rear Bumper Tow Hook Cover	55.90	55.90	55.90
10	2	Rear Bumper Side Moulding Lh/Rh	1,083.80	541.90	541.90
11	2	Rear Bumper Bracket Lh/Rh	129.40	129.40	119.10
12	1	Rear Bumper Reinforcement	686.20	686.20	460.00
13	1	Rear End Panel Upper	799.30	799.30	799.30
14	1	Rear End Panel Lower	543.70	543.70	0.00
15	1	Rear End Panel Trim	261.10	261.10	188.70
16	1	Tailgate Weatherstrip	332.90	332.90	0.00
17	1	Rhr Fender Arch Garnish	939.90	939.90	939.90
18	2	Rear Number Plate Lamp Lh/Rh	160.60	0.00	0.00
19	1	Tailgate Outer Handle	164.50	0.00	0.00
20	1	Tailgate Emblem	123.70	123.70	0.00
21	1	Tailgate Nameplate Tiguan	134.80	134.80	0.00
22	1	Tailgate Nameplate Tsi	95.60	95.60	0.00
23	1	Tailgate Nameplate Bluemotion	88.70	88.70	0.00
24	1	Exhaust Silencer	1,517.90	1,517.90	1,282.58
25	1	Exhaust Mid Pipe	972.50	0.00	0.00
26	2	Exhaust Mounting	94.80	94.80	94.80
27	1	Exhaust Clamp	112.30	112.30	112.30
28	1	Rear Crossmember	2,162.60	2,162.60	1,967.20
29	2	Rear Lower Arm Lh/Rh	671.20	0.00	0.00
Subtotal :			15,660.50	12,534.60	10,176.28
Less 0 %			0.00	0.00	0.00
TOTAL :			15,660.50	12,534.60	10,176.28

SPECIAL NETT ITEM

1	1	Rear Number Plate	70.00	70.00	50.00
2	2	Joint Sealant	120.00	80.00	60.00
TOTAL :			190.00	150.00	110.00

TOTAL FOR SPARE PARTS : 15,850.50 12,684.60 10,286.28

VICOM LTD
REINSPECTION REPORT

SLB4458J @ 14/03/2017

Annex B: Adjustment on Labour and Spray Painting

# Job Description	Workshop Estimate (S\$)	Absolute Appraisal Services Pte Ltd (per their report) (S\$)	VAC Reinspection (S\$)
1 Chassis alignment	400.00	300.00	0.00
2 To remove & refit rear trimmings	150.00	120.00	120.00
3 To renew reverse sensor	100.00	80.00	40.00
4 To check rear lighting & wirings	80.00	50.00	20.00
5 To cut & renew exhaust silencer, repair mid pipe	250.00	200.00	60.00
6 Anti rust proofing on rear portion	120.00	80.00	30.00
7 To drop rear undercarriages, renew rear crossmember	500.00	400.00	300.00
8 Conduct wheel alignment	120.00	80.00	60.00
9 To dismantle & replace damaged parts. Repair all affected areas	2,000.00	1,500.00	800.00
10 To putty & respray affected area	1,600.00	1,400.00	800.00
11 Cquartz finest nano tech ceramic coating	2,200.00	1,800.00	0.00
TOTAL FOR LABOUR AND SPRAY PAINTING	7,520.00	6,010.00	2,230.00

Summary

Description	Workshop Estimate (S\$)	Absolute Appraisal Services Pte Ltd (per their report) (S\$)	VAC Reinspection (S\$)
TOTAL FOR SPARE PARTS	15,850.50	12,684.60	10,286.28
TOTAL FOR LABOUR AND SPRAY PAINTING	7,520.00	6,010.00	2,230.00
TOTAL REPAIR COST	23,370.50	18,694.60	12,516.28

REINSPECTION REPORT**Annex C: Our Comments and Conclusion****CONCLUSION**

Based on our re-adjustment, the part by part repairs amounts to S\$12,516.28
i.e. parts = S\$10,286.28, labour/spray-painting cost = S\$2,230.00.

We would state, in conclusion, the claim for the repairs to be considered at S\$12,516.28 on a part by part basis, with a repair period of 8 working days. For your understanding, the complete details are reflected in the Summary of Annex B.

As between our adjustment of S\$12,516.28 and the recommended repair cost of S\$18,694.60 by Absolute Appraisal Services Pte Ltd, a reduction of S\$6,178.32 resulted.

We submit our re-inspection report for your kind consideration and would add our re-inspection was carried out to the best of our ability, knowledge and experience. In addition, we also submit for your insight 42 photographs of the repaired vehicle taken during our re-inspection.

Tommie Lim
for VICOM Ltd



REINSPECTION REPORT

Annex C: Our Comments and Conclusion

COMMENTS

Based on our physical re-inspection of the repaired vehicle, we opine the repairs generally were carried out satisfactorily, except for following items disallowed on basis as stated:

A) Items do not require replacement as they could be reused

- 1) Rear bumper reflector lh (photographs does not support damaged)
- 2) Rear bumper reverse lamp lh (photographs does not support damaged)
- 3) Tailgate weatherstrip (photographs does not support damaged)

B) Items not in use

- 1) Rear end panel lower

C) Not necessary

- 1) Tailgate emblem (photographs does not support damaged on tailgate)
- 2) Tailgate nameplate tiguán (photographs does not support damaged on tailgate)
- 3) Tailgate nameplate tsi (photographs does not support damaged on tailgate)
- 4) Tailgate nameplate bluemotion (photographs does not support damaged on tailgate)

D) Spare parts price adjusted

- 1) Rear bumper sensor holder
- 2) Rear bumper bracket lh/rh
- 3) Rear bumper reinforcement
- 4) Rear end panel trim
- 5) Exhaust silencer
- 6) Rear crossmember
- 7) Rear number plate
- 8) Joint sealant

E) No invoice supported

- 1) Quartz finest nano tech ceramic coating

For your understanding of our re-adjustment on the parts, the full details are reflected in Annex A of this re-inspection report.

For labour and spray-painting cost, we have re-adjusted downwards from S\$6,010.00 to S\$2,230.00 to reflect at market rates. The reduction is S\$3,780.00.

For your understanding of our re-adjustment on labour/spray-painting cost, the full details are reflected in Annex B of this re-inspection report.

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

ARI GOH & PARTNERS

Ref : CS/LAW18006387/Gvbs2

10 ANSON ROAD #21-08A INTERNATIONAL
PLAZASINGAPORE 079903

Date : 02-05-2018



Code : L023

1. Policy Particulars :- THIRD PARTY CLAIM (RESURVEY INSPECTION)

Insured Veh.	SKF 9265G	Veh. Inspected	SLB 4458J
Policy No.	TKSF/C900-ACC-37834.17/sf	Coverage (\$)	0.00
Claim No.	DAI.17.0282.WT.lsm	Excess (\$)	0.00
Assign From	WILLY TAY	Assign Date	06/04/2018

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN TIGUAN	c.c	1390
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	WVGZZZ5NZGW065604	Colour	WHITE
Odometer	27324	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	255/40R19	PIRELLI	6 mm
L/H Front Tyre	255/40R19	PIRELLI	6 mm
R/H Rear Tyre	255/40R19	PIRELLI	6 mm
L/H Rear Tyre	255/40R19	PIRELLI	6 mm

4. Description of Damages

THE VEHICLE HAD COMPLETED ITS REPAIR WORKS.
REPAIR CONDITION SEE DETAILS.

5. General Information

Accident Date	14/03/2017	Inspection Date	17/04/2018
Survey held at	300 SEMBAWANG ROAD, SINGAPORE 758532		
Repairer	CHUAN HO AUTO SERVICE		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
-------------------------------------	----------------

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLB 4458J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER (UPPER)	REPLACED	1,343.30	1,343.30
1	REAR BUMPER (LOWER)	REPLACED	833.20	833.20
1	REAR BUMPER LOWER TRIM	REPLACED	696.80	696.80
2	REAR BUMPER REFLECTOR LH/RH @ \$81.00	REPLACED	162.00	162.00
2	REAR BUMPER REVERSE LAMP LH/RH @ \$120.30	REPLACED	240.60	240.60
4	REAR BUMPER REVERSE SENSOR @ \$194.80	REPLACED 2PCS ONLY	779.20	389.60
6	REAR BUMPER SENSOR HOLDER @ \$41.40	REPLACED	248.40	142.40
1	REAR BUMPER SENSOR HARNESS	SERVICEABLE	225.60	-
1	REAR BUMPER TOW HOOK COVER	REPLACED	55.90	55.90
2	REAR BUMPER SIDE MOULDING LH/RH @ \$541.90	O/S REPLACED	1,083.80	541.90
2	REAR BUMPER BRACKET LH/RH @ \$64.70	REPLACED	129.40	129.40
1	REAR BUMPER REINFORCEMENT	REPLACED	686.20	554.95
1	REAR END PANEL (UPPER)	REPLACED	799.30	799.30
1	REAR END PANEL (LOWER)	REPLACED	543.70	432.73
1	REAR END PANEL TRIM	REPLACED	261.10	261.10
1	TAILGATE WEATHER-STRIP	REPLACED	332.90	252.81
1	RHR FENDER ARCH GARNISH	REPLACED	939.90	939.90
2	REAR NUMBER PLATE LAMP LH/RH @ \$80.30	SERVICEABLE	160.60	-
1	TAILGATE OUTER HANDLE	SERVICEABLE	164.50	-
1	TAILGATE EMBLEM	REPLACED	123.70	123.70
1	TAILGATE NAMEPLATE 'TIGUAN'	REPLACED	134.80	134.80
1	TAILGATE NAMEPLATE 'TSI'	REPLACED	95.60	95.60
1	TAILGATE NAMEPLATE 'BLUEMOTION'	REPLACED	88.70	88.70
1	EXHAUST SILENCER	REPLACED	1,517.90	1,458.00
1	EXHAUST MID PIPE	REPAIRED SEE LABOUR	972.50	-
2	EXHAUST MOUNTING @ \$47.40	REPLACED	94.80	94.80
1	EXHAUST CLAMP	REPLACED	112.30	112.30
1	REAR CROSSMEMBER	REPLACED	2,162.60	2,162.60

Report Ref No. CS/LAW18006387/Gvbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR LOWER ARM LH/RH @ \$335.60	SERVICEABLE	671.20	-
			15,660.50	12,046.39
	SPECIAL NETT ITEMS			
1	REAR NUMBER PLATE (SN)	REPLACED	70.00	50.00
2	JOINT SEALANT @ \$60.00 (SN)	REPLACED	120.00	60.00
			190.00	110.00
	LABOUR			
	CHASSIS ALIGNMENT.	NOT NECESSARY	400.00	-
	TO REMOVE & REFIT REAR TRIMMINGS.		150.00	120.00
	TO RENEW REVERSE SENSOR.		100.00	40.00
	TO CHECK REAR LIGHTING & WIRINGS.		80.00	30.00
	TO CUT & RENEW EXHAUST SILENCER. REPAIR MID PIPE.		250.00	150.00
	ANTI RUST PROOFING ON REAR PORTION.		120.00	80.00
	TO DROP REAR UNDERCARRIAGES, RENEW REAR CROSSMEMBER.		500.00	300.00
	CONDUCT WHEEL ALIGNMENT.		120.00	60.00
	TO DISMANTLE & REPLACE DAMAGED PARTS. REPAIR ALL AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF EXHAUST MID PIPE.		2,000.00	800.00
	TO PUTTY & RESPRAY AFFECTED AREA.		1,600.00	800.00
	CQUARTZ FINEST NANO-TECH CERAMIC COATING.	NOT NECESSARY	2,200.00	-
			7,520.00	2,380.00
GRAND TOTAL			23,370.50	14,536.39
RECOMMENDED COST OF REPAIRS				14,536.39

Report Ref No. CS/LAW18006387/Gvbs2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MinstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.