

ASS. REC. BY

REF: CS/AGI18006562/Kvd3ⁿ²

Special instruction:

Surveyor: Kenneth

ASSIGNMENT (Office)

From (Person): Albert Hong

of AGI

Date/Time: 9/4/18 @ 5:52pm

Estimated Cost:

Bill to:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SHB 9695E

Insured: SLH 6306Z

at Workshop n/s: Trans. Cab

Tel:

of No. 2 AMK Street 63

Policy No:

Claim No: C10001486

Sum Insured:

Excess:

Make of Veh.
(Client's Record)

D.O.A. 05/04/2018

CA / REV / REP. / REV 24 HRS ^{lwp}

H.O.D. Endorsement:

Date/Time: 9:25am @ 10/4/18

Person Contacted: Candy

Vehicle: IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	<u>SHB 9695E - CC3/TMI16010073/Kgbn2</u>
	<u>D.O.A. 27/5/16</u>

14/9/18 @ 11:21am Albert call up said Trans - Cab submit LS \$500f
will amend report to them

14/9/18 To re-open amend to LS \$500 Celine 17/9/18
1st close date = 18/4/18

19/9/18 Reopen ref only. ↓

REF: AGI

ASSIGNMENT

From:

Date: 10/04/18

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SHB 9695E

at Workshop m/s Trans-Cab

of No. 2 AMK st-63

Insured:

Policy No:

Claims No:

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

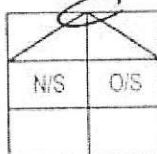

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

01

days

Res.: Yes or No

Lum Sum:

20

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS ^{lwp}

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No: S11B 9695E Yr Regn: 07 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mercury Latitude cc 1995

Colour:

White / R

A/C: Insured / Std / NI / NA

Sp. Reading:

645770

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

VFI ABL 15AUC 273106

Gen. Cond. ☒ Good / Fair / Poor / BurntSteering: In ☒ order / Jammed / Leaked / Burnt orBrake: In ☒ order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size:

F: Conti 215/60R16

R: Long

BS / DUN / EXNOVA / G / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal:

9

mm

R/Bal:

5

mm

L/Bal:

9

mm

L/Bal:

5

mm

D.O.A:

5/4/18

D.O.A:

10/4/18

Survey held at

Des. of Damages: ☒ Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

11/4 File pass to Catherine.

Q 635-12 (Ref 22, 430-41, 977)

RECEIVED 12 APR 2018

Date/Time File Pass to?

☐

Preli. Report

n

☐

Final Report

Date/Time File Return to?

10/4 - typist

Report Format:

TP

Lump Sum / L.B. / S:

635-12

Days Of Repair:

1

Resurvey No. of Trip:

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech insp (\$

☐

Week-end (\$

Survey Fee

Transportation

1 - 2 - 3 - 4 - 5

1 - Photos

1 - Other

TOTAL

450

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No.: 6287 6666 Fax No.: 6257 1330

CO./GST Reg. No. 201019626G

SHB 9695E

AAD1804-067

Not Authorised
618mg @ 635.12

Vehicle No.:	SHB 9695E
Chassis No.:	VF1ABL15AUC273106
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE
Date of Accident :	5.4.2018
Third Party Insurer :	AUTO & GENERAL

		PART		LIST
1	1	BUMPER COVER FRT	\$	<i>R</i> 1,259.42 X
2	1	BUMPER SPOILER FRT	\$	<i>SL</i> 181.75 X
3	1	BUMPER ABSORBER FRT	\$	<i>SL</i> 394.68 X
4	1	BUMPER RETAINER FRT LH	\$	<i>SL</i> 151.41 X
5	1	BUMPER SUPPORT FRT	\$	<i>SL</i> 123.88 X
6	1	BUMPER RETAINER FRT RH	\$	<i>SL</i> 150.77 X
7	1	BUMPER SUPPORT FRT	\$	<i>SL</i> 123.88 X
8	1	BUMPER UNDERTRAY FRT	\$	<i>SL</i> 472.83 X
9	1	BUMPER GRILLE LOWER FRT	\$	<i>CM</i> 266.80 ✓
10	1	BUMPER FOG LAMP GRILLE LH	\$	<i>SL</i> 207.21
11	1	BUMPER FOG LAMP GRILLE RH	\$	<i>SL</i> 207.21
12	1	BUMPER BEAM FRT	\$	<i>R</i> 914.08
13	1	TOW COVER FRT	\$	<i>SL</i> 28.61
14	1	RADIATOR GRILLE	\$	<i>SL</i> 1,707.78
15	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	<i>RA</i> 225.36
16	1	RADIATOR GRILLE FRAME	\$	<i>SL</i> 1,353.75
17	1	FRAME FULL SUPPORT PANEL	\$	<i>SL</i> 615.90
18	1	FRAME FULL SUPPORT BRACKET	\$	<i>R</i> 89.79
19	1	HEADLAMP LH	\$	<i>SL</i> 1,184.43
20	1	HEADLAMP RH	\$	<i>SL</i> 1,184.43
21	1	HEADLAMP PANEL FRT LH	\$	<i>R</i> 152.15
22	1	HEADLAMP PANEL FRT RH	\$	<i>R</i> 152.15
23	1	BONNET	\$	<i>R</i> 1,941.63
24	1	BONNET INSULATOR	\$	<i>SL</i> 405.73
25	1	BONNET STRUT LH	\$	<i>SL</i> 88.61
26	1	BONNET STRUT RH	\$	<i>SL</i> 88.61
27	1	BONNET HINGE LH	\$	<i>R</i> 348.31
28	1	BONNET HINGE RH	\$	<i>R</i> 348.31

Trans-cab Auto Services Pte Ltd

AAD1804-067

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9695E

29	1	BONNET CABLE COVER	\$	Sh 161.03 X
30	1	BONNET SEAL OUTER	\$	Sh 92.36 X
31	1	BONNET SEAL INNER	\$	Sh 157.28 X
32	1	FENDER PANEL FRT LH	\$	R 783.83 X
33	1	FENDER PANEL FRT RH	\$	R 783.83 X

TOTAL	\$	16,347.81
10%	\$	1,634.78
	\$	14,713.03

Special Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	na 52.00
2	1SET	BUMPER CLIP FRT	\$	na 66.00
3	1	BUMPER BRACKET CLIP FRT LH	\$	na 12.00
4	1	BUMPER SUPPORT CLIP FRT LH	\$	na 10.50
5	1	BUMPER BRACKET CLIP FRT RH	\$	na 12.00
6	1	BUMPER SUPPORT CLIP FRT RH	\$	na 10.50
7	1	TOW COVER FRT	\$	Sh 14.50
8	1SET	RADAIOR GRILLE SCREW	\$	na 16.00
9	1SET	BUMPER GRILLE LOWER CLIP	\$	na 69.00
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	na 70.00
11	2	FRAME FULL SUPPORT PANEL NUT	\$	na 20.00
12	2	FRAME FULL SUPPORT PANEL STUD	\$	na 30.00
21	1	Windscreen moulding	\$	na 100.00
22	1SET	Front licence plate with holder	\$	Not na 80.00 15.00

TOTAL	\$	562.50
TOTAL PARTS	\$	15,275.53

Panel beating, knocking and straightening the
necessary portion, remove and renewal of parts,
adjust and realign the same

\$ 2,450.00 ^{15.00}

To apply paint protection system (PPS) maintain
and enhancement

\$ na 380.00 X

Trans-cab Auto Services Pte Ltd

AAD1804-067

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9695E

Putty and spray painting of the affected portion.	\$	220/ 2,200.00
To rust-proofing of the affected areas.	\$	~ 170.00 X
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	~ 380.00 X
To check steering geometry and computer wheel alignment	\$	~ 220.00 X
To transfer of tire, rim and on wheel balancing.	\$	~ 170.00 X
To Check Electrical Lighting Concerned.	\$	~ 170.00 X
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	~ 380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	~ 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	~ 380.00 X
To replace, refix and top up coolant for radiator	\$	~ 170.00 X
To vacuum, replace, refix and recharge Air Intercooler	\$	~ 170.00 X
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	~ 170.00 X

TOTAL \$ 7,790.00**Over All Total \$ 23,065.53****(LUMP SUM) Repair Days****7 DAYS****1 day**

LKR Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

COPY



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTO & GENERAL INSURANCE (S) PL			Ref : CS/AGI18006562/Kvd3n2	
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924			Date : 18-04-2018	
			Code : AGI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLL 6306Z	Veh. Inspected	SHB 9695E	
Policy No.		Coverage (\$)	0.00	
Claim No.	C10001486	Excess (\$)	0.00	
Assign From	ALBERT HONG	Assign Date	09/04/2018	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	VF1ABL15AUC273106	Colour	WHITE / RED	
Odometer	645770	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	9 mm	
L/H Front Tyre	215/60 R16	GITI	9 mm	
R/H Rear Tyre	215/60 R16	LING LONG	5 mm	
L/H Rear Tyre	215/60 R16	LING LONG	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/04/2018	Inspection Date	10/04/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		1 Working Days		

COPY



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 9695E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	TO REPAIR SEE LABOUR	1,259.42	-
1	BUMPER SPOILER FRT	SERVICEABLE	181.75	-
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH	SERVICEABLE	151.41	-
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH	SERVICEABLE	150.77	-
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	472.83	-
1	BUMPER GRILLE LOWER FRT	CRACKED	266.80	266.80
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	914.08	-
1	TOW COVER FRT	SERVICEABLE	28.61	-
1	RADIATOR GRILLE	SERVICEABLE	1,707.78	-
1	RADIATOR GRILLE BADGE "RENAULT"	NOT NECESSARY	225.36	-
1	RADIATOR GRILLE FRAME	SERVICEABLE	1,353.75	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	615.90	-
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	89.79	-
1	HEADLAMP LH	SERVICEABLE	1,184.43	-
1	HEADLAMP RH	SERVICEABLE	1,184.43	-
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	152.15	-
1	HEADLAMP PANEL FRT RH	TO REPAIR SEE LABOUR	152.15	-
1	BONNET	TO REPAIR SEE LABOUR	1,941.63	-
1	BONNET INSULATOR	SERVICEABLE	405.73	-
1	BONNET STRUT LH	SERVICEABLE	88.61	-
1	BONNET STRUT RH	SERVICEABLE	88.61	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	348.31	-

Report Ref No. CS/AGI18006562/Kvd3n2

COPY


LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET CABLE COVER	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER	SERVICEABLE	92.36	-
1	BONNET SEAL INNER	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH	TO REPAIR SEE LABOUR	783.83	-
1	FENDER PANEL FRT RH	TO REPAIR SEE LABOUR	783.83	-
	LESS 10% DISCOUNT		-1,634.78	-26.68
			14,713.02	240.12
	<u>SPECIAL NETT ITEMS</u>			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	52.00	-
1	SET BUMPER CLIP FRT (SN)	NOT NECESSARY	66.00	-
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN)	SERVICEABLE	14.50	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	DENTED	80.00	25.00
			562.50	25.00
	<u>LABOUR</u>			
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER COVER FRT,BUMPER BEAM FRT,FRAME FULL SUPPORT BRACKET,HEADLAMP PANEL FRT LH,HEADLAMP PANEL FRT RH,BONNET,BONNET HINGE LH,BONNET HINGE RH,FENDER PANEL FRT LH AND FENDER PANEL FRT RH.		2,450.00	150.00
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		2,200.00	220.00

Report Ref No. CS/AGI18006562/Kvd3n2

COPY


LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.	NOT NECESSARY	170.00	-
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	NOT NECESSARY	380.00	-
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.	NOT NECESSARY	170.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			7,790.00	370.00
GRAND TOTAL			23,065.52	635.12
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				500.00

Report Ref No. CS/AGI18006562/Kvd3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.