

12/03/2018

REC BY:

REF: CS3/MSH/8004373/19632/11 Special Instruction:

Surveyor

Wilson

ASSIGNMENT (Office)

From (Person):

Elaine Ngu

of

msch

Date/Time:

02032018

Estimated Cost:

Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SJS 2942A

Insured:

YP 5940Z

at Workshop m/s

Motor Intel Automa

Tel:

9838 3318

of

13 Keki Bukit Rd 4 #01-20

Policy No:

MSD/VCC/18-00004

Claim No:

MSC/V/18-00019

Sum Insured:

Excess:

Make of Veh:

D.O.A. 17012018

(Client's Record)

CA / REV / REP. / REV 24 HRS WP

H.O.D. Endorsement:

Date/Time:

07032018 456am

Person Contacted:

Wilson

Vehicle IN/OUT

Date/Time	Action/Instruction (X) Estimate	Do Not Finalize
	SJS 2942A - MS/ INC 15010256 / 19632/1	DA 180615
	YP 5940Z - X	
	Dismantle Part : 09032018	

10 days

US \$8650/- (Red: 5350/- :38%)

20/1

RECEIVED 10 MAY 2018

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Mar 2018		13 Apr 2018 10:04 Edit Adj Rpt	S\$0.00 Edit Estimates	S\$0.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	SG SAGAWA AMEROID PTE LTD , Co. Reg. No.: 199100423D								
Main Claimant:	CHAN HUA HSING ALVIN , ID: S8103346C								
Vehicle Reg. No.:	SJS2942A	Date of Loss:	02/03/2018 17:00 - :59 [102 Months and 23 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / MSC/V/18-000361	Policy/Cover Note No.:	MSD/VCC/18-000004 (Comprehensive) Coverage: 01/01/2018 - 31/12/2018						
Vehicle Reg. No. (Insured):	YP5940Z	Policy No. (Claimant):							
		Excess:	S\$2,000.00						
Repairer:	Motor Intel Automo Pte Ltd (HQ) Bartley Blz Centre, 13 Kakai Bukit Road 4, #01-20, 417807 Kaki Bukit - Tel:								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Elaine Ngu Siau Mei - 6594 2540]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Teo Cheng Ming Wilson] ... [Final Rpt due 03/05/2018]								
Driver/Custodian (Insured):	WANG DAYONG () , NRIC: G6758188T, Tel: +6598338196								
Adj Asg. Remarks:	survey done- requested by catherine chong to put into correct file no. please reload all documents								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
MSIG_SG (30/04/2018): Report Send Back Alerts - SJS2942A (TP)									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

S K AUTO CONSULTANTS

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/018/0144SK
Your Reference: TBA

Date: 6/4/2018

TO: CHUA HUA HSING ALVIN
c/o Motor Intel Automo Pte Ltd
13 Kaki Bukit Road 4 #01-20
Bartley Biz Centre
Singapore 417807

Assessment of Vehicle No : SJS 2942A
Date of Accident : 02/03/2018
Date of Inspection : 05/03/2018

We have carried out a physical assessment of SJS 2942A at Motor Intel Automo PL according to your instructions on 05/03/2018 and are pleased to submit our report as follows;

1.VEHICLE PARTICULARS

Registration No.	:	SJS 2942A
Make & Model	:	Honda FIT 1.3G A
Year of Registration	:	2009
Engine Capacity (cc)	:	1339 cc
Chassis No.	:	GE61075936
Engine No.	:	L13A4085349
Colour	:	Silver
Mileage (km)	:	101224

2.VEHICLE CONDITION

Body Paint:	:	Good
Steering	:	Serviceable
Foot Brake	:	Serviceable
Parking Brake	:	Serviceable

3.TYRE PARTICULARS & CONDITION

Front

RH Make/Size	:	Pirelli 195/50R15 - 50%
LH Make/Size	:	Pirelli 195/50R15 - 50%

Rear

RH Make/Size	:	Pirelli 195/50R15 - 50%
LH Make/Size	:	Pirelli 195/50R15 - 50%

Note: % denotes the remaining percentage of the tyre

S K AUTO CONSULTANTS


Page No. 2

Our Reference TP/018/0144SK
Vehicle No. SJS 2942A

4. DESCRIPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the REAR portion (badly damaged)

Please see attached schedule for details & photographs.

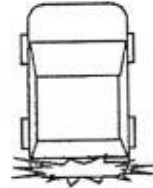

Estimated Amount : S\$18,608.08
Adjusted Amount : S\$14,000/-
Estimated Repair Days : 16 days

Pursuant to your instruction, we have NOT AUTHORIZED repair.
The assessment was conducted on a "Without Prejudice" basis.

If we are not notified of anything to the contrary within 14 Days from the date hereof, this report shall be treated as correct

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by S K AUTO CONSULTANTS for any reliance on this report by any third party.

S K AUTO CONSULTANTS

Page No. 3

Our Reference TP/018/0144SK
Vehicle No. SJS 2942A

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)		OUR ASSESSMENT(\$\$)	
	PARTS (LIST ITEMS)					
1	Tail Gate	Distorted		1085.00		1085.00
2	Tail Gate Number Plate lamps @ \$75.00	Damaged		150.00		150.00
1	Tail Gate Lock	Damaged		186.60		186.60
1	Tail Gate Wiper Motor	Damaged		288.00		288.00
2	Tail Gate Damper @ \$246.00 *stiffen	Damaged*		492.00		492.00
1	Tail Gate Weatherstrip	Deformed		162.70		162.70
1	Tail Gate centre Garnish	Damaged		155.60		155.60
1	Tail Gate Emblem - FIT	Necessary		42.00		42.00
1	Tail Gate Inner Board	Deformed		254.00		254.00
1	Rear Windscreen moulding	Necessary		185.00		185.00
1	Rear Fender RH & LH @654.20	Distorted		1308.40		1308.40
2	Rear Fender Inner Garnish	Deformed		382.00		382.00
1	Rear Windscreen Moulding (lower)	Necessary		68.00		68.00
2	Tail Lamp LH & RH	Broken/Dmg.		715.20	1 pc	715.20 LH Boro
1	Tail Lamp Base Panel LH	Distorted		238.90		238.90 R x
1	RHS Rear wheel house panel	Distorted		782.00		782.00 R x
1	Spare Tyre Panel Board	Deformed		258.60		258.60 R x
1	Spare Tyre Panel	Distorted		737.20		737.20 R x
1	Fuel tank outer lid	Damaged		242.00		242.00 R x
1	Driver seat support bracket	Bent		450.00		450.00 R x
1	Rear End Panel	Distorted		485.20		485.20 R x
1	Rear End Panel Top Garnish	Deformed		116.20		116.20 S V L x
1	Rear Bumper	Deformed/Crk.		879.00		879.00
2	Rear Bumper Side Retainer @ \$38.10	Damaged		76.20		76.20
1	Rear Fender Inner Shield LH	Deformed		95.00		95.00
1	Rear exhaust silencer assembly	Damaged/bent		598.00		598.00 R x
2	Rear shock absorber RHS & LHS @392.00	Damaged		784.00		784.00 S V L x
2	Rear wheel bearing @278.00	Damaged		556.00		556.00 S V L x
1	Rear axle	Damaged /Bent		1250.00		1250.00 S V L x
2	Rear exhaust mountings	Necessary		48.00		48.00 S V L x
1	Rear Windscreen	Broken		989.30		989.30
				14060.10		14060.10
		less 20%		2812.02	20%	2812.02
				11248.08		11248.08
		PART C/F		11248.08		11248.08

S K AUTO CONSULTANTS

Page No. 4

Our Reference TP/018/0144SK
Vehicle No. SJS 2942A

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(S\$)	OUR ASSESSMENT(S\$)
	<u>PARTS (LIST ITEMS)</u>	PARTS B/F	11248.08	11248.08
	<u>SPECIAL NETT ITEMS</u>			
1 set	Rear Bumper Clips	Necessary	60.00	40.00 ✓
1	Reverse Sensor	Broken	280.00	250.00 ✓
1	Rear Windscreen Sealant	Necessary	100.00	80.00 ✓
1	Rear End Panel Sealant	Necessary	100.00	80.00 ✓
1 set	Rear Fender Inner Shield Clips	Necessary	50.00	40.00 ✓
2	Rear Fender 1/4 Glass Sealant	Necessary	160.00	100.00 ✓
1	Rear tailgate top spoiler	Cracked	780.00	780.00 ✓
1	Wiper Blade	Damaged	50.00	50.00 ✓
		TOTAL PARTS	12828.08	12668.08

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Mar 2018		13 Apr 2018 10:04 Edit Adj Rpt	S\$8,650.00 Edit Estimates	S\$8,650.00 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	SG SAGAWA AMEROID PTE LTD , Co. Reg. No.: 199100423D		
Main Claimant:	CHAN HUA HSING ALVIN , ID: S8103346C		
Vehicle Reg. No.:	SJS2942A	Date of Loss:	02/03/2018 17:00 - :59 [102 Months and 23 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / MSC/V/18-000361	Policy/Cover Note No.:	MSD/VCC/18-000004 (Comprehensive) Coverage: 01/01/2018 - 31/12/2018
Vehicle Reg. No. (Insured):	YP5940Z	Policy No. (Claimant):	
		Excess:	S\$2,000.00
Repairer:	Motor Intel Automo Pte Ltd (HQ) Bartley Biz Centre, 13 Kakai Bukit Road 4, #01-20, 417807 Kaki Bukit - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Elaine Ngu Siau Mei - 6594 2540]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Teo Cheng Ming Wilson] ... [Final Rpt due 03/05/2018]		
Driver/Custodian (Insured):	WANG DAYONG (), NRIC: G6758188T, Tel: +6598338196		
Adj Asg. Remarks:	survey done- requested by catherine chong to put into correct file no. please reload all docements		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- MSIG_SG (30/04/2018): Report Send Back Alerts - SJS2942A (TP)

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SJS2942A (MSC/V/18-000361)**
[YP5940Z]

TP
CHAN HUA HSING ALVIN
Mar 2 2018 5:00PM
[SG SAGAWA AMERIOD PTE LTD]
Motor Intel Automo Pte Ltd

Upload Documents Upload Photos Compose New Letter

View View in Browser ▼

Photos/Images			3 per page ▼	✓
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	15/05/18 10:27	General View	1 Load JPG	✓
2	15/05/18 10:27	General View	1 Load JPG	✓
3	15/05/18 10:27	General View	1 Load JPG	✓
4	15/05/18 10:27	General View	1 Load JPG	✓
5	15/05/18 10:27	General View	1 Load JPG	✓
6	15/05/18 10:27	General View	1 Load JPG	✓
7	15/05/18 10:27	General View	1 Load JPG	✓
8	15/05/18 10:27	General View	1 Load JPG	✓
9	15/05/18 10:27	General View	1 Load JPG	✓
10	15/05/18 10:27	General View	1 Load JPG	✓
11	15/05/18 10:27	General View	1 Load JPG	✓
12	15/05/18 10:27	General View	1 Load JPG	✓
13	15/05/18 10:27	General View	1 Load JPG	✓
14	15/05/18 10:27	General View	1 Load JPG	✓
15	15/05/18 10:27	General View	1 Load JPG	✓
16	15/05/18 10:27	General View	1 Load JPG	✓
17	15/05/18 10:27	General View	1 Load JPG	✓
18	15/05/18 10:27	General View	1 Load JPG	✓
19	15/05/18 10:27	General View	1 Load JPG	✓
20	15/05/18 10:27	General View	1 Load JPG	✓
Documentation			1 per page ▼	✓
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	28/04/18 11:58	POLICE REPORT- SJS2942A.pdf	1 Load PDF	
2	28/04/18 11:58	S K AUTO CONSULTANTS REPORT- SJS2942A.pdf	1 Load PDF	
3	28/04/18 11:59	TP SURVYOR PHOTO 1 - SJS2942A.pdf	1 Load PDF	
4	28/04/18 11:59	TP SURVYOR PHOTO 2 - SJS2942A.pdf	1 Load PDF	
5	28/04/18 11:59	TP SURVYOR PHOTO 3 - SJS2942A.pdf	1 Load PDF	
6	28/04/18 11:59	TP SURVYOR PHOTO 4 - SJS2942A.pdf	1 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	15/05/18 10:25	PRS INVOICE	1 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset Save Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG18004373/LQBS2-1

Date: 15/05/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: MSD/VCC/18-000004
 Claimant Vehicle No: SJS2942A Insured Vehicle No: YP5940Z
 Date of Loss: 02/03/2018 Nature of Claim: TP Claim No: MSC/V/18-000361

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SJS2942A
 Make & Model: HONDA FIT, 1.3 G (A) Engine No: L13A4085349
 Reg. Date: 07/08/2009 (Man. Year: 2008) Chassis No: GE61075936
 Colour: Silver Odometer: 0 km
 Engine Capacity: 1339 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Fair Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/60R14 Rear Tyre Size: 185/60R14
 Front Left Side: Pirelli 3 mm Rear Left Side: Pirelli 3 mm
 Front Right Side: Pirelli 3 mm Rear Right Side: Pirelli 3 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	12,828.08	7,145.12	5,682.96	44.30
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,780.00	3,710.00	2,070.00	35.81
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	18,608.08	10,855.12	7,752.96	41.66
Approved Total (Overridden) (S\$)		8,650.00		
Nett Amount (S\$)	18,608.08	8,650.00	9,958.08	53.51

INSPECTION

Date of Assignment: 13/04/2018
 Date Inspected: 07/03/2018 Inspected At: Motor Intel Automo Pte Ltd (HQ)
 Bartley Biz Centre, 13 Kaki Bukit Road 4, #01-20
 Singapore 417807
 Estimated Period of Repair: 10.0 days

Adjuster: Teo Cheng Ming Wilson

Manager: CATHERINE CHONG KAI LING

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 15 May 2018)
Parts:	144	HONDA FIT 1.3 G (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJS2942A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAIL GATE	Distorted	1,085.00 FL	*1,085.00 FL
2	2		*TAIL GATE NUMBER PLATE LAMPS	Damaged	150.00 FL	*150.00 FL
3	1		*TAIL GATE LOCK	Damaged	186.60 FL	*186.60 FL
4	1		*TAIL GATE WIPER MOTOR	Damaged	288.00 FL	*288.00 FL
5	1		*TAIL GATE DAMPER	Damaged / Stiffen	492.00 FL	*492.00 FL
6	1		*TAIL GATE WEATHERSTRIP	Deformed	162.70 FL	*162.70 FL
7	1		*TAIL GATE CENTRE GARNISH	Damaged	155.60 FL	*155.60 FL
8	1		*TAIL GATE EMBLEM - FIT	Necessary	42.00 FL	*42.00 FL
9	1		*TAIL GATE INNER BOARD	Deformed	254.00 FL	*254.00 FL
10	1		*REAR WINDSCREEN MOULDING	Necessary	185.00 FL	*185.00 FL
11	1		*REAR FENDER RH & LH	Distorted	1,308.40 FL	*1,308.40 FL
12	2		*REAR FENDER INNER GARNISH	Deformed	382.00 FL	*382.00 FL
13	1		*REAR WINDSCREEN MOULDING (LOWER)	Necessary	68.00 FL	*68.00 FL
14	1		*TAIL LAMP LH & RH	N/s Broken	715.20 FL	*357.60 FL
15	1		*TAIL LAMP BASE PANEL LH	Repair	238.90 FL	*- FL
16	1		*RHS REAR WHEEL HOUSE PANEL	Repair	782.00 FL	*- FL
17	1		*SPARE TYRE PANEL BOARD	Repair	258.60 FL	*- FL
18	1		*SPARE TYRE PANEL	Repair	737.20 FL	*- FL
19	1		*FUEL TANK OUTER LID	Repair	242.00 FL	*- FL
20	1		*DRIVER SEAT SUPPORT BRACKET	Repair	450.00 FL	*- FL
21	1		*REAR END PANEL	Repair	485.20 FL	*- FL
22	1		*REAR END PANEL TOP GARNISH	Serviceable	116.20 FL	*- FL
23	1		*REAR BUMPER	Deformed / Cracked	879.00 FL	*879.00 FL
24	2		*REAR BUMPER SIDE RETAINER	Damaged	76.20 FL	*76.20 FL
25	1		*REAR FENDER INNER SHIELD LH	Deformed	95.00 FL	*95.00 FL
26	1		*REAR EXHAUST SILENCER ASSEMBLY	Repair	598.00 FL	*- FL
27	2		*REAR SHOCK ABSORBER RHS & LHS	Serviceable	784.00 FL	*- FL
28	2		*REAR WHEEL BEARING	Serviceable	556.00 FL	*- FL
29	1		*REAR AXLE	Serviceable	1,250.00 FL	*- FL
30	2		*REAR EXHAUST MOUNTINGS	Serviceable	48.00 FL	*- FL
31	1		*REAR WINDSCREEN	Broken	989.30 FL	*989.30 FL
32	1		*SET REAR BUMPER CLIPS	Necessary	60.00 FS	*40.00 FS
33	1		*REVERSE SENSOR	Broken	280.00 FS	*250.00 FS
34	1		*REAR WINDSCREEN SEALANT	Necessary	100.00 FS	*80.00 FS
35	1		*REAR END PANEL SEALANT	Necessary	100.00 FS	*80.00 FS
36	1		*SET REAR FENDER INNER SHIELD CLIPS	Necessary	50.00 FS	*40.00 FS
37	2		*REAR FENDER 1/4 GLASS SEALANT	Necessary	160.00 FS	*100.00 FS
38	1		*REAR TAILGATE TOP SPOILER	Cracked	780.00 FS	*780.00 FS
39	1		*WIPER BLADE	Damaged	50.00 FS	*50.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	15,640.10	8,576.40
- List Item Discount on L Items 20.00/20.00% (S\$)	2,812.02	1,431.28

Report was unsubmitted during this print-out.

5/15/2018

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
					Total Parts (\$\$)	12,828.08
						7,145.12

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACE THE DAMAGED PARTS AND COMPONENTS.	New	2,400.00	1,500.00
2	TO SUPPLY PAINT MATERIALS, EXPANDABLE ITEMS & PUTTY RESPRAY PAINT ON AFFECTED DAMAGED PARTS REPLACED & (REPAIRED REAR DOOR LHS & RHS)	New	1,600.00	1,200.00
3	TO REMOVE AND REFIX REAR BOOT COMPARTMENT FITTINGS, GARNISH ETC. SO AS TO FACILITATE REPAIRS FOR REAR PORTION.	New	250.00	120.00
4	TO REMOVE AND REFIX REAR FENDER 1/4 GLASS TO FACILITATE REPAIRS OF REAR FENDER.	New	200.00	80.00
5	TO REMOVE AND REFIX WIRING & CHECK ALL ELECTRICAL COMPONENTS AT THE ACCIDENT DAMAGED AREAS.	New	120.00	60.00
6	TO REMOVE AND REPLACE REAR EXHAUST SILENCER ASSEMBLY.	New	250.00	80.00
7	TO REPLACE REAR WINDSCREEN.	New	150.00	100.00
8	TO CARRY OUT REAR CHASSIS ALIGNMENT.	New	350.00	250.00
9	TO CARRY OUT COMPUTERISED WHEEL ALIGNMENT TEST.	New	120.00	80.00
10	TO REPLACE REVERSE SENSOR.	New	100.00	60.00
11	TO PERFORM ANTI RUST TREATMENT ON AFFECTED PARTS.	New	240.00	180.00
Gross Labour Cost (S\$)			5,780.00	3,710.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >