



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2003842  
INV Date 13/05/2020  
Reference CC6/LPC18008243/Aha3n2  
Code LPC2



### PROFESSIONAL SERVICE FEE

Vehicle No. SJJ 7792E  
Insured Veh. SJW 7497P  
Claim No. 18/18/18/VP05/020581  
Policy No. Z18VP05017967  
Accident Date 01/05/2018  
Inspection Date 02/05/2018

Description	Total
Third Party Express Settlement	450.00
<b>Subtotal</b>	<b>450.00</b>
<b>GST (7%)</b>	<b>31.50</b>
<b>Grand Total</b>	<b>481.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD		Ref : CC6/LPC18008243/Aha3n2		
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Date : 13-05-2020		
		Code : LPC2		
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SJW 7497P	Veh. Inspected	SJJ 7792E	
Policy No.	Z18VP05017967	Coverage (\$)	0.00	
Claim No.	18/18/18/VP05/020581	Excess (\$)	0.00	
Assign From		Assign Date	02/05/2018	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	SUBARU IMPREZA	c.c	1498	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	JF1GH3KW48G015640	Colour	GREY	
Odometer	158395	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	PIRELLI	6 mm	
L/H Front Tyre	205/55 R16	PIRELLI	6 mm	
R/H Rear Tyre	205/55 R16	PIRELLI	6 mm	
L/H Rear Tyre	205/55 R16	PIRELLI	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	01/05/2018	Inspection Date	02/05/2018	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>4 Working Days</b>		



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJJ 7792E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BUMPER	DEFORMED	650.00	650.00
1	REAR BUMPER SIDE RETAINER	NECESSARY	63.00	63.00
1	REAR BUMPER REFLECTOR RH	CRACKED	90.00	90.00
1	REAR BUMPER REINFORCEMENT	BENT	350.00	232.00
1	REAR TAIL LAMP RH	CRACKED	461.80	421.80
1	REAR TAIL LAMP LOWER BRACKET RH	CRACKED	62.00	62.00
1	REAR AIR VENT RH	CRACKED	111.00	58.70
1	REAR END PANEL	DENTED	529.60	529.60
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	189.40	-
1	EXHAUST PIPE	TO REPAIR SEE LABOUR	1,244.00	-
	LESS 20% DISCOUNT		-750.16	-421.42
			3,000.64	1,685.68
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	SET REAR TAIL LAMP CLIPS (SN)	NECESSARY	20.00	20.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	20.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			430.00	300.00
<b><u>LABOUR</u></b>				
	TO PANEL BEAT ,WELDING ,STRAIGHTEN ,REMOVE AND REFIX DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF EXHAUST PIPE .		1,600.00	500.00
	TO PUTTY ,SPRAY PAINT ,WAX, POLISH.		1,200.00	400.00
	TO APPLY RUST PROOFING ,ON AFFECTED AREAS.		250.00	40.00
	TO CHECK BULB ,WIRING FOR DAMAGES.		150.00	30.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		120.00	50.00
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	120.00	-
			3,440.00	1,020.00



GRAND TOTAL		6,870.64	3,005.68
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,400.00

Report Ref No. CC6/LPC18008243/Aha3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 7792E

RE-INSPECTION








## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

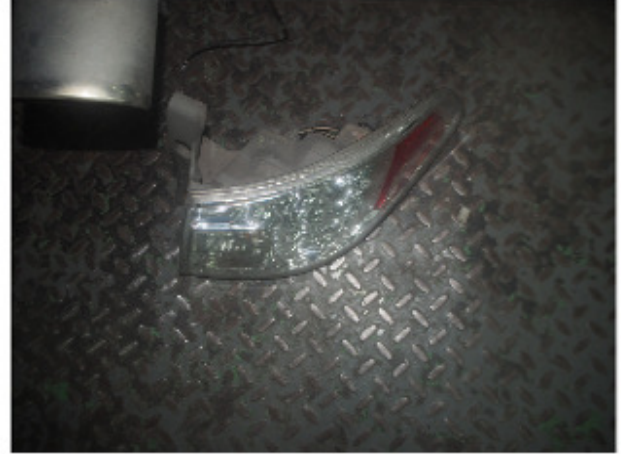



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 7792E

INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

