



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2003868
INV Date 13/05/2020
Reference CC3/CTI18008563/Kea3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SHB 7874T
Insured Veh. SKU 4398K
Claim No. SNM18D02320C02
Policy No. DMPCSN3070241600
Accident Date 04/05/2018
Inspection Date 09/05/2018

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC3/CTI18008563/Kea3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Date : 13-05-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKU 4398K	Veh. Inspected	SHB 7874T
Policy No.	DMPCSN3070241600	Coverage (\$)	0.00
Claim No.	SNM18D02320C02	Excess (\$)	0.00
Assign From		Assign Date	09/05/2018

2. Vehicle Particulars & Condition

Make & Model	CHEVROLET EPICA (A)	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	KL11A69RJBB106353	Colour	WHITE / RED
Odometer	648485	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	GITI	9 mm
L/H Front Tyre	195/65 R15	GITI	9 mm
R/H Rear Tyre	195/65 R15	GITI	9 mm
L/H Rear Tyre	195/65 R15	GITI	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/05/2018	Inspection Date	09/05/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 7874T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	SERVICEABLE	1,202.00	-
1	FRONT BUMPER LOWER ABSORBER	SERVICEABLE	180.00	-
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	356.00	-
1	FRONT BUMPER RETAINER RH	SERVICEABLE	102.00	-
1	FRONT BUMPER RETAINER LH	SERVICEABLE	102.00	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	78.00	-
1	FRONT BUMPER LOWER STIFFENER	TO REPAIR SEE LABOUR	134.37	-
1	FRONT BUMPER BRACKET LH	TO REPAIR SEE LABOUR	10.00	-
1	FRONT BUMPER BRACKET RH	TO REPAIR SEE LABOUR	10.00	-
1	BUMPER FOG LAMP COVER RH	SERVICEABLE	32.40	-
1	BUMPER FOG LAMP COVER LH	SERVICEABLE	32.40	-
1	HEADLAMP LH	SERVICEABLE	816.00	-
1	HEADLAMP LH INNER PANEL	TO REPAIR SEE LABOUR	611.16	-
1	FRONT FENDER LH	DENTED / BUCKLED	837.60	837.60
1	FRONT FENDER LINER LH	SERVICEABLE	47.00	-
1	FRONT FENDER INNER WHEEL HOUSE PANEL LH	TO REPAIR SEE LABOUR	1,437.00	-
1	FRONT SHOCK ABSORBER ASSY LH	SERVICEABLE	216.17	-
1	FRONT SHOCK ABSORBER TOP MOUNTING LH	SERVICEABLE	48.32	-
1	FRONT LOWER ARM LH	SERVICEABLE	283.00	-
1	FRONT KNUCKLE ARM LH	SERVICEABLE	230.00	-
1	FRONT DOOR LH	TO REPAIR SEE LABOUR	1,133.00	-
1	FRONT DOOR GLASS GUIDE RH CHROME MOULDING	SERVICEABLE	60.00	-
1	FRONT DOOR OUTER MOULDING	SERVICEABLE	220.00	-
1	FRONT DOOR OUTER HANDLE	SERVICEABLE	125.00	-
1	FRONT DOOR HANDLE SUPPORT	SERVICEABLE	3.00	-

Report Ref No. CC3/CTI18008563/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR OUTER HANDLE INNER SEAL	SERVICEABLE	89.15	-
1	FRONT DOOR OUTER KEY LOCK	SERVICEABLE	25.00	-
1	FRONT DOOR HINGE UPPER	TO REPAIR SEE LABOUR	65.00	-
1	FRONT DOOR HINGE LOWER	TO REPAIR SEE LABOUR	65.00	-
1	FRONT DOOR INNER LOCK	TO REPAIR SEE LABOUR	586.00	-
1	FRONT DOOR INNER LOCK CATCH LH	TO REPAIR SEE LABOUR	206.00	-
1	FRONT DOOR CHECK /ARRESTOR	SERVICEABLE	67.50	-
1	FRONT DOOR WEATHERSTRIP LH	SERVICEABLE	138.79	-
1	FRONT DOOR GLASS CHANNEL WEATHERSTRIP	SERVICEABLE	160.00	-
1	FRONT DOOR INNER TRIM BOARD	SERVICEABLE	455.69	-
1	FRONT DOOR WINDOW GLASS	SERVICEABLE	456.12	-
1	FRONT DOOR POWER WINDOW MOTOR (MASTER) LH	SERVICEABLE	284.97	-
1	FRONT DOOR POWER WINDOW MOTOR SWITCH	SERVICEABLE	145.00	-
1	FRONT DOOR WINDOW REGULATOR GEAR LH	SERVICEABLE	84.58	-
1	FRONT DOOR OUTER PILLAR PANEL LH	TO REPAIR SEE LABOUR	715.00	-
1	FRONT DOOR PILLAR INNER PANEL LH	TO REPAIR SEE LABOUR	850.00	-
1	FRONT DOOR CENTER PILLAR PANEL LH	TO REPAIR SEE LABOUR	698.15	-
1	FRONT SIDE VIEW MIRROR ASSY LH	DENTED / CUT	1,191.00	1,191.00
1	REAR DOOR LH (PANEL A-RR DR LH)	TO REPAIR SEE LABOUR	1,133.00	-
1	REAR DOOR WEATHERSTRIP -INNER	SERVICEABLE	41.40	-
1	REAR DOOR WEATHERSTRIP -2ND FRAME	SERVICEABLE	25.90	-
1	REAR DOOR TOP HINGE	TO REPAIR SEE LABOUR	35.00	-
1	REAR DOOR BOTTOM HINGE	TO REPAIR SEE LABOUR	35.00	-
1	REAR DOOR INNER LOCK	TO REPAIR SEE LABOUR	425.00	-
1	REAR DOOR CHECK /ARRESTOR	SERVICEABLE	65.00	-

Report Ref No. CC3/CTI18008563/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR LOCK STRIKER /LATCH	TO REPAIR SEE LABOUR	120.00	-
1	REAR DOOR OUTER WEATHERSTRIP MOULDING	SERVICEABLE	85.00	-
1	SIDE ROCKER PANEL GARNISH LH	SERVICEABLE	236.40	-
1	REAR FENDER LH	TO REPAIR SEE LABOUR	1,145.00	-
1	REAR FENDER INNER TRIM LH	SERVICEABLE	418.44	-
1	FRONT SIDE ROCKER PANEL GARNISH LH	SERVICEABLE	236.40	-
1	FRONT SIDE ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	600.00	-
1	FRONT SIDE ROCKER PANEL INNER LH	TO REPAIR SEE LABOUR	519.30	-
1	REAR BUMPER	SERVICEABLE	1,202.00	-
	LESS 10% DISCOUNT		-2,091.22	-202.86
			18,820.99	1,825.74
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER FASTENER CLIP (SN)	NOT NECESSARY	24.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	192.00	-
1	SET RADIATOR GRILLE CLIP (SN)	NOT NECESSARY	35.00	-
1	SET FRONT FENDER LINER CLIP (SN)	NOT NECESSARY	30.00	-
1	FRONT FENDER RR BRACKET LH (SN)	TO REPAIR SEE LABOUR	7.10	-
1	REAR WHEEL RIM HUB CAP LH (SN)	SERVICEABLE	166.30	-
1	REAR TYRE LH (SN)	SERVICEABLE	180.00	-
1	REAR TYRE RIM RLH (SN)	SERVICEABLE	126.00	-
1	SET REAR FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	30.00	-
			790.40	-
	<u>LABOUR</u>			
	TO CHECK ELECTRICAL LIGHTING CONCERNED .		170.00	20.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FRONT BUMPER REINFORCEMENT,FRONT BUMPER LOWER STIFFENER,FRONT BUMPER BRACKET LH,FRONT BUMPER BRACKET RH,HEADLAMP LH INNER PANEL,FRONT FENDER INNER WHEEL HOUSE PANEL LH,FRONT DOOR LH,FRONT DOOR HINGE UPPER,FRONT DOOR HINGE LOWER,FRONT DOOR INNER LOCK,FRONT DOOR INNER LOCK LATCH LH, } FRONT DOOR OUTER PILLAR PANEL LH,FRONT DOOR PILLAR INNER PANEL LH,FRONT DOOR CENTER PILLAR PANEL LH,REAR DOOR LH (PANEL A-RR DR LH),REAR DOOR TOP HINGE,REAR DOOR BOTTOM HINGE,REAR DOOR INNER LOCK,REAR DOOR LOCK STRIKER /LATCH,REAR FENDER LH,FRONT SIDE ROCKER PANEL OUTER LH,FRONT SIDE ROCKER PANEL INNER LH AND FRONT FENDER RR BRACKET LH.}		4,500.00	500.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		4,000.00	800.00
	TOWING FEES.	NOT NECESSARY	120.00	-
	TO DISMANTLE AND REFIT FRONT END SUSPENSION ,UNDERCARRIAGE PARTS ,FINAL CHECKING AND TESTING .	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO RUST -PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO TRANSFER OF DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			10,460.00	1,350.00
	GRAND TOTAL		30,071.39	3,175.74



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,550.00
---	--	--	----------

Report Ref No. CC3/CT118008563/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 7874T

INSPECTION

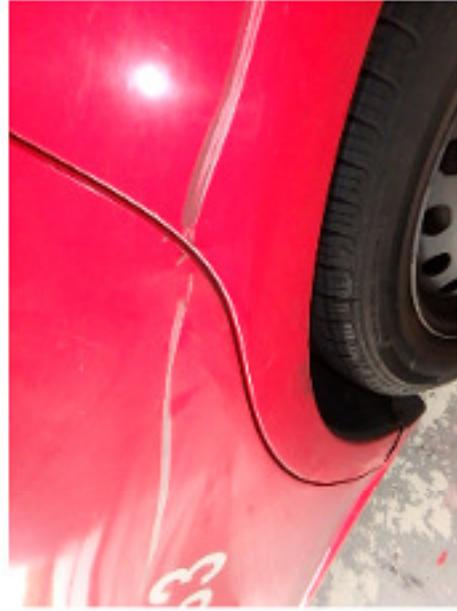




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

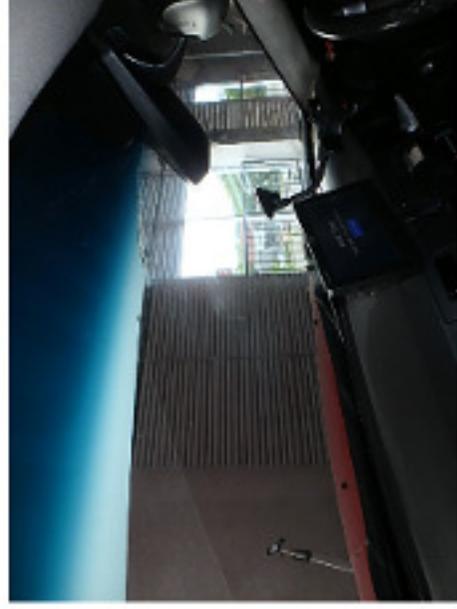



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paye Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

