



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2004531
INV Date 24/06/2020
Reference CC3/EQI18009081/K1pa3q2
Code EQI



PROFESSIONAL SERVICE FEE

Vehicle No. SHB 7808K
Insured Veh. SLD 925T
Claim No. DM18HO01328-JG
Policy No. DMCFHQ17-000185
Accident Date 13/05/2018
Inspection Date 17/05/2018

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD

Ref : CC3/EQ18009081/K1pa3q2

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEXSINGAPORE 069110

Date : 24-06-2020



Code : EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLD 925T	Veh. Inspected	SHB 7808K
Policy No.	DMCFHQ17-000185	Coverage (\$)	0.00
Claim No.	DM18HO01328-JG	Excess (\$)	0.00
Assign From		Assign Date	17/05/2018

2. Vehicle Particulars & Condition

Make & Model	CHEVROLET EPICA	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	KL1LA69RJBB109867	Colour	RED
Odometer	454692	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	GITI	7 mm
L/H Front Tyre	195/65 R15	GITI	7 mm
R/H Rear Tyre	195/65 R15	GITI	7 mm
L/H Rear Tyre	195/65 R15	GITI	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	13/05/2018	Inspection Date	17/05/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 7808K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT FENDER RH	DENTED	837.60	837.60
1	FRONT FENDER LINER RH	SERVICEABLE	47.00	-
1	FENDER INSULATION RH	SERVICEABLE	39.00	-
1	FRONT FENDER INNER WHEEL HOUSE PANEL RH	SERVICEABLE	1,437.00	-
1	FRONT DOOR RH	DENTED	1,133.00	1,133.00
1	FRONT DOOR GLASS GUIDE RH CHROME MOULDING	SERVICEABLE	60.00	-
1	FRONT DOOR OUTER MOULDING	SERVICEABLE	220.00	-
1	FRONT DOOR OUTER HANDLE	SERVICEABLE	125.00	-
1	FRONT DOOR HANDLE SUPPORT	SERVICEABLE	3.00	-
1	FRONT DOOR OUTER HANDLE INNER SEAL	SERVICEABLE	89.15	-
1	FRONT DOOR OUTER KEY LOCK	SERVICEABLE	25.00	-
1	FRONT DOOR HINGE UPPER	SERVICEABLE	65.00	-
1	FRONT DOOR HINGE LOWER	SERVICEABLE	65.00	-
1	FRONT DOOR INNER LOCK	SERVICEABLE	586.00	-
1	FRONT DOOR INNER LOCK LATCH RH	SERVICEABLE	206.00	-
1	FRONT DOOR CHECK /ARRESTOR	SERVICEABLE	67.50	-
1	FRONT DOOR WEATHERSTRIP RH	SERVICEABLE	138.79	-
1	FRONT DOOR GLASS CHANNEL WEATHERSTRIP	SERVICEABLE	160.00	-
1	FRONT DOOR INNER TRIM BOARD	SERVICEABLE	455.69	-
1	FRONT DOOR WINDOW GLASS	SERVICEABLE	456.12	-
1	FRONT DOOR POWER WINDOW MOTOR (MASTER) RH	SERVICEABLE	284.97	-
1	FRONT DOOR POWER WINDOW MOTOR SWITCH	SERVICEABLE	145.00	-
1	FRONT DOOR WINDOW REGULATOR GEAR RH	SERVICEABLE	84.58	-
1	FRONT DOOR OUTER PILLAR PANEL RH	SERVICEABLE	715.00	-
1	FRONT DOOR PILLAR INNER PANEL RH	SERVICEABLE	850.00	-
1	FRONT DOOR CENTER PILLAR PANLE RH	SERVICEABLE	698.15	-
1	FRONT SIDE VIEW MIRROR ASSY RH	SERVICEABLE	1,191.00	-
1	REAR DOOR RH (PANEL A-RR DR LH)	SERVICEABLE	1,133.00	-
1	FRONT SIDE ROCKER PANEL GARNISH RH	TO REPAIR SEE LABOUR	236.40	-
1	FRONT SIDE ROCKER PANEL OUTER RH	SERVICEABLE	600.00	-

Report Ref No. CC3/EQ18009081/K1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT SIDE ROCKER PANEL INNER RH	SERVICEABLE	519.30	-
1	FRONT BUMPER (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-1,267.33	-197.06
			11,405.92	1,773.54
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER FASTENER CLIP (SN)	SERVICEABLE	24.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	192.00	-
1	SET RADIATOR GRILLE CLIP (SN)	SERVICEABLE	35.00	-
1	SET FRONT FENDER LINER CLIP (SN)	SERVICEABLE	30.00	-
1	FRONT FENDER RR BRACKET RH (SN)	SERVICEABLE	7.10	-
1	REAR WHEEL RIM HUB CAP RH (SN)	SERVICEABLE	166.30	-
1	REAR TYRE RH (SN)	SERVICEABLE	180.00	-
1	REAR TYRE RIM RH (SN)	SERVICEABLE	126.00	-
1	SET REAR FENDER INNER TRIM CLIP RH (SN)	SERVICEABLE	30.00	-
			790.40	-
	<u>LABOUR</u>			
	TO CHECK ELECTRICAL LIGHTING CONCERNED.	NOT NECESSARY	170.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION.REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FRONT SIDE ROCKER PANEL GARNISH RH AND FRONT BUMPER .		4,500.00	600.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		4,000.00	800.00
	TOWING FEES.	NOT NECESSARY	120.00	-
	TO DISMANTLE AND REFIT FRONT END SUSPENSION ,UNDERCARRIAGE PARTS ,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	50.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-

Report Ref No. CC3/EQ18009081/K1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO TRANSFER OF DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	50.00
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			10,460.00	1,500.00
GRAND TOTAL			22,656.32	3,273.54
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,600.00

Report Ref No. CC3/EQ18009081/K1pa3q2

KALVIN ANG WEI KUN

Automotive Assessor / Investigator

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 7808K

INSPECTION

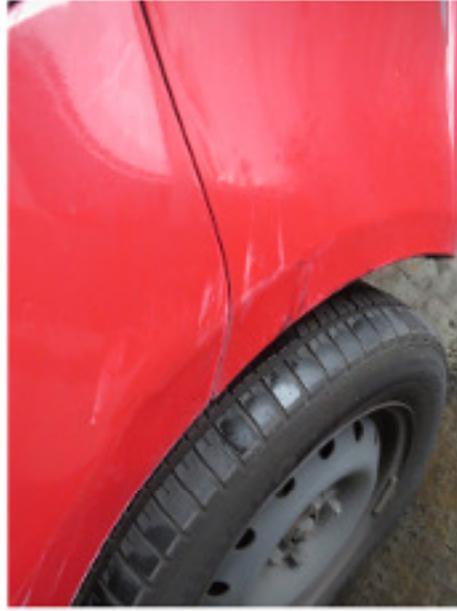



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

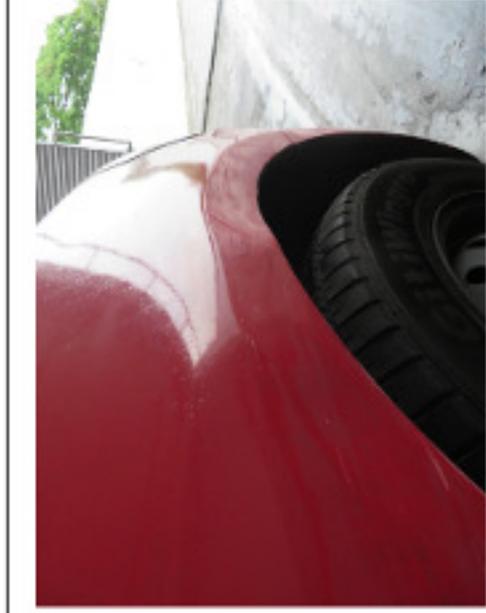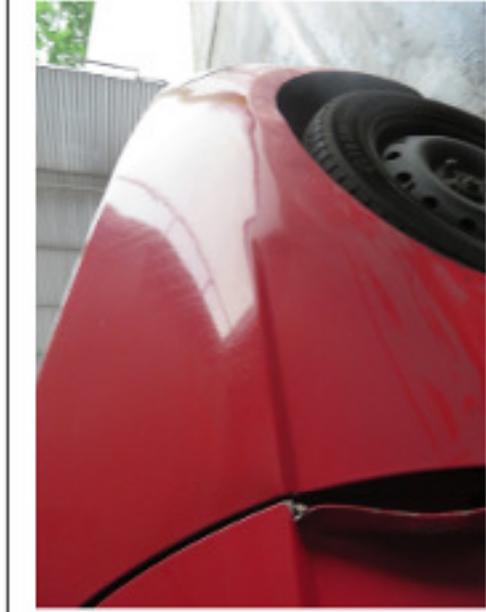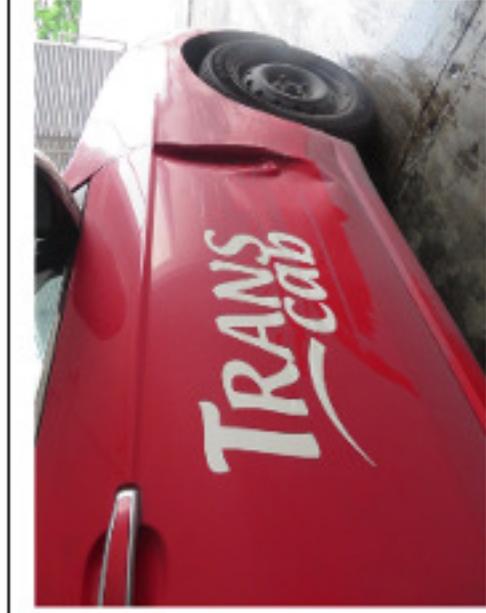



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

