

Surveyor:

ASSIGNMENT (Office)

CNS

From (Person):

Karen Tan

of

FCI

Date/Time:

30/5/18 @ 4:03pm

Estimated Cost:

Bill to:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHB 96892

Insured:

SHA 25064

at Workshop m/s

Truns Ceib

Tel:

6 287 6666

of

No-2 AMK sf-63

Policy No:

Claim No:

D18004198MPSTH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

23/05/2018

(Client's Record)

CA / REV / REP. / REV 24 HRS

'up'

31/05/2018

H.O.D. Endorsement:

Date/Time:

4:35pm @ 30/5/18

Person Contacted:

Candy

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction (✓) Estimate
	SHB 96892 - CC3 / III 17017423 / Kw63 DVA: 6/9/17
	SHA 25064 - CS / FCI 17019531 / R/q62 DVA: 3/10/17
1/6/18	Email preli revised to FCI
3/9/18	LS \$ 11,000 (Red 64,425.97, 85b)

ASS. REC. BY:

REF:

1721

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.



Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

07 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

31/5 Mr. Paul to Catharine

RECEIVED 03 SEP 2018

Veh No:

S113 96892

Yr Regn:

07, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

c.c

1985

Colour:

M. White / R

A/C:

Insured / Std / NI / NA

Sp. Reading

577821

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

V11 ABL15AUC

273057

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Modl:

R11 / S/Rim / STD A/Rim or

Tyre Size:

F: Giti

215/60R16

R: Falken

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

7

mm

L/Bal.

6

mm

L/Bal.

7

mm

D.O.A.

23/5/18

D.O.I.

30/5/18

Survey held at

Des. of Damages:

Frt / Rear / O/S / N/S / UIC / Rooftop or

& Body

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Prel. Report



: Final Report

1)

Date/Time, File Return to?

2)

3/9 - typist

Report Format:

CWS

Lump Sum / I.B.I. (\$) :

11,000/2

Days Of Repair:

7

Resurvey No. of Trip:

-

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S - R.S. St

Fixtures

Others

TOTAL

65745 = 975

1704 975

50

30

1225



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAVA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: D18004198MFSH

Our ref: CS/FCI18009764/Kvd3

Date : 1/6/2018

The Motor Claims Department
M/s FIRST CAPITAL INSURANCE LTD

Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SHB 9689Z


We thank for your instruction on 30/5/2018

Please be informed that we had conducted the inspection of the above mentioned vehicle on
30/5/2018 at the premises of M/s TRANS-CAB AUTO SERVICES PTE LTD
and have the following to report:-

Workshop Estimate Amount	: S\$75,425.97
Revised Estimate Amount	: S\$13,779.21
"Check" Items Amount	: S\$1,177.88
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the
rear and front portion

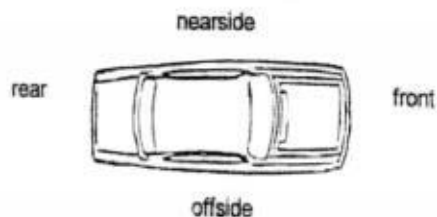

Comments/Present Status:
Damages Consistent

Yours faithfully,

Kenneth Kong
Licensed Appraiser

Job Sheet (/ClaimWS/Surveyor/JobSheet/240771)



PRI Documents



Close X

PRI Header Details

Claim No	D18004198MFSH	Policy No	D-18088936MFSH	Claimant S.No & Name	1 & TRANS-C/
Workshop Name	TRANS-CAB AUTO SERVICES PTE LTD (Contact Person : CANDY)	Survey Location & Contact Details	NO. 2 ANG MO KIO STREET 63 Mobile: 0 , Phone: 62876666 , Fax: 62571330 EmailId: CANDY.KONG@TRASCAB.COM.SG		
Our Surveyor	LKK AUTO CONSULTANTS PTE LTD	Instructions To Surveyor	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM		
Insured Name	COMFORT TRANSPORTATION PTE LTD	Insured Vehicle No	SHA2506U	TP Vehicle No	SHB9689Z
PRI Recieved Date	30-05-2018 01:21:47 PM	Surveyor Appointed Date	30-05-2018 04:01:59 PM	Surveyor Accept Date	30-05-2018 0

Survey Report Upload

Surveyor Inspection Date *:		Surveyor Report Date	30-05-2018	Upload Survey Report *:	Choose File
-----------------------------	--	----------------------	------------	-------------------------	--

Vehicle Particulars

Make	Please Select Make ▼	Model	Please Select Model ▼	Year	Select Year ▼
Chasis No		Engine No		Mileage	
Color		Cubic Capacity			

Multiple Documents Upload

File Name

Action

Surveyor Job Remarks

Remarks

MOTOR SURVEY ASSIGNMENT

Date	25-05-2018	Our Ref No. D18004198MFSH
Accident Date	23-05-2018	Claim Type. Third Party
Insured Vehicle	SHA2506U	Third Party Vehicle. SHB9689Z
Survey Location	NO. 2 ANG MO KIO STREET 63	
Contact Person.	CANDY	
Contact No.	62876666/ 0	Fax No. 62571330
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS-CAB AUTO SERVICES PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	KARENT	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.

This is a computer generated letter, no signature required.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Friday, 1 June 2018 8:21 AM
To: 'Claim Workflow System'
Cc: KARENTAN@MSFIRSTCAPITAL.COM.SG; SUR
Subject: RE: SURVEY ASSESSMENT - D18004198MFSH/1, SHB 9689Z
Attachments: SHB 9689Z PRELI ADVISED.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle SHB 9689Z
Date of survey: 30/5/2018
Number of days: 7 days

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Wednesday, 30 May 2018 4:40 PM
To: 'Claim Workflow System' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: KARENTAN@MSFIRSTCAPITAL.COM.SG; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D18004198MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claim Workflow System [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Wednesday, 30 May 2018 4:02 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWSMOTORCLAIMS@MSFIRSTCAPITAL.COM.SG; KARENTAN@MSFIRSTCAPITAL.COM.SG
Subject: PRI: SURVEY ASSESSMENT - D18004198MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Best Regards,

Admin Team
Claim Workflow System
Motor Claims Department
MS First Capital Insurance Limited
Tel : 6507 3848
Fax : 6507 3849

PS: This is a system generated mail. Please do not reply to this mail.

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHB9689Z

Vehicle to be Exported: Yes

Intended De-registration Date: 24 May 2018

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2013

Engine No.: M9R8839C000127

Chassis No.: VF1ABL15AUC273057

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 18 Jul 2013

First Registration Date: 18 Jul 2013

Transfer Count: 0

Actual ARF Paid: \$12,498.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 17 Jul 2021

PARF Rebate Amount: \$9,373.00

Intended COE Rebate Details

COE Expiry Date: 17 Jul 2021

COE Category: A - Car (1600cc & below)

COE Period(Years): 8

PQP Paid: \$51,810.00

COE Rebate Amount: \$20,372.00

Total Rebate Amount: \$29,745.00**Message**

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 24 May 2018.

OK

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z**AAD1805-230***Not Authored
L/Sing &*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHB 9689Z

VF1ABL15AUC273057

RENAULT

LATITUDE

23.5.2018

FCIL**PART****LIST**

1	1	BUMPER COVER FRT	\$	<i>Bu</i>	1,259.42	✓
2	1	BUMPER SPOILER FRT	\$	<i>Sn</i>	181.75	X
3	1	BUMPER ABSORBER FRT	\$	<i>Sn</i>	394.68	X
4	1	BUMPER RETAINER FRT LH	\$	<i>Dis</i>	151.41	✓
5	1	BUMPER SUPPORT FRT	\$	<i>Sn</i>	123.88	X
6	1	BUMPER RETAINER FRT RH	\$	<i>Dis</i>	150.77	✓
7	1	BUMPER SUPPORT FRT	\$	<i>Sn</i>	123.88	X
8	1	BUMPER UNDERTRAY FRT	\$	<i>Sn</i>	472.83	X
9	1	BUMPER GRILLE LOWER FRT	\$	<i>Sn</i>	266.80	X
10	1	BUMPER FOG LAMP GRILLE LH	\$	<i>Sn</i>	207.21	X
11	1	BUMPER FOG LAMP GRILLE RH	\$	<i>Sn</i>	207.21	X
12	1	BUMPER BEAM FRT	\$	<i>R</i>	914.08	X
13	1	TOW COVER FRT	\$	<i>Sn</i>	28.61	X
14	1	RADIATOR GRILLE	\$	<i>mgmt</i>	1,707.78	✓
15	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	<i>ru</i>	225.36	✓
16	1	RADIATOR GRILLE FRAME	\$	<i>CM</i>	1,353.75	✓
17	1	FRAME FULL SUPPORT PANEL	\$	<i>CM</i>	615.90	✓
18	1	FRAME FULL SUPPORT BRACKET	\$	<i>R</i>	89.79	X
19	1	FRONT BRACE PANEL	\$	<i>R</i>	177.22	} X
20	1	HORN	\$	<i>Sn</i>	314.17	
21	1	HORN BRACKET	\$	<i>R</i>	40.45	
22	1	HEADLAMP LH	\$	<i>Sn</i>	1,184.43	
23	1	HEADLAMP RH	\$	<i>Sn</i>	1,184.43	
24	1	HEADLAMP PANEL FRT LH	\$	<i>R</i>	152.15	
25	1	HEADLAMP PANEL FRT RH	\$	<i>R</i>	152.15	
26	1	BONNET	\$	<i>R</i>	1,941.63	
27	1	BONNET INSULATOR	\$	<i>Sn</i>	405.73	}
28	1	BONNET STRUT LH	\$	<i>Sn</i>	88.61	
29	1	A/C CONDENSER	\$	<i>Sn</i>	2,020.37	

Trans-cab Auto Services Pte Ltd

AAD1805-230

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z

30	1	BONNET STRUT RH	\$	SL	88.61	
31	1	BONNET HINGE LH	\$	N	348.31	
32	1	BONNET HINGE RH	\$	N	348.31	
33	1	BONNET LOCK	\$	N	305.48	
34	1	BONNET CABLE	\$	SL	119.19	
35	1	BONNET CABLE COVER	\$	SL	161.03	
36	1	BONNET SEAL OUTER	\$	SL	92.36	
37	1	BONNET SEAL INNER	\$	SL	157.28	
38	1	FENDER PANEL FRT LH	\$	N	783.83	
39	1	FENDER PANEL FRT RH	\$	N	783.83	
40	1	WHEELARCH FRT LH	\$	SL	278.84	
41	1	WHEELARCH FRT RH	\$	SL	278.84	
42	1	FENDER BRACKET LOWER LH	\$	SL	15.79	
43	1	FENDER BRACKET LOWER RH	\$	SL	15.79	
44	1	FENDER INSULATOR LH	\$	SL	130.84	
45	1	FENDER INSULATOR RH	\$	SL	130.84	
46	1	BUMPER COVER REAR	\$	Bu	1,108.46	✓
47	1	BUMPER LOWER REAR	\$	N	768.84	✓
48	1	BUMPER BRACKET CTR REAR	\$	Dis	113.47	✓
49	1	BUMEPR BRACKET SIDE RH REAR	\$	SL	135.97	X
50	1	BUMEPR RETAINER RH REAR	\$	SL	44.99	X
51	1	BUMPER REFLECTOR RH	\$	SL	43.61	X
52	1	BUMEPR BRACKET SIDE LH REAR	\$	SL	135.97	X
53	1	BUMEPR RETAINER LH REAR	\$	SL	44.99	X
54	1	BUMPER REFLECTOR LH	\$	SL	43.61	X
55	1	BUMPER BEAM REAR	\$	B	777.52	✓
56	1	BUMPER BEAM BRACKET LH REAR	\$	Dis	225.95	✓
57	1	BUMPER BEAM BRACKET RH REAR	\$	Dis	225.95	✓
58	1	BOOT REAR	\$	N	2,872.68	X
59	1	BOOT FINISHER	\$	SL	470.06	X
60	1	BOOT WHEATERSTRIP	\$	Bu	323.05	✓
61	1	BOOT REFLECTOR LAMP LH	\$	SL	493.35	X
62	1	BOOT REFLECTOR LAMP RH	\$	SL	493.35	X
63	1	BOOT BADGE 'RENAULT'	\$	N	225.36	✓
64	1	BOOT BADGE	\$	N	225.36	✓
65	1	BOOT STRUT LH	\$	SL	276.08	X
66	1	BOOT STRUT RH	\$	SL	276.08	X
67	1	BOOT HINGE LH	\$	N	367.84	X

Trans-cab Auto Services Pte Ltd

AAD1805-230

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z

68	1	BOOT HINGE RH	\$	R	367.84	
69	1	BOOT INNER TRIM	\$	Sh	586.45	
70	1	BOOT SWITCH	\$	Sh	168.13	
71	1	BOOT LOCK	\$	R	202.67	
72	1	BOOT LOCK CATCH	\$	R	74.40	
73	2	LICENCE PLATE LAMP	\$	Sh	50.52	
74	2	BOOT RUBBER PLUG	\$	Sh	221.81	
75	1	FENDER PANEL INNER TRIM REAR LH	\$	Sh	671.45	
76	1	FENDER PANEL REAR LH	\$	R	3,299.13	
77	1	WHEELARCH REAR LH	\$	Sh	543.47	
78	1	FENDER PANEL INNER TRIM REAR RH	\$	Sh	671.45	
79	1	FENDER PANEL REAR RH	\$	R	3,299.13	
80	1	WHEELARCH REAR RH	\$	Sh	543.47	
81	1	FENDER PANEL REAR LH	\$	R	3,299.13	
82	1	WHEELARCH REAR LH	\$	Sh	543.47	
83	1	TAILLAMP RH	\$	Sh	552.55	
84	1	TAILLAMP PANEL RH	\$	R	986.70	
85	1	TAILLAMP LH	\$	Sh	552.55	
86	1	TAILLAMP PANEL LH	\$	R	986.70	
87	1	OUTER PANEL REAR (End Panel)	\$	R	1,471.77	
88	1	OUTER PANEL REAR (End Panel)TRIM	\$	CM	404.56	
89	1	SPARE WHEEL PANEL (Luggage Floor Panel)	\$	R	2,189.88	X
90	1	SPARE WHEEL PANEL TRIM	\$	Sh	612.21	X
91	1	EXHAUST REAR	\$	R	7,489.05	X
92	1	EXHAUST CAP REAR	\$	R	230.49	X

TOTAL	\$	59,887.17
10%	\$	5,988.72
	\$	53,898.45

Specical Nett

1	1SET	RADAIOR GRILLE FRAME CLIP	\$	nn	52.00	
2	1SET	BUMPER CLIP FRT	\$	nn	66.00	
3	1	BUMPER BRACKET CLIP FRT LH	\$	nn	12.00	X
4	1	BUMPER SUPPORT CLIP FRT LH	\$	nn	10.50	X
5	1	BUMPER BRACKET CLIP FRT RH	\$	nn	12.00	X

Trans-cab Auto Services Pte Ltd

AAD1805-230

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z

6	1	BUMPER SUPPORT CLIP FRT RH	\$	na	10.50 X
7	1	TOW COVER FRT	\$	na	14.50 X
8	1SET	RADAIOR GRILLE SCREW	\$	na	16.00 X
9	1SET	BUMPER GRILLE LOWER CLIP	\$	na	69.00 X
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	Whe	70.00 ✓
11	2	FRAME FULL SUPPORT PANEL NUT	\$	na	20.00 X
12	2	FRAME FULL SUPPORT PANEL STUD	\$	na	30.00 X
13	1	Windscreen moulding	\$	na	100.00 X
14	1SET	Front licence plate with holder	\$	Red	80.00 455m
15	1SET	PARKING AID	\$	Shen	700.00 600m
16	1SET	REAR BUMPER CLIP	\$	na	66.00 —
17	1SET	BUMPER BRACKET CTR CLIP	\$	na	33.00 —
18	1SET	BUMEPR BRACKET SIDE CLIP RH RR	\$	na	10.00 X
19	1SET	BUMEPR RETAINER RH CLIP RR	\$	na	20.00 X
20	1SET	BUMEPR BRACKET SIDE CLIP LH RR	\$	na	10.00 X
21	1SET	BUMEPR RETAINER CLIP LH RR	\$	na	20.00 X
22	1SET	BUMPER LOWER REAR RIVET	\$	na	22.00 X
23	1SET	BUMPER LOWER REAR CLIP	\$	na	66.00 ✓
24	1	EXHAUST MOUNTING REAR	\$	Sh	17.82 X
25	1SET	BOOT FINISHER CLIP	\$	na	24.20 X
26	1	BOOT STICKER "Trans-cab"	\$	na	30.00 —
27	1	BOOT STICKER "6555-3333"	\$	na	30.00 —
28	1	BOOT INNER TRIM CLIP	\$	na	45.00
29	1SET	FENDER WHEELARCH REAR RH CLIP	\$	na	35.00
30	1SET	FENDER WHEELARCH REAR LH CLIP	\$	na	35.00
31	1	FENDER INNER TRIM CLIP LH	\$	na	28.00
32	1	FENDER INNER TRIM CLIP LH	\$	na	28.00
33	1	TAILLAMP CLIP RH	\$	na	5.00
34	1	TAILLAMP CLIP LH	\$	na	5.00
35	2	REAR WINDSCREEN SELANT	\$	na	80.00
36	1	WINDSCREEN MOULDING	\$	na	100.00
37	1	REAR WINDSCREEN INNER SPONGE SEAL	\$	na	100.00
38	1	SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	Sh	385.00
39	1	SPARE TYRE	\$	Sh	330.00
			\$		2,787.52

Trans-cab Auto Services Pte Ltd**AAD1805-230**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z**TOTAL PARTS \$ 56,685.97**

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	11001 5,400.00
Towing Fees.	\$	na 120.00 X
To apply paint protection system (PPS) maintain and enhancement	\$	na 380.00 X
Putty and spray painting of the affected portion.	\$	6,000.00 bpa
To rust-proofing of the affected areas.	\$	170.00 ba
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00 ba
To check steering geometry and computer wheel alignment	\$	na 220.00 X
To transfer of tire, rim and on wheel balancing.	\$	↪ 170.00 X
To Check Electrical Lighting Concerned.	\$	170.00 401
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	na 380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	↪ 380.00 X
To lift-up engine with gear box and refit.	\$	↪ 440.00 X

Trans-cab Auto Services Pte Ltd**AAD1805-230**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9689Z

To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	~ 440.00 X
To remove and refit air bag system and reset.	\$	~ 480.00 X
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	~ 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	380.00 100
To replace, refix and top up coolant for radiator	\$	170.00 50
To vacuum, replace, refix and recharge Air Intercooler	\$	170.00 50
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	~ 170.00 X
To Rust-Proofing Of The Affected Areas.	\$	170.00 60
To reinstall rear bumper parking sensor.	\$	170.00 60
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00 60
To repair and realign rear exhaust pipe.	\$	~ 170.00 X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	~ 170.00 X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	~ 170.00 X
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	~ 170.00 X

ices Pte Ltd

63 Singapore 569111

Fax No. : 6257 1330

019626G

AAD1805-230

To supply and re-do rear luggage floor panel insulation padding.

\$ *nn* 380.00 X

To transfer of rear fender fittings, attachment and perform water seepage test.

\$ *nn* 380.00 X

To transfer of rear windscreen fittings and conduct water seepage test.

\$ *nn* 170.00 X

To check steering geometry and computer wheel alignment

\$ *nn* 220.00 X

TOTAL \$ **18,740.00**

Over All Total \$ **75,425.97**

(LUMP SUM) Repair Days

20 DAYS
7 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Trans-Cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel: 6287 6666

Fax: 6287 7764

Co. Reg. No.: 201019626G

GST Reg. No.: 201019626G

Tax Invoice / Debit Note

TO: MS FIRST CAPITAL INSURANCE LIMITED 36 Robinson Road #16-01 City House 068877 Singapore ATTENTION:	INVOICE NO. : INV1806-135 DATE : 30. June 2018 REFERENCE NO : AAD1805-230 TERMS : DUE DATE : 30. June 2018 PAGE : 1
--	--

NO.	CODE	DESCRIPTION	QTY	UNIT PRICE	AMOUNT
1.	6050101	REPAIR-SHB9689Z;DOA 23.05.18(LUMP SUM-18)	1	11,770.00	11,770.00

Total SGD Excl. GST : 11,000.00

7% GST : 770.00

Total SGD Incl. GST : 11,770.00

**** ELEVEN THOUSAND SEVEN HUNDRED SEVENTY SGD ONLY ****

- 1) All cheques should be crossed and made payable to "Trans-Cab Auto Services Pte Ltd"
- 2) Please quote our Invoice Number during payment.
- 3) We reserve the right to charge interest @ 1.5% per month on overdue invoice.
- 4) Any dispute as to the accuracy, charges etc of this invoice must be communicated within 10 days from the date hereof failing which it shall be deemed to have been unconditionally accepted.

E. & O. E.

THIS IS A COMPUTER GENERATED INVOICE WHICH REQUIRES NO SIGNATURE

D18/4/98/CLP4/K7

Trans-Cab Services Pte Ltd

No. 2 Ang Mo Kio Street 63

Tel No.: 6287 6666 Fax No. 6281 1400

Co./GST Reg. No. 200303878K



Our Ref : AAD1805-230

Your Ref : SHA2506U

Date : 06.July 2018

FIRST CAPITAL INSURANCE

Dear Sir/Madam,

**ACCIDENT INVOLVING SHB9689Z AND SHA2506U ON 23/05/18 12:00 PM ALONG
MANDAI LAKE ROAD SINGAPORE ZOO TAXI STAND**

It appears that the above accident was caused by your insured's negligence. We, therefore seeking compensation from you for our financial loss as itemized below :-

1.	Cost of Repair (inclusive of 7% GST)	\$	11,770.00
2.	Loss of Rental for <u>15</u> days @ \$ <u>99.32</u> per day	\$	1,489.80
3.	Loss of Income for <u>15</u> days @ \$ <u>50.00</u> per day	\$	750.00
4.	LTA Search Fee	\$	0.00
5.	Survey Fee	\$	0.00
	Total	\$	14,009.80

We enclose a copy of the following documents for your consideration :-

GIA report lodged by our driver
Certificate of Insurance
Original final repair bill

Rental rate and mileage records
Authorization To Act
LTA Search Fee

Kindly let us have the discharge voucher within the next 14 days, failing which we shall proceed to hand over the conduct of this matter to our solicitors without further reference to you.

Yours Faithfully

Trans-Cab Services Pte Ltd



Jasmine Tan

General Manager

Tel No. : 6603 1250 (DID)

Note : Please email any further correspondence to claims@transcab.com.sg (6603 1259)

TPD (2)

7/20/18



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI18009764/Kvd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 10-09-2018	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 2506U	Veh. Inspected	SHB 9689Z	
Policy No.	D-18088936MFSH	Coverage (\$)	0.00	
Claim No.	D18004198MFSH	Excess (\$)	0.00	
Assign From	KARENT	Assign Date	30/05/2018	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	VF1ABL15AUC273057	Colour	METALLIC WHITE / RED	
Odometer	577821	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	6 mm	
L/H Front Tyre	215/60 R16	GITI	6 mm	
R/H Rear Tyre	215/60 R16	FALKEN	7 mm	
L/H Rear Tyre	215/60 R16	FALKEN	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/05/2018	Inspection Date	30/05/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 7

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 9689Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER FRT	BUCKLED	1,259.42	1,259.42
1	BUMPER SPOILER FRT	SERVICEABLE	181.75	-
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH	DISTORTED	151.41	151.41
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH	DISTORTED	150.77	150.77
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	472.83	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	266.80	-
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	914.08	-
1	TOW COVER FRT	SERVICEABLE	28.61	-
1	RADIATOR GRILLE	MTG CRACKED	1,707.78	1,707.78
1	RADIATOR GRILLE BADGE "RENAULT"	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	CRACKED	1,353.75	1,353.75
1	FRAME FULL SUPPORT PANEL	CRACKED	615.90	615.90
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	89.79	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	HORN	SERVICEABLE	314.17	-
1	HORN BRACKET	TO REPAIR SEE LABOUR	40.45	-
1	HEADLAMP LH	SERVICEABLE	1,184.43	-
1	HEADLAMP RH	SERVICEABLE	1,184.43	-
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	152.15	-
1	HEADLAMP PANEL FRT RH	TO REPAIR SEE LABOUR	152.15	-
1	BONNET	TO REPAIR SEE LABOUR	1,941.63	-

Report Ref No. CS/FC118009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 2 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET INSULATOR	SERVICEABLE	405.73	-
1	BONNET STRUT LH	SERVICEABLE	88.61	-
1	A/C CONDENSER	SERVICEABLE	2,020.37	-
1	BONNET STRUT RH	SERVICEABLE	88.61	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	305.48	-
1	BONNET CABLE	SERVICEABLE	119.19	-
1	BONNET CABLE COVER	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER	SERVICEABLE	92.36	-
1	BONNET SEAL INNER	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH	TO REPAIR SEE LABOUR	783.83	-
1	FENDER PANEL FRT RH	TO REPAIR SEE LABOUR	783.83	-
1	WHEELARCH FRT LH	SERVICEABLE	278.84	-
1	WHEELARCH FRT RH	SERVICEABLE	278.84	-
1	FENDER BRACKET LOWER LH	SERVICEABLE	15.79	-
1	FENDER BRACKET LOWER RH	SERVICEABLE	15.79	-
1	FENDER INSULATOR LH	SERVICEABLE	130.84	-
1	FENDER INSULATOR RH	SERVICEABLE	130.84	-
1	BUMPER COVER REAR	BUCKLED	1,108.46	1,108.46
1	BUMPER LOWER REAR	DENTED	768.84	768.84
1	BUMPER BRACKET CTR REAR	DISTORTED	113.47	113.47
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR LH	SERVICEABLE	43.61	-
1	BUMPER BEAM REAR	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR	DISTORTED	225.95	225.95

Report Ref No. CS/FCI18009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No: 19-9607198-R

Page No.: 3 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUMPER BEAM BRACKET RH REAR	DISTORTED	225.95	225.95
1	BOOT REAR	TO REPAIR SEE LABOUR	2,872.68	-
1	BOOT FINISHER	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP	CUT	323.05	323.05
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	493.35	-
1	BOOT BADGE "RENAULT"	NECESSARY	225.36	225.36
1	BOOT BADGE	NECESSARY	225.36	225.36
1	BOOT STRUT LH	SERVICEABLE	276.08	-
1	BOOT STRUT RH	SERVICEABLE	276.08	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM	SERVICEABLE	586.45	-
1	BOOT SWITCH	SERVICEABLE	168.13	-
1	BOOT LOCK	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	74.40	-
2	LICENCE PLATE LAMP	SERVICEABLE	50.52	-
2	BOOT RUBBER PLUG	SERVICEABLE	221.81	-
1	FENDER PANEL INNER TRIM REAR LH	SERVICEABLE	671.45	-
1	FENDER PANEL REAR LH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH	SERVICEABLE	543.47	-
1	FENDER PANEL INNER TRIM REAR RH	SERVICEABLE	671.45	-
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH	SERVICEABLE	543.47	-
1	FENDER PANEL REAR LH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH	SERVICEABLE	543.47	-
1	TAILLAMP RH	SERVICEABLE	552.55	-

Report Ref No. CS/FCI18009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP LH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL LH	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL)	BENT	1,471.77	1,471.77
1	OUTER PANEL REAR (END PANEL) TRIM	CRACKED	404.56	404.56
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM	SERVICEABLE	612.21	-
1	EXHAUST REAR	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR	TO REPAIR SEE LABOUR	230.49	-
	LESS 10% DISCOUNT		-5,988.71	-1,133.47
			53,898.43	10,201.21
	SPECIAL NETT ITEMS			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NECESSARY	52.00	52.00
1	SET BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN)	NOT NECESSARY	14.50	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NECESSARY	70.00	70.00
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	DENTED	80.00	45.00
1	SET PARKING AID (SN)	SHORTED	700.00	600.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NECESSARY	33.00	33.00

Report Ref No. CS/FCI18009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	SET BOOT FINISHER CLIP (SN)	NOT NECESSARY	24.20	-
1	BOOT STICKER "TRANS-CAB" (SN)	NECESSARY	30.00	30.00
1	BOOT STICKER "6555-3333" (SN)	NECESSARY	30.00	30.00
1	BOOT INNER TRIM CLIP (SN)	NOT NECESSARY	45.00	-
1	SET FENDER WHEELARCH REAR RH CLIP (SN)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN)	NOT NECESSARY	35.00	-
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP RH (SN)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN)	NOT NECESSARY	5.00	-
2	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
1	SPARE TYRE RIM (ROUE 7J 16H 2547)(SN)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN)	SERVICEABLE	330.00	-
			2,787.52	1,058.00
	LABOUR			
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME. }		5,400.00	1,100.00

Report Ref No. CS/FCI18009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT,FRAME FULL SUPPORT BRACKET,FRONT BRACE PANEL,HORN,HEADLAMP PANEL FRT LH,HEADLAMP PANEL FRT RH,BONNET,BONNET HINGE LH,BONNET HINGE RH,BONNET LOCK,FENDER PANEL FRT LH,FENDER PANEL FRT RH,BOOT REAR,BOOT HINGE LH,BOOT HINGE RH,BOOT LOCK,BOOT LOCK CATCH,FENDER PANEL REAR LH,FENDER PANEL REAR RH,FENDER PANEL REAR LH,TAILLAMP PANEL RH,TAILLAMP PANEL LH,SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL),EXHAUST REAR AND EXHAUST CAP REAR. }		-	-
	TOWING FEES.	NOT NECESSARY	120.00	-
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	880.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	60.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.		380.00	60.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	40.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.	NOT NECESSARY	440.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP,OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.	NOT NECESSARY	480.00	-
	TO DROP DIESEL TANK,PIPES,HOSES TO FACILITATE BODYWORK REPAIR,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR CONDENSER.		380.00	100.00
	TO REPLACE,REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00

Report Ref No. CS/FCI18009764/Kvd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 7 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO VACUUM, REPLACE, REFILL AND RECHARGE AIR INTERCOOLER.		170.00	50.00
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	60.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
			18,740.00	2,520.00
	GRAND TOTAL		75,425.95	13,779.21
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,000.00

Report Ref No. CS/FCI18009764/Kvd3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.