

ASS. REC. BY:

REF:

Tm1 /

CC3 / TM18009934 / Krbn2

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

SKX 4793L

Policy No.

MW011169

Claims No.

M1802673

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S14B 9824A

Yr Regn:

08, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

c.c

1995

Colour:

h. white / h.

A/C:

Insured / Std / NI / NA

Sp. Reading

252743

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC 273314

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: N/A / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

215/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Giti

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

25/5/18

D.O.I.

30/5/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rear O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

31/5

File para to Catherine

L1 by 890501

(Red: \$62,992.42, 87%).

S14B 9824A

- CS/TP14020153/Krbu2

SKX 4793L

- X

DCA: 18-10-14

RECEIVED 05 JUN 2018

Date/Time, File Pass to?

1) typist

Date/Time, File Return to?

2)



Prell. Report



Final Report

Days Of Repair:

4

Resurvey No. of Trip:

-

Add Fee:



Site Insp (\$



Interview (\$



Tech Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Report Format:

TP

Lump Sum / H-I: (\$

9050

250

10

260

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	3878K

Vehicle Details

Vehicle No.:	SHB9824A
Vehicle to be Exported:	Yes
Intended De-registration Date:	28 May 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2013
Engine No.:	M9R8839C000383
Chassis No.:	VF1ABL15AUC273314
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	20 Aug 2013
First Registration Date:	20 Aug 2013
Transfer Count:	0
Actual ARF Paid:	\$12,498.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	19 Aug 2021
PARF Rebate Amount:	\$9,373.00

Intended COE Rebate Details

COE Expiry Date:	19 Aug 2021
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$54,952.00
COE Rebate Amount:	\$22,158.00
Total Rebate Amount:	\$31,531.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 28 May 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	28/05/2018 11:32
Date Of Accident	25/05/2018 16:45
Exact Location Of Accident	WOODLANDS AVENUE 7 TOWARDS WOODLANDS AVENUE 2
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB9824A
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62866666

Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	LEE ENG SWEE
NRIC No	S2554082D
Date Of Birth	25/07/1945
Occupation	OUTDOOR
Date Of Driving Pass	30/01/1971
Driving Experience	47 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96921711
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 34 MARSILING DRIVE #12-381
Postcode	730034
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - U-TURN
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

On 25.05.2018 at about 1645hours, I was travelling straight on the extreme right lane along Woodlands Avenue 7 towards Woodlands Avenue 2 when the traffic arrow lights turn green, I proceeded to make a right turn towards Woodlands Avenue 2. Suddenly Vehicle B (SKX4793L) on my right made a U-turn without checking for oncoming vehicle and traffic light. Hence, Vehicle B's hit onto my taxi's right front portion.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKX4793L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	RAIHNAB BINTE ABDULLAH
NRIC/Passport Number	S8219108I
Contact Number	98597940
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

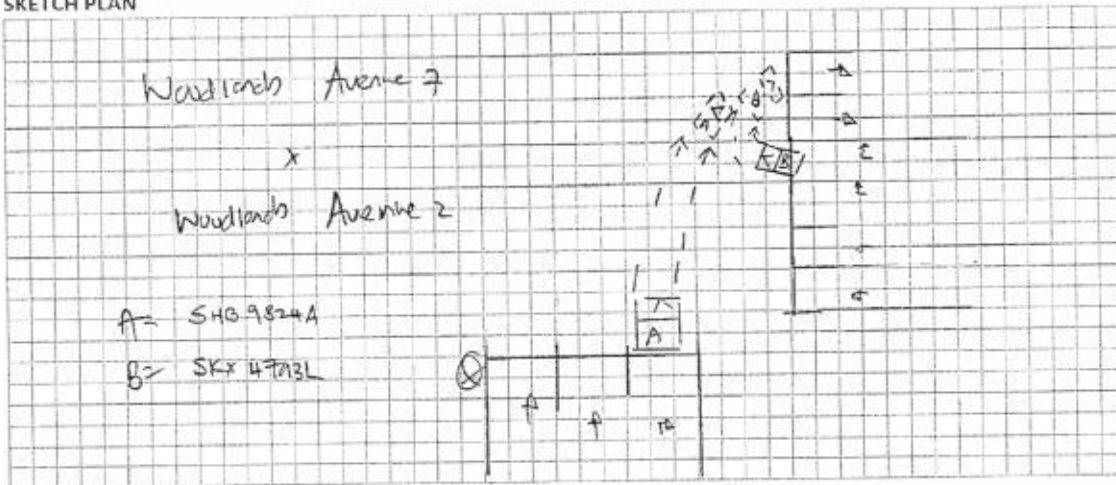

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

plz see attach GA Report

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9824A

AAD1805-252

Not Authored
11 Sep @ 9050h

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHB 9824A

VF1ABL15AUC273314

RENAULT

LATITUDE

25.5.2018

*Abcio***PART****LIST**

1	1	BUMPER COVER FRT	\$	<i>Bt</i> 1,259.42 ✓
2	1	BUMPER SPOILER FRT	\$	<i>Sn</i> 181.75 X
3	1	BUMPER ABSORBER FRT	\$	<i>CM</i> 394.68 ✓
4	1	BUMPER RETAINER FRT LH	\$	<i>Sn</i> 151.41 X
5	1	BUMPER SUPPORT FRT	\$	<i>Sn</i> 123.88 X
6	1	BUMPER RETAINER FRT RH	\$	<i>DR</i> 150.77 ✓
7	1	BUMPER SUPPORT FRT	\$	<i>Sn</i> 123.88 X
8	1	BUMPER UNDERTRAY FRT	\$	<i>Sn</i> 472.83 X
9	1	BUMPER GRILLE LOWER FRT	\$	<i>Sn</i> 266.80 X
10	1	BUMPER FOG LAMP GRILLE LH	\$	<i>Sn</i> 207.21 X
11	1	BUMPER FOG LAMP GRILLE RH	\$	<i>Sn</i> 207.21 X
12	1	BUMPER BEAM FRT	\$	<i>Bt</i> 914.08 ✓
13	1	TOW COVER FRT	\$	<i>Sn</i> 28.61 X
14	1	RADIATOR GRILLE	\$	<i>CM</i> 1,707.78 ✓
15	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	<i>Sn</i> 225.36 ✓
16	1	RADIATOR GRILLE FRAME	\$	<i>CM</i> 1,353.75 ✓
17	1	FRAME FULL SUPPORT PANEL	\$	<i>CM</i> 615.90 ✓
18	1	FRAME FULL SUPPORT BRACKET	\$	<i>R</i> 89.79 X
19	1	FRONT BRACE PANEL	\$	<i>R</i> 177.22 X
20	1	HORN	\$	<i>Sn</i> 314.17 X
21	1	HORN BRACKET	\$	<i>R</i> 40.45 X
22	1	HEADLAMP LH	\$	<i>Sn</i> 1,184.43 X
23	1	HEADLAMP RH	\$	<i>mjcm</i> 1,184.43 ✓
24	1	HEADLAMP PANEL FRT LH	\$	<i>R</i> 152.15 X
25	1	HEADLAMP PANEL FRT RH	\$	<i>R</i> 152.15 X
26	1	BONNET	\$	<i>Bt</i> 1,941.63 ✓
27	1	BONNET INSULATOR	\$	<i>Sn</i> 405.73 X
28	1	BONNET STRUT LH	\$	<i>Sn</i> 88.61 X

Trans-cab Auto Services Pte Ltd**AAD1805-252**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9824A

29	1	BONNET STRUT RH	\$	88.61	}	X
30	1	BONNET HINGE LH	\$	348.31		
31	1	BONNET HINGE RH	\$	348.31		
32	1	BONNET LOCK	\$	305.48		
33	1	BONNET CABLE	\$	119.19		
34	1	BONNET CABLE COVER	\$	161.03		
35	1	BONNET SEAL OUTER	\$	92.36	}	
36	1	BONNET SEAL INNER	\$	157.28		
37	1	FENDER PANEL FRT RH	\$	783.83	}	
38	1	WHEELARCH FRT RH	\$	278.84		
39	1	FENDER BRACKET LOWER RH	\$	15.79	}	
40	1	FENDER INSULATOR RH	\$	130.84		
41	1	WIPER RESERVOIR	\$	348.25	}	
42	1	WIPER RESERVOIR NECK	\$	136.11		
43	1	WIPER RESERVOIR MOTOR	\$	270.06	}	
44	1	AIR CLEANER LOWER	\$	271.26		
45	1	AIR CLEANER HOSE	\$	76.14	}	
46	1	BASE BATTERY TRAY	\$	363.40		
47	1	AIR CLEANER BOX	\$	464.20	}	
48	1	TURBO DUCT	\$	1,027.80		
49	1	A/C HEATER VALVE	\$	484.50	}	
50	1	SUBFRAME OUTER FRT	\$	2,652.45		
51	1	SUBFRAME BRACKET OUTER LH	\$	92.36	}	
52	1	ENGINE UNDERTRAY	\$	564.98		
53	1	A/C CONDENSER	\$	2,020.37	}	
54	1	A/C CONDENSER GARNISH LH UPPER	\$	39.67		
55	1	A/C CONDENSER GARNISH RH UPPER	\$	39.67	}	
56	1	A/C CONDENSER GARNISH LH	\$	58.81		
57	1	A/C CONDENSER GARNISH RH	\$	59.60	}	
58	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	208.39		
59	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	658.72	}	
60	1	A/C PIPE COMPRESSOR	\$	334.29		
61	1	A/C PIPE	\$	658.72	}	
62	1	A/C COMRPRESSOR	\$	2,684.61		
77	1	AIR COOLER	\$	792.60	}	
78	1	AIR INTERCOOLER HOSE (LONG)	\$	1,014.13		
79	1	AIR INTERCOOLER HOSE (Short)	\$	375.14	}	

Trans-cab Auto Services Pte Ltd**AAD1805-252**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9824A

80	1	TRANSMISSION COOLER	\$	Sum 1,219.30	}	X
81	1	TRANSMISSION COOLER PAD	\$	17.96		
82	1	RADIATOR	\$	1,202.20		
83	2	RADIATOR STUD UPPER	\$	14.41		
84	2	RADIATOR BUSH UPPER	\$	50.12		
85	2	RADIATOR MTG LOWER	\$	55.85		
86	1	RADIATOR FAN COWLING	\$	820.54		
87	1	RADIATOR FAN MOTOR LH	\$	967.36		
88	1	RADIATOR FAN MOTOR RH	\$	1,479.46		
89	1	RADIATOR TANK	\$	324.62		
90	1	RADIATOR HOSE UPPER	\$	240.56		
91	1	RADIATOR HOSE LOWER	\$	491.18		
92	1	RADIATOR TANK HOSE	\$	61.18		
93	1	AUTO COMPUTER	\$	5,032.17		
94	1	INJECTION COMPUTER	\$	4,706.30		

95 1 RHD HYDRAULIC POWER(ROCK&PINION)

96 1 STEERING PUMP ELECTRIC L70Y

97 1 STEERING PINION RACK L70Y

TOTAL	\$	61,199.91
10%	\$	6,119.99
	\$	55,079.92

Specical Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	na	52.00	✓
2	1SET	BUMPER CLIP FRT	\$	na	66.00	✓
3	1	BUMPER BRACKET CLIP FRT LH	\$	na	12.00	} X
4	1	BUMPER SUPPORT CLIP FRT LH	\$	na	10.50	
5	1	BUMPER BRACKET CLIP FRT RH	\$	na	12.00	
6	1	BUMPER SUPPORT CLIP FRT RH	\$	na	10.50	
7	1	TOW COVER FRT	\$	Sum	14.50	
8	1SET	RADAIOR GRILLE SCREW	\$	na	16.00	} X
9	1SET	BUMPER GRILLE LOWER CLIP	\$	na	69.00	
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	na	70.00	✓
11	2	FRAME FULL SUPPORT PANEL NUT	\$	na	20.00	X
12	2	FRAME FULL SUPPORT PANEL STUD	\$	na	30.00	X

Trans-cab Auto Services Pte Ltd**AAD1805-252**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9824A

21	1	Windscreen moulding	\$	<i>nn</i> 100.00 <i>X</i>
22	1SET	Front licence plate with holder	\$	<i>B</i> 80.00 <i>455n</i>

TOTAL	\$	562.50
TOTAL PARTS	\$	55,642.42

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	<i>600</i> 5,400.00
Towing Fees.	\$	120.00 <i>50</i>
To apply paint protection system (PPS) maintain and enhancement	\$	<i>nn</i> 380.00 <i>X</i>
Putty and spray painting of the affected portion.	\$	6,000.00 <i>600</i>
To rust-proofing of the affected areas.	\$	170.00 <i>60</i>
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	<i>nn</i> 380.00 <i>X</i>
To check steering geometry and computer wheel alignment	\$	<i>nn</i> 220.00 <i>X</i>
To transfer of tire, rim and on wheel balancing.	\$	<i>nn</i> 170.00 <i>X</i>
To Check Electrical Lighting Concerned.	\$	170.00 <i>20</i>
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	<i>nn</i> 380.00 <i>X</i>
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	<i>nn</i> 380.00 <i>X</i>

Trans-cab Auto Services Pte Ltd

AAD1805-252

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9824A

To lift-up engine with gear box and refit.	\$	~ 440.00 X
To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	~ 440.00 X
To remove and refit air bag system and reset.	\$	~ 480.00 X
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	~ 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	' 380.00 10d
To replace, refix and top up coolant for radiator	\$	170.00 5d
To vacuum, replace, refix and recharge Air Intercooler	\$	170.00 5d
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	~ 170.00 X

TOTAL	\$	16,400.00
--------------	-----------	------------------

Over All Total	\$	72,042.42
-----------------------	-----------	------------------

Repair Days (LUMP SUM)~~20 DAYS~~

4 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI18009934/KRBN2

Date: 07/06/2018

REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MW011169
Claimant Vehicle No :	SHB9824A	Insured Vehicle No :	SKX4793L
Date of Loss:	25/05/2018	Nature of Claim:	TP
		Claim No:	M1802673

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHB9824A	Engine No:	M9R8839C000383
Make & Model:	RENAULT LATITUDE, 2.0 L (A)	Chassis No:	VF1ABL15AUC273314
Reg. Date:	20/08/2013 (Man. Year: 2013)	Odometer:	252743 km
Colour:	Metallic White/Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Giti 9 mm	Rear Left Side:	Giti 9 mm
Front Right Side:	Giti 9 mm	Rear Right Side:	Giti 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	55,642.43	9,711.47	45,930.96	82.55
Miscellaneous Items	0.00	0.00	0.00	
Labour	16,400.00	1,590.00	14,810.00	90.30
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	72,042.43	11,301.47	60,740.96	84.31
Approved Total (Overridden) (S\$)		9,050.00		
(S\$)	72,042.43	9,050.00	62,992.43	87.44
+ GST 7.00/7.00% (S\$)	5,042.97	633.50	4,409.47	87.44
Nett Amount (S\$)	77,085.40	9,683.50	67,401.90	87.44

INSPECTION

Date of Assignment:	04/06/2018	
Date Inspected:	30/05/2018 Inspected At:	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111
Estimated Period of Repair:	4.0 days	

Adjuster: KENNETH KONG

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our

knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 07 Jun 2018)
Parts: 143	RENAULT LATITUDE 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHB9824A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*BUMPER COVER FRT	Bent	1,259.42 FL	*1,259.42 FL
2	1	*BUMPER SPOILER FRT	Serviceable	181.75 FL	*- FL
3	1	*BUMPER ABSORBER FRT	Cracked	394.68 FL	*394.68 FL
4	1	*BUMPER RETAINER FRT LH	Serviceable	151.41 FL	*- FL
5	1	*BUMPER SUPPORT FRT	Serviceable	123.88 FL	*- FL
6	1	*BUMPER RETAINER FRT RH	Distorted	150.77 FL	*150.77 FL
7	1	*BUMPER SUPPORT FRT	Serviceable	123.88 FL	*- FL
8	1	*BUMPER UNDERTRAY FRT	Serviceable	472.83 FL	*- FL
9	1	*BUMPER GRILLE LOWER FRT	Serviceable	266.80 FL	*- FL
10	1	*BUMPER FOG LAMP GRILLE LH	Serviceable	207.21 FL	*- FL
11	1	*BUMPER FOG LAMP GRILLE RH	Serviceable	207.21 FL	*- FL
12	1	*BUMPER BEAM FRT	Bent	914.08 FL	*914.08 FL
13	1	*TOW COVER FRT	Serviceable	28.61 FL	*- FL
14	1	*RADIATOR GRILLE	Cracked	1,707.78 FL	*1,707.78 FL
15	1	*RADIATOR GRILLE BADGE RENAULT	Necessary	225.36 FL	*225.36 FL
16	1	*RADIATOR GRILLE FRAME	Cracked	1,353.75 FL	*1,353.75 FL
17	1	*FRAME FULL SUPPORT PANEL	Cracked	615.90 FL	*615.90 FL
18	1	*FRAME FULL SUPPORT BRACKET	Repair	89.79 FL	*- FL
19	1	*FRONT BRACE PANEL	Repair	177.22 FL	*- FL
20	1	*HORN	Serviceable	314.17 FL	*- FL
21	1	*HORN BRACKET	Repair	40.45 FL	*- FL
22	1	*HEADLAMP LH	Serviceable	1,184.43 FL	*- FL
23	1	*HEADLAMP RH	Mtg Cracked	1,184.43 FL	*1,184.43 FL
24	1	*HEADLAMP PANEL FRT LH	Repair	152.15 FL	*- FL
25	1	*HEADLAMP PANEL FRT RH	Repair	152.15 FL	*- FL
26	1	*BONNET	Bent	1,941.63 FL	*1,941.63 FL
27	1	*BONNET INSULATOR	Serviceable	405.73 FL	*- FL
28	1	*BONNET STRUT LH	Serviceable	88.61 FL	*- FL
29	1	*BONNET STRUT RH	Serviceable	88.61 FL	*- FL
30	1	*BONNET HINGE LH	Repair	348.31 FL	*- FL
31	1	*BONNET HINGE RH	Repair	348.31 FL	*- FL
32	1	*BONNET LOCK	Repair	305.48 FL	*- FL
33	1	*BONNET CABLE	Serviceable	119.19 FL	*- FL
34	1	*BONNET CABLE COVER	Serviceable	161.03 FL	*- FL
35	1	*BONNET SEAL OUTER	Serviceable	92.36 FL	*- FL
36	1	*BONNET SEAL INNER	Serviceable	157.28 FL	*- FL
37	1	*FENDER PANEL FRT RH	Bent	783.83 FL	*783.83 FL
38	1	*WHEELARCH FRT RH	Serviceable	278.84 FL	*- FL
39	1	*FENDER BRACKET LOWER RH	Serviceable	15.79 FL	*- FL
40	1	*FENDER INSULATOR RH	Serviceable	130.84 FL	*- FL
41	1	*WIPER RESERVOIR	Serviceable	348.25 FL	*- FL
42	1	*WIPER RESERVOIR NECK	Serviceable	136.11 FL	*- FL
43	1	*WIPER RESERVOIR MOTOR	Serviceable	270.06 FL	*- FL
44	1	*AIR CLEANER LOWER	Serviceable	271.26 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*AIR CLEANER HOSE	Serviceable	76.14 FL	*-FL
46	1		*BASE BATTERY TRAY	Serviceable	363.40 FL	*-FL
47	1		*AIR CLEANER BOX	Serviceable	464.20 FL	*-FL
48	1		*TURBO DUCT	Serviceable	1,027.80 FL	*-FL
49	1		*A/C HEATER VALVE	Serviceable	484.50 FL	*-FL
50	1		*SUBFRAME OUTER FRT	Serviceable	2,652.45 FL	*-FL
51	1		*SUBFRAME BRACKET OUTER LH	Repair	92.36 FL	*-FL
52	1		*ENGINE UNDERTRAY	Serviceable	564.98 FL	*-FL
53	1		*A/C CONDENSER	Serviceable	2,020.37 FL	*-FL
54	1		*A/C CONDENSER GARNISH LH UPPER	Serviceable	39.67 FL	*-FL
55	1		*A/C CONDENSER GARNISH RH UPPER	Serviceable	39.67 FL	*-FL
56	1		*A/C CONDENSER GARNISH LH	Serviceable	58.81 FL	*-FL
57	1		*A/C CONDENSER GARNISH RH	Serviceable	59.60 FL	*-FL
58	1		*A/C PIPE CONDENSER TO COMPRESSOR	Serviceable	208.39 FL	*-FL
59	1		*A/C PIPE CONDENSER TO EXPENSION VALVE	Serviceable	658.72 FL	*-FL
60	1		*A/C PIPE COMPRESSOR	Serviceable	334.29 FL	*-FL
61	1		*A/C PIPE	Serviceable	658.72 FL	*-FL
62	1		*A/C COMPRESSOR	Serviceable	2,684.61 FL	*-FL
63	1		*AIR COOLER	Serviceable	792.60 FL	*-FL
64	1		*AIR INTERCOOLER HOSE (LONG)	Serviceable	1,014.13 FL	*-FL
65	1		*AIR INTERCOOLER HOSE (SHORT)	Serviceable	375.14 FL	*-FL
66	1		*TRANSMISSION COOLER	Serviceable	1,219.30 FL	*-FL
67	1		*TRANSMISSION COOLER PAD	Serviceable	17.96 FL	*-FL
68	1		*RADIATOR	Serviceable	1,202.20 FL	*-FL
69	2		*RADIATOR STUD UPPER	Serviceable	14.41 FL	*-FL
70	2		*RADIATOR BUSH UPPER	Serviceable	50.12 FL	*-FL
71	2		*RADIATOR MTG LOWER	Serviceable	55.85 FL	*-FL
72	1		*RADIATOR FAN COWLING	Serviceable	820.54 FL	*-FL
73	1		*RADIATOR FAN MOTOR LH	Serviceable	967.36 FL	*-FL
74	1		*RADIATOR FAN MOTOR RH	Serviceable	1,479.46 FL	*-FL
75	1		*RADIATOR TANK	Serviceable	324.62 FL	*-FL
76	1		*RADIATOR HOSE UPPER	Serviceable	240.56 FL	*-FL
77	1		*RADIATOR HOSE LOWER	Serviceable	491.18 FL	*-FL
78	1		*RADIATOR TANK HOSE	Serviceable	61.18 FL	*-FL
79	1		*AUTO COMPUTER	Serviceable	5,032.17 FL	*-FL
80	1		*INJECTION COMPUTER	Serviceable	4,706.30 FL	*-FL
81	1		*RHD HYDRAULIC POWER (ROCK & PINION)	Serviceable	5,154.52 FL	*-FL
82	1		*STEERING PUMP ELECTRIC L70Y	Serviceable	2,306.90 FL	*-FL
83	1		*STEERING PINION RACK L70Y	Serviceable	4,413.11 FL	*-FL
84	1		*SET RADIATOR GRILLE FRAME CLIP	Necessary	52.00 FS	*52.00 FS
85	1		*SET BUMPER CLIP FRT	Necessary	66.00 FS	*66.00 FS
86	1		*BUMPER BRACKET CLIP FRT LH	Not Necessary	12.00 FS	*-FS
87	1		*BUMPER SUPPORT CLIP FRT LH	Not Necessary	10.50 FS	*-FS
88	1		*BUMPER BRACKET CLIP FRT RH	Not Necessary	12.00 FS	*-FS
89	1		*BUMPER SUPPORT CLIP FRT RH	Not Necessary	10.50 FS	*-FS
90	1		*TOW COVER FRT	Serviceable	14.50 FS	*-FS
91	1		*SET RADIATOR GRILLE SCREW	Not Necessary	16.00 FS	*-FS
92	1		*SET BUMPER GRILLE LOWER CLIP	Not Necessary	69.00 FS	*-FS
93	1		*SET FRAME FULL SUPPORT PANEL CLIP	Necessary	70.00 FS	*70.00 FS
94	2		*FRAME FULL SUPPORT PANEL NUT	Not Necessary	20.00 FS	*-FS
95	2		*FRAME FULL SUPPORT PANEL STUD	Not Necessary	30.00 FS	*-FS
96	1		*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*-FS
97	1		*SET FRONT LICENCE PLATE WITH HOLDER	Bent	80.00 FS	*45.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	61,762.42	10,764.63
- List Item Discount on L Items 10.00/10.00% (\$\$)	6,119.99	1,053.16
Total Parts (\$\$)	55,642.43	9,711.47

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
-----	-----	----------	-------------	-----------	------------	--------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	5,400.00	600.00
2	TOWING FEES	New	120.00	50.00
3	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT	New	380.00	-
4	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	6,000.00	660.00
5	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	60.00
6	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER,TO ENABLE REPAIR	New	380.00	-
7	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	-
8	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING	New	170.00	-
9	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
10	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK	New	380.00	-
11	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR	New	380.00	-
12	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT	New	440.00	-
13	TO REMOVE AND RENEW POWER STEERING PUMP,OIL COOLER PIPE AND FINAL CHECKING AND TESTING	New	440.00	-
14	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET	New	480.00	-
15	TO DROP DIESEL TANK,PIPES,HOSES TO FACILITATE BODYWORK REPAIR,FINAL CHECKING AND TESTING	New	380.00	-
16	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR CONDENSER	New	380.00	100.00
17	TO REPLACE,REFIX AND TOP UP COOLANT FOR RADIATOR	New	170.00	50.00
18	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR INTERCOOLER	New	170.00	50.00
19	TO TRANSFER OF FENDER FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	-
Gross Labour Cost (\$\$)			16,400.00	1,590.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >