



Your Ref: TP/IP/12087/2018
Our Ref : CI/TPD18010484/Z

04th April 2018

Fatal Accident Investigation Team
Traffic Police Department
Singapore Police Force
10 Ubi Avenue 3
Singapore 408865

MECHANICAL INSPECTION REPORT OF MOTOR CAR SJL 4167U

1. We refer to your request on 07th March 2018 to conduct a physical inspection of a motor Car bearing registration number SJL 4167U (herein referred to as "Motor Car"), which was involved in a fatal road traffic accident on 21st February 2018.
2. The objective of the inspection is to determine if there was any possible mechanical failure to the Motor Car that may have contributed to the accident.
3. Following the request, we had carried out a physical inspection of the Motor Car on 04th April 2018 at the premises of Traffic Police vehicle pound, 517 Airport Road Singapore 539942. We now set out below our observations and comments with respect to this inspection.

General Condition

4. The mileage of the Motor Car at the time of our inspection was recorded at 465906km.
5. The Motor Car had sustained a relatively minor impact damages that was confined to its frontal portion. Its front number plate was observed to be cracked; its lower right bumper was chipped & it's right front tyre was deflated likely due to the accident's collision impact.
6. This was likely due to the consistency of the accident's case facts that the Motor Car driver was driving his Motor Car when he made a right turn at the cross junction of Eu Tong Sen Street by Upper Pickering Street and knocked into a pedestrian who was crossing the road at the pedestrian crossing. See photo 1 to 7 below.

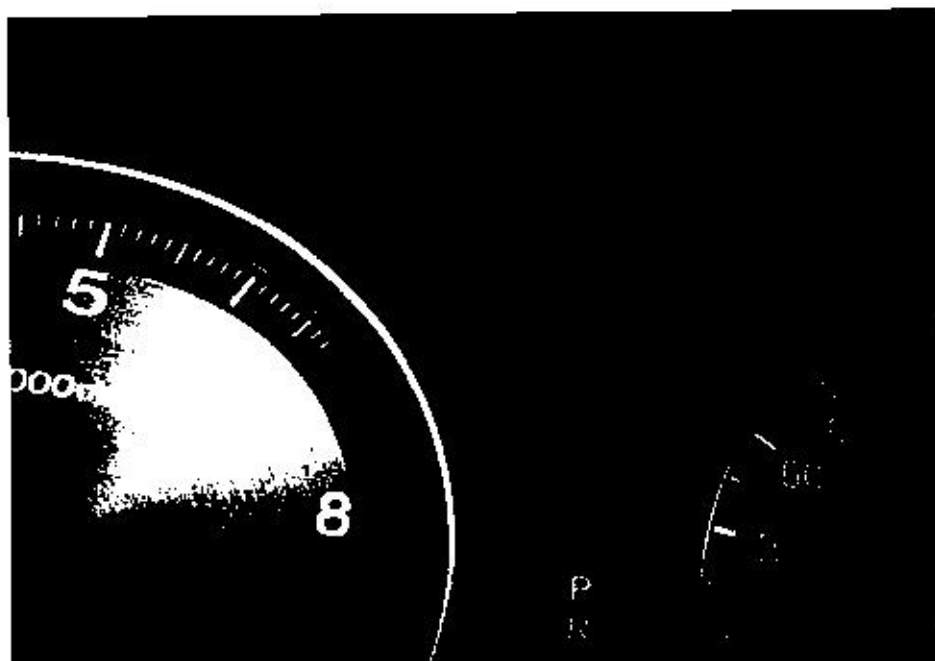


Photo 1 shows the mileage of the Motor Car at the time of our inspection was recorded at 465906km.



Photo 2 shows a general view of the front body of the Motor Car at the time of our inspection. The Motor Car was observed to have sustained a relatively minor impact damages that was confined to its frontal portion. Its front number plate was observed to be cracked & its lower right hand front bumper was chipped likely due to the accident's collision impact.



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 67414108



Photo 3 shows a general view of the front right body of the Motor Car at the time of our inspection. The Motor Car was observed to have sustained a relatively minor impact damages that was confined to its frontal portion.



Photo 4 shows a general view of the front left body of the Motor Car at the time of our inspection. The Motor Car was observed to have sustained a relatively minor impact damages that was confined to its frontal portion.



Photo 5 shows a general view of the rear body of the Motor Car at the time of our inspection. The Motor Car was observed to be in good general condition.



Photo 6 shows a close up view of the front number plate of the Motor Car at the time of our inspection. The Motor Car had sustained relatively minor damages at the front lower bumper & a cracked number plate of the Motor Car.



Photo 7 shows a close up view of the front lower bumper of the Motor Car at the time of our inspection. The Motor Car had sustained relatively minor damages at the front lower bumper of the Motor Car.

Tyres and Wheel Rims

7. The condition of the Motor Car's 4 tyres was observed to be in serviceable condition, we did not find any tear, cut or burst mark(s) on the outer and the inner sidewalls as well as across the tread of the 4 tyres. The 4 tyres were also observed to be sufficiently inflated for vehicular operation. The remaining tread depth of the 4 tyres was approximately between 4 & 5mm. The tyre brand, tyre size and remaining tread depth of the 4 tyres were recorded as follows:-

Yokohama BluEarth-A
205/55R17 (5mm)

Falken ZIEX ZE914
215/50R17 (4mm)



Yokohama BluEarth-A
205/55R17 (5mm)

Falken ZIEX ZE914
215/50R17 (4mm)



8. The 4 tyres were observed to be wrapped around alloy wheel rims that were found to be without any significant damage except for some marks of grazing nature on the wheel rims, which are commonly associated to grazing against a road kerb. See photo 8 to 11 below.



Photo 8 shows the condition of the front right tyre of the Motor Car, which was observed to be in serviceable condition with remaining tread depth of approximately 4mm. The tyre, which was wrapped around alloy wheel rim, was also observed to be sufficiently inflated for vehicular operation.



Photo 9 shows the condition of the front left tyre of the Motor Car, which was observed to be in serviceable condition with remaining tread depth of approximately 4mm. The tyre, which was wrapped around alloy wheel rim, was also observed to be sufficiently inflated for vehicular operation.



Photo 10 shows the condition of the rear left tyre of the Motor Car, which was observed to be in serviceable condition with remaining tread depth of approximately 5mm.

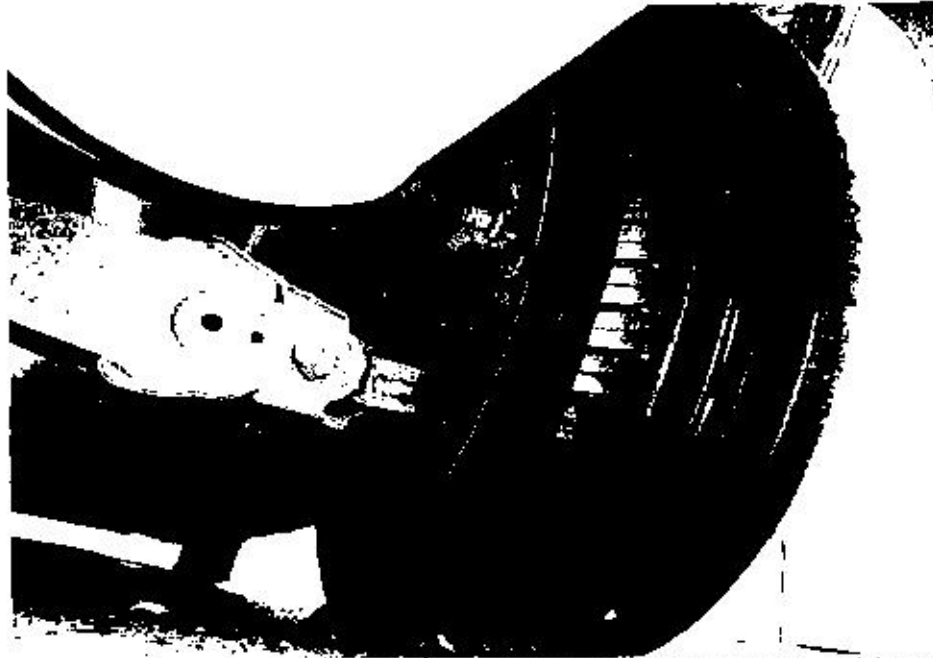


Photo 11 shows the condition of the rear right tyre of the Motor Car, which was observed to be in serviceable condition with remaining tread depth of approximately 5mm.

Engine Compartment & Operating Fluids

9. Upon examination of the engine compartment of the Motor Car, we had observed all the parts and components inside the engine compartment to be intact and unaffected by the accident. The brake fluid, engine oil, ATF fluid and engine coolant were all found to be of sufficient level for operating purposes. Visually, there was also no contamination found to these fluids.
10. Further investigation of the engine compartment revealed no sign(s) or indication(s) of fluid leakage and/or fluid stain within the engine compartment of the Motor Car.
11. Our subsequent checks on the underside of the Motor Car revealed fluid stain observed to be pre-existed prior the accident looking at the dust accumulated with it. Our checks on the engine fluid had also indicated that the engine fluid was of sufficient level for operational purposes, and without contamination. Visually, the various undercarriage components of the Motor Car were all observed to be intact and without any visible damage. See photo 12 to 16 below.

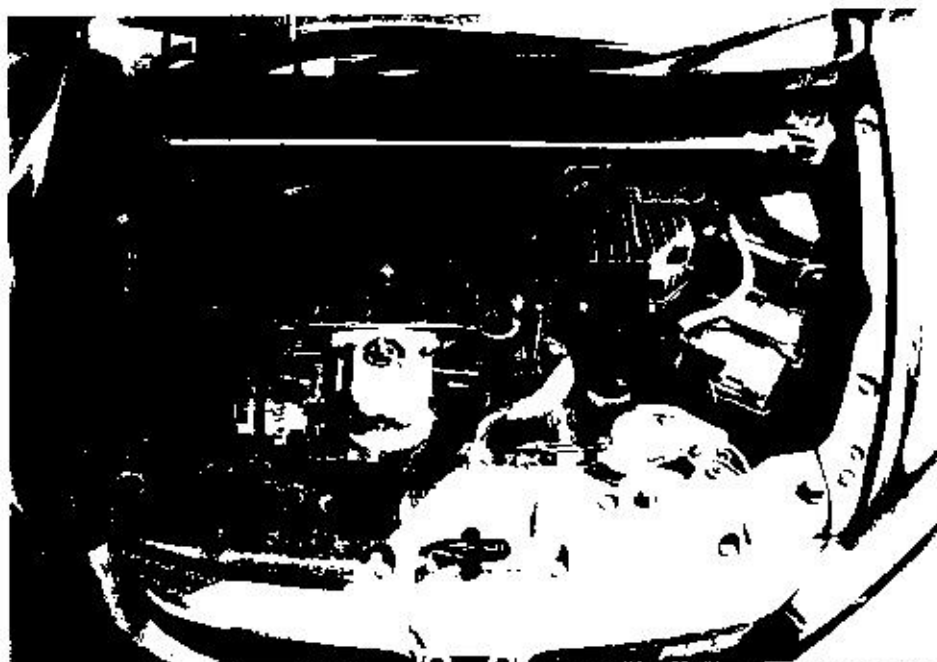


Photo 12 shows a general view of the Motor Car's engine compartment. The various parts and components inside the engine compartment were unaffected by the accident. There was also no sign(s) or indication(s) of fresh fluid leakage and/or fluid stain within the engine compartment.

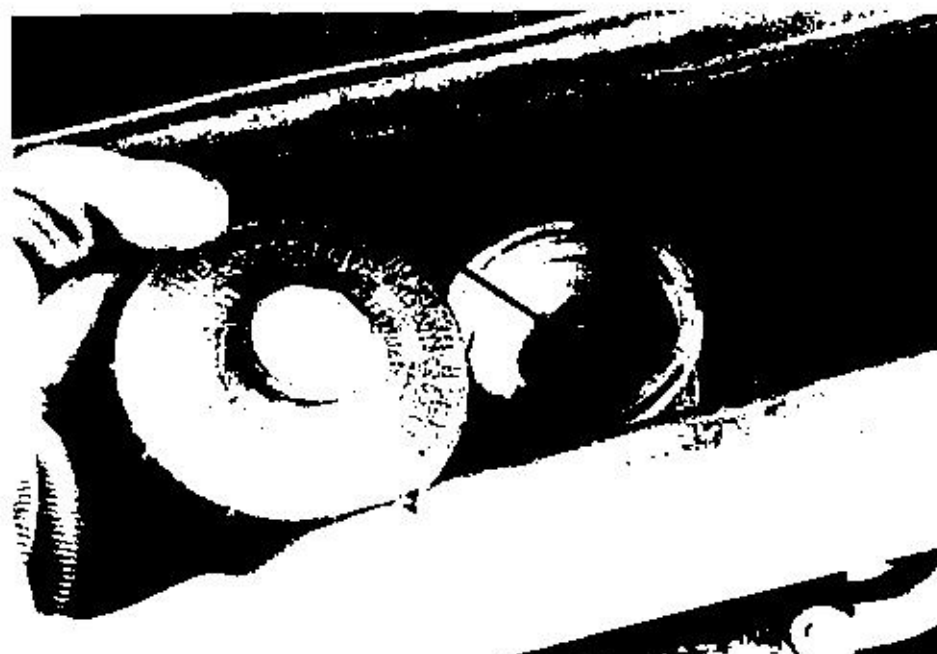


Photo 13 shows the brake fluid reservoir of the Motor Car at the time of our inspection. The brake fluid was observed to be of sufficient level (arrowed) and without any visible contamination.

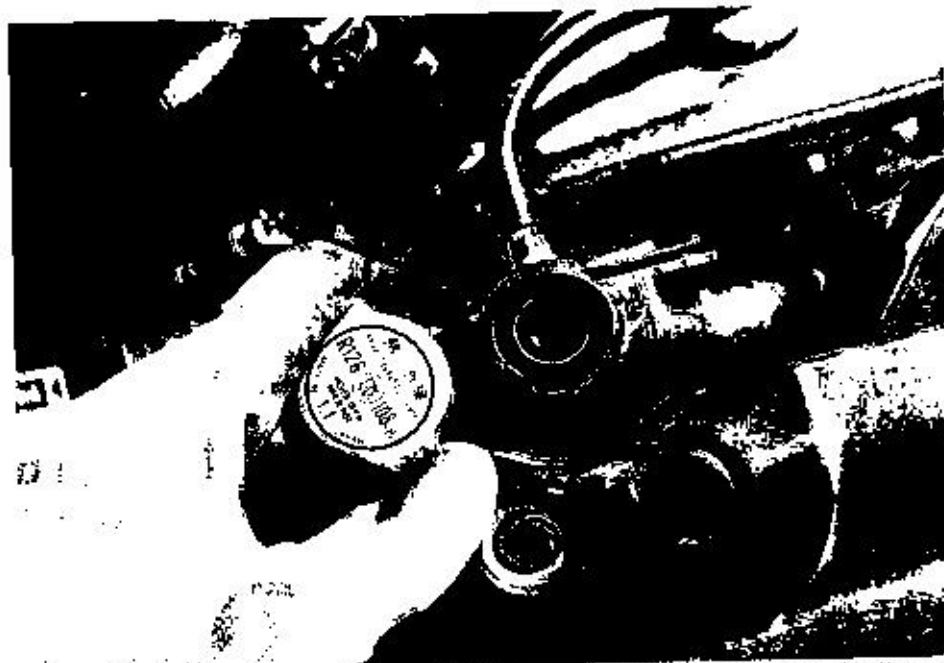


Photo 14 shows the engine coolant fluid reservoir of the Motor Car at the time of our inspection. The engine coolant fluid was observed to be of sufficient level and without any visible contamination.



Photo 15 shows the engine oil dip stick of the Motor Car at the time of our inspection. The engine oil was observed to be of sufficient level and without any visible contamination.



Photo 16 shows the ATF oil dip stick of the Motor Car at the time of our inspection. The ATF oil was observed to be of sufficient level and without any visible contamination.

Steering System & Braking System

12. The mechanical components of the Motor Car's steering system and braking system were all found to be visually intact and undamaged. Our visual examination of the various steering components, which had included the rack and pinion, tie rods, tie rod ends and ball joints, revealed that these components were all generally in good condition. Components of the braking system like the brake master pump, brake booster, brake callipers and brake hoses amongst others were also found to be without any damage upon our visual inspection.
13. Static test on the steering system of the Motor Car also revealed no abnormality to the steering system. We did not experience any abnormal free play and/or other resistance when turning the steering wheel left and right to full lock positions. Our visual examination of the various steering components which had included the steering rack and pinion, tie rods, tie rod ends and ball joints revealed that these components were all generally in good condition. See photo 17 - 20 below.

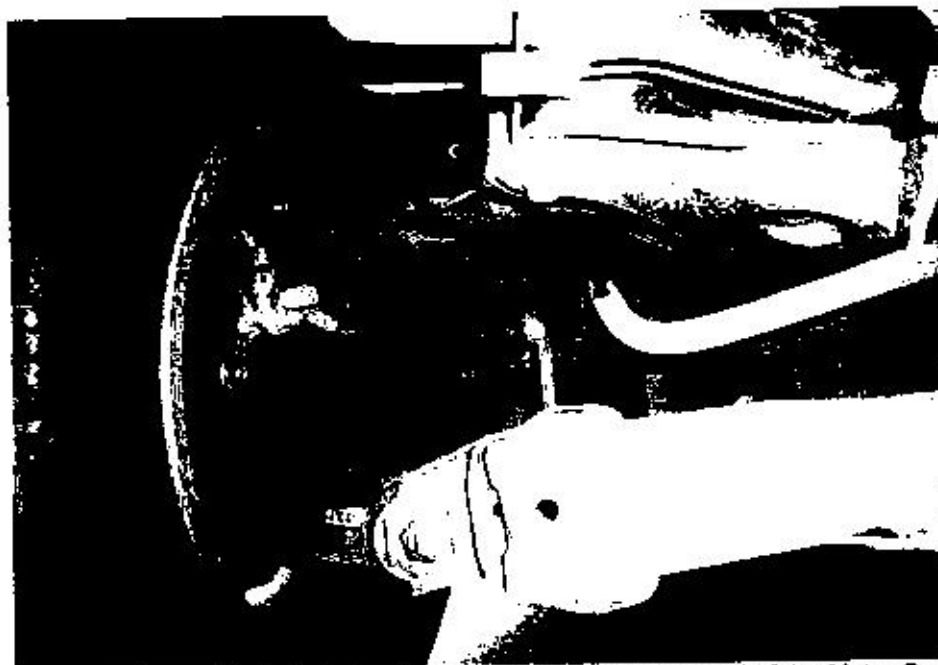


Photo 17 shows the brake hose (arrowed) at the rear left wheel of the Motor Car. We did not observe any leakage of brake fluid at the time of our inspection of the Motor Car. Our visual inspection of the various mechanical components of the Motor Car's braking system revealed all to be intact without visible damage.

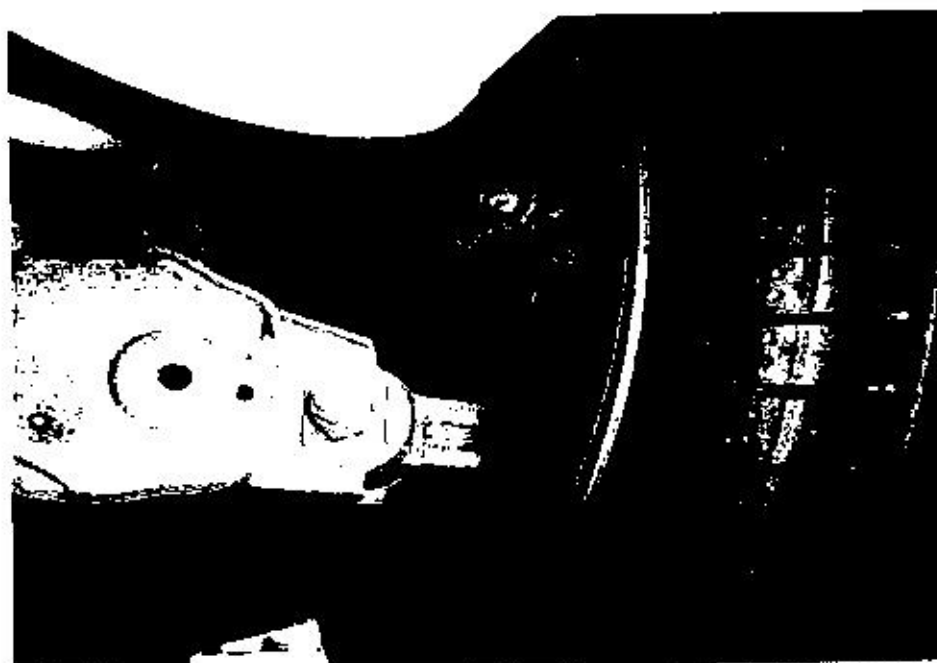


Photo 18 shows the brake hose (arrowed) at the rear right wheel of the Motor Car. We did not observe any leakage of brake fluid at the time of our inspection of the Motor Car. Our visual inspection of the various mechanical components of the Motor Car's braking system revealed all to be intact without visible damage.

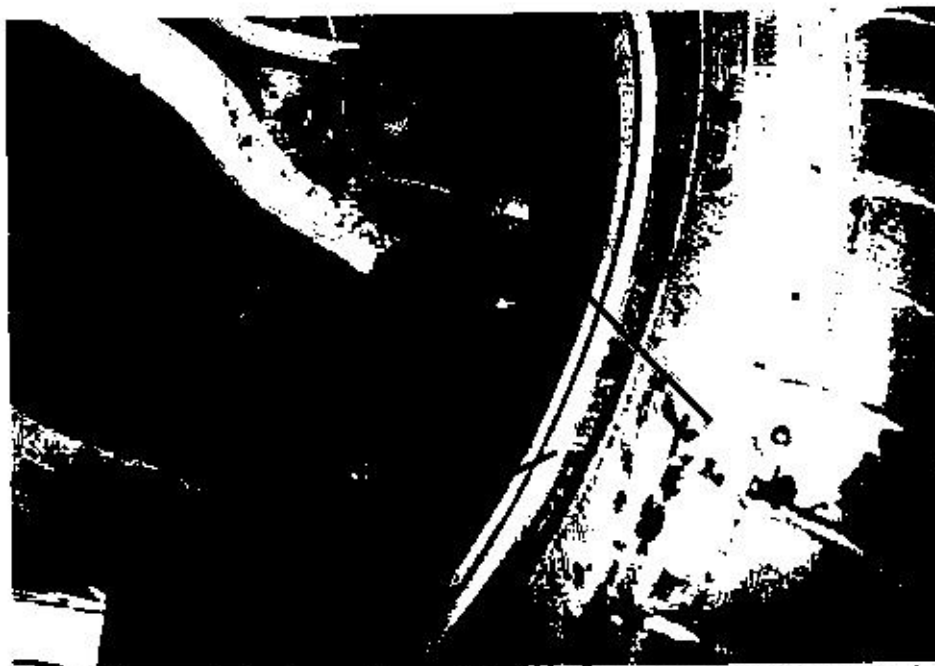


Photo 19 shows the various undercarriage components at the front right wheel of the Motor Car, in particular the steering tie rod (arrowed). The various steering components were all found to be intact, suggesting that the steering system of the Motor Car was likely to be in serviceable condition.



Photo 20 shows the various undercarriage components at the front left wheel of the Motor Car. We did not observe any leakage of brake fluid (arrowed) at the time of our inspection of the Motor Car. Our visual inspection of the various mechanical components of the Motor Car's braking system revealed all to be intact and without visible damage, indicating that the braking system was likely to be in serviceable condition at the material time of accident.



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 67414108

Electronic Safety / Warning Indicators

14. The Motor Car's automatic self-test of the functionality of its various electronic operating systems like the Anti-Brake Lock System (ABS) and Supplemental Restraint System (SRS) during cranking of the engine had indicated that these systems were in working condition and without abnormality. This can be established from the warning lights disappearing from the instrument panel after the self-test. See photo 21 & 22 below.

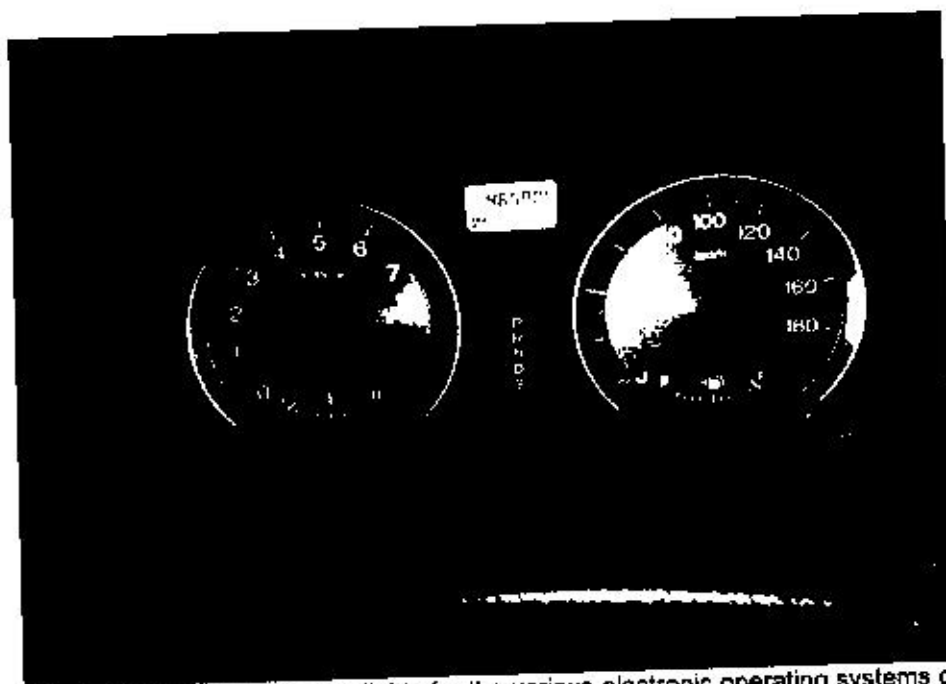


Photo 21 shows the warning lights for the various electronic operating systems of the Motor Car appearing on its instrument panel during the self-test when the engine is cranked, in particular the ABS light and SRS light.

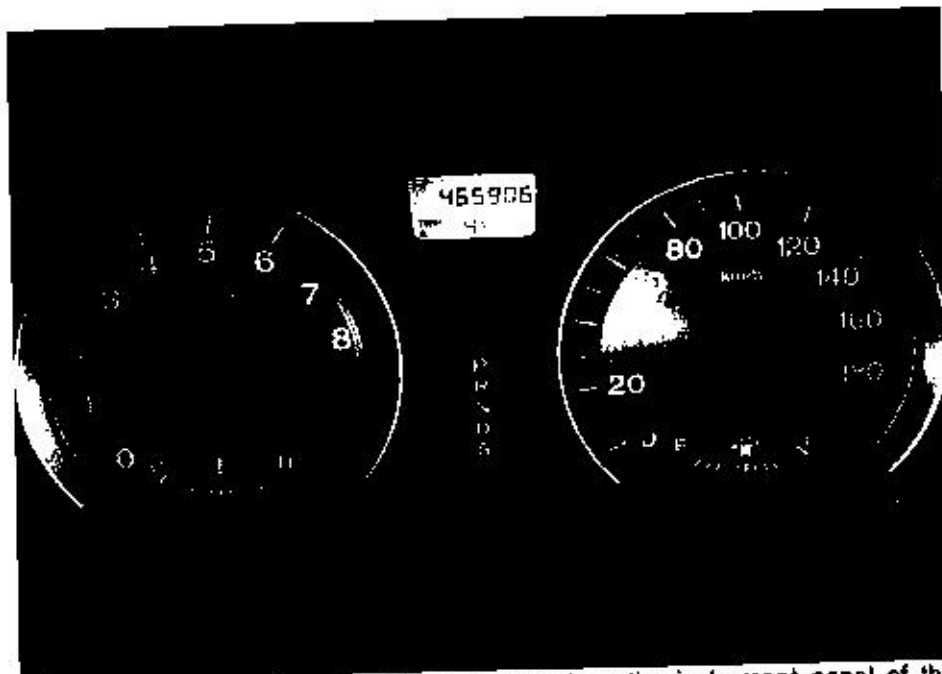


Photo 22 shows no warning lights illuminated on the instrument panel of the Motor Car after the engine was cranked. This would suggest that there was no abnormality to the various electronic operating systems of the Motor Car, like the ABS and SRS.

Operational Behaviour of the Motor Taxi

15. A short operational test of the Motor Car, to primarily determine whether there was any abnormality to its engine system, its transmission system and braking system was subsequently carried out.
16. During the operational test, the transmission system of the Motor Car was able to be shifted to drive mode and reverse mode without any difficulty. There were no abnormal sounds heard and/or abnormal behaviour of the Motor Car's engine system. It was able to move forward and backward normally. The braking system was also found to be in working condition as the Motor Car was able to slow down and come to a complete stop upon depressing of the brake pedal. See photo 23 to 25 below.

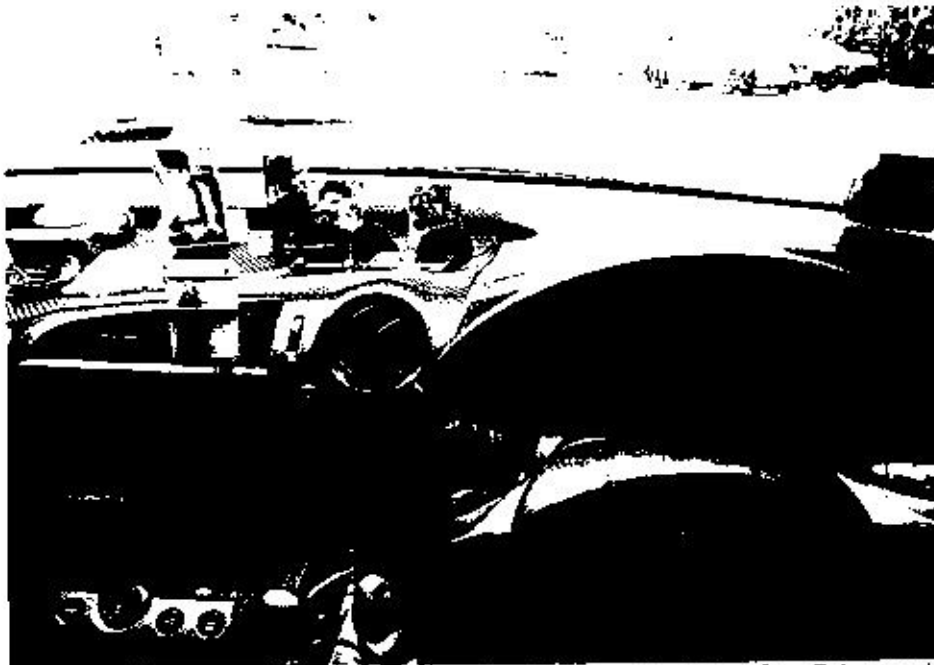


Photo 23 shows we conducted an operational test on the Motor Car. Drive mode were engaged at time of our test. There was no abnormality observed at time of testing.



Photo 24 shows we conducted an operational test on the Motor Car. Reverse mode were engaged at time of our test. There was no abnormality observed at time of testing.



Photo 25 shows we conducted an operational test on the Motor Car. Drive mode, Reverse mode & Neutral mode were engaged at time of our test. Brake pedal was also engaged to a complete stop. There was no abnormality observed at time of testing.

Conclusion

17. From our physical inspection of the Motor Car, it appears that its engine system, transmission system, steering system and braking system were all in serviceable condition. We did not find any evidence(s) to suggest that there was possible mechanical failure to the Motor Car that may have caused and/or contributed to the accident.
18. A short operational test of the Motor Car, which we had conducted, did not produce any sign(s) or symptom(s) to suggest that there was any abnormality to its engine system, its transmission system and braking system.



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 67414108

19. The Motor Car's 4 tyres was observed to be in serviceable condition, we did not find any tear, cut or burst mark(s) on the outer and the inner sidewalls as well as across the tread of the 4 tyres. The 4 tyres were also observed to be sufficiently inflated for vehicular operation. The remaining tread depth of the 4 tyres was approximately between 4 & 5mm.

Rohaizal A. Rahim
Technical Investigator

Ang Bryan Tani
AMSOE, AMIRTE, AFF SAE, M.MATAI, AFF.Inst.AEA
Senior Technical Investigator
Technical Investigation & Reconstructionist (SAE-A)

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.