



Accident Photo



Accident Photo

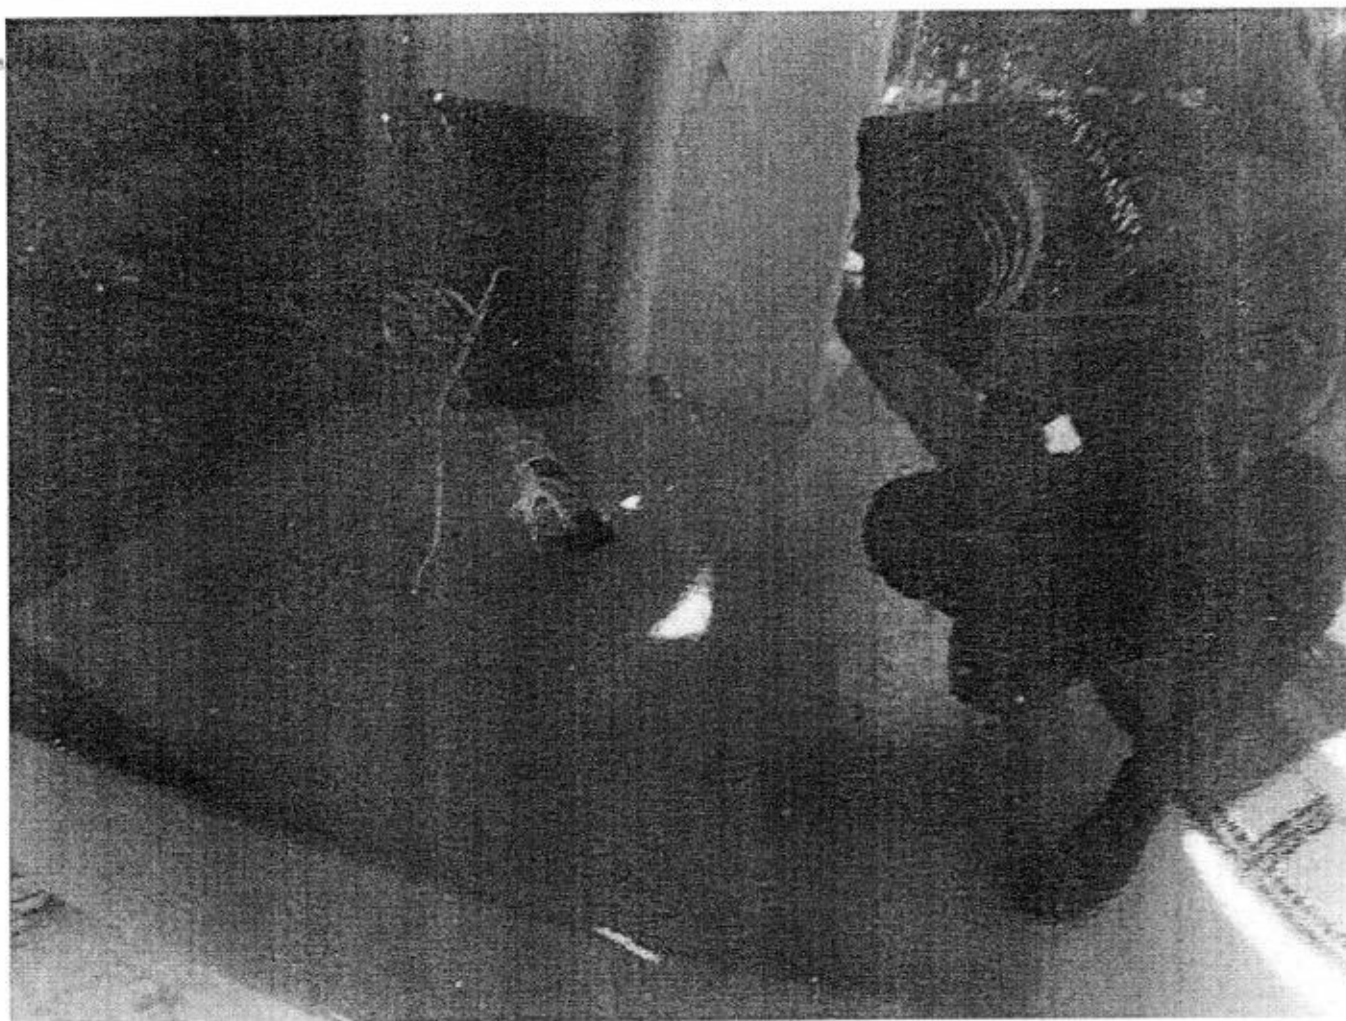


Accident Photo

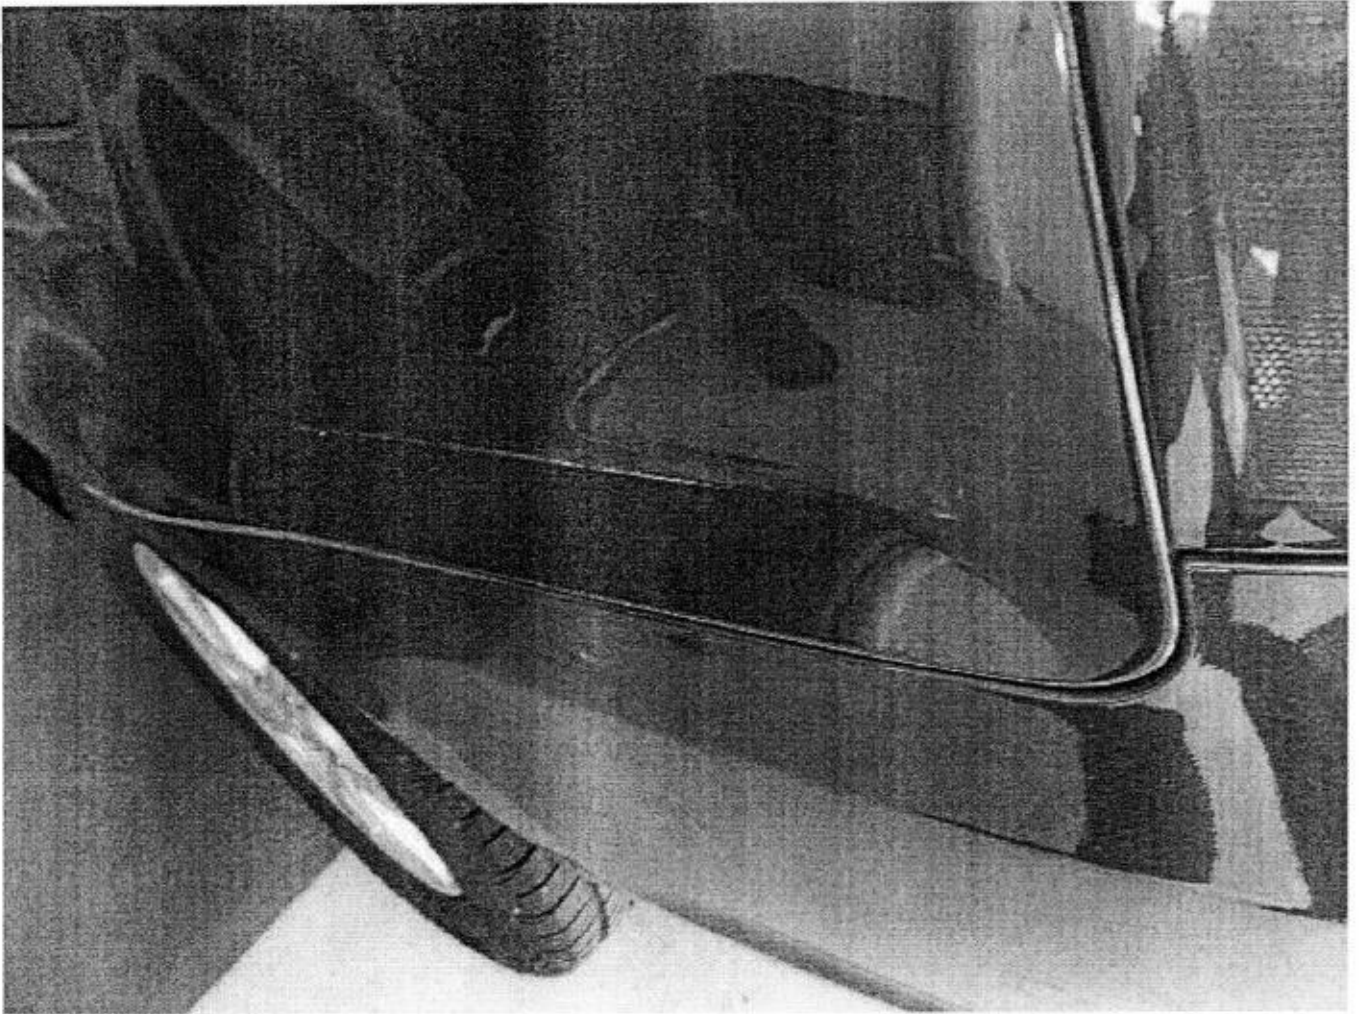


Accident Photo




Accident Photo

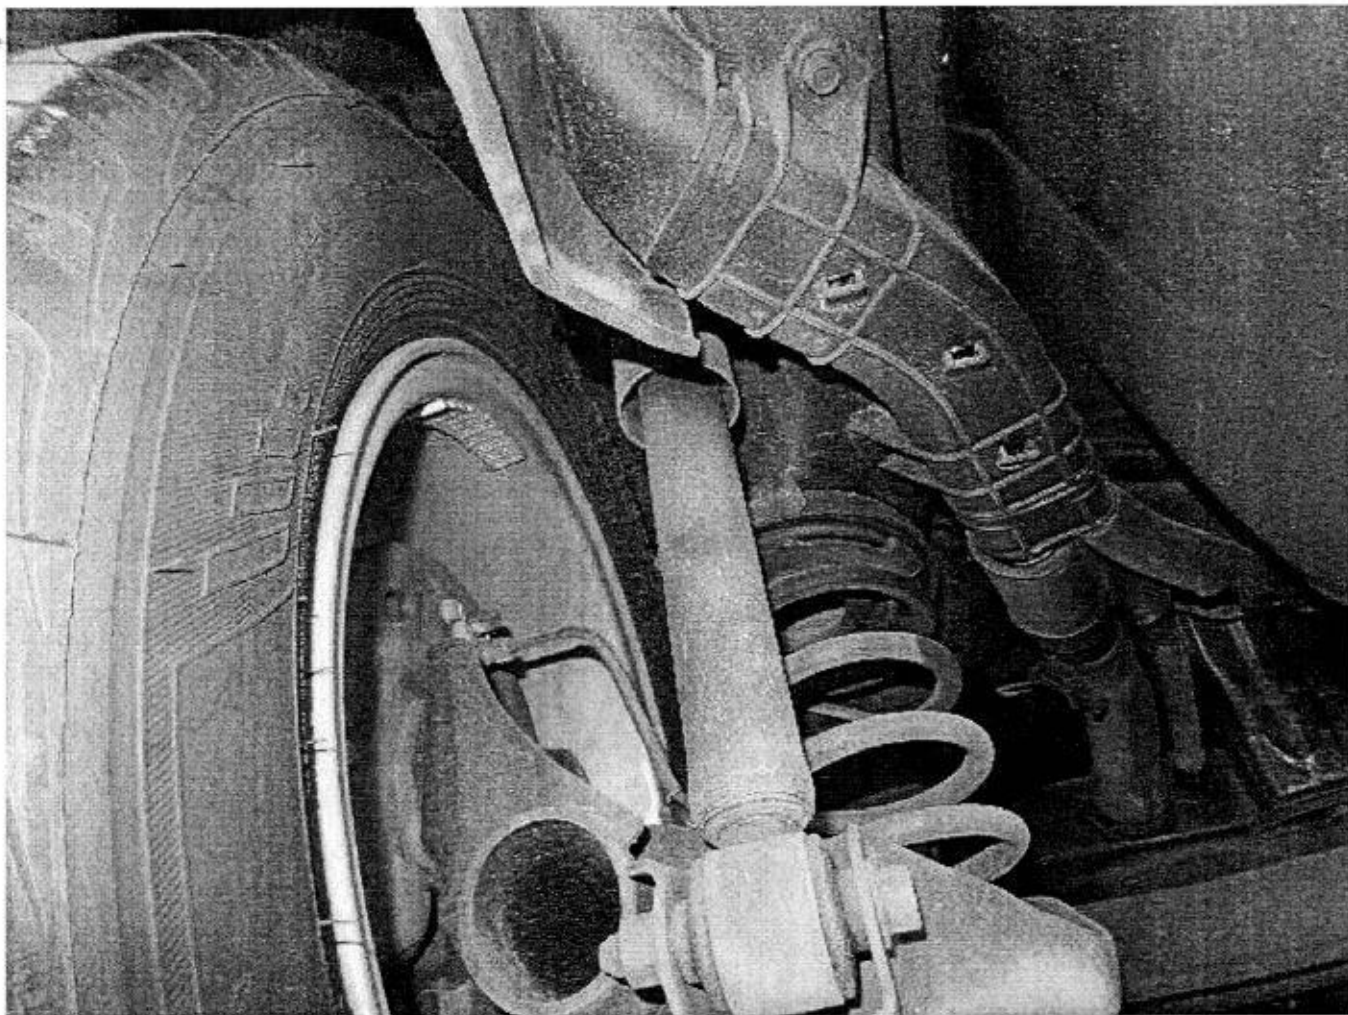


Accident Photo

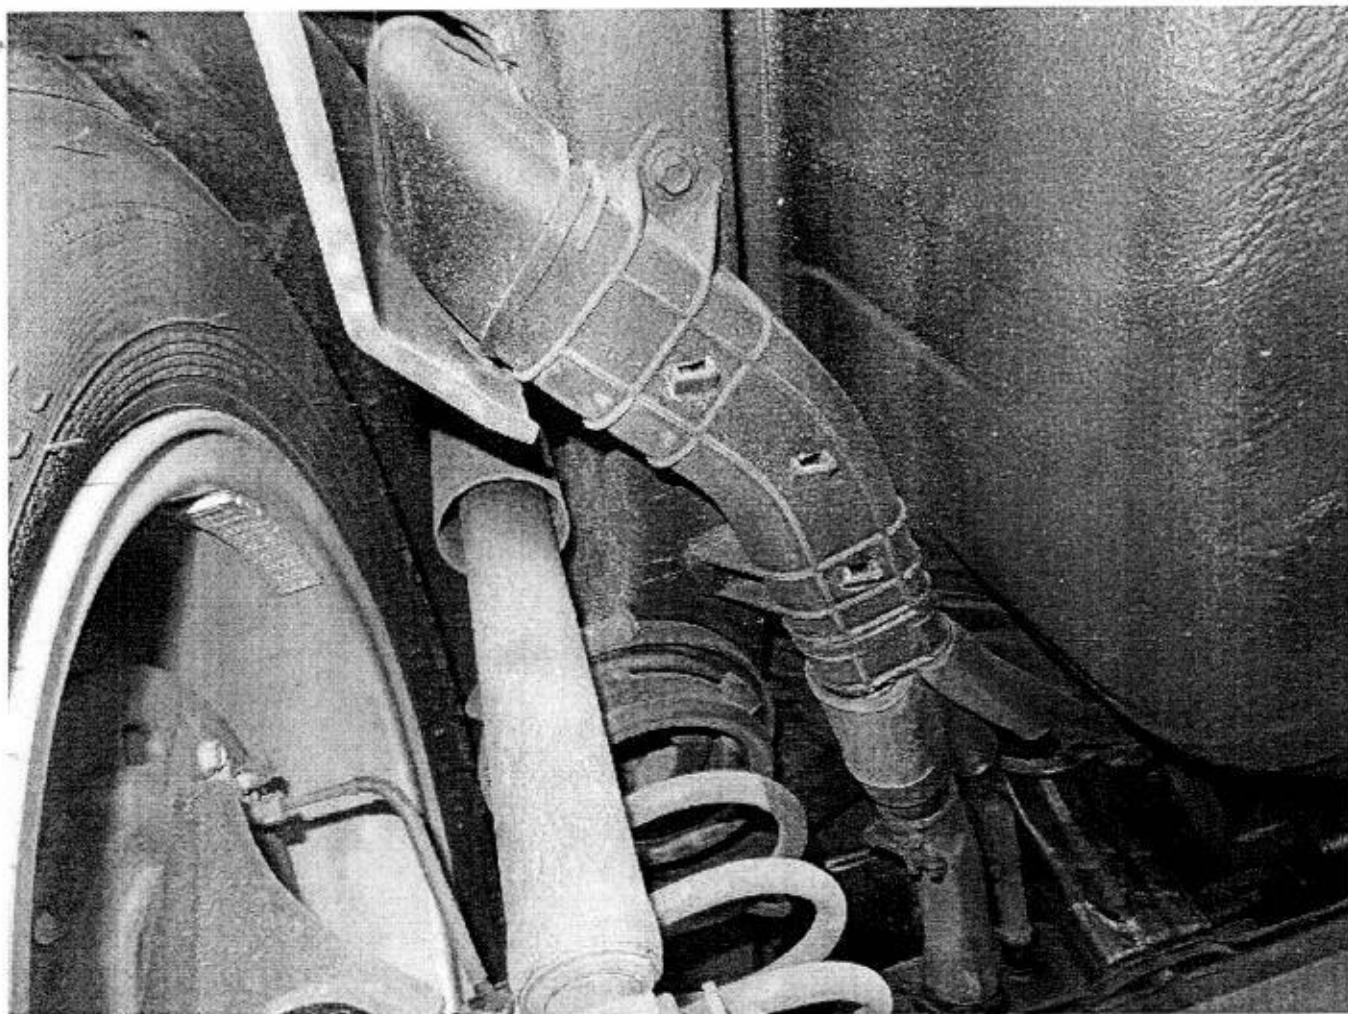


Accident Photo

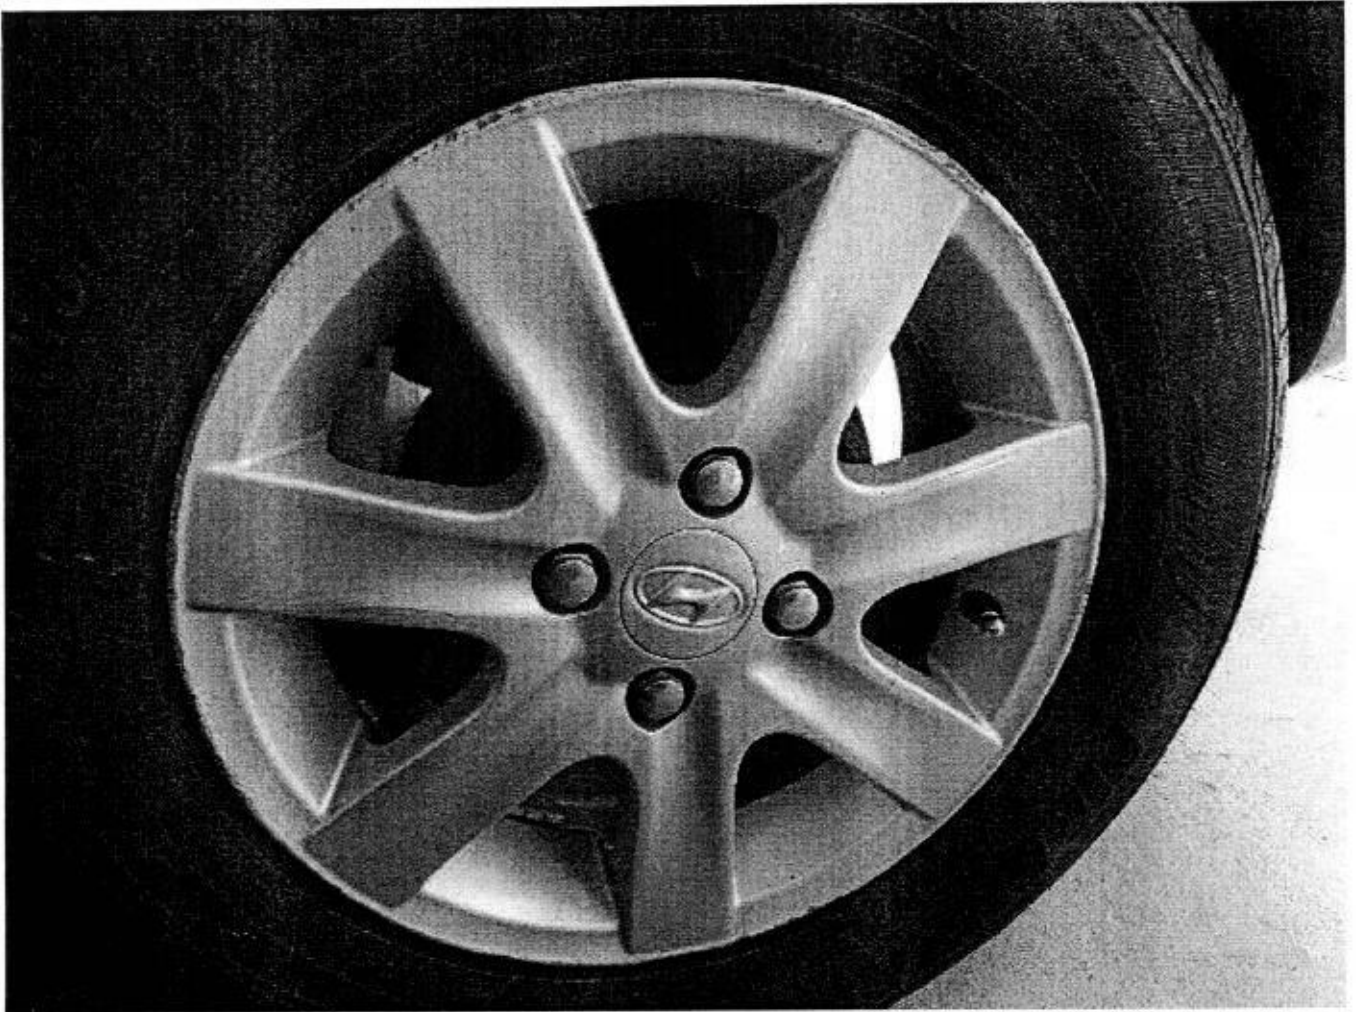

Accident Photo

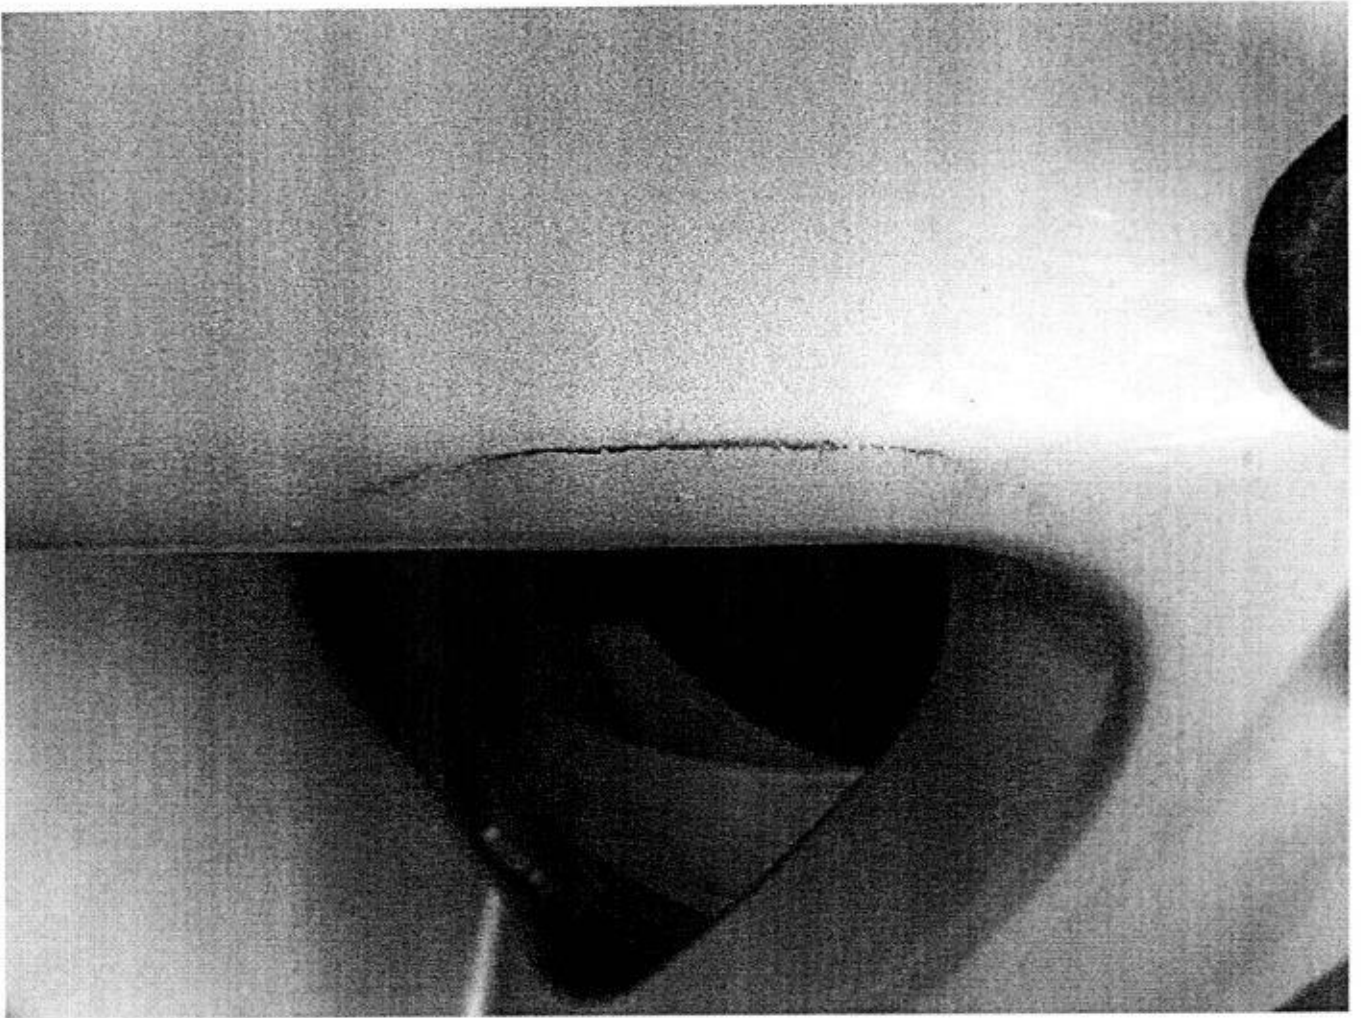

Accident Photo

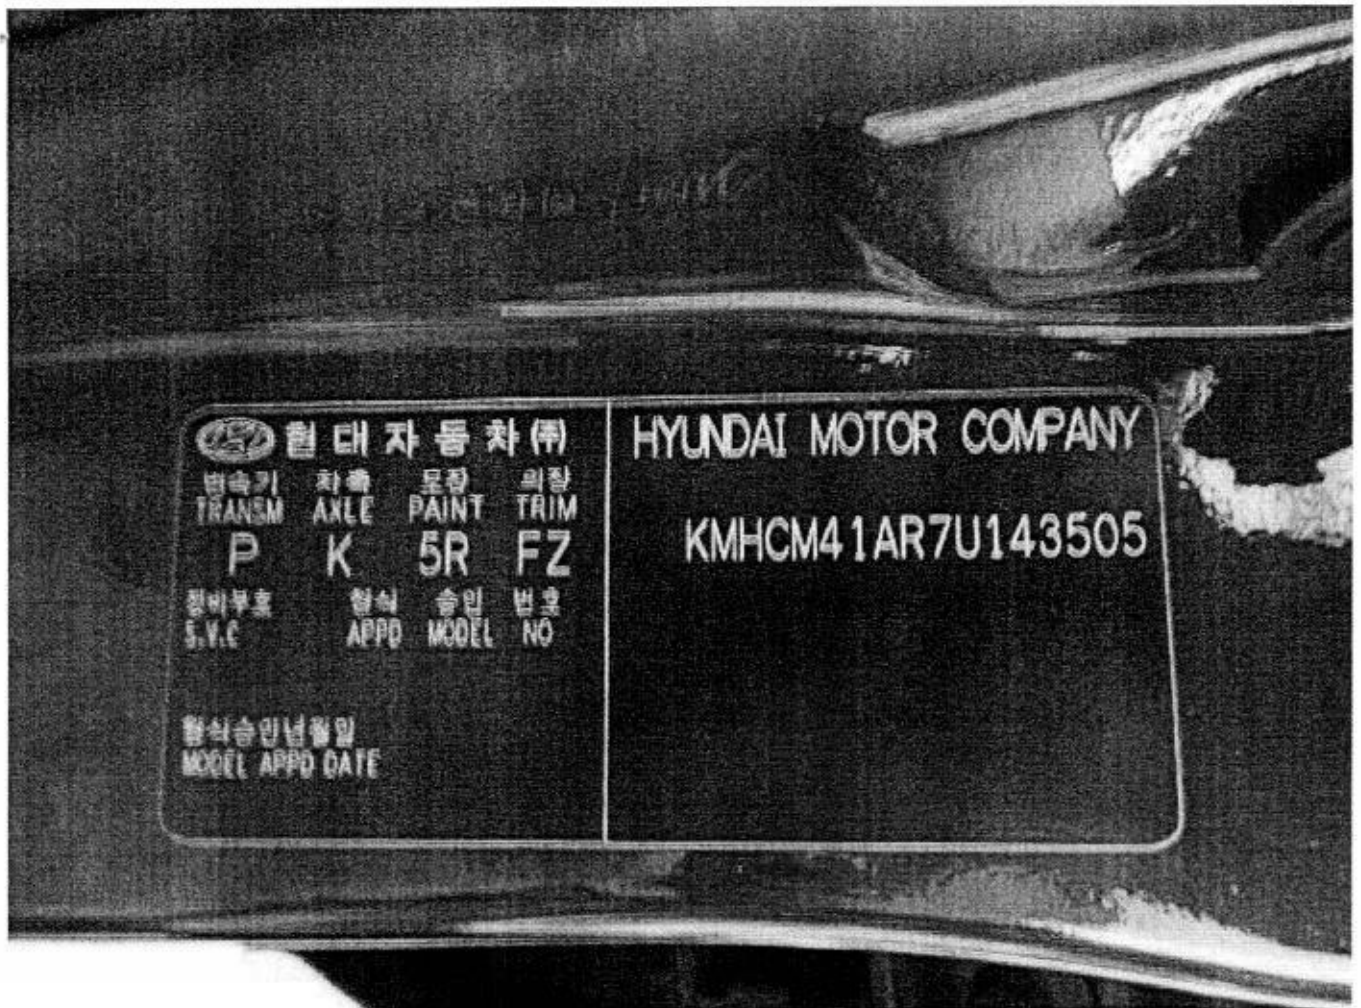

Koays Accident Reconstruction Pte Ltd (Co.Reg No 201600526H)
 1 Sophia Road, #03-10 Peace Centre
 Singapore 228149
 Tel: 6552 3952 / 6369 9462 Fax: 6552 3952 / 66488254

VEHICLE DAMAGE INSPECTION REPORT

Our File No: S115-0103Q-TJ
 Date: 15/03/2016

REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MB005843
Claimant Vehicle No :	SJV269H	Insured Vehicle No :	SFL1422A
Date of Loss:	27/02/2016	Nature of Claim:	TP
		Claim No:	M1600995

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJV269H	Engine No:	L13A4122914
Make & Model:	HONDA FIT, 1.3 G (A)	Chassis No:	GE61112124
Reg. Date:	07/01/2010 (Man. Year: 2010)	Odometer:	54802 km
Colour:	Black		
Engine Capacity:	1339 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	175/65R14	Rear Tyre Size:	175/65R14
Front Left Side:	Bridgestone 4 mm	Rear Left Side:	Bridgestone 5 mm
Front Right Side:	Bridgestone 4 mm	Rear Right Side:	Bridgestone 5 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	7,000.00	-7,000.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	4,020.00	-4,020.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	0.00	11,020.00	-11,020.00	
Approved Total (Overridden) (\$\$)		8,800.00		
Nett Amount (\$\$)	0.00	8,800.00	-8,800.00	

INSPECTION

Date of Assignment:	01/03/2016	Inspected At:	Yi Heng Motor Workshop (HQ)
Date Inspected:	01/03/2016		Blk 1 Kaki Bt Ave 6 #02-19 Singapore 417883
Estimated Period of Repair:	11.0 days		Singapore 417883

Adjuster: Kelvin Koay

Manager: Melvin Lum

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 15 Mar 2016)
Parts: 144 HONDA FIT 1.3 G (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: Koays Accident Reconstruction Pte Ltd/SJV269H/15/03/2016 14:25
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*Accident parts (see attached)		0.00 F	*7,000.00 F
Total Parts (S\$)					0.00	7,000.00

F=Franchise part.

Koays Accident Reconstruction Pte Ltd/SJV269H/15/03/2016 14:25. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	Towing	New	0.00	50.00
2	Labour to remove, repair/replace and assemble damaged items (panel)	New	0.00	1,540.00
3	Labour to remove, repair/replace and assemble undercarriage items (mechanical)	New	0.00	250.00
4	Spray painting	New	0.00	2,000.00
5	Air-con condenser replacement & refill gas	New	0.00	100.00
6	Electrical wiring	New	0.00	80.00
Gross Labour Cost (\$\$)			0.00	4,020.00

Koays Accident Reconstruction Pte Ltd/SJV269H/15/03/2016 14:25. Not valid without Reference section.

< END OF ESTIMATES >



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simel St.3 #02-24 S(529890)

Mobile: 9296 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

VEHICLE INSPECTION REPORT

Report No.: PAS/TP/0040316

Date of Report : 11/05/2016

To: Mr Yat Koh Yuen
Blk 262 Tampines Street 21
#04-272
Singapore 520262

Date of Assignment : 01/03/2016
Report requested by : Mr Yat Koh Yuen
Date of Accident : 27/02/2016
Date of Inspection : 01/03/2016
Claim No. : Third Party Claim
Policy No. : -

PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SJV269H (OPC)
Make & Model : Honda Fit (A)
Year of Registration : 2010
Colour : Met. Black

Engine Capacity (cc) : 1339cc
Mileage (km) : 54802km
Chassis / Frame No. : GE61112124
Engine No. : L13A4122914

TYRE CONDITION

Front LH : 7 mm
Make : Bridgestone

Front RH : 7 mm
Make : Bridgestone

Rear LH : 7 mm
Make : Bridgestone

Rear RH : 7 mm
Make : Bridgestone

Road wheels Type : Alloy

(The above represents the approximate remaining life of tyre treads)

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Apparent Engine Modification : Nil

PLACE OF INSPECTION

Location : M/s. Yi Heng Motor Workshop
1, Kaki Bukit Ave 6, #02-19, Autobay @ Kaki Bukit, Singapore 417883

ASSESSMENT

Repairer's Estimate : S 39,461.41
Revised Amount : S 36,460.37
Less Excess : S -
Recommended Reserve : S 29,150.00 (Lump Sum)

Estimated Normal Period of Repairs : 28 Working Days

Disclaimer: This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party.

Continue / ..

Page 1 of 2



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S1529890
Mobile 9295 2204 Fax 6722 8508 Email pasvos@hotmail.com

Business Reg 201404434D

Vehicle No : SJV269H (OPC)

Report No. : PAS/TP/0040316

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. Yi Heng Motor Workshop, 1, Kaki Bukit Ave 6, #02-19, Autobay @ Kaki Bukit, Singapore 417883.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the front, RHS and LHR portions. (The all 4 roadwheels were also affected)

DAMAGES

The bonnet, front support panel, front chassis members, front bumper, front fenders, front wheel housings, radiator assy, a/c condenser, a/c compressor, auto transmission, both front rims, front knuckle arms, front lower arms, front shock absorbers, driveshafts, front crossmember, P/steering rack assy, LHF door, headlamps, front grilles, RHS doors, RH rocker panel, rear bumper, rear end panel, LHR fender, LHR fender inner panel, LHR door, LH rocker panel, LHR rim, LHR shock absorber, rear axle beam, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$36,460.37.

CONCLUSION

The repairer has agreed to undertake the repairs at a lump sum of SGD \$29,150.00.


This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,

Prominent Appraiser Services Pte Ltd

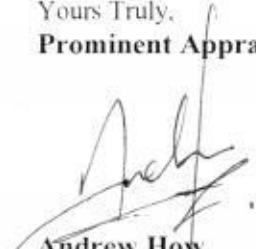
Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434D

Vehicle No.: SJV269H (OPC)

Report No.: PAS/TP/0040316

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition		Repairer's Estimate (\$\$)	Our Assessment (\$\$)
1	1 pc	Frt bumper	Broken/Dislodged		\$ 603.20	\$ 603.20
2	6 pcs	Frt bumper clip	Necessary	\$ 3.90	\$ 23.40	\$ 23.40
3	1 pc	Frt bumper reinforcement	Dented		\$ 322.90	\$ 322.90
4	2 pcs	Frt bumper side retainer R/L	Necessary	\$ 22.70	\$ 45.40	\$ 45.40
5	1 pc	Frt bumper tow cover	Broken		\$ 18.50	\$ 18.50
6	1 pc	Frt bumper lower grille	Broken		\$ 122.40	\$ 122.40
7	1 pc	Frt grille	Broken/Cracked		\$ 153.00	\$ 153.00
8	1 pc	Bonnet <i>Repair</i>	Dented/Distorted		\$ 665.90	\$ 665.90
9	1 pc	Bonnet lock <i>not new</i>	Dented/Bent		\$ 116.30	\$ 116.30
10	1 pc	Air-Duct	Refit		\$ 121.10	\$ -
11	4 pcs	Air-Duct clip	Necessary	\$ 3.90	\$ 15.60	\$ 15.60
12	2 pcs	Bonnet seal <i>Not New</i>	Necessary	\$ 18.50	\$ 37.00	\$ 37.00
13	2 pcs	Bonnet hinge	Bent	\$ 39.90	\$ 79.80	\$ 79.80
14	2 pcs	Head lamp assy R/L	Cracked/Defaced	\$ 757.90	\$ 1,515.80	\$ 1,515.80
15	2 pcs	Head lamp clip R/L	Necessary	\$ 3.70	\$ 7.40	\$ 7.40
16	2 pcs	Head lamp lower bracket R/L	Dented/Bent	\$ 23.40	\$ 46.80	\$ 46.80
17	2 pcs	Frt fender R/L <i>RH Repair</i>	Dented/Distorted	\$ 381.40	\$ 762.80	\$ 762.80
18	2 pcs	Frt fender inner cowling R/L	Torn	\$ 121.00	\$ 242.00	\$ 242.00
19	10 pcs	Frt fender inner cowling clip R/L	Necessary	\$ 3.90	\$ 39.00	\$ 39.00
20	1 pc	Frt support panel	Dented		\$ 581.90	\$ 581.90
21	1 pc	Air con condenser	Dented/Bent		\$ 979.20	\$ 979.20
22	1 pc	Air con liquid pipe <i>Not New</i>	Dented/Bent		\$ 260.10	\$ 260.10
23	1 pc	Air con suction hose <i>Not New</i>	Dented/Bent		\$ 189.70	\$ 189.70
24	1 pc	Radiator assy	Dented		\$ 1,683.00	\$ 1,683.00
25	1 pc	Air con fan assy	Dented/Broken		\$ 558.20	\$ 558.20
26	1 pc	Radiator fan cowling	Dented		\$ 119.40	\$ 119.40
27	1 pc	Radiator fan motor	Dented/Damaged		\$ 397.80	\$ 397.80
28	1 pc	Radiator fan blade	Broken		\$ 70.40	\$ 70.40
29	1 pc	Air con discharge hose <i>Not New</i>	Dented/Bent		\$ 214.20	\$ 214.20
30	1 pc	Frt wheel housing panel LH <i>Repair</i>	Dented/Distorted		\$ 587.20	\$ 587.20
31	1 pc	Frt side member LH <i>Repair</i>	Dented/Distorted		\$ 621.10	\$ 621.10
32	1 pc	RH wing mirror cover	Broken/Dislodged/Missing		\$ 121.20	\$ 121.20
33	1 pc	Washer Tank	Dented		\$ 67.40	\$ 67.40
34	1 pc	Engine under cover - LH	Torn/Broken		\$ 45.30	\$ 45.30
35	1 pc	Engine under cover - RH	Torn/Broken		\$ 45.30	\$ 45.30
36	2 pcs	Frt shock absorber R/L	Bent/Jammed	\$ 374.80	\$ 749.60	\$ 749.60
37	2 pcs	Frt shock absorber mounting R/L	Torn	\$ 25.80	\$ 51.60	\$ 51.60
38	2 pcs	Frt knuckle arm R/L	Bent	\$ 213.40	\$ 426.80	\$ 426.80
39	2 pcs	Frt knuckle arm bearing R/L	Necessary	\$ 192.50	\$ 385.00	\$ 385.00
40	1 pc	Frt lower arm R/L	Dented/Bent		\$ 196.70	\$ 196.70
41	2 pcs	Frt wheel bearing hub R/L	Distorted	\$ 286.00	\$ 572.00	\$ 572.00
42	1 pc	Frt anti-roll bar	Bent		\$ 296.60	\$ 296.60
43	2 pcs	Frt anti-roll bar bush	Necessary	\$ 8.00	\$ 16.00	\$ 16.00
44	2 pcs	Frt anti-roll bar link R/L	Bent	\$ 67.40	\$ 134.80	\$ 134.80
45	1 pc	Power steering rack assy	Bent/Jammed		\$ 1,387.30	\$ 1,387.30
					\$ 15,696.10	\$ 15,575.00



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S(529890)

Mobile 9295 2204 Fax: 6722 8508 Email pasves@hotmail.com

Business Reg 201404434D

Vehicle No. : SJV269H (OPC)

Report No. : PAS/TP/0040316

S/No.	Qty	Parts Descriptions	Condition	Repairer's Estimate (\$)	Our Assessment (\$)
				\$ 15,696.10	\$ 15,575.00
46	1 pc	Steering cross member	Dented/Distorted	\$ 628.90	\$ 628.90 ✓
47	1 pc	Drive shaft LH	Bent/Warped	\$ 980.80	\$ 980.80 ✓
48	1 pc	Drive shaft RH	Bent/Warped	\$ 943.40	\$ 943.40 ✓
49	1 pc	A.B.S speed sensor LH	Refit	\$ 165.80	\$ - X
50	1 pc	A.B.S speed sensor RH	Refit	\$ 165.80	\$ - X
51	1 pc	Air con compressor	Dented/Cracked	\$ 1,360.00	\$ 1,360.00 ✓
52	1 pc	Air con belt	Refit	\$ 46.00	\$ - X
53	1 pc	Auto gear box assy	Dented/Cracked	\$ 6,857.20	\$ 6,857.20 ✓
54	1 pc	Auto transmission fluid	Necessary	\$ 120.00	\$ 120.00 ✓
55	1 pc	Airbag crash sensor (SRS) LH	Dented/Cracked	\$ 180.20	\$ 180.20 ✓
56	1 pc	Gear box mounting	Refit	\$ 188.40	\$ - X
57	1 pc	Engine side mounting RH	Refit	\$ 103.60	\$ - X
58	1 pc	Engine rear mounting	Refit	\$ 180.60	\$ - X
59	1 pc	Frt door RH <i>Repair</i>	Dented/Distorted	\$ 1,046.60	\$ 1,046.60 X
60	1 pc	Frt door weatherstrip RH <i>Repair</i>	Torn/Necessary	\$ 92.00	\$ 92.00 X
61	1 pc	Frt door black tape RH <i>Repair</i>	Necessary	\$ 18.40	\$ 18.40 X
62	1 pc	Rr door LH <i>Repair</i>	Dented/Distorted	\$ 1,096.20	\$ 1,096.20 X
63	1 pc	Rr door black tape LH <i>Repair</i>	Necessary	\$ 18.40	\$ 18.40 X
64	1 pc	Rr door weatherstrip LH <i>Repair</i>	Torn/Necessary	\$ 116.00	\$ 116.00 X
65	1 pc	Rr bumper	Dented	\$ 456.00	\$ 456.00 ✓
66	6 pcs	Rr bumper clip	Necessary	\$ 3.90	\$ 23.40 ✓
67	1 pc	Rr bumper side retainer R/L	Necessary	\$ 14.70	\$ 14.70 ✓
68	1 pc	Rr splash shield LH <i>Repair</i>	Torn/Deformed	\$ 68.50	\$ 68.50 X
69	3 pcs	Rr splash shield clip LH <i>Repair</i>	Necessary	\$ 3.90	\$ 11.70 X
70	1 pc	Rr fender LH <i>Repair</i>	Dented/Distorted	\$ 780.10	\$ 780.10 X
71	1 pc	Rr quarter glass moulding LH <i>Repair</i>	Necessary	\$ 125.80	\$ 125.80 X
72	1 pc	Rr wheel bearing hub LH	Distorted	\$ 241.70	\$ 241.70 ✓
73	1 pc	Rr axle beam	Bent/Distorted	\$ 897.70	\$ 897.70 ✓
74	1 pc	Rr shock absorber LH	Bent	\$ 242.80	\$ 242.80 ✓
75	1 pc	Frt bumper lower lip	Torn	\$ 89.90	\$ 89.90 ✓
				\$ 32,956.70	\$ 31,985.40
			Less Discount : 20%	\$ 6,591.34	20% \$ 6,397.08
			List Parts Sub-Total :	\$ 26,365.36	\$ 25,588.32
1	1 set	Frt licence plate	Dented/Necessary	S/N \$ 80.00	\$ 50.00 ✓
2	1 pc	Frt licence plate bracket (OPC)	Bent/Necessary	S/N \$ 60.00	\$ 20.00 ✓
3	1 pc	Frt licence plate seal (OPC)	Necessary	S/N \$ 16.05	\$ 16.05 ✓
4	2 pcs	Frt sport rim R/L	Dented/Broken	S/N \$ 1,700.00	\$ 1,300.00 800
5	2 pcs	Frt tyre R/L (Depreciate 10%)	Cut/Punctured	S/N \$ 560.00	\$ 504.00 360
6	2 pcs	Brake fluid	Necessary	S/N \$ 50.00	\$ 30.00 ✓
7	1 pc	Rr quarter glass seal LH <i>Repair</i>	Necessary	S/N \$ 50.00	\$ 20.00 X
8	1 pc	Rr quarter glass sealant LH <i>Repair</i>	Necessary	S/N \$ 60.00	\$ 40.00 X
9	1 pc	Rr sport rim LH	Dented/Defaced	S/N \$ 850.00	\$ 650.00 400
10	1 pc	Rr tyre LH (Depreciate 10%)	Cut/Bulged	S/N \$ 280.00	\$ 252.00 180
			Special Nett Sub-Total :	\$ 3,706.05	\$ 2,882.05
			Parts Total :	\$ 30,071.41	\$ 28,470.37



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434C

Vehicle No.: SJV269H (OPC)

Report No.: PAS/TP/0040316

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	Towing (Include vehicle crane out service).	\$ 200.00	\$ 200.00 150
2	To check electrical system, repair wire harness & focus headlamp.	\$ 80.00	\$ 60.00 30
3	To mount vehicle on chassis jig bench.	\$ 300.00	\$ 300.00 X
4	To conduct 4 wheel alignment (2x).	\$ 120.00	\$ 120.00 80
5	To remove, replace and reinstall a/c condenser, a/c compressor & a/c pipings. (Include vacuum & recharge a/c gas)	\$ 300.00	\$ 180.00 60
6	To remove, replace and reinstall radiator & cooling system. (Include pressure test cooling system)	\$ 120.00	\$ 60.00 ✓
7	To remove and reinstall engine & gearbox assy for necessary repairs. (Include remove engine component parts)	\$ 600.00	\$ 550.00 480
8	To remove and reinstall dashboard for necessary repairs.	\$ 300.00	\$ 300.00 X
9	To remove, replace and reinstall airbag crash sensor and reset/reprogram SRS system.	\$ 200.00	\$ 160.00 100
10	To remove, check and replace front undercarriage parts.	\$ 800.00	\$ 450.00 ✓
11	To remove, check and replace rear undercarriage parts.	\$ 600.00	\$ 400.00 300
12	To remove and reinstall LHR quarter glass for necessary repairs.	\$ 120.00	\$ 80.00 X
13	To remove and reinstall rear interior trims, garnishes, seats, etc. for necessary repairs.	\$ 150.00	\$ 150.00 80
14	To send vehicle to LTA for inspection and re-seal of no.plate (OPC).	\$ 100.00	\$ 80.00 60
15	To spray painting on affected area.	\$ 2,500.00	\$ 2,350.00 2000
16	To straighten, repair, realign on affected area and replace damaged parts.	\$ 2,420.00	\$ 2,200.00 1600
17	To remove and reinstall fuel tank, pipings, etc. for necessary repairs.	\$ 100.00	\$ 60.00 X
18	To spray anti-rust coating on new and affected panels.	\$ 180.00	\$ 150.00 80
19	To transfer RHF door component parts to new door.	\$ 100.00	\$ 70.00 X
20	To transfer RHR door component parts to new door.	\$ 100.00	\$ 70.00 X
Labour Total :		\$ 9,390.00	\$ 7,990.00

5530



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S(529890)

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434D

Vehicle No. : SJV269H (OPC)

Report No. : PAS/TP/0040316

S/No. Labour Descriptions

Repairer's Estimate (S\$) Our Assessment (S\$)

Total (Parts & Labour) : \$ 39,461.41 \$ 36,460.37

For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 29,150.00

Under normal circumstances, the repairs should be completed within a reasonable period of 28 Working Days.

290 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

total: 23288.37.
h/s: 18.6K.
18 Pump.



51 UBI AVE 1, #01/02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL: (065) 6256 3561 FAX: (065) 6256 4315

Your Ref: AKN-atv-INS-Y44-98490-16

Date: 02nd August 2018

Our Ref: CS1/LAW18011778/Avbs2

M/s Vision Law LLC
133 New Bridge Road #18-01/02
Chinatown Point
Singapore 059413

Dear Sir / Madam,

**EVALUATION REPORT (PAPER SURVEY) OF ACCIDENT VEHICLE NO:
SVJ 269H INSURED VEHICLE: SFL 1422A ACCIDENT DATE: 27/02/2016**

We thank you for your instruction on 24/04/2018.

We acknowledge receipt of the following documents:-

- a) Automobile Inspection Report of SVJ 269H from M/s Koays Accident Reconstruction Pte Ltd.
- b) Survey report by Prominent Appraiser Services Pte Ltd with photographs.
- c) Singapore Accident Statement of Vehicles SVJ 269H, SFL 1422A and SJA 4614D.

Based on the documents received from you, we have evaluated the damages of the vehicle and have the following comments:-

1. Information Recorded: -

Registration Number	: SVJ 269H
Make & Model	: Honda Fit, 1.3 G (A)
Year of Registration	: 2010
Chassis Number	: GE61112124
Engine Capacity	: 1339 cc

2. We recommend that the repairs of the entire damage require about 18 (Eighteen) working days to complete.
3. We hereby provide our recommendations on the cost of repair to the damaged vehicle as stated in the following page.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJV 269H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRT BUMPER	BROKEN / DISLODGE	603.20	548.20
6	FRT BUMPER CLIP @ \$3.90	NECESSARY	23.40	23.40
1	FRT BUMPER REINFORCEMENT	DENTED	322.90	245.00
2	FRT BUMPER SIDE RETAINER R/L @ \$22.70	NECESSARY	45.40	45.40
1	FRT BUMPER TOW COVER	BROKEN	18.50	18.50
1	FRT BUMPER LOWER GRILLE	BROKEN	122.40	122.40
1	FRT GRILLE	BROKEN / CRACKED	153.00	153.00
1	BONNET	TO REPAIR SEE LABOUR	665.90	-
1	BONNET LOCK	NOT NECESSARY	116.30	-
1	AIR-DUCT	REFIT	121.10	-
4	AIR-DUCT CLIP @ \$3.90	NECESSARY	15.60	15.60
2	BONNET SEAL @ \$18.50	NOT NECESSARY	37.00	-
2	BONNET HINGE @ \$39.90	NOT NECESSARY	79.80	-
2	HEAD LAMP ASSY R/L @ \$757.90	CRACKED / DEFACED	1,515.80	1,515.80
2	HEAD LAMP CLIP R/L @ \$3.70	NECESSARY	7.40	7.40
2	HEAD LAMP LOWER BRACKET R/L @ \$23.40	DENTED / BENT	46.80	46.80
2	FRT FENDER R/L	O/S TO REPAIR SEE LABOUR/N/S DENTED / DISTORTED	762.80	381.40
2	FRT FENDER INNER COWLING R/L @ \$121.00	TORN	242.00	242.00
10	FRT FENDER INNER COWLING CLIP R/L @ \$3.90	NECESSARY	39.00	39.00
1	FRT SUPPORT PANNEL	DENTED	581.90	581.90
1	AIR CON CONDENSER	DENTED / BENT	979.20	979.20
1	AIR CON LIQUID PIPE	NOT NECESSARY	260.10	-
1	AIR CON SUCTION HOSE	NOT NECESSARY	189.70	-
1	RADIATOR ASSY	DENTED	1,683.00	1,237.00
1	AIR CON FAN ASSY	DENTED / BROKEN	558.20	558.20
1	RADIATOR FAN COWLING	DENTED	119.40	119.40

Report Ref No. CS1/LAW18011778/Avbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR FAN MOTOR	DENTED / DAMAGED	397.80	397.80
1	RADIATOR FAN BLADE	BROKEN	70.40	70.40
1	AIR CON DISCHARGE HOSE	NOT NECESSARY	214.20	-
1	FRT WHEEL HOUSING PANEL LH	TO REPAIR SEE LABOUR	587.20	-
1	FRT SIDE MEMBER LH	TO REPAIR SEE LABOUR	621.10	-
1	RH WING MIRROR COVER	BROKEN / DISLODGE / MISSING	121.20	121.20
1	WASHER TANK	DENTED	67.40	67.40
1	ENGINE UNDER COVER - LH	TORN / BROKEN	45.30	45.30
1	ENGINE UNDER COVER - RH	TORN / BROKEN	45.30	45.30
2	FRT SHOCK ABSORBER R/L @ \$374.80	BENT / JAMMED	749.60	749.60
2	FRT SHOCK ABSORBER MOUNTING R/L @ \$25.80	TORN	51.60	51.60
2	FRT KNUCKLE ARM R/L @ \$213.40	BENT	426.80	426.80
2	FRT KNUCKLE ARM BEARING R/L @ \$192.50	NECESSARY	385.00	385.00
1	FRT LOWER ARM R/L	DENTED / BENT	196.70	196.70
2	FRT WHEEL BEARING HUB R/L @ \$286.00	DISTORTED	572.00	572.00
1	FRT ANTI-ROLL BAR	BENT	296.60	296.60
2	FRT ANTI-ROLL BAR BUSH @ \$8.00	NECESSARY	16.00	16.00
2	FRT ANTI-ROLL BAR LINK R/L @ \$67.40	BENT	134.80	134.80
1	POWER STEERING RACK ASSY	BENT / JAMMED	1,387.30	1,387.30
1	STEERING CROSS MEMBER	DENTED / DISTORTED	628.90	628.90
1	DRIVE SHAFT LH	BENT / WARPED	980.80	980.80
1	DRIVE SHAFT RH	BENT / WARPED	943.40	943.40
1	A.B.S. SPEED SENSOR LH	REFIT	165.80	-
1	A.B.S. SPEED SENSOR RH	REFIT	165.80	-
1	AIR CON COMPRESSOR	DENTED / CRACKED	1,360.00	1,360.00
1	AIR CON BELT	REFIT	46.00	-
1	AIRBAG CRASH SENSOR (SRS) LH	DENTED / CRACKED	180.20	180.20
1	GEAR BOX MOUNTING	REFIT	188.40	-

Report Ref No. CS1/LAW18011778/Avbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE SIDE MOUNTING RH	REFIT	103.60	-
1	ENGINE REAR MOUNTING	REFIT	180.60	-
1	FRT DOOR RH	TO REPAIR SEE LABOUR	1,046.60	-
1	FRT DOOR WEATHERSTRIP RH	NOT NECESSARY	92.00	-
1	FRT DOOR BLACK TAPE RH	NOT NECESSARY	18.40	-
1	RR DOOR LH	TO REPAIR SEE LABOUR	1,096.20	-
1	RR DOOR BLACK TAPE LH	NOT NECESSARY	18.40	-
1	RR DOOR WEATHERSTRIP LH	NOT NECESSARY	116.00	-
1	RR BUMPER	DENTED	456.00	456.00
6	RR BUMPER CLIP @ \$3.90	NECESSARY	23.40	23.40
1	RR BUMPER SIDE RETAINER R/L	NECESSARY	14.70	14.70
1	RR SPLASH SHIELD LH	NOT NECESSARY	68.50	-
3	RR SPLASH SHIELD CLIP LH @ \$3.90	NECESSARY	11.70	-
1	RR FENDER LH	TO REPAIR SEE LABOUR	780.10	-
1	RR QUARTER GLASS MOULDING LH	NOT NECESSARY	125.80	-
1	RR WHEEL BEARING HUB LH	DISTORTED	241.70	241.70
1	RR AXLE BEAM	BENT / DISTORTED	897.70	897.70
1	RR SHOCK ABSORBER LH	BENT	242.80	242.80
1	FRT BUMPER LOWER LIP	TORN	89.90	89.90
	LESS 20% DISCOUNT		-5,195.90	-3,580.58
			20,783.60	14,322.32
1	AUTO GEAR BOX ASSY (SN)	DENTED / CRACKED	6,857.20	1,500.00
1	AUTO TRANSMISSION FLUID (SN)	NECESSARY	120.00	80.00
	LESS 20% DISCOUNT		-1,395.44	-
			5,581.76	1,580.00
	SPECIAL NETT ITEMS			
1	SET FRT LICENCE PLATE (SN)	DENTED / NECESSARY	80.00	50.00

Report Ref No. CS1/LAW18011778/Avbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRT LICENCE PLATE BRACKET (OPC) (SN)	BENT / NECESSARY	60.00	20.00
1	FRT LICENCE PLATE SEAL (OPC) (SN)	NECESSARY	16.05	16.05
2	FRT SPORT RIM R/L (SN)	DENTED / BROKEN	1,700.00	800.00
2	FRT TYRE R/L (SN)	CUT / PUNCTURE	560.00	360.00
2	BRAKE FLUID (SN)	NECESSARY	50.00	30.00
1	RR QUARTER GLASS SEAL LH (SN)	NOT NECESSARY	50.00	-
1	RR QUARTER GLASS SEALANT LH (SN)	NOT NECESSARY	60.00	-
1	RR SPORT RIM LH (SN)	DENTED / DEFACED	850.00	400.00
1	RR TYRE LH (SN)	CUT / BULGED	280.00	180.00
			3,706.05	1,856.05
	LABOUR			
	TOWING (INCLUDE VEHICLE CRANE OUT SERVICE).		200.00	150.00
	TO CHECK ELECTRICAL SYSTEM, REPAIR WIRE HARNESS & FOCUS HEADLAMP.		80.00	30.00
	TO MOUNT VEHICLE ON CHASSIS JIG BENCH.	NOT NECESSARY	300.00	-
	TO CONDUCT 4 WHEEL ALIGNMENT (2X).		120.00	80.00
	TO REMOVE, REPLACE AND REINSTALL A/C CONDENSER, A/C COMPRESSOR & A/C PIPINGS. (INCLUDE VACUUM & RECHARGE A/C GAS)		300.00	60.00
	TO REMOVE AND REINSTALL RADIATOR & COOLING SYSTEM. (INCLUDE PRESSURE TEST COOLING SYSTEM)		120.00	60.00
	TO REMOVE AND REINSTALL ENGINE & GEARBOX ASSY FOR NECESSARY REPAIRS. (INCLUDE REMOVE ENGINE COMPONENT PARTS)		600.00	480.00
	TO REMOVE AND REINSTALL DASHBOARD FOR NECESSARY REPAIRS.	NOT NECESSARY	300.00	-
	TO REMOVE, REPLACE AND REINSTALL AIRBAG CRASH SENSOR AND RESET / REPROGRAM SRS SYSTEM.		200.00	100.00
	TO REMOVE, CHECK AND REPLACE FRONT UNDERCARRIAGE PARTS.		800.00	450.00
	TO REMOVE, CHECK AND REPLACE REAR UNDERCARRIAGE PARTS.		600.00	300.00
	TO REMOVE AND REINSTALL LHR QUARTER GLASS FOR NECESSARY REPAIRS.	NOT NECESSARY	120.00	-

Report Ref No. CS1/LAW18011778/Avbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REINSTALL REAR INTERIOR TRIMS, GARNISHES, SEATS, ETC. FOR NECESSARY REPAIRS.		150.00	80.00
	TO SEND VEHICLE TO LTA FOR INSPECTION AND RE-SEAL OF NO. PLATE (OPC).		100.00	60.00
	TO SPRAY PAINTING ON AFFECTED AREA.		2,500.00	2,000.00
	TO STRAIGHTEN, REPAIR, REALIGN ON AFFECTED AREA AND REPLACE DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF BONNET, O/S FRT FENDER R/L, FRT WHEEL HOUSING PANEL LH, FRT SIDE MEMBER LH, FRT DOOR RH, RR DOOR LH AND RR FENDER LH.		2,420.00	1,600.00
	TO REMOVE AND REINSTALL FUEL TANK, PIPINGS, ETC. FOR NECESSARY REPAIRS.	NOT NECESSARY	100.00	-
	TO SPRAY ANTI-RUST COATING ON NEW AND AFFECTED PANELS.		180.00	80.00
	TO TRANSFER RHF DOOR COMPONENT PARTS TO NEW DOOR.	NOT NECESSARY	100.00	-
	TO TRANSFER RHR DOOR COMPONENT PARTS TO NEW DOOR.	NOT NECESSARY	100.00	-
			9,390.00	5,530.00
GRAND TOTAL			39,461.41	23,288.37
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				18,600.00

Report Ref No. CS1/LAW18011778/Avbs2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.