

ASS. REC. BY:

REF: CS/7CL18012575/K4bn2

Special Instruction:

Survivor

ASSIGNMENT (Office)

From (Person): CWS Sorensen Ler of FEL Date/Time: 10072018 635pm

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SHF 761K Insured: SH 9059E

at Workshop m/s Trans - Cab Tel: 6287 6666

of No. 2 Amk St 63

Policy No: Claim No: D18005310MFSH

Sum Insured: Excess:

Make of Veh: D.O.A. 08072018
(Client's Record)

CA / REV / REP. / REV 24 HRS 'DS'

11-072018

H.O.D. Endorsement:

Date/Time: 10072018 Person Contacted: Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SHF 761K - TR4/ASM1800353/KJC3 DCA: 01012018
	SH 9059E - CS/7CL16013076/DABell DCA: 03062018

ASSIGNMENT

From: _____ Date: 11/7/2018

Estimated Cost: _____

OD ☒ TP ☐ WS ☐ TP RES ☐ OD RES ☐ EVA ☐ INV ☐ MV

To Inspect Vehicle No: SHF 761K

at Workshop m/s Trans-cab

of No. 2 AMK St-63.

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

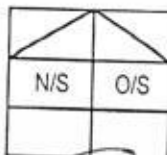

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 01 days Res.: Yes or No

Lum Sum: 1.31 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS (DS)

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHF 761K Yr Regn: 06, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Renault Clio c.c. 1895

Colour: M. White Red A/C: Insured / Std / NI / NA

Sp. Reading: 231.569 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VF-1ABC 15AUC 283336

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: M/S/Rim / STD A/Rim or

Tyre Size: F: Giti 215/60R16

R: Falken

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal. 8 mm

L/Bal. 8 mm

D.O.A. 8/7/18

Rear

R/Bal. 4 mm

L/Bal. 4 mm

D.O.I. 11/7/18

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

12/7/18 per 2 Catherine

81077-96 (Red. 56442.18 : 9890)

RECEIVED 17 JUL 2018

Date/Time, File Pass to?



: Preli. Report



: Final Report

1) H/T Typist

Date/Time, File Return to?

2)

Report Format: TP

Lump Sum / I.B.I. (\$) (1077-96)

Days Of Repair: 1

Resurvey No. of Trip: 1

Add Fee:



: Site Insp (\$)



: Interview (\$)



: Tech. Invs (\$)



: Weekend (\$)

Survey Fee:

Transportation:

S + RS \$

Photos

Others

TOTAL

47x15=705

1704

50

12

937

MOTOR SURVEY ASSIGNMENT

Date	10-07-2018	Our Ref No. D18005310MFSH
Accident Date	08-07-2018	Claim Type. Third Party
Insured Vehicle	SH9059E	Third Party Vehicle. SHF761K
Survey Location	NO. 2 ANG MO KIO STREET 63	
Contact Person.	GHIEEN YEE LOONG	
Contact No.	62876666/ 0	Fax No. 62571330
Survey Type	WITHOUT PREJUDICE: QUANTUM TO BE AGREED (EST. COR - \$57,520.14)	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS-CAB AUTO SERVICES PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	SERENE	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	3878K

Vehicle No.:	SHF761K
Vehicle to be Exported:	Yes
Intended De-registration Date:	09 Jul 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2015
Engine No.:	M9R8839C003373
Chassis No.:	VF1ABL15AUC283336
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	30 Jun 2016
First Registration Date:	30 Jun 2016
Transfer Count:	0
Actual ARF Paid:	\$19,998.00

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Jun 2024
PARF Rebate Amount:	\$14,998.00

COE Expiry Date:	29 Jun 2024
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$37,164.00
COE Rebate Amount:	\$27,743.00
Total Rebate Amount:	\$42,741.00

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

OK

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K**AAD1807-074**

NOT AUTHORIZED
Resony B4 paint 81077.96

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHF 761K

VF1ABL15AUC283336

RENAULT

LATITUDE

8.7.2018

FCIL**PART****LIST**

1	1 BUMPER COVER REAR	\$	<i>R</i> 1,108.46 <i>X</i>
2	1 BUMPER LOWER REAR	\$	<i>DAVID</i> 768.84 ✓
3	1 BUMPER BRACKET CTR REAR	\$	<i>Sn</i> 113.47
4	1 BUMPR BRACKET SIDE RH REAR	\$	<i>Sn</i> 135.97
5	1 BUMPR RETAINER RH REAR	\$	<i>Sn</i> 44.99
6	1 BUMPER REFLECTOR RH	\$	<i>Sn</i> 43.61
7	1 BUMPR BRACKET SIDE LH REAR	\$	<i>Sn</i> 135.97
8	1 BUMPR RETAINER LH REAR	\$	<i>Sn</i> 44.99
9	1 BUMPER REFLECTOR LH	\$	<i>Sn</i> 43.61
10	1 BUMPER BEAM REAR	\$	<i>R</i> 777.52
11	1 BUMPER BEAM BRACKET LH REAR	\$	<i>R</i> 225.95
12	1 BUMPER BEAM BRACKET RH REAR	\$	<i>R</i> 225.95
13	1 BOOT REAR	\$	<i>R</i> 2,872.68
14	1 BOOT FINISHER	\$	<i>Sn</i> 470.06
15	1 BOOT WHEATERSTRIP	\$	<i>Sn</i> 323.05
16	1 BOOT REFLECTOR LAMP LH	\$	<i>Sn</i> 493.35
17	1 BOOT REFLECTOR LAMP RH	\$	<i>Sn</i> 493.35
18	1 BOOT BADGE 'RENAULT'	\$	<i>Sn</i> 225.36
19	1 BOOT BADGE	\$	<i>Sn</i> 225.36
20	1 BOOT STRUT LH	\$	<i>Sn</i> 276.08
21	1 BOOT STRUT RH	\$	<i>Sn</i> 276.08
22	1 BOOT HINGE LH	\$	<i>R</i> 367.84
23	1 BOOT HINGE RH	\$	<i>R</i> 367.84
24	1 BOOT INNER TRIM	\$	<i>Sn</i> 586.45
25	1 BOOT SWITCH	\$	<i>Sn</i> 168.13
26	1 BOOT LOCK	\$	<i>R</i> 202.67
27	1 BOOT LOCK CATCH	\$	<i>R</i> 74.40
28	2 LICENCE PLATE LAMP	\$	<i>Sn</i> 50.52
29	2 BOOT RUBBER PLUG	\$	<i>Sn</i> 221.81

Trans-cab Auto Services Pte Ltd**AAD1807-074**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K

30	1 DOOR PANEL REAR LH	\$	<i>R</i>	2,844.66	}
31	1 FENDER PANEL INNER TRIM REAR LH	\$	<i>Sh</i>	671.45	
32	1 FENDER PANEL REAR LH	\$	<i>R</i>	3,299.13	
33	1 WHEELARCH REAR LH	\$	<i>Sh</i>	543.47	
34	1 FENDER PANEL INNER TRIM REAR RH	\$	<i>Sh</i>	671.45	
35	1 FENDER PANEL REAR RH	\$	<i>R</i>	3,299.13	
36	1 WHEELARCH REAR RH	\$	<i>Sh</i>	543.47	
37	1 TAILLAMP RH	\$	<i>Sh</i>	552.55	
38	1 TAILLAMP PANEL RH	\$	<i>R</i>	986.70	
39	1 TAILLAMP LH	\$	<i>Sh</i>	552.55	
40	1 TAILLAMP PANEL LH	\$	<i>R</i>	986.70	
41	1 OUTER PANEL REAR (End Panel)	\$	<i>R</i>	1,471.77	
42	1 OUTER PANEL REAR (End Panel)TRIM	\$	<i>Sh</i>	404.56	
43	1 SPARE WHEEL PANEL (Luggage Floor Panel)	\$	<i>R</i>	2,189.88	
44	1 SPARE WHEEL PANEL TRIM	\$	<i>Sh</i>	612.21	
45	1 EXHAUST REAR	\$	<i>R</i>	7,489.05	
46	1 EXHAUST CAP REAR	\$	<i>R</i>	230.49	
47	1 FUEL FLAP L70Y	\$	<i>Sh</i>	343.57	
48	1 CHASSIS PANEL REAR RH	\$	<i>R</i>	3,766.43	
49	1 WHEEL HOUSING PANEL REAR RH	\$	<i>R</i>	4,682.09	
TOTAL		\$		47,505.69	⁶⁷
10%		\$		4,750.57	
		\$		42,755.12	

Special Nett

1	1SET PARKING AID	\$	<i>Sh</i>	700.00	}
2	1SET REAR BUMPER CLIP	\$	<i>na</i>	66.00	
3	1SET BUMPER BRACKET CTR CLIP	\$	<i>na</i>	33.00	
4	1SET BUMPER BRACKET SIDE CLIP RH RR	\$	<i>na</i>	10.00	
5	1SET BUMPER RETAINER RH CLIP RR	\$	<i>na</i>	20.00	
6	1SET BUMPER BRACKET SIDE CLIP LH RR	\$	<i>na</i>	10.00	
7	1SET BUMPER RETAINER CLIP LH RR	\$	<i>na</i>	20.00	
8	1SET BUMPER LOWER REAR RIVET	\$	<i>na</i>	22.00	
9	1SET BUMPER LOWER REAR CLIP	\$	<i>na</i>	66.00	
10	1 EXHAUST MOUNTING REAR	\$	<i>Sh</i>	17.82	<i>X</i>
11	1SET BOOT FINISHER CLIP	\$	<i>na</i>	24.20	<i>X</i>
12	1 BOOT STICKER "Trans-cab"	\$	<i>na</i>	30.00	<i>X</i>

Trans-cab Auto Services Pte Ltd

AAD1807-074

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K

13	1 BOOT STICKER "6555-3333"	\$	<i>nn</i> 30.00	} X
14	1 BOOT INNER TRIM CLIP	\$	<i>5</i> 45.00	
15	1SET FENDER WHEELARCH REAR RH CLIP	\$	<i>5</i> 35.00	
16	1SET FENDER WHEELARCH REAR LH CLIP	\$	<i>5</i> 35.00	
17	1 FENDER INNER TRIM CLIP LH	\$	<i>5</i> 28.00	
18	1 FENDER INNER TRIM CLIP LH	\$	<i>5</i> 28.00	
19	1 TAILLAMP CLIP RH	\$	<i>5</i> 5.00	
20	1 TAILLAMP CLIP LH	\$	<i>5</i> 5.00	
21	2 REAR WINDSCREEN SELANT	\$	<i>5</i> 80.00	
22	1 WINDSCREEN MOULDING	\$	<i>5</i> 100.00	
23	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	<i>5</i> 100.00	
24	1 SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	<i>5</i> 385.00	
25	1 SPARE TYRE	\$	<i>5</i> 330.00	

TOTAL \$ 2,225.02

TOTAL PARTS \$ 44,980.14**LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	6,000.00 <i>2201</i>
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	4,200.00 <i>1001</i>
To Rust-Proofing Of The Affected Areas.	\$	<i>nn</i> 170.00 X
To reinstall rear bumper parking sensor.	\$	<i>5</i> 170.00 X
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	<i>5</i> 170.00 X
To repair and realign rear exhaust pipe.	\$	<i>5</i> 170.00 X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	<i>5</i> 170.00 X

Trans-cab Auto Services Pte Ltd

AAD1807-074

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K

To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	nn 170.00	X
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	4 170.00	X
To supply and re-do rear luggage floor panel insulation padding.	\$	4 380.00	X
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	4 380.00	X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	4 170.00	X
To check steering geometry and computer wheel alignment	\$	4 220.00	X
To transfer of rear door fittings, attachment and perform water seepage test.	\$	4 380.00	X

TOTAL \$ 12,540.00**Over All Total \$ 57,520.14**

57900.12

(LUMP SUM)**Repair Days****20 DAYS**

1 day

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD		Ref : CS/FCI18012575/Ktbn2		
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 18-07-2018		
		Code : FCI2		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SH 9059E	Veh. Inspected	SHF 761K	
Policy No.		Coverage (\$)	0.00	
Claim No.	D18005310MFSH	Excess (\$)	0.00	
Assign From	SERENE	Assign Date	10/07/2018	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	VF1ABL15AUC283336	Colour	METALLIC WHITE / RED	
Odometer	231569	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	8 mm	
L/H Front Tyre	215/60 R16	GITI	8 mm	
R/H Rear Tyre	215/60 R16	FALKEN	4 mm	
L/H Rear Tyre	215/60 R16	FALKEN	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	08/07/2018	Inspection Date	11/07/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)DAMAGES CONSISTENT TO ACCIDENT REPORT. B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		1 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 761K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER REAR	TO REPAIR SEE LABOUR	1,108.46	-
1	BUMPER LOWER REAR	DENTED / DISTORTED	768.84	768.84
1	BUMPER BRACKET CTR REAR	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR LH	SERVICEABLE	43.61	-
1	BUMPER BEAM REAR	TO REPAIR SEE LABOUR	777.52	-
1	BUMPER BEAM BRACKET LH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BUMPER BEAM BRACKET RH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BOOT REAR	TO REPAIR SEE LABOUR	2,872.68	-
1	BOOT FINISHER	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP	SERVICEABLE	323.05	-
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	493.35	-
1	BOOT BADGE "RENAULT"	NOT NECESSARY	225.36	-
1	BOOT BADGE	NOT NECESSARY	225.36	-
1	BOOT STRUT LH	SERVICEABLE	276.08	-
1	BOOT STRUT RH	SERVICEABLE	276.08	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM	SERVICEABLE	586.45	-
1	BOOT SWITCH	SERVICEABLE	168.13	-

Report Ref No. CS/FCI18012575/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT LOCK	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	74.40	-
2	LICENCE PLATE LAMP	SERVICEABLE	50.52	-
2	BOOT RUBBER PLUG	SERVICEABLE	221.81	-
1	DOOR PANEL REAR LH	TO REPAIR SEE LABOUR	2,844.66	-
1	FENDER PANEL INNER TRIM REAR LH	SERVICEABLE	671.45	-
1	FENDER PANEL REAR LH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH	SERVICEABLE	543.47	-
1	FENDER PANEL INNER TRIM REAR RH	SERVICEABLE	671.45	-
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH	SERVICEABLE	543.47	-
1	TAILLAMP RH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP LH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL LH	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL)	TO REPAIR SEE LABOUR	1,471.77	-
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM	SERVICEABLE	612.21	-
1	EXHAUST REAR	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR	TO REPAIR SEE LABOUR	230.49	-
1	FUEL FLAP L70Y	SERVICEABLE	343.57	-
1	CHASSIS PANEL REAR RH	TO REPAIR SEE LABOUR	3,766.43	-
1	WHEEL HOUSING PANEL REAR RH	TO REPAIR SEE LABOUR	4,682.09	-

Report Ref No. CS/FC118012575/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-4,750.57	-76.88
			42,755.10	691.96
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NOT NECESSARY	66.00	-
1	SET BUMPER BRACKET CTR CLIP (SN)	NOT NECESSARY	33.00	-
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	SET BOOT FINISHER CLIP (SN)	NOT NECESSARY	24.20	-
1	BOOT STICKER "TRANS-CAB" (SN)	NOT NECESSARY	30.00	-
1	BOOT STICKER "6555-3333" (SN)	NOT NECESSARY	30.00	-
1	BOOT INNER TRIM CLIP (SN)	NOT NECESSARY	45.00	-
1	SET FENDER WHEELARCH REAR RH CLIP (SN)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN)	NOT NECESSARY	35.00	-
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP RH (SN)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN)	NOT NECESSARY	5.00	-
2	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
1	SPARE TYRE RIM (ROUE 7J 16H 2547)(SN)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN)	SERVICEABLE	330.00	-
			2,225.02	66.00
	<u>LABOUR</u>			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	220.00

Report Ref No. CS/FCI18012575/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME. }		4,200.00	100.00
	INCLUSIVE OF THE REPAIR OF BUMPER COVER REAR,BUMPER BEAM REAR,BUMPER BEAM BRACKET LH REAR,BUMPER BEAM BRACKET RH REAR,BOOT REAR,BOOT HINGE LH,BOOT HINGE RH,BOOT LOCK,BOOT LOCK CATCH,DOOR PANEL REAR LH,FENDER PANEL REAR LH,FENDER PANEL REAR RH,TAILLAMP PANEL RH,TAILLAMP PANEL LH,OUTER PANEL REAR (END PANEL),SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL),EXHAUST REAR,EXHAUST CAP REAR,CHASSIS PANEL REAR RH AND WHEEL HOUSING PANEL REAR RH. }		-	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR.	NOT NECESSARY	170.00	-
	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITITNGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
			12,920.00	320.00
	GRAND TOTAL		57,900.12	1,077.96

Report Ref No. CS/FCI18012575/Ktbn2



RECOMMENDED COST OF REPAIRS			1,077.96
-----------------------------	--	--	----------

Report Ref No. CS/FCI18012575/Ktbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.