

Surveyor: NAZ

REF:

MSIG CC3/MSH18015710/NAZ/AX/08/1P/2072

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SLU 11415

Policy No. A29069766MKF

Claims No. 568115

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 8 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHB 52510 Yr Regn: 18 DEC 2015

Typ: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRIMA C.C. 1798

Colour: Maroon A/C: Insured / Std / NI /

Sp. Reading 330, 052 T/Radio: Insured / Std / NI /

Eng/No: _____

C/No: JTDKN36U405767035

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In Order / Jammed / Leaked / Burnt or

Brake: In Order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195 / 65 R15

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or EACKEN

Front

Rear

R/Bal. 5 mm R/Bal. 6 mm

L/Bal. 5 mm L/Bal. 6 mm

D.O.A. 21/8/18 D.O.I. 24/8/18

Survey held at SART WOODLANDS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

REAR N/I, N/I REAR

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

21/10/18

SHB 52510 - CC3 / AXA / 110000000 / T/HDP

SLU 11415 - X

MSIG P/P

DA: 05/03/2011

Part by Part \$6462.97 (Red: 15315.53; 70%)

RECEIVED 11 OCT 2018

Date/Time, File Pass to?

☐ : Preli. Report

☒ : Final Report

1) 11/10 Typist

Date/Time, File Return to?

2)

Days Of Repair: 8

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

Add Fee: ☐ : Site Insp (\$) S + RS. SI

☐ : Interview (\$) Photos

☐ : Tech. Invs (\$) Others

☐ : Weekend (\$)

TOTAL

Report Format: TP

Lump Sum / I.B.I: (\$ 6462.97)

200

10

210

Denise Tay (LKKAUTO)

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC) <YeoPohsuan@smrt.com.sg>
Sent: Wednesday, 10 October 2018 12:01 PM
To: Naz (LKKAUTO)
Cc: SUR; CS A Team
Subject: RE: SHB5251D
Attachments: img-X10120412-0001.pdf

Hi Naz,

Please refer to the amended estimate for finalization.

Thanks & Regards
Poh Suan

From: Naz (LKKAUTO) [mailto:Naz@lkkauto.com]
Sent: Wednesday, 10 October 2018 10:39 AM
To: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)
Cc: SUR; CS A Team
Subject: Re: SHB5251D

Dear Ms Yeo,

Apologies for the oversight. Attached herewith is the amended marked estimate. The LH Rear Door was repaired and not replaced. Therefore I have deducted the labour of \$50 from the final cost. We will proceed to finalize if you are agreeable with the amended COR.

Thank you.

Best Regards,

Naz | Technical Investigator

LKK Auto Consultants

Phone: 6841-2157 | Email: Naz@lkkauto.com | Fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC) <YeoPohsuan@smrt.com.sg>
Sent: Tuesday, 9 October 2018 11:56 AM

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	21/08/2018 13:29
Date Of Accident	21/08/2018 09:50
Exact Location Of Accident	PIE TOWARDS TUAS
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB5251D
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	MUHAMMAD NUR DZHORIF BIN ISMAIL
NRIC No	S8527458I
Date Of Birth	30/09/1985
Occupation	OUTDOOR
Date Of Driving Pass	14/05/2010
Driving Experience	8 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
E Mail Address	NOEMAIL

Address	774
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	WOODLANDS EAST N.P.C
Police Station Address	ROAD: 3 WOODLANDS DRIVE 63 , POSTCODE: 737890 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT - T/20180821/2064 On the 21/08/2018 at about 1000, I was driving my taxi SHB5251D along the center lane of PIE towards Tuas before Clementi exit. Due to the slow traffic ahead, I slowed down my taxi when suddenly a car SLU1141S hit my taxi at the rear left side. I stopped my taxi immediately and subsequently came out to make a check. I discovered that the rear left side of my taxi was badly damaged. The driver of the said car which hit me also came out to make a check. After which, an LTA Officer came to scene to assist and escorted us to Clementi loop. At that point of time, I exchanged particulars with the driver of the said car. The driver and the passenger of the said car claimed that they are not injured at that point of time. I then went to the Clinic as I felt pain on my backbone and neck area. I received a total of 3 days MC. There is an in-car camera installed in my taxi and it captured the whole incident. I am making this report for insurance purposes.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLU1141S
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE HIRE
Name of Driver	ZAKIAH HANIM BINTE ABDUL KHALID
NRIC/Passport Number	S8726448C
Contact Number	

Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver) 2
Passenger 1
NAME: ;
GENDER: : MALE

DETAILS OF INJURED PERSON 1

Name MUHAMMAD NUR DZHORIF BIN ISMAIL
Approximate Age
Injuries Sustain
Injured person in which vehicle? SHB5251D
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

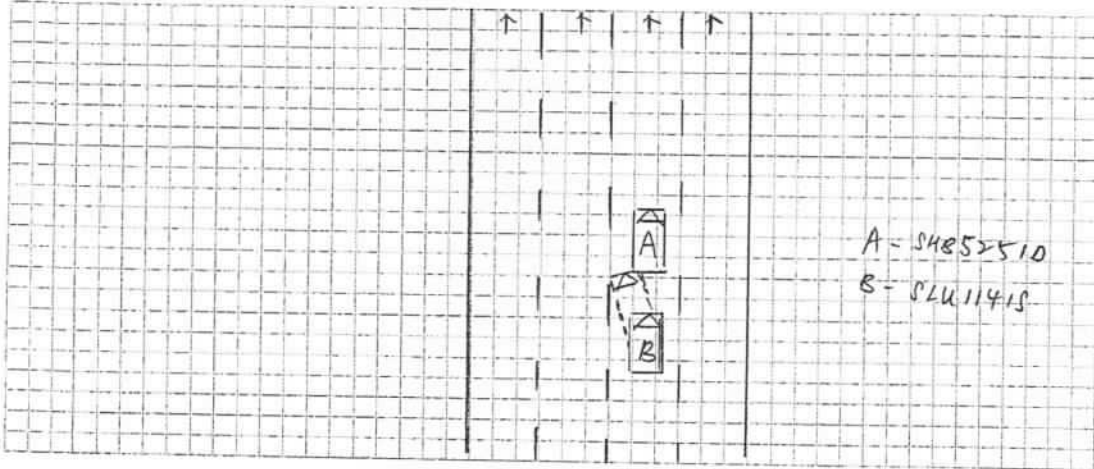

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO POLICE REPORT - 7/2180821/2014

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
Date & Time:

[Signature]

Driver's Signature
(If driver is not the policyholder)
Date & Time:

[Signature] 21/8/2018

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



**SINGAPORE
POLICE FORCE**



T/20180821/2064

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

1 of 3

Report No. T/20180821/2064

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 21/08/2018 13:00	Vide Report No.:	Station Diary No.: 79
--	------------------	--------------------------

Informant's Particulars

Name of Informant: MUHAMMAD NUR DZHORIF BIN ISMAIL	Address: APT BLK 774 WOODLANDS CRESCENT #03-22 SINGAPORE 730774		
ID Type / ID No.: NRIC NO / S8527458I	Contact No.: Home/Office: Mobile: 82986169		
Nationality: SINGAPORE CITIZEN	Email:		
Sex: Male	Age: 32	Date of Birth: 30/09/1985	Type of Informant: Driver
Race: Boyanese	Language:		Institution / School Name:
Occupation: Taxi driver	Driving Licence Information: Class: 2B,2A,2,3 Date of Expiry:		

General Information of the Accident

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 21/08/2018 10:00	Type of Location:
Location: Along Road 1 PAN ISLAND EXPRESSWAY				
ALONG PIE TOWARDS TUAS BEFORE CLEMENTI EXIT.				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow:		Traffic Control:		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SHB5251D	Car	TOYOTA	PRIUS TAXI (SMRT)	Maroon	Seriously Damaged	0
SLU1141S	Car	TOYOTA	PRIUS HYBRID 1.8 CVT	Silver	Slightly Damaged	1

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20180821/2064

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

2 of 3

Report No. T/20180821/2064

CONTINUATION OF REPORT

Driver			
Name	MUHAMMAD NUR DZHORIF BIN ISMAIL	ID No.	S8527458I
Related Vehicle	SHB5251D (Car)	Contact No.	82986169
Hospital/Clinic	CARE4LIFE MEDICAL CLINIC (YISHUN)	Class of Driving Licence & Expiry Date	Class: 2B,2A,2,3 Date of Expiry: NIL
Date Treatment	21/08/2018	Date Discharge	21/08/2018
No. of Days granted Medical Leave	03	Degree of Injury	Slight
Driver			
Name	ZAKIAH HANIM BINTE ABDUL KHALID	ID No.	S8726448C
Related Vehicle	SLU1141S (Car)	Contact No.	96642585
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On the 21/08/2018 at about 1000hrs, I was driving my taxi (SHB5251D) along the center lane of Pan Island Expressway towards Tuas before Clementi exit. Due to the slow traffic ahead, I slowed down my taxi when suddenly a car (SLU1141S) hit my taxi at the rear left side.

I stopped my taxi immediately and subsequently came out to make a check. I discovered that the rear left side of my taxi was badly damaged. The driver of the said car which hit me also came out to make a check. After which, an LTA Officer came to scene to assist and escorted us to Clementi Loop. At that point of time, I exchanged particulars with the driver of the said car. The driver and the passenger of the said car claimed that they are not injured at that point of time.

I then went to the Clinic as I felt pain on my backbone and neck area. I received a total of 03 days MC. There is an in-car camera installed in my taxi and it captured the whole incident. I am making this report for insurance purposes.



**SINGAPORE
POLICE FORCE**



T/20180821/2064

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

3 of 3

Report No. T/20180821/2064

CONTINUATION OF REPORT

Sketch Plan


Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: J / Sgt 2 NG KOK-WEI JOHN— <i>Ng Kok-Wei</i>	Signature Of Informant: <i>[Signature]</i>
Signature Of Interpreter: Not applicable	Date/Time: 21/08/2018 13:00
Officer In Charge Of Case: TP / AEIT / Staff Sgt WONG SIEU LUI Contact No.: 65476151	Classification Of Case:
Authentication Stamp NP168	SN 130

Section A - Accident Details

Registration Number	SHB5251D
Case Reference Number	TAX/08/18/2078
Registration Date	18/12/15
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	MUHAMMAD NUR DZHORIF BIN ISMAIL
Type of Accident	HEAD TO REAR
Accident Date and Time	21/08/18 9:50 AM
Accident Reported Date and Time	21/08/18 1:30 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	000024097625
Special Instruction to ARC, if any	TOWED \$40 / SLU1141S - MSIG (LKK) BEFORE PAINT PHOTO AND AFTER PAINT PHOTO ,FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR Muid Nazri (LKK) & Email nazri@lkk.com.my HP: 08904220 TEL: 62662554
Prepared Date and Time	21/08/2018 1:49 PM
Chassis Number	JTDKN36U405787035
Mileage	
Work Shop	
Repair Completion Date and Time	

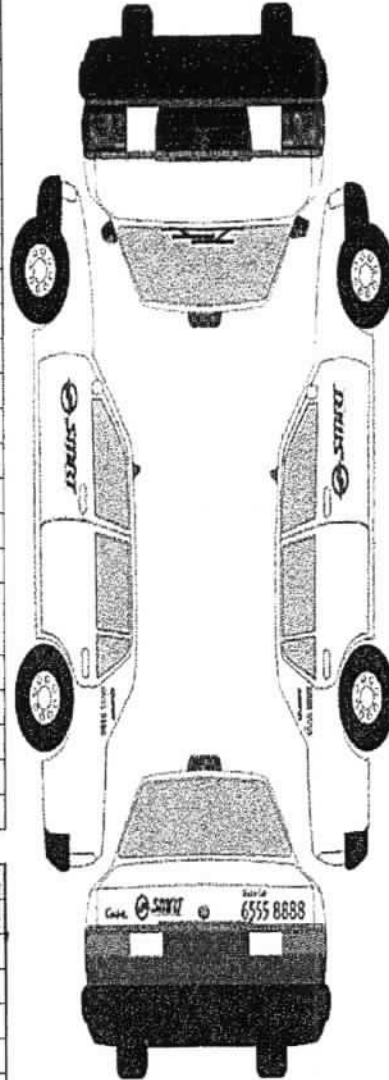
Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,690.00	\$1,200.00
Total Spray Cost	\$3,312.00	\$1,250.00
Total Spare Part Cost	\$7,240.98	\$3,547.97
Total Other Cost	\$1,931.00	\$515.00
TOTAL COST	\$14,173.98	\$6,512.97
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	10.0	8.0
Prepared / Adjusted By	Taxi Estimator Team	NAZ (LKK)
ARC / Surveyor Sign Off Date	23/08/2018 10:48 AM	24/08/2018 1:23 PM
Signature	<i>P</i>	<i>LKK</i>
Remarks	21,778.50	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1810-0178	Invoice Number	
Quotation Date	09.10.2018	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works		
Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR LH REAR PORTION	\$1,690.00	\$1,200.00
Total Labour	\$1,690.00	\$1,200.00

Part 2 - Spray Painting & Panel Beating Related Works		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY REAR PANEL	\$180.00	\$100.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$0.00
TO RESPRAY REAR CHASSIS LH	\$180.00	\$0.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	\$180.00	\$0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
TO RESPRAY REAR FENDER LH	\$378.00	\$200.00
TO RESPRAY REAR LH WHEEL HOUSE	\$180.00	\$0.00
TO RESRAY REAR DOOR LH	\$378.00	\$200.00
TO RESPRAY ROCKER PANEL MOULDING	\$180.00	\$100.00
TO RESPRAY FUEL LID COVER	\$180.00	\$50.00
TO RESPRAY SPOILER	\$180.00	\$100.00
Total Spray Painting & Panel Beating	\$3,312.00	\$1,250.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	\$40.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$200.00	\$100.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$20.00
TO ALIGN CHASSIS	\$350.00	\$0.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$20.00
TO REMOVE AND REFIX REAR WINDSCREEN	\$120.00	\$50.00
TO REMOVE / REFIT SEAT	\$120.00	\$0.00
TO REMOVE & REFIT REAR QUARTER GLASS LH	\$120.00	\$50.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$125.00	\$125.00
TO TRANSFER DOOR MECHANISM	\$120.00	\$50.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	\$120.00	\$20.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	\$120.00	\$20.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$1,931.00	\$515.00

Part 4 - Spare Parts / Material Usage									
Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
6505548		52159-47905	BUMPER REAR	1.00	\$458.60	30.00	\$321.02	Replace	Replace
6505547		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	30.00	\$143.99	Replace	Replace
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	0.00	\$139.60	30.00	\$0.00	Replace	Check
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	0.00	\$139.60	30.00	\$0.00	Replace	Check
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace

ORA
BT
SVC
SVC
not working

	77377-75010	RETAINER, FUEL LID CABLE	0.00	\$5.90	30.00	\$0.00	Replace	Not Given	X
	77201-47250	PIPE SUB-ASSY, FUEL NECK	0.00	\$230.80	30.00	\$0.00	Replace	Not Given	X
	61608-47061	PANEL SUB-ASSY, QTR WHEEL HOUSE	0.00	\$588.40	30.00	\$0.00	Replace	Check	X
	61606-47010	PANEL, QUARTER WHEEL HOUSE, OUTER LH	0.00	\$326.70	30.00	\$0.00	Replace	Check	X
6505487	67004-47080	DOOR RR/LH	1.00	\$954.50	100.00	\$0.00	Replace	Repair	R
	75852-47900	MOULDING BODY, LH	1.00	\$673.60	100.00	\$0.00	Replace	Repair	R
6505461	81581-47170	TAIL LAMP LH	1.00	\$548.40	30.00	\$383.88	Replace	Replace	/
	52563-47010	TAIL LAMP BRACKET, LH	1.00	\$30.70	30.00	\$21.49	Replace	Replace	/
6505550	52576-47020	BUMPER SIDE RETAINER RRA H	1.00	\$94.80	30.00	\$66.36	Replace	Replace	/
6505549	52575-47020	BUMPER SIDE RETAINER RRRH	1.00	\$94.80	30.00	\$66.36	Replace	Replace	/
Total				\$14,760.50		\$3,647.97			

nn
nn
nn
svl

cra / 3548.6
nec /
cra /
cra /

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

3547.97
+ 1200.00
+ 1765.00 (1,715)

6512.97

50.00 (Transfer door mechanism)

6462.97



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Service Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number: 63685562
Estimator Telephone Number: 85662623
Accident Reporting Number: 06002072

Date Generated : 09/10/2018

User ID : PehSuan

6505617		76088-47020	BUMPER LIP COVER RR/LH	1.00	\$72.20	30.00	\$50.54	Replace	Replace	/	CVA
6505618		76087-47020	BUMPER LIP COVER RR/RH	0.00	\$118.10	30.00	\$0.00	Replace	Not Given	X	SVC
6505619		76891-47020	BUMPER LIP REAR	1.00	\$228.90	30.00	\$160.23	Replace	Replace	/	OVA
		58308-47011	UNDER COVER SUB-ASSY, RR FLOOR	0.00	\$514.50	30.00	\$0.00	Replace	Check	X	SVC
			PIXEL STICKER	2.00	\$60.00 (20)	0.00	\$120.00	Replace	Replace	/	WEC
6505522		58307-47060	END PANEL	1.00	\$602.10	30.00	\$421.47	Replace	Replace	/	DD
6505523		58311-47071	SPARE TYRE PANEL	0.00	\$667.70	30.00	\$0.00	Replace	Check	X	SVC
4005314	COMMON		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X	NN
		57604-47030	MEMBER SUB-ASSY, RR LH	0.00	\$174.10	30.00	\$0.00	Replace	Check	X	SVC
		58303-47301	FLOOR PANEL RR/LH	0.00	\$102.00	30.00	\$0.00	Replace	Check	X	SVC
		89997-30070	ANTENNA, ELECTRICAL	0.00	\$157.40	30.00	\$0.00	Replace	Check	X	SVC
		67005-47241	LOWER REAR TAILGATE ASSY	1.00	\$1,007.90	100.00	\$0.00	Replace	Repair	R	R
		68810-47010	TAILGATE DOOR HINGE LH/RH	0.00	\$58.30	30.00	\$0.00	Replace	Not Given	X	SVC
		76801-47070-B0	TAILGATE OUTSIDE GARNISH	0.00	\$504.90	30.00	\$0.00	Replace	Not Given	X	SVC
	COMMON		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	/	WEC 4506-7
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	/	WEC
6505639		75310-47020	EMBLEM REAR	1.00	\$60.30	30.00	\$42.21	Replace	Replace	/	WEC
		75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	30.00	\$36.33	Replace	Replace	/	WEC
		75442-47030	NAME PLATE (PRIUS)	1.00	\$60.80	30.00	\$42.56	Replace	Replace	/	WEC
		75443-47030	NAME PLATE (TOYOTA)	1.00	\$51.90	30.00	\$36.33	Replace	Replace	/	WEC
			NUMBER PLATE	0.00	\$15.00	0.00	\$0.00	Replace	Not Given	X	NN
			NUMBER PLATE FRAME	0.00	\$12.00	0.00	\$0.00	Replace	Not Given	X	NN
6505463		81271-53011	LICENSE PLATE LAMP	0.00	\$35.70	30.00	\$0.00	Replace	Not Given	X	NN
6505620		76085-47910	SPOILER REAR	0.00	\$953.70	30.00	\$0.00	Replace	Not Given	X	SVC
6505464		81006-47011	3RD BRAKE LAMP	0.00	\$231.30	30.00	\$0.00	Replace	Check	X	SVC
		75574-47020	TAIL GATE DOOR GLASS MOULDING LH	0.00	\$29.40	30.00	\$0.00	Replace	Check	X	NN
		75573-47080	TAIL GATE DOOR GLASS MOULDING RH	0.00	\$29.40	30.00	\$0.00	Replace	Check	X	NN
	COMMON		SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Check	X	NN
		75575-47030	MOULDING BACK WINDOW, LOWER NO.1	0.00	\$29.40	30.00	\$0.00	Replace	Check	X	NN
	COMMON		SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Check	X	NN
		58418-4707080	BOX, DECK FLOOR, COVER LH	0.00	\$230.10	30.00	\$0.00	Replace	Check	X	SVC
		64997-47020	BOX, DECK FLOOR, LH	0.00	\$196.80	30.00	\$0.00	Replace	Check	X	SVC
		64993-47020	BOX, DECK FLOOR, RR	0.00	\$649.70	30.00	\$0.00	Replace	Check	X	SVC
		58416-4703083	BOX, RR FLOOR, BOARD	0.00	\$679.60	30.00	\$0.00	Replace	Check	X	SVC
		67881-47022	TAILGATE DOOR WEATHER STRIP	1.00	\$353.40	30.00	\$247.38	Replace	Replace	/	B+
		64718-47031B0	END PANEL COVER, DECK TRIM HOLE	1.00	\$46.10	30.00	\$32.27	Replace	Replace	/	S D/S
		64716-47031B0	END PANEL COVER, DECK TRIM RR	0.00	\$121.10	30.00	\$0.00	Replace	Check	X	SVC
		64740-47031B2	PANEL ASSY, DECK LH	1.00	\$307.00	30.00	\$214.90	Replace	Replace	/	S D
6505476		61602-47091	FENDER RR/LH	1.00	\$766.80	30.00	\$536.76	Replace	Replace	/	DD
	COMMON		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	/	WEC
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	/	WEC 4631-70
		62720-47031	QUARTER GLASS RR/LH	1.00	\$168.10	30.00	\$117.67	Replace	Replace	/	WEC
	COMMON		SEALANT W/SCREEN	1.00	\$37.00	0.00	\$37.00	Replace	Replace	/	WEC
6505477		65638-47021	FENDER LINER RR/LH	1.00	\$141.30	30.00	\$98.91	Replace	Replace	/	TORN
		52592-47021	BUMPER SEAL, RR LH	1.00	\$88.90	30.00	\$62.23	Replace	Replace	/	WEC
		65632-47041	SILL MEMBER PLATE RR/LH	0.00	\$57.50	30.00	\$0.00	Replace	Check	X	SVC
		62940-16060	DUCT ASSY, QUARTER	1.00	\$70.40	30.00	\$49.28	Replace	Replace	/	CRA
		77350-47030	LID ASSY, FUEL	0.00	\$102.00	30.00	\$0.00	Replace	Not Given	X	SVC
		77035-47090	CABLE SUB-ASSY, FUEL LID	0.00	\$63.90	30.00	\$0.00	Replace	Not Given	X	SVC

10132-44

REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/08/18/2078	Date of Collection	/ /
Vehicle No	SHB 5251 D	Date of Request	28 /08/2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	2

S/N	Part Number	Part Description	Quantity	Unit Price
		END PANEL COVER, DECK TRM	1 pc	✓ DIS
		PANEL ASSY, DECK LH	1 pc	✓ DD

<<<Please submit photographs for damaged parts>>>

I, (Name) _____ 28/11/18
(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC/ Reservation / Number
Photo Submitted	YES / NO	Date of submission

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5251D
Ref. No : TAX/08/18/2078
Reg. Date : 18/12/2015
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : MUHAMMAD NUR DZHORIF
BIN ISMAIL
Type of Accident : HEAD TO REAR
Date / Time of Accident : 21/08/2018 09:50:00 AM
Accident Reported Date / Time : 21/08/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 21/08/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024097625
Special Instruction to ARC,if any :
TOWED \$40 / SLU1141S
Prepared Date : 21/08/2018 01:49:51 PM



Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U405767035

Mileage

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,690.00	0.00
Total Spray Painting Charges	: 3,312.00	0.00
Total Material Charges	: 11,499.97	11,499.97
Other Charges	: 1,931.00	0.00
TOTAL	: 18,432.97	0.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 10.00 ⁸	0.00
Prepared / Adjusted By	:	
Arc / Surveyor Sign Off Date	: 23/08/2018 10:48:37 AM	01/01/1900 12:00:00 AM

P

Prepared / Adjusted Date :

Remarks :

Prepared Date : 23/08/2018 10:47:11 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount :

Prepared Date :

NA2 LKK

23/8/18 1130

P/P

8 DAY

BEFORE PAINT

31/8/18

LKK Auto Consultants hence notify the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey
• Parts prices are subject to confirmation
• Third party survey is on a "Without Prejudice" basis
• No illegal modification(s) is allowed
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company
Acknowledged by Repairer
Signature:
Date:

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH REAR PORTION	1,690.00	0.00
Total Labour	1,690.00 1,200	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00 200	0.00
TO RESPRAY REAR PANEL	180.00 100	0.00
TO RESPRAY REAR SPARE TYRE PANEL	180.00 ? X NN	0.00
TO RESPRAY REAR CHASSIS LH	180.00 ? X NN	0.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00 ? X NN	0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00 100	0.00
TO RESPRAY TAIL GATE	378.00 200	0.00
TO RESPRAY BUMPER BEAM	180.00 ? X NN	0.00
TO RESPRAY REAR FENDER LH	378.00 200	0.00
TO RESPRAY REAR LH WHEEL HOUSE	180.00 X NN	0.00
TO RESRAY REAR DOOR LH	378.00 200	0.00
TO RESPRAY ROCKER PANEL MOULDING	180.00 100	0.00
TO RESPRAY FUEL LID COVER	180.00 50	0.00
TO RESPRAY SPOILER	180.00 100	0.00
Total Spray Painting & Panel Beating	3,312.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

TOWING CHARGE

TO CHECK WIRING AND SYSTEM FUNCTION

TO APPLY RUST-PROOFING ON AFFECTED AREA

TO TEST AND REFIX REVERSE SENSOR SYSTEM

TO ALIGN CHASSIS

TO TRANSFER REAR TAILGATE MECHANISM

TO REMOVE AND REFIX REAR WINDSCREEN

TO REMOVE / REFIT SEAT

TO REMOVE & REFIT REAR QUARTER GLASS LH

TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)

TO TRANSFER DOOR MECHANISM

TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.

TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE

TO REPLACE SUNDRY PARTS

TO WASH AND VACUUM

Total Other Costs

Quotation from AKC

Adjusted by Surveyor, if applicable

56.00	40	0.00
80.00	20	0.00
200.00	100	0.00
120.00	20	0.00
350.00	?	0.00 X
120.00	20	0.00
120.00	50	0.00
120.00	X 10	0.00
120.00	50	0.00
125.00	/ all	0.00
120.00	50 X 10	0.00
120.00	20	0.00
120.00	20	0.00
100.00	X 10	0.00
60.00	X 10	0.00
1,931.00		0.00

△

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No <i>/CRA</i>
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No <i>/BT</i>
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No <i>?XSV</i>
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No <i>?XSV</i>
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No <i>/CRA</i>
76088-47020		6505617	BUMPER LIP COVER RR/LH	1	72.20	25.00	54.15	Replace	Replace	No <i>/CRA</i>
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No <i>XSV</i>
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No <i>/CRA</i>
58308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.87	Replace	Replace	No <i>?XSV</i>
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No <i>/CRA</i>
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No <i>/CRA</i>
58311-47071		6505523	SPARE TYRE PANEL	1	667.70	25.00	500.77	Replace	Replace	No <i>?XSV</i>
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No <i>?XSV</i>
57604-47030			MEMBER SUB-ASSY, RR LH	1	174.10	25.00	130.57	Replace	Replace	No <i>?XSV</i>
58303-47301			FLOOR PANEL RR/LH	1	102.00	25.00	76.50	Replace	Replace	No <i>?XSV</i>
89997-30070			ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Replace	No <i>?XSV</i>
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace	No <i>X2</i>
68810-47010			TAILGATE DOOR HINGE LH/RH	2	58.30	25.00	87.45	Replace	Replace	No <i>XSV</i>
76801-47070-B0			TAILGATE OUTSIDE GARNISH	1	504.90	25.00	378.67	Replace	Replace	No <i>XSV</i>
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No <i>/CRA</i>
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No <i>/CRA</i>
75310-17020		6505639	EMBLEM REAR	1	60.30	25.00	45.22	Replace	Replace	No <i>/CRA</i>
75374-17051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No <i>/CRA</i>
75442-17030			NAME PLATE (PRIUS)	1	60.80	25.00	45.60	Replace	Replace	No <i>/CRA</i>
75443-17030			NAME PLATE (TOYOTA)	1	51.90	25.00	38.92	Replace	Replace	No <i>/CRA</i>
			NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace	No <i>XSV</i>
			NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace	No <i>XSV</i>
1271-3011		6505463	LICENSE PLATE LAMP	2	35.70	10.00	64.26	Replace	Replace	No <i>XSV</i>
6085-7910		6505620	SPOILER REAR	1	953.70	25.00	715.27	Replace	Replace	No <i>XSV</i>

Number			Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
81006-47011	6505464	3RD BRAKE LAMP	1	231.30	10.00	208.17	Replace	Replace	No <i>?XSV</i>
75574-47020		TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace	No <i>?XSV</i>
75573-47080		TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace	No <i>?XSV</i>
	COMMON	SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace	No <i>?XSV</i>
75575-47030		MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace	No <i>?XSV</i>
	COMMON	SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No <i>?XSV</i>
58418-47070B0		BOX, DECK FLOOR, COVER LH	1	230.10	25.00	172.57	Replace	Replace	No <i>?XSV</i>
64997-47020		BOX, DECK FLOOR, LH	1	196.80	25.00	147.60	Replace	Replace	No <i>?XSV</i>
64993-47020		BOX, DECK FLOOR, RR	1	649.70	25.00	487.27	Replace	Replace	No <i>?XSV</i>
58416-47030B3		BOX, RR FLOOR, BOARD	1	679.60	25.00	509.70	Replace	Replace	No <i>?XSV</i>
67881-47022		TAILGATE DOOR WEATHER STRIP	1	353.40	25.00	265.05	Replace	Replace	No <i>BR</i>
64718-47031B0		END PANEL COVER, DECK TRIM HOLE	1	46.10	25.00	34.57	Replace	Replace	No <i>?XSV</i>
64716-47031B0		END PANEL COVER, DECK TRIM, RR	1	121.10	25.00	90.82	Replace	Replace	No <i>?XSV</i>
64740-47031B2		PANEL ASSY, DECK LH	1	307.00	25.00	230.25	Replace	Replace	No <i>?XSV</i>
61602-47091	6505476	FENDER RR/LH	1	766.80	25.00	575.10	Replace	Replace	No <i>DD</i>
	COMMON	SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No <i>rec</i>
		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No <i>rec</i>
32720-47031		QUARTER GLASS RR/LH	1	168.10	25.00	126.07	Replace	Replace	No <i>rec</i>
	COMMON	SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No <i>rec</i>
35638-47021	6505477	FENDER LINER RR/LH	1	141.30	25.00	105.97	Replace	Replace	No <i>rec</i>
32592-47021		BUMPER SEAL, RR LH	1	88.90	25.00	66.67	Replace	Replace	No <i>rec</i>
35632-47041		SILL MEMBER PLATE RR/LH	1	57.50	25.00	43.12	Replace	Replace	No <i>?XSV</i>
32940-6060		DUCT ASSY, QUARTER	1	70.40	25.00	52.80	Replace	Replace	No <i>rec</i>
7350-47030		LID ASSY, FUEL	1	102.00	25.00	76.50	Replace	Replace	No <i>XSV</i>
7035-7090		CABLE SUB-ASSY, FUEL LID	1	63.90	25.00	47.92	Replace	Replace	No <i>XSV</i>
7377-5010		RETAINER, FUEL LID CABLE	1	5.90	25.00	4.42	Replace	Replace	No <i>XSV</i>
7201-7250		PIPE SUB-ASSY, FUEL NECK	1	230.80	25.00	173.10	Replace	Replace	No <i>XSV</i>
1608-7061		PANEL SUB-ASSY, QTR WHEEL HOUSE	1	588.40	25.00	441.30	Replace	Replace	No <i>?XSV</i>

Number		Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
61606-47010		PANEL, QUARTER WHEEL HOUSE, OUTER LH	1	326.70	25.00	245.02	Replace	Replace	No <i>? XR</i>
67004-47080	6505487	DOOR RR/LH	1	954.50	25.00	715.87	Replace	Replace	No <i>XR</i>
75852-47900		MOULDING BODY, LH	1	673.60	25.00	505.20	Replace	Replace	No <i>XR</i>
81561-47170	6505461	TAIL LAMP LH	1	548.40	10.00	493.56	Replace	Replace	No <i>/CR</i>
52563-47010		TAIL LAMP BRACKET, LH	1	30.70	25.00	23.02	Replace	Replace	No <i>/mu</i>
52576-47020	6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No <i>/CR</i>
52575-47020	6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No <i>/CR</i>
TOTAL MATERIALS							11,500.10	11,499.97	
TOTAL MATERIALS(Discounted)							11,499.97	11,499.97	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

...CLAIM SUBFOLDER...(Pending for Survey Report)
















CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	30 Aug 2018		30 Aug 2018 10:52 Edit Adj Rpt	S\$6,462.97 Edit Estimates	S\$6,462.97 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: GRAB RENTALS PTE LTD , Co. Reg. No.: 201617200G									
Main Claimant: SMRT TAXIS PTE LTD , Co. Reg. No.: 198905369K									
Vehicle Reg. No.: SHB5251D		Date of Loss: 21/08/2018 09:00 - :59 [32 Months and 3 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / 568115		Policy/Cover Note No.: A29069766MKF (Comprehensive) Coverage: 01/02/2018 - 31/01/2019							
Vehicle Reg. No. (Insured): SLU1141S		Policy No. (Claimant):							
		Excess: S\$2,000.00							
Repairer: SMRT Automotive Services Pte Ltd (Woodlands) 60 Woodlands Industrial Park E4, 757705 Woodlands - Tel: 68662628									
Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Eliza Ho Teng Boon - 6594 2554]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Muhammad Nazril Bin Abdullah] ... [Imm.Advice due 31/08/2018]									
Driver/Custodian (Insured): ZAKIAN HANIM BINTE ABDUL KHALID (31 / Male), NRIC: S8726448C, Tel: +6596642585									
Adj Asg. Remarks: DIRECT SURVEY DONE BY LKK AUTO ON 29/08/2018									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SHB5251D (568115)
[SLU1141S]
TP
SMRT TAXIS PTE LTD
Aug 21 2018 9:00AM
[GRAB RENTALS PTE LTD]
SMRT Automotive Services Pte Ltd

Upload Documents Upload Photos Compose New Letter			View View in Browser	
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	30/08/18 09:51	Accident Statement From: SC - Reg. No: SLU1141S, Claimant: GRAB RENTALS PTE LTD	Load HTM	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
2	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
3	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
4	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
5	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
6	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
7	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
8	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
9	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
10	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
11	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
12	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
13	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
14	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
15	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
16	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
17	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
18	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
19	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
20	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
21	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
22	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
23	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
24	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
25	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
26	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
27	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
28	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
29	10/10/18 10:40	General View	Load JPG	<input checked="" type="checkbox"/>
30	10/10/18 10:40	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
31	10/10/18 10:40	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
32	10/10/18 10:40	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
33	10/10/18 10:40	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
34	10/10/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
35	10/10/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
36	10/10/18 10:40	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
37	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
38	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
39	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
40	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
41	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
42	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
43	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
44	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
45	10/10/18 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	30/08/18 09:51	TPD SH85251D GIA REPORT From: SC - Reg. No: SLU1141S, Claimant: GRAB RENTALS PTE LTD	 Load PDF	
2	30/08/18 09:53	TPD SH85251D - ESTIMATE REPAIR	 Load PDF	
3	30/08/18 09:53	DIRECT SURVEY DONE BY LKK AUTO CONSULTANTS ON 29/08/2018	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 100px; width: 100%;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/MSG18015720/NTBE2

Date: 22/10/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: A29069766MKF

Claimant Vehicle No : SHB5251D

Insured Vehicle No : SLU1141S

Date of Loss: 21/08/2018

Nature of Claim: TP

Claim No: 568115

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SHB5251D

Make & Model: TOYOTA PRIUS, 1.8 (A)

Engine No: 2ZR6565647

Reg. Date: 18/12/2015 (Man. Year: 2015)

Chassis No: JTDKN36U405767035

Colour: Maroon

Odometer: 330052 km

Engine Capacity: 1798 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Falken 5 mm	Rear Left Side:	Falken 6 mm
Front Right Side:	Falken 5 mm	Rear Right Side:	Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,810.50	3,547.97	11,262.53	76.04
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,933.00	2,915.00	4,018.00	57.95
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	21,743.50	6,462.97	15,280.53	70.28

INSPECTION

Date of Assignment: 30/08/2018

Date Inspected: 24/08/2018 Inspected At:

SMRT Automotive Services Pte Ltd
(Woodlands)
60 Woodlands Industrial Park E4
Singapore 757705

Estimated Period of Repair: 8.0 days

Adjuster: Muhammad Nazril Bin Abdullah

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 22 Oct 2018)
Parts: 144	TOYOTA PRIUS 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHB5251D)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER REAR (DISC 30%)	Cracked	458.60 F	*321.02 F
2	1		*BUMPER REINFORCEMENT REAR (DISC 30%)	Bent	205.70 F	*143.99 F
3	1		*BUMPER LIP COVER RR/LH (DISC 30%)	Cracked	72.20 F	*50.54 F
4	1		*BUMPER LIP REAR (DISC 30%)	Cracked	228.90 F	*160.23 F
5	1		*END PANEL (DISC 30%)	Dented	602.10 F	*421.47 F
6	1		*EMBLEM REAR (DISC 30%)	Necessary	60.30 F	*42.21 F
7	1		*NAME PLATE (HYBRID) (DISC 30%)	Necessary	51.90 F	*36.33 F
8	1		*NAME PLATE (PRIUS) (DISC 30%)	Necessary	60.80 F	*42.56 F
9	1		*NAME PLATE (TOYOTA) (DISC 30%)	Necessary	51.90 F	*36.33 F
10	1		*TAILGATE DOOR WEATHERSTRIP (DISC 30%)	Bent	353.40 F	*247.38 F
11	1		*END PANEL COVER, DECK TRIM HOLE (DISC 30%)	Distorted	46.10 F	*32.27 F
12	1		*PANEL ASSY, DECK LH (DISC 30%)	Damaged	307.00 F	*214.90 F
13	1		*FENDER RR/LH (DISC 30%)	Dented	766.80 F	*536.76 F
14	1		*QUARTER GLASS RR/LH (DISC 30%)	Necessary	168.10 F	*117.67 F
15	1		*FENDER LINER RR/LH (DISC 30%)	Torn	141.30 F	*98.91 F
16	1		*BUMPER SEAL, RR LH (DISC 30%)	Necessary	88.90 F	*62.23 F
17	1		*DUCT ASSY, QUARTER (DISC 30%)	Cracked	70.40 F	*49.28 F
18	1		*TAIL LAMP LH (DISC 30%)	Cracked	548.40 F	*383.88 F
19	1		*TAIL LAMP BRACKET, LH (DISC 30%)	Necessary	30.70 F	*21.49 F
20	1		*BUMPER SIDE RETAINER RR/LH (DISC 30%)	Cracked	94.80 F	*66.36 F
21	1		*BUMPER SIDE RETAINER RR/RH (DISC 30%)	Cracked	94.80 F	*66.36 F
22	1		*SENSOR REVERSE (SN)	Not Working	180.00 F	*180.00 F
23	2		*PIXEL STICKER (SN)	Necessary	120.00 F	*120.00 F
24	1		*SMRT LOGO (SN)	Necessary	7.80 F	*7.80 F
25	1		*STICKER DECAL 6555 8888 (SN)	Necessary	21.60 F	*21.60 F
26	1		*SMRT LOGO (SN)	Necessary	7.80 F	*7.80 F
27	1		*STICKER DECAL 6555 8888 (SN)	Necessary	21.60 F	*21.60 F
28	1		*SEALANT W/SCREEN (SN)	Necessary	37.00 F	*37.00 F
29	1		*ARM SUB-ASSY, RR BUMPER LH	Serviceable	139.60 F	*- F
30	1		*ARM SUB-ASSY, RR BUMPER RH	Serviceable	139.60 F	*- F
31	1		*BUMPER LIP COVER RR/RH	Serviceable	118.10 F	*- F
32	1		*UNDER COVER SUB-ASSY	Serviceable	514.50 F	*- F
33	1		*SPARE TYRE PANEL	Serviceable	667.70 F	*- F
34	1		*MEMBER SUB-ASSY. RR LH	Serviceable	174.10 F	*- F
35	1		*FLOOR PANEL RR/LH	Serviceable	102.00 F	*- F
36	1		*ANTENNA, ELECTRICAL LOWER REAR	Serviceable	157.40 F	*- F
37	1		*TAILGATE DOOR HINGE LH/RH	Serviceable	58.30 F	*- F
38	1		*TAILGATE OUTSIDE GARNISH	Serviceable	504.90 F	*- F
39	1		*SPOILER REAR	Serviceable	953.70 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*3RD BRAKE LAMP	Serviceable	231.30 F	*- F
41	1		*BOX, DECK FLOOR, COVER LH	Serviceable	230.10 F	*- F
42	1		*BOX, DECK FLOOR, LH	Serviceable	196.80 F	*- F
43	1		*BOX, RR FLOOR, BOARD	Serviceable	679.60 F	*- F
44	1		*END PANEL COVER, DECK TRIM RR	Serviceable	121.10 F	*- F
45	1		*SILL MEMBER PLATE RR/LH	Serviceable	57.50 F	*- F
46	1		*LID ASSY, FUEL	Serviceable	102.00 F	*- F
47	1		*PANEL, QUARTER WHEEL HOUSE OUTER LH	Serviceable	326.70 F	*- F
48	1		*BOX, DECK FLOOR, RR	Serviceable	649.70 F	*- F
49	1		*SEALANT SIKAFLEX	Not Necessary	37.00 F	*- F
50	1		*NUMBER PLATE	Not Necessary	15.00 F	*- F
51	1		*NUMBER PLATE FRAME	Not Necessary	12.00 F	*- F
52	1		*LICENSE PLATE LAMP	Not Necessary	35.70 F	*- F
53	1		*TAIL GATE DOOR GLASS MOULDING LH	Not Necessary	29.40 F	*- F
54	1		*TAILGATE DOOR GLASS MOULDING RH	Not Necessary	29.40 F	*- F
55	1		*SEALANT W/SCREEN	Not Necessary	37.00 F	*- F
56	1		*MOULDING BACK WINDOW, LOWER NO.1	Not Necessary	29.40 F	*- F
57	1		*SEALANT W/SCREEN	Not Necessary	37.00 F	*- F
58	1		*CABLE SUB-ASSY, FUEL LID	Not Necessary	63.90 F	*- F
59	1		*RETAINER, FUEL LID CABLE	Not Necessary	5.90 F	*- F
60	1		*PIPE SUB-ASSY, FUEL NECK	Not Necessary	230.80 F	*- F
61	1		*PANEL SUB-ASSY, QTR WHEEL HOUSE	Not Necessary	588.40 F	*- F
62	1		*TAILGATE ASY	Repair	1,007.90 F	*- F
63	1		*DOOR RR/LH	Repair	954.50 F	*- F
64	1		*MOULDING BODY, LH	Repair	673.60 F	*- F
65	1		*PANEL ASSY, DECK LH (NPA)	Dented	0.00 F	*- F
66	1		*END PANEL COVER, DECK TRIM HOLE (NPA)	Distorted	0.00 F	*- F

F=Franchise part.

Total Parts (\$\$) 14,810.50 3,547.97

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING & BODY WORK	New	1,690.00	1,200.00
2	SPRAY PAINT	New	3,312.00	1,250.00
3	TOWING CHARGE	New	56.00	40.00
4	TO CHECK WIRING AND SYSTEM FUNCTION	New	80.00	20.00
5	TO APPLY RUST-PROOFING ON AFFECTED AREA	New	200.00	100.00
6	TO TEST AND REFIX REVERSE SENSOR SYSTEM	New	120.00	20.00
7	TO ALIGN CHASSIS	New	350.00	0.00
8	TO TRANSFER REAR TAILGATE MECHANISM	New	120.00	20.00
9	TO REMOVE AND REFIX REAR WINDSCREEN	New	120.00	50.00
10	TO REMOVE / REFIT SEAT	New	120.00	0.00
11	TO REMOVE & REFIT QUARTER GLASS LH	New	120.00	50.00
12	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM	New	125.00	125.00
13	TO TRANSFER DOOR MECHANISM	New	120.00	0.00
14	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	New	120.00	20.00
15	TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	New	120.00	20.00
16	TO REPLACE SUNDRY PARTS	New	100.00	0.00
17	TO WASH AND VACUUM	New	60.00	0.00
Gross Labour Cost (S\$)			6,933.00	2,915.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >