

ASB INC. BY

REF

CS/MSG18016271/Ued3ez

Special Instruction

Surveyor
Mimen

Marcus

ASSIGNMENT (Office)

Policy Person

Chhia Nyuk Pui

MSIA

Date/Time: 6/9/18 @ 9:21am

Estimated Cost

Bill to

OD / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No.

SKS 2794Z

Insured:

SFZ 6825P

at Workshop m/c

Kan Fook Sing

Tel:

6747 9560

of

No. 61 Defu Lane 12

Policy No.

D27389422 TMP

Claim No.

569365

Sum Insured

Excess

Make of Veh:

(Client's Record)

D.O.A. 02/09/2018

CA / REV / REP. / REV 24 HRS

up

H.O.D. Endorsement

Date/Time:

10:20am @ 6/9/18

Person Contacted

Alice

Vehicle IN OUT

Date/Time	Action/Instruction (✓) Estimate
	SKS 2794Z - NA / MSG18016031 / F3 DOA: 2/9/18
	SFZ 6825P - NA / MSG18016031 / F3 DOA: 2/9/18
10/9/18	Revert thru Mimen; Adjust in Mimen

(08/11/13) wef

ASS. REC. BY: MORRIS

REF:

M514/

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SKS 27942

at Workshop m/s 148

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 4 days Res.: Yes or No

Lum Sum: 1.31 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SKS27942 Yr Regn: 4115

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CAI

Make: Toyota harrier c.c. 1986

Colour: purple A/C: Insured / Std / NI / NA

Sp. Reading: 3252 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: 25u 60 00.27246

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Order / Jammed / Leaked / Burnt or

Brake: Order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 225/55 R17
R: _____

BS DUN EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front		Rear	
R/Bal. <u>7</u>	mm	R/Bal. <u>7</u>	mm
L/Bal. <u>7</u>	mm	L/Bal. <u>7</u>	mm
D.O.A. <u>2/9/18</u>		D.O.I. <u>6/9/18</u>	

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Fr.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>LTA' 60016</u>
<u>B/12</u>	<u>Confirmed final fig of \$110.00 with repairer. (Red. 200.58, 36%)</u>
	<u>RECEIVED 13 DEC 2018</u>

Date/Time, File Pass to?

: Prel. Report
 : Final Report

1) _____
Date/Time, File Return to?

2) _____

Days Of Repair: 4

Resurvey No. of Trip: 1

Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech. Invs (\$ _____)
 : Weekend (\$ _____)

Survey Fee: _____
Transportation: _____
S + RS: _____
Photos _____
Others _____

<u>150</u>
<u>10</u>

Report Format : TP
Lump Sum / I.B.I. : (\$ 110.00)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MSIG INSURANCE (SINGAPORE) PTE LTD		Ref : CS/MSG18016271/Urd3	
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 06-09-2018	
		Code : MSG	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SFZ 6825P	Veh. Inspected	SKS 2794Z
Policy No.	D27389422TMP	Coverage (\$)	0.00
Claim No.	569365	Excess (\$)	0.00
Assign From	MERIMEN (CHHIA NYUK PUI)	Assign Date	06/09/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	02/09/2018	Inspection Date	06/09/2018
Survey held at	KAN FOOK SING MOTOR WORKSHOP 61 DEFU LANE 12 SINGAPORE 539147		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	03 Sep 2018 Sendback Est	05 Sep 2018 16:41 S\$7,916.35	06 Sep 2018 09:21 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

Insured:	MICHAEL MATTHEW LEE @LEE THIAM CHYE, ID: S0024959I		
Main Claimant:	Lim Cheng Chuan, ID: S1466561G		
Vehicle Reg. No.:	SKS2794Z	Date of Loss:	02/09/2018 10:00 - :59 [29 Months From LTA Reg Date (Man Yr)]
Claim Type:	TP / 569365	Policy/Cover Note No.:	D27389422TMP (Third Party Only) Coverage: 31/10/2017 - 30/10/2018
Vehicle Reg. No. (Insured):	SFZ6825P	Policy No. (Claimant):	5098708943
		Excess:	
Repairer:	Kan Fook Sing Motor Workshop (Defu) No. 61 Defu Lane 12, 539147 Defu Lane - Tel: 67479560		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Chhia Nyuk Pul - 6594 2521]		
Claimant's Insurer:	NTUC Income Insurance Co-operative Ltd (HQ) - Tel:		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 07/09/2018]		
Driver/Custodian (Insured):	MICHAEL MATTHEW LEE @LEE THIAM CHYE (68 / Male), NRIC: S0024959I		
Adj Asg. Remarks:	Car in, on WP. Please contact us ASAP if you cannot attend this assignment. LIABILITY: 100% CONTACT:67479560		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)[Compose Case Mail](#)

ALL ASSOCIATED TASKS

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chhia Nyuk Pul

Date: 10 Sep 2018

Preliminary Advice

Insured Vehicle No	: SFZ6825P	Accident Date	: 02/09/2018
TP Vehicle No	: SKS2794Z	Assignment Date	: 06/09/2018
Make	: TOYOTA HARRIER	Est. Duration of Repair	: 4.00
Date of Inspection	: 06/09/2018		
Inspection At	: KAN FOOK SING MOTOR WORKSHOP (DEFU) NO. 61 DEFU LANE 12 SINGAPORE 539147		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	7,916.35
Revised Amount	:S\$	4,876.58
Check Items (Estimated)	:S\$	1,657.70
Total	:S\$	6,534.28
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$
Pre-Accident Value	:S\$
COE / PARF Rebate	:S\$
Salvage Value	:S\$
Margin for Repair	:S\$

Remarks

() The vehicle is economical/not economical for repair.

(X) The above survey was conducted on a 'without prejudice' basis.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6561G
Vehicle Details	
Vehicle No.:	SKS2794Z
Vehicle to be Exported:	No
Intended Deregistration Date:	07 Sep 2018
Vehicle Make:	TOYOTA
Vehicle Model:	HARRIER 2.0 ELEGANCE AT ABS D/AIRBAG 2WD
Primary Colour:	Black
Manufacturing Year:	2014
Engine No.:	3ZRB459245
Chassis No.:	ZSU600027246
Maximum Power Output:	111.0 kW (148 bhp)
Open Market Value:	\$27,067.00
Original Registration Date:	02 Apr 2015
First Registration Date:	02 Apr 2015
Transfer Count:	0
Actual ARF Paid:	\$19,894.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	01 Apr 2025
PARF Rebate Amount:	\$14,920.00
Intended COE Rebate Details	
COE Expiry Date:	01 Apr 2025
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$68,668.00
COE Rebate Amount:	\$45,096.00
Total Rebate Amount:	\$60,016.00

The information contained herein is correct as at 07 Sep 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	03/09/2018 16:36
Date Of Accident	02/09/2018 09:55
Exact Location Of Accident	JUNCTION OF SIGLAP HILL & LA SALLE STREET
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKS2794Z
Insured/Policyholder	
Name Of Registered Owner	LIM CHENG CHUAN
NRIC No	S1466561G
Email Address	JOHN_LIM@OUTLOOK.SG
Mobile Phone No	(LOCAL) +65-98508850
Alternative Phone No	OTHERS-98508850
Vehicle Particulars	
Manufacturer	TOYOTA
Model	HARRIER 2.0 ELEGANCE AT ABS D/AIRBAG 2WD
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5098708943
Cover Note Number	02/04/2018 TO 01/04/2019
Driver	
Name of Driver	LIM CHENG CHUAN
NRIC No	S1466561G
Date Of Birth	22/11/1961
Occupation	INDOOR
Date Of Driving Pass	26/05/1979
Driving Experience	39 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98508850
Fax Number	
Contact Number	OTHERS-98508850
Email Address	JOHN_LIM@OUTLOOK.SG

Address	66 BAYSHORE ROAD #23-02 (S) 469985
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - CROSS JUNCTION
Weather Conditions	AFTER DRIZZLE
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

refer with attach.


Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SFZ6825P
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	CHUA ZI WEI
NRIC/Passport Number	S8329573B
Contact Number	96883905
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

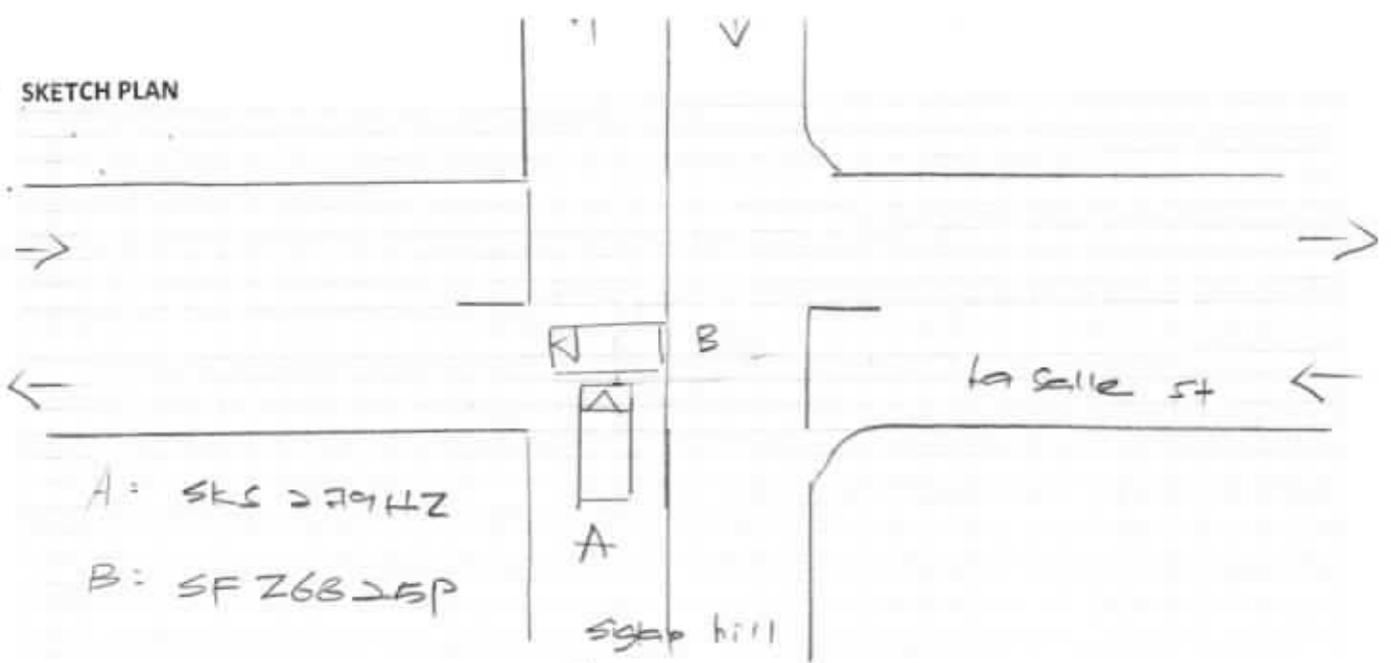

A: SKS 2794Z
 B: SF 26825P

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer with attach.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 3/9/18 4:41pm

Driver's Signature

(If driver is not the policyholder)
 Date & Time: 3/9/18 4:41pm



Reporting Centre Personnel's Signature

Name:
 NRIC/FIN No.:

Attached video download from recorder and brief description for the report :

On 2 Sep 2018 at about 9:55 am, I drove along Siglap Road and turned into Siglap Hill. While travelling along Siglap Hill at the junction of Siglap Hill and La Salle Street, a vehicle SFZ6825P on my right from La Salle Street suddenly drove across the junction without giving way to the flow of traffic along Siglap Hill. I tried braking but SFZ6825P came too close in front of me that I collided on the passenger side of the vehicle.

The driver of SFZ6825P Michael Lee NRIC S8329573B came out of the car and apologised that he did not see me. There was a lady passenger at the front seat of SFZ6825P and Michael Lee confirmed that there was no injury.

The driver of another car who was at the left of the junction came forward after the accident and informed me that he witnessed the accident and said he heard my tire screech sound that I was trying to brake. He left me his name and contact as Mr Chua Zi Wei, NRIC S8329573B, contact number 96883905.

The road condition was little wet as there was a light drizzle earlier but the drizzle had stopped before the accident.
My set of tires was new as I just changed a week ago.



3/9/18

**KAN FOOK SING MOTOR
WORKSHOP
61 DEFU LANE 12
SINGAPORE
539147**

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/1
Date Calculated: 04/09/2018 09:41

Full Report - V1
Registration: SKS2794Z
Printed: 04/09/2018 16:41

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ryan Kan	Date of Incident:	02/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	5098708943	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

*not Approved
LKK
Take photo before
painting
6/9/18
Hony
Marius*

Vehicle Details

Vehicle

Manufacturer: *TOYOTA
Model: *HARRIER
Sub Model:
Model Sheet Number: 2426 01
Registration: SKS2794Z
Registration Month: May
Registration Year: 2015
VIN Number:
Odometer: Not Known
Colour:
Engine Number:
Fuel Level: %

Model Specs

FROM 03/2015
2.7 LTR 138KW
TYRES 235/55 VR 19
FRONT DRIVE
TWO COAT METALLIC
LED HEADLAMP
AUTO GEARBOX 6 SPEED
WHEELS 7.5J X 19 ALU
PRODUCTION IN JAPAN
PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection: Repairer
Pre-Accident Damage:

Severity of Impact:
Vehicle Status on
Inspection:
Date of Inspection: 04/09/2018

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary damage must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer
Signature:
Date: 04/09/2018



Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/1
Date Calculated: 04/09/2018 09:41

Full Report - V1
Registration: SKS2794Z
Printed: 04/09/2018 16:41

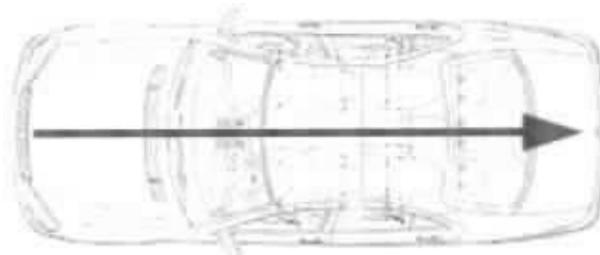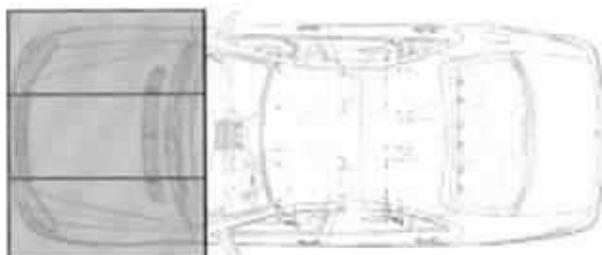

Addresses

Cost Summary

Total Labour	\$1,040.00
Total Paint/Material	\$249.40
Total Parts	\$6,546.95
Total of Additional Costs	\$80.00
Excess:	TBA
Grand Total Exc GST:	\$7,916.35
7 % GST:	\$554.14
Grand Total Inc GST:	\$8,470.49

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
NN	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS	14.0	70.00
NN	R + R RADIATOR BADGE	1.0	5.00
NN	RENEW FRONT BUMPER REINFORCEMENT	1.0	5.00
NN	R + R R/HEADLAMP (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMP	4.0	20.00
NN	R + R HEADLAMPS (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMPS	8.0	40.00
NN	RENEW UPPER RADIATOR PANEL	5.0	25.00
NN	RENEW RIGHT FRONT PANEL	15.0	75.00
NN	RENEW R/FRT WING (FRONT BUMPER, RIGHT HEADLAMP ASSY AND R/SILL MOULDING REMOVED) INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R.	7.0	35.00
NN	RENEW BONNET INCLUDES: R + R OR RENEW ATTACHED PARTS	6.0	30.00
NN	R + R LOCK CARRIER	2.0	10.00
NN	R + R R/DOOR SILL MOULDING	3.0	15.00
NN	DRAIN AIR CONDITIONING	3.0	15.00
NN	REFILL AIR CONDITIONING	7.0	35.00
NN	R + R AIR CONDITIONING CONDENSER	2.0	10.00 x
NN	R + R COOLING ASSEMBLY	5.0	25.00 y
0741	REPAIR L/F WING	5.0*	25.00

LABOUR COST

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/1
Date Calculated: 04/09/2018 09:41

Full Report - V1
Registration: SKS2794Z
Printed: 04/09/2018 16:41

344	1	FRT IMPACT ABSORBER	-0%	Y	65.00*	/
381	1	FRT BUMPER GRILLE	-0%	Y	125.00*	/
391	1	FRT LWR BUMP GRILLE	-0%	Y	100.00*	/
410	1	GRILLE	-0%	C	200.00*	/
471	1	BONNET	0%	A	580.00*	X
493	1	BONNET LOCK	0%	A	55.00*	X
561	1	LEFT HEADLAMP ASSY	-0%	C	980.00*	/
562	1	RIGHT HEADLAMP ASSY	-0%	C	980.00*	/
742	1	R/F WING	0%	A	315.00*	X
790	4	R/F WING CLAMP KIT	-0%	A	15.00*	X
988	1	LOCK CARRIER STRUT	0%	A	65.00*	X
1016	1	UPPER AIR GUIDE	0%	A	140.00*	X
1017	1	LOCK CARRIER BRKT	0%	A	185.00*	X
1020	1	R/F PANEL	0%	R	360.00*	X
4465	1	CONDENSER	0%	A	520.00*	X
1000	1	BONNET CHROME	-0%	C	110.00*	/
1000	1	L/OUT BUMP BRKT	0%	A	25.00*	X
1000	1	R/OUT BUMP BRKT	0%	A	25.00*	X
1000	1	UPP AIR GUIDE CLIP	-0%	A	15.00*	X
1000	1	FRT BUMP TOP BEAM	-0%	A	95.00*	X
1000	1	L/F BUMP BEAM	0%	A	50.00*	X
1000	1	R/F BUMP BEAM	0%	A	50.00*	X

f: OEM Parts
g: Original
h: Secondhand
p: Parallel
x: Exchange

Saving \$18.00
Sub Total \$5,693.00
Mark Up From Cost (15%) 3343 \$853.95
Sundry Parts (Fixed) \$0.00
Total Parts \$6,546.95

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AIR CON COOLANT SPECIALIST	0%	\$50.00 X
FRT NUMBER PLATE SPECIALIST		\$30.00 /
Total Extras		\$80.00

Final Calculation

Total Parts		\$6,546.95
Labour		
Total Panel/Mechanical	\$440.00	
Total Paintwork	\$600.00	
Total Labour		\$1,040.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$80.00	
Total of Additional Costs		\$80.00
Total Paint/Material Costs		\$249.40
Grand Total Excludes GST		\$7,916.35
GST @ 7 %		\$554.14
Grand Total Includes GST		\$8,470.49

8012.60

7-3418
152
3930.70

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/1
Date Calculated: 04/09/2018 09:41

Full Report - V1
Registration: SKS2794Z
Printed: 04/09/2018 16:41

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/2
Date Calculated: 10/09/2018 03:06

Full Report - V1
Registration: SKS2794Z
Printed: 10/09/2018 10:06

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	02/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	5098708943	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	*TOYOTA
Model:	*HARRIER
Sub Model:	
Model Sheet Number:	2426 01
Registration:	SKS2794Z
Registration Month:	May
Registration Year:	2015
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 03/2015	LED HEADLAMP
2.7 LTR 138KW	AUTO GEARBOX 6 SPEED
TYRES 235/55 VR 19	WHEELS 7.5J X 19 ALU
FRONT DRIVE	PRODUCTION IN JAPAN
TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:		Severity of Impact:	
Steering:		Vehicle Status on Inspection:	
Brakes Pedal Travel:		Date of Inspection:	04/09/2018
Place of Inspection:	Repairer		
Pre-Accident Damage:			
Tyres Condition:		Tread Depth RHF:	
Tread Depth LHF:		Tread Depth RHR:	
Tread Depth LHR:		Direction of Impact:	
Damage Areas:			

Claim Reference:

Full Report - V1



Assessment Number: KFS01543

Registration: SKS2794Z

Version: KFSMOTOR/2

Printed: 10/09/2018 10:06

Date Calculated: 10/09/2018 03:06

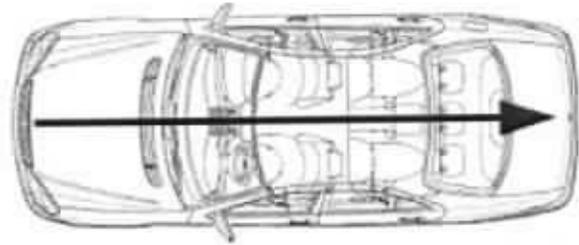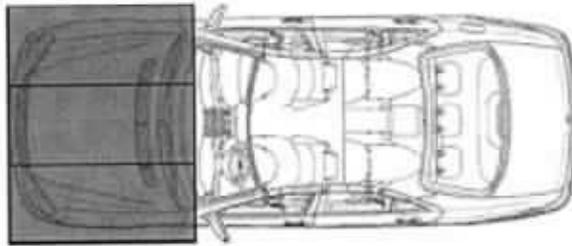

Addresses

Cost Summary

Total Labour	\$815.00
Total Paint/Material	\$150.33
Total Parts	\$5,488.95
Total of Additional Costs	\$80.00
Excess:	TBA
Grand Total Exc GST:	\$6,534.28
7 % GST:	\$457.40
Grand Total Inc GST:	\$6,991.68

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
NN	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS	14.0	70.00
NN	R + R RADIATOR BADGE	1.0	5.00
NN	RENEW FRONT BUMPER REINFORCEMENT	1.0	5.00
NN	R + R R/HEADLAMP (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMP	4.0	20.00
NN	R + R HEADLAMPS (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMPS	8.0	40.00
NN	R + R RIGHT FRONT WING (FRONT BUMPER, RIGHT HEADLAMP ASSY AND R/SILL MOULDING REMOVED) INCLUDES: WHEELHOUSE LINER R + R.	5.0	25.00
NN	RENEW UPPER RADIATOR PANEL	5.0	25.00
NN	RENEW RIGHT FRONT PANEL	15.0	75.00
NN	R + R LOCK CARRIER	2.0	10.00
NN	DRAIN AIR CONDITIONING	3.0	15.00
NN	REFILL AIR CONDITIONING	7.0	35.00
NN	R + R AIR CONDITIONING CONDENSER	2.0	10.00
NN	R + R COOLING ASSEMBLY	5.0	25.00
0741	REPAIR L/F WING	5.0*	25.00
LABOUR COST			
Total Work Units		77.0	
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		7.7HRS	\$385.00

Claim Reference:

Full Report - V1

Assessment Number: KFS01543

Registration: SKS2794Z

Version: KFSMOTOR/2

Printed: 10/09/2018 10:06

Date Calculated: 10/09/2018 03:06

Paint Labour	8.6HRS	\$430.00
Total Labour	16.3HRS	\$815.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$50.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
988	LOCK CARRIER STRUT SURFACE PAINT	4.0	
1017	LOCK CARRIER BRKT SURFACE PAINT	5.0	
1020	R/F PANEL SURFACE PAINT	4.0	
278	R/F BUMPER COVER NEW PART PAINT K1R	3.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
741	L/F WING REPAIR PAINTING <50%	12.0	
277	L/F BUMPER COVER SURFACE PAINT PLAST.	3.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0	
LABOUR COST - PAINT			
TIME(PAINT)		56.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		86.0	
Total Paintwork Labour		8.6HRS	\$430.00
MATERIAL COST - PAINT			Cost Price
New Part Painting - Plastic K1R			\$57.07
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$39.10
Surface Paint Plastic			\$0.73
Repair Painting			\$15.83
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$150.33
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$150.33

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
257	1	FRONT NUMBER PLATE				0%	0.00F
278	1	R/F BUMPER COVER				0%	18.00*
283	1	FRONT BUMPER				0%	350.00*
321	1	L/INN BUMPER BRACKET				0%	50.00*
322	1	R/INN BUMPER BRACKET				0%	50.00*
328	1	R/BUMP IMPACT DAMPER				0%	25.00*
340	1	FRT BUMPER REINF				0%	120.00*
344	1	FRT IMPACT ABSORBER				0%	65.00*
381	1	FRT BUMPER GRILLE				0%	125.00*
391	1	FRT LWR BUMP GRILLE				0%	100.00*
410	1	GRILLE				0%	200.00*
493	1	BONNET LOCK				0%	55.00*
561	1	LEFT HEADLAMP ASSY				0%	980.00*
562	1	RIGHT HEADLAMP ASSY				0%	980.00*
790	4	R/F WING CLAMP KIT				0%	15.00*

Claim Reference:
 Assessment Number: KFS01543
 Version: KFSMOTOR/2
 Date Calculated: 10/09/2018 03:06

Full Report - V1
 Registration: SKS2794Z
 Printed: 10/09/2018 10:06

988	1	LOCK CARRIER STRUT	0%	65.00*
1016	1	UPPER AIR GUIDE	0%	140.00*
1017	1	LOCK CARRIER BRKT	0%	185.00*
1020	1	R/F PANEL	0%	360.00*
4465	1	CONDENSER	0%	520.00*
1000	1	BONNET CHROME	0%	110.00*
1000	1	L/OUT BUMP BRKT	0%	25.00*
1000	1	R/OUT BUMP BRKT	0%	25.00*
1000	1	UPP AIR GUIDE CLIP	0%	15.00*
1000	1	FRT BUMP TOP BEAM	0%	95.00*
1000	1	L/F BUMP BEAM	0%	50.00*
1000	1	R/F BUMP BEAM	0%	50.00*
f:		OEM Parts		Saving \$18.00
g:		Original		Sub Total \$4,773.00
h:		Secondhand		Mark Up From Cost (15 %) \$715.95
p:		Parallel		Sundry Parts (Fixed) \$0.00
x:		Exchange		Total Parts \$5,488.95

THIS ASSESSMENT CONTAINS UNPRICED PARTS
 NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AIR CON COOLANT SPECIALIST	0%	\$50.00
FRT NUMBER PLATE SPECIALIST		\$30.00
Total Extras		\$80.00

Final Calculation

Total Parts		\$5,488.95
Labour		
Total Panel/Mechanical	\$385.00	
Total Paintwork	\$430.00	
Total Labour		\$815.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$80.00	
Total of Additional Costs		\$80.00
Total Paint/Material Costs		\$150.33
Grand Total Excludes GST		\$6,534.28
GST @ 7 %		\$457.40
Grand Total Includes GST		\$6,991.68

Assessment Notes

**KAN FOOK SING MOTOR
WORKSHOP
61 DEFU LANE 12
SINGAPORE
539147**

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/2
Date Calculated: 27/11/2018 03:17

Full Report - V1
Registration: SKS2794Z
Printed: 27/11/2018 11:17

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Patricia Kan	Date of Incident:	02/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	5098708943	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	*TOYOTA
Model:	*HARRIER
Sub Model:	
Model Sheet Number:	2426 01
Registration:	SKS2794Z
Registration Month:	May
Registration Year:	2015
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 03/2015	LED HEADLAMP
2.7 LTR 138KW	AUTO GEARBOX 6 SPEED
TYRES 235/55 VR 19	WHEELS 7.5J X 19 ALU
FRONT DRIVE	PRODUCTION IN JAPAN
TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition



Vehicle Status

Pre-Accident Condition:		Severity of Impact:	
Steering:		Vehicle Status on Inspection:	
Brakes Pedal Travel:		Date of Inspection:	04/09/2018
Place of Inspection:	Repairer		
Pre-Accident Damage:			
Tyres Condition:			
Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	
Damage Areas:		Direction of Impact:	

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/2
Date Calculated: 27/11/2018 03:17

Full Report - V1
Registration: SKS2794Z
Printed: 27/11/2018 11:17

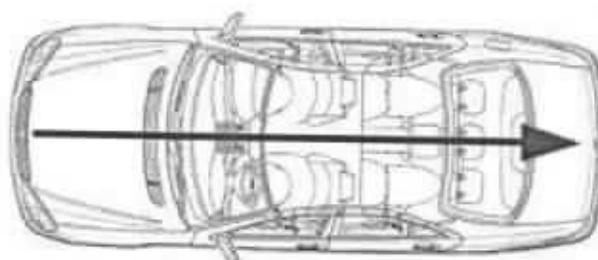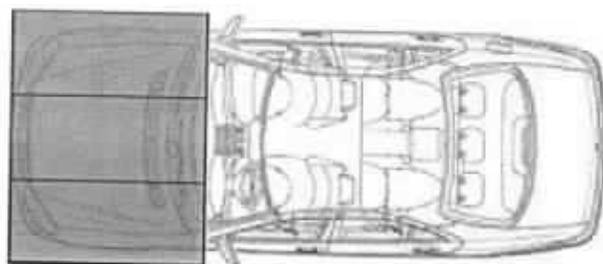

Addresses

Cost Summary

Total Labour	\$1,005.00
Total Paint/Material	\$219.32
Total Parts	\$3,930.70
Total of Additional Costs	\$30.00
Excess:	TBA
Grand Total Exc GST:	\$5,185.02
7 % GST:	\$362.95
Grand Total Inc GST:	\$5,547.97

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
NN	RENEW FRONT BUMPER	14.0	70.00
	INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS		
NN	R + R FRONT BUMPER REINFORCEMENT	2.0	10.00
NN	R + R RADIATOR BADGE	1.0	5.00
NN	R + R HEADLAMPS (BUMPER REMOVED)	8.0	40.00
	INCLUDES: ADJUST HEADLAMPS		
NN	DRAIN AIR CONDITIONING	3.0	15.00
NN	REFILL AIR CONDITIONING	7.0	35.00
0340	REPAIR FRT BUMPER REINF	10.0*	50.00 ✓
0471	REPAIR BONNET	10.0*	50.00 ✓
0741	REPAIR L/F WING	5.0*	25.00 ✗
0742	REPAIR R/F WING	10.0*	50.00
1009	REPAIR INNER FRT PANEL CPL	20.0*	100.00 50
LABOUR COST			
	Total Work Units	90.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	9.0HRS	\$450.00
	Paint Labour	11.1HRS	\$555.00
	Total Labour	20.1HRS	\$1,005.00

PAINT WORK

Guide Number Description

Time Basis 10 WU = 1 HR. Price = \$50.00/HR

- TWO COAT METALLIC
- PREPARE OFF VEHICLE

WU Cost Price (\$)

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/2
Date Calculated: 27/11/2018 03:17

Full Report - V1
Registration: SKS2794Z
Printed: 27/11/2018 11:17

278	R/F BUMPER COVER NEW PART PAINT K1R	3.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
471	BONNET REPAIR PAINTING <50%	23.0	
741	L/F WING REPAIR PAINTING <50%	12.0	
742	R/F WING REPAIR PAINTING <50%	12.0	
277	L/F BUMPER COVER SURFACE PAINT PLAST.	3.0	
1009	INNER FRT PANEL CPL SURFACE PAINT	7.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0	
LABOUR COST - PAINT			
TIME(PAINT)		81.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		111.0	
Total Paintwork Labour		11.1HRS	\$555.00
MATERIAL COST - PAINT			
New Part Painting - Plastic K1R			Cost Price \$57.07
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$46.07
Surface Paint Plastic			\$0.73
Repair Painting			\$77.85
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$219.32
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$219.32

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
257	1	FRONT NUMBER PLATE				0%	0.00F
278	1	R/F BUMPER COVER				0%	23.00*
283	1	FRONT BUMPER				0%	350.00*
321	1	L/INN BUMPER BRACKET				0%	60.00*
322	1	R/INN BUMPER BRACKET				0%	60.00*
344	1	FRT IMPACT ABSORBER				0%	65.00*
350	1	FRT BUMPER CLAMP KIT				0%	15.00*
381	1	FRT BUMPER GRILLE				0%	215.00*
391	1	FRT LWR BUMP GRILLE				0%	130.00*
410	1	GRILLE				0%	200.00*
561	1	LEFT HEADLAMP ASSY				0%	980.00*
562	1	RIGHT HEADLAMP ASSY				0%	980.00*
790	4	R/F WING CLAMP KIT				0%	15.00*
8781	1	FRT ENG COMP PROTECT				0%	60.00*
1000	1	BONNET CHROME				0%	140.00*
1000	1	UPP AIR GUIDE CLIP				0%	15.00*
1000	1	FRT BUMP TOP BEAM				0%	110.00*
f: OEM Parts				Saving			\$18.00
g: Original				Sub Total			\$3,418.00
h: Secondhand				Mark Up From Cost (15 %)			\$512.70
p: Parallel				Sundry Parts (Fixed)			\$0.00
x: Exchange				Total Parts			\$3,930.70

THIS ASSESSMENT CONTAINS UNPRICED PARTS
 NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

KAN FOOK SING MOTOR WORKSHOP

Claim Reference:
Assessment Number: KFS01543
Version: KFSMOTOR/2
Date Calculated: 27/11/2018 03:17

Full Report - V1
Registration: SKS2794Z
Printed: 27/11/2018 11:17

Extras

Description	Betterment	Price
FRT NUMBER PLATE SPECIALIST	0%	\$30.00
	Total Extras	\$30.00

Final Calculation

Total Parts			
Labour			\$3,930.70
Total Panel/Mechanical		\$450.00	
Total Paintwork		\$555.00	
Total Labour			\$1,005.00
Additional Costs			
Corr Prot Materials External		\$0.00	
Corr Prot Materials Internal		\$0.00	
Cost of Specialist		\$30.00	
Total of Additional Costs			\$30.00
Total Paint/Material Costs			\$219.32
Grand Total Excludes GST			\$5,185.02
GST @ 7 %			\$362.95
Grand Total Includes GST			\$5,547.97

Assessment Notes

簡福星嘍哆工廠
 KAY FOOK SING MOTOR WORKSHOP
 61 DEFU LANE 12
 SINGAPORE 539147
 TEL: 67479560, 68582126, 68584361
 FAX: 67481006, 62818428

MSIG INSURANCE (SINGAPORE) PTE LTD
 4 SHENTON WAY #21-01
 SGX CENTRE 2
 SINGAPORE 068807

INVOICE NO : TEST
 DATE : 13-09-2018

VEHICLE NO. : SKS2794Z
 ACCIDENT DATE : 02-09-2018 09:55
 THIRD PARTY REF. : SFZ6825P

ATTN: MOTOR CLAIMS DEPT.

INVOICE COST OF REPAIRS TO VEICLE SKS2794Z TOYOTA HARRIER 2.0 ELEGANCE AT ABS

QTY	PARTS DESCRIPTION	AMOUNT (SG\$)
1	FRONT BONNET CHROME	140.00 ✓
2	FRONT HEADLAMP @\$980.00	1960.00 ✓
10	FRONT FENDER SHIELD CLIP@\$1.50	15.00 ✓
1	FRONT GRILLE	200.00 ✓
10	FRONT GRILLE TOP GARNISH CLIP@\$1.50	15.00 ✓
1	FRONT BUMPER	350.00 ✓
1	FRONT BUMPER TOP BEAM	110.00 ✓
1	FRONT BUMPER FOAM CENTRE	65.00 ✓
2	FRONT BUMPER SIDE RETAINER@\$60.00	120.00 ✓
1	FRONT BUMPER LOWER	215.00 ✓
1	FRONT BUMPER TOW COVER	23.00 ✓
1	FRONT BUMPER CENTRE GRILLE	130.00 ✓
1	FRONT BUMPER LOWER COVER	60.00 ✓
1	FRONT BUMPER CLIP @\$1.50 <i>ADD</i>	15.00 ✓
		<u>3,418.00</u>
	ADD 15 %	512.70
	TOTAL (A)	<u>3,930.70</u>
SPECIAL NETT ITEMS		
1	FRONT NUMBER PLATE	30.00
	TOTAL (C)	<u>30.00</u>
LABOUR CHARGES		
1	TOTAL PANEL/MECHANICAL LABOUR	450.00

1/2

簡福星摩哆工廠
 LIN FOOK SING MOTOR WORKSHOP
 61 DEFU LANE 12
 SINGAPORE 539147
 TEL: 67479560, 68582126, 68584361
 FAX: 67481006, 62818428

VEHICLE NO. : SKS2794Z
 ACCIDENT DATE : 02-09-2018 09:55
 THIRD PARTY REF. : SFZ6825P

QTY	PARTS DESCRIPTION	AMOUNT (SGS)
1	TOTAL PAINTWORK	555.00
1	TOTAL PAINT/MATERIAL	219.32
TOTAL (D)		<u>1,224.32</u>
TOTAL REPAIR COST :		<u>5,185.02</u>
G S T :		<u>362.95</u>
INVOICE AMOUNT :		<u>5,547.97</u>

5110.02

2/2



合興汽車零件私人有限公司 HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

M/S: KAN FOOK SING MOTOR WORKSHOP

61 DEFU LANE 12

SINGAPORE 539147

TAX INVOICE

NO: DLI9207599

PAGE: 1

DATE: 07/09/2018


A/C CODE: LDKF239

TERMS: CR

VEH NO: SKS2794Z

Handwritten initials

Part No	Description	Location	Qty	Unit Price	Amount
1 T75770-48030 ✓	HOOD MLDING	DDS	1	SIN 140.00	SIN 140.00
2 T2614-48040 ✓	FR BUMPER SPONGE	DDS	1	65.00	65.00
3 T52535-48040 ✓	FR RET RH	DUIAD13	1	60.00	60.00
4 T52411-48020	FR BUMPER GUARD	DB3AA	1	215.00	215.00
5 T53285-48020-C0 ✓	FR TOW HOOK CVR RH	DUIB240	1	23.00	23.00
6 T53112-48150 ✓	FR LWR GRILLE	DUIU6	1	130.00	130.00
7 T52161-0K040 ✓	CLIP	DUIAD10	10	1.50	15.00
TOTAL QUANTITY:			16	TOTAL	SIN 648.00
				ADD GST @ 7%	45.36
				GRAND TOTAL	<u>SIN 693.36</u>

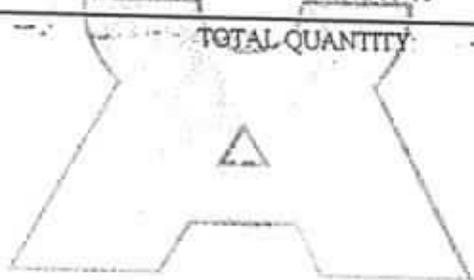

Print / LIM / 07/09/2018 3:07:42 PM

SALESMAN LIM


This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE

Handwritten signature
GOODS RECEIVED BY



E. & O E



Customer Name & Address:

KAN FOOK SING MOTOR WORKSHOP
 61 DEFU LANE 12
 SINGAPORE 539147
 **sks2794z T/harrier

INVOICE No.: A 11318

DATE: 7/9/2018

TERMS: 30 DAYS

S/No.	DESCRIPTION	QUANTITY	UNIT PRICE	AMOUNT
1	BUMPER FRT	1	\$ 350.00	\$ 350.00
2	F BUMPER RETIANER R	1	\$ 60.00	\$ 60.00
3	F BUMPER RETIANER L	1	\$ 60.00	\$ 60.00
4	GRILL	1	\$ 200.00	\$ 200.00
Singapore Dollars			TOTAL	\$ 670.00
			GST 7%	\$ 46.90
			DEPOSIT	\$ -
			BALANCE	\$ 716.90

Goods Sold are not exchangeable and returnable.

All cheques should be crossed "A/C PAYEE" and made payable to LION'S AUTO TRADING PTE LTD.

for LION'S AUTO TRADING PTE LTD

Customer's Signature and Stamp

Authorised Signature



日美汽車私人有限公司


JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450816 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg
GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 0228



Dept Direct: 6328 9010

Dept Direct: 6365 9811

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9797

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KAN FOOK SING MOTOR WORKSHOP
NO. 61 DEEUL LANE 12

SINGAPORE
TEL: 67479560 FAX: 67481006
ATTN: RYAN / PAT / TAN

588 2794

TAX INVOICE : AR201809-04028
DATE : 10/09/2018
CUSTOMER ID : KAN001
VEH REG. NO. :
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SO STOCKID	DESCRIPTION	Stk Loc	QTY	U/PRICE	AMOUNT
T52029-48010	FRT BUMPER UPPER REINF	U1	1	110.00	110.00
ZSU60:AVU65	SUPPLIER				

SUB-TOTAL : 110.00
ADD GST 7.00% : 7.70

E. & O.E TOTAL AMOUNT SGD : 117.70

[P] 10/09/2018 9:07:25AM

[E] 10/09/2018 9:07:07AM

Goods Sold are not refundable for Cash.
Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

Goods Received in Good Order

JAE Auto-Pte-Ltd
Sales Executive: JASON



This is computer generated document.
No signature is required.

Signature / Co Stamp / Date

ORIGINAL



合興汽車零件私人有限公司 HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

M/S: KAN FOOK SING MOTOR WORKSHOP
61 DEFULANE 12
SINGAPORE 539147

TAX INVOICE

NO: DLI9207711

PAGE: 1


DATE: 11/09/2018

A/C CODE: LDKF239

TERMS: CR

VEH NO: SKS2794Z

Part No	Description	Location	Qty	Unit Price	Amount
1 T81140-48440 ✓	HEADLAMP UNIT LED RH	DB2BB6	1	SIN 980.00	SIN 980.00
2 52161-0K040V ✓	CLIP	DUIAD10-10	10	1.50	15.00
3 T90467-07211 ✓	CLIP	DD1AS3-6	10	1.50	15.00
TOTAL QUANTITY			21	TOTAL	SIN 1,010.00
				ADD GST @ 7%	70.70
				GRAND TOTAL	<u>SIN 1,080.70</u>

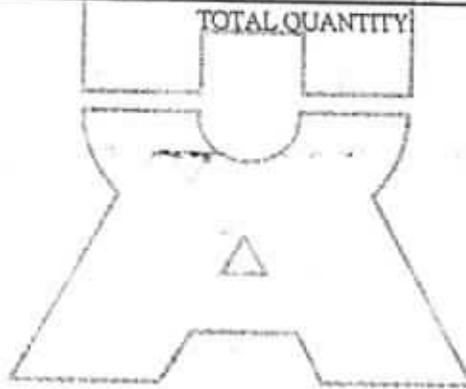

Print / LIM / 11/09/2018 0:12:06 AM


SALESMAN: LIM

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE

E & O E

GOODS RECEIVED BY





合興汽車零件私人有限公司 HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

M/S: KAN FOOK SING MOTOR WORKSHOP

61 DEFU LANE 12

SINGAPORE 539147

TAX INVOICE

NO: *DLI9207782

PAGE: 1

DATE: 12/09/2018

A/C CODE: LDKF239

TERMS: CR

Handwritten: S/S 27/14


Handwritten signature

Part No	Description	Location	Qty	Unit Price	Amount
T52618-48010	FR BUMPER LWR ABSORBER	DUIF2-1	1	SIN 60.00	SIN 60.00

TOTAL QUANTITY:

1	TOTAL	SIN 60.00
	ADD GST @ 7%	4.20
	GRAND TOTAL	SIN 64.20

SELF COLLECTION

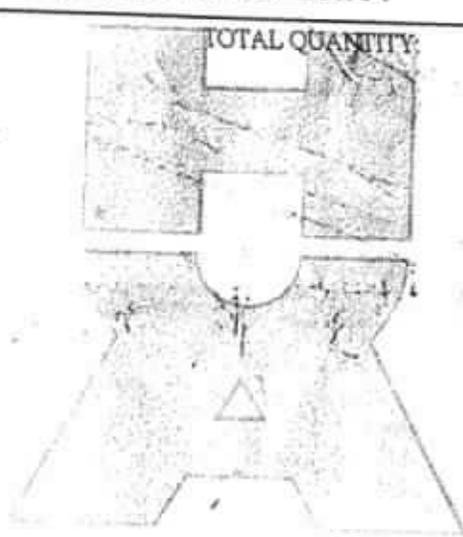

Handwritten signature

Handwritten signature

Print / LIM / 12/09/2018 10:02:45 AM

SALESMAN: LIM

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE

E. & O. E.

GOODS RECEIVED BY





合興汽車零件私人有限公司 HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

M/S: KAN FOOK SING MOTOR WORKSHOP

61 DEFULANE 12

SINGAPORE 539147

FAX INVOICE

NO: *DLI9207780

PAGE 1

DATE 12/09/2018


A/C CODE LDKF239

TERMS CR

VEH NO: SKS2794Z

Part No	Description	Location	Qty	Unit Price	Amount
T81070-48890	HEADLAMP UNIT-LH	DB2GC2	1	SIN 980.00	SIN 980.00
TOTAL QUANTITY:			1	TOTAL	SIN 980.00
				ADD GST @ 7%	68.60
				GRAND TOTAL	<u>SIN 1,048.60</u>

SELF COLLECTION

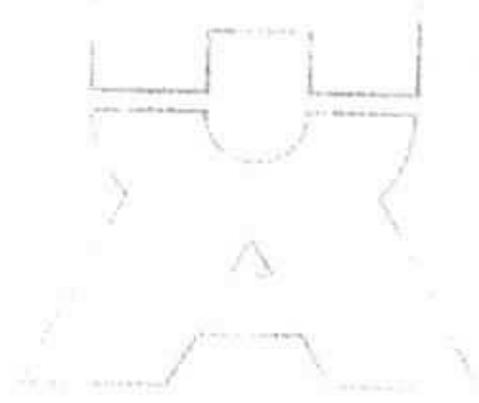

3418

Print / LIM / 12/09/2018 @ 5:59 AM

SALESMAN LIM

This document is computer generated. No signature required

GOODS SOLD ARE NOT RETURNABLE

E & O E

GOODS RECEIVED BY _____



51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Full Report - V1
Registration: SKS2794Z
Printed: 10/12/2018 17:55

Claim Reference:
Assessment Number: KFS01543
Version: LKKAUTOC/4
Date Calculated: 10/12/2018 09:53

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	02/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	5098708943	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	*TOYOTA
Model:	*HARRIER
Sub Model:	
Model Sheet Number:	2426 01
Registration:	SKS2794Z
Registration Month:	May
Registration Year:	2015
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 03/2015	LED HEADLAMP
2.7 LTR 138KW	AUTO GEARBOX 6 SPEED
TYRES 235/55 VR 19	WHEELS 7.5J X 19 ALU
FRONT DRIVE	PRODUCTION IN JAPAN
TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:		Severity of Impact:	
Steering:		Vehicle Status on Inspection:	
Brakes Pedal Travel:		Date of Inspection:	04/09/2018
Place of Inspection:	Repairer		
Pre-Accident Damage:			
Tyres Condition:			
Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	
Damage Areas:		Direction of Impact:	

Claim Reference:

Full Report - V1



Assessment Number: KFS01543

Registration: SKS2794Z

Version: LKKAUTOC/4

Printed: 10/12/2018 17:55

Date Calculated: 10/12/2018 09:53

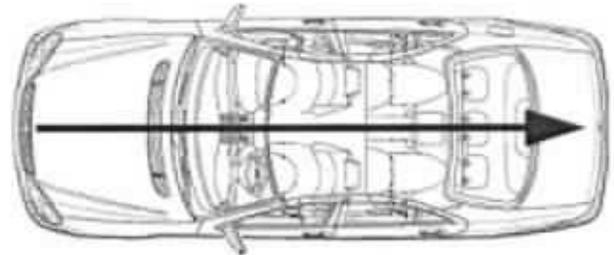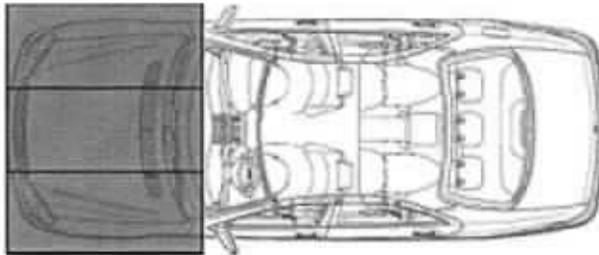

Addresses

Cost Summary

Total Labour	\$930.00
Total Paint/Material	\$219.32
Total Parts	\$3,930.70
Total of Additional Costs	\$30.00
Excess:	TBA
Grand Total Exc GST:	\$5,110.02
7 % GST:	\$357.70
Grand Total Inc GST:	\$5,467.72

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
NN	RENEW FRONT BUMPER	14.0	70.00
	INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS		
NN	R + R FRONT BUMPER REINFORCEMENT	2.0	10.00
NN	R + R RADIATOR BADGE	1.0	5.00
NN	R + R HEADLAMPS (BUMPER REMOVED)	8.0	40.00
	INCLUDES: ADJUST HEADLAMPS		
NN	DRAIN AIR CONDITIONING	3.0	15.00
NN	REFILL AIR CONDITIONING	7.0	35.00
0340	REPAIR FRT BUMPER REINF	10.0*	50.00
0471	REPAIR BONNET	10.0*	50.00
0742	REPAIR R/F WING	10.0*	50.00
1009	REPAIR INNER FRT PANEL CPL	10.0*	50.00

LABOUR COST

Total Work Units	75.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	7.5HRS	\$375.00
Paint Labour	11.1HRS	\$555.00
Total Labour	18.6HRS	\$930.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$50.00/HR

Guide Number	Description	WU	Cost Price (\$)
278	R/F BUMPER COVER NEW PART PAINT K1R - TWO COAT METALLIC - PREPARE OFF VEHICLE	3.0	

Claim Reference:

Full Report - V1

Assessment Number: KFS01543

Registration: SKS2794Z

Version: LKKAUTOC/4

Printed: 10/12/2018 17:55

Date Calculated: 10/12/2018 09:53

283	FRONT BUMPER NEW PART PAINT K1R	12.0	
471	BONNET REPAIR PAINTING <50%	23.0	
741	L/F WING REPAIR PAINTING <50%	12.0	
742	R/F WING REPAIR PAINTING <50%	12.0	
277	L/F BUMPER COVER SURFACE PAINT PLAST.	3.0	
1009	INNER FRT PANEL CPL SURFACE PAINT	7.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0	
LABOUR COST - PAINT			
	TIME(PAINT)	81.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	111.0	
	Total Paintwork Labour	11.1HRS	\$555.00
MATERIAL COST - PAINT			
	New Part Painting - Plastic K1R		\$57.07
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$46.07
	Surface Paint Plastic		\$0.73
	Repair Painting		\$77.85
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$219.32
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$219.32

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1000	1	BONNET CHROME			0%	140.00*
283	1	FRONT BUMPER			0%	350.00*
257	1	FRONT NUMBER PLATE			0%	0.00F
1000	1	FRT BUMP TOP BEAM			0%	110.00*
350	1	FRT BUMPER CLAMP KIT			0%	15.00*
381	1	FRT BUMPER GRILLE			0%	215.00*
8781	1	FRT ENG COMP PROTECT			0%	60.00*
344	1	FRT IMPACT ABSORBER			0%	65.00*
391	1	FRT LWR BUMP GRILLE			0%	130.00*
410	1	GRILLE			0%	200.00*
321	1	L/INN BUMPER BRACKET			0%	60.00*
561	1	LEFT HEADLAMP ASSY			0%	980.00*
278	1	R/F BUMPER COVER			0%	23.00*
790	4	R/F WING CLAMP KIT			0%	15.00*
322	1	R/INN BUMPER BRACKET			0%	60.00*
562	1	RIGHT HEADLAMP ASSY			0%	980.00*
1000	1	UPP AIR GUIDE CLIP			0%	15.00*
f: OEM Parts				Saving		\$18.00
g: Original				Sub Total		\$3,418.00
h: Secondhand				Mark Up From Cost (15 %)		\$512.70
p: Parallel				Sundry Parts (Fixed)		\$0.00
x: Exchange				Total Parts		\$3,930.70

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference:

Full Report - V1

Assessment Number: KFS01543

Registration: SKS2794Z

Version: LKKAUTOC/4

Printed: 10/12/2018 17:55

Date Calculated: 10/12/2018 09:53

Description	Betterment	Price
FRT NUMBER PLATE SPECIALIST	0%	\$30.00
	Total Extras	\$30.00
Final Calculation		
Total Parts		\$3,930.70
Labour		
Total Panel/Mechanical	\$375.00	
Total Paintwork	\$555.00	
Total Labour		\$930.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$30.00	
Total of Additional Costs		\$30.00
Total Paint/Material Costs		\$219.32
Grand Total Excludes GST		\$5,110.02
GST @ 7 %		\$357.70
Grand Total Includes GST		\$5,467.72

Assessment Notes

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	03 Sep 2018 Sendback Est	05 Sep 2018 16:41 S\$7,916.35	06 Sep 2018 09:21 Edit Adj Rpt	S\$5,110.02 Edit Estimates	S\$5,110.02 View Rpt		Pending for Survey Report Cancel Case
Supp #1	27 Nov 2018 11:37 Sendback Est	27 Nov 2018 11:38 S\$96.25	27 Nov 2018 11:38 Assign			Combine Suppl.	New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	MICHAEL MATTHEW LEE @LEE THIAM CHYE , ID: S00249591								
Main Claimant:	Lim Cheng Chuan , ID: S1466561G								
Vehicle Reg. No.:	SKS2794Z	Date of Loss:	02/09/2018 10:00 - :59 [41 Months From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 569365	Policy/Cover Note No.:	D27389422TMP (Third Party Only) Coverage: 31/10/2017 - 30/10/2018						
Vehicle Reg. No. (Insured):	SFZ6825P	Policy No. (Claimant):	5098708943						
		Excess:							
Repairer:	Kan Fook Sing Motor Workshop (Defu) No. 61 Defu Lane 12, 539147 Defu Lane - Tel: 67479560								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Chhia Nyuk Pui - 6594 2521]								
Claimant's Insurer:	NTUC Income Insurance Co-operative Ltd (HQ) - Tel:								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 06/10/2018]								
Driver/Custodian (Insured):	MICHAEL MATTHEW LEE @LEE THIAM CHYE (68 / Male), NRIC: S00249591								
Adj Asg. Remarks:	Car in. on WP. Please contact us ASAP if you cannot attend this assignment. LIABILITY: 100% CONTACT:67479560								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SKS2794Z (569365)
 [SFZ6825P]
 TP
 Lim Cheng Chuan
 Sep 2 2018 10:00AM
 [MICHAEL MATTHEW LEE @LEE THIAM CHYE]
 Kan Fook Sing Motor Workshop

Upload Documents			Upload Photos			Compose New Letter			View <input type="button" value="View in Browser"/>		
Video									1 per page		<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)						Thumbnail	Print		
1	03/09/18 17:02	Video - Accident <small>[Linked Accident Report Documents]</small>							Load MP4		
Assessment Reports									1 per page		<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)						Thumbnail	Print		
1	03/09/18 17:16	Accident Statement							Load HTM		
2	05/09/18 16:41	Repairer Estimates							Load HTM		
3	27/11/18 11:38	Repairer Estimates Suppl. #1							Load HTM		
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)						Thumbnail	Print		
1	05/09/18 17:02	Accident Statement <small>From: SC - Reg. No: SFZ6825P, Claimant: MICHAEL MATTHEW LEE@LEE THIAM CHYE</small>							Load HTM		
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print		
1	10/09/18 10:14	Adjuster Immediate Advice							Load HTM		
Photos/Images									3 per page		<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print		
1	06/09/18 17:18	Chassis Number							Load JPG	<input checked="" type="checkbox"/>	
2	06/09/18 17:18	Odometer Reading							Load JPG	<input checked="" type="checkbox"/>	
3	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
4	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
5	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
6	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
7	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
8	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
9	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
10	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
11	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
12	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
13	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
14	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
15	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
16	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
17	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
18	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
19	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
20	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
21	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
22	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
23	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
24	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	
25	06/09/18 17:19	General View							Load JPG	<input checked="" type="checkbox"/>	

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
				<input checked="" type="checkbox"/>
26	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
27	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
28	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
29	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
30	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
31	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
32	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
33	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
34	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
35	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
36	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
37	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
38	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
39	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
40	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
41	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
42	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
43	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
44	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
45	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
46	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
47	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
48	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
49	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
50	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
51	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
52	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
53	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
54	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
55	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
56	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
57	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
58	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
59	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
60	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
61	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
62	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
63	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
64	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
65	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
66	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
67	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
68	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
69	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
70	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
71	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
72	06/09/18 17:19	General View	Load JPG	<input checked="" type="checkbox"/>
73	07/12/18 09:08	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
74	07/12/18 09:08	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
75	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
76	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
77	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
78	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
79	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
80	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
81	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
82	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
83	07/12/18 09:08	Reinspection Photo		<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	04/09/18 16:09	E-filed GIA report		
2	04/09/18 16:45	Audatex report		
3	12/12/18 17:32	Letter of Demand		
4	12/12/18 17:32	Authorisation to Act		
5	12/12/18 17:32	Repairer's Bill		
6	12/12/18 17:32	Rental Bill		
7	12/12/18 17:32	LTA search		
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	05/09/18 17:02	SKS2794Z TP E-FILE REPORT From: SC - Reg. No: SF26825P, Claimant: MICHAEL MATTHEW LEE@LEE THIAM CHYE		
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/09/18 10:16	SKS 2794Z AUTODEX ADJUSTMENT		

Linked Accident Report Documents

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	03/09/18 17:02	Video - Accident		
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	03/09/18 17:16	Accident Statement		
2	08/09/18 12:05	Addendum Sheet		
3	08/09/18 12:05	Accident Statement Addm. #1		
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
2	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
3	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
4	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
5	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
6	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
7	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
8	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
9	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
10	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
11	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
12	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
13	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
14	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>
15	03/09/18 17:01	Accident Photo		<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
				<input checked="" type="checkbox"/>
16	03/09/18 17:01	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
17	03/09/18 17:08	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
18	03/09/18 17:08	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
19	03/09/18 17:08	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
20	03/09/18 17:08	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
21	03/09/18 17:08	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	03/09/18 17:10	Accident Sketch Plan	 Load TIF	
2	03/09/18 17:10	Accident Sketch Plan	 Load TIF	
3	03/09/18 17:10	Accident Sketch Plan	 Load TIF	
4	03/09/18 17:10	certificate of insurance	 Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
<div style="border: 1px solid black; width: 100%; height: 100%;"></div>			
Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co. Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18016271/UCD3E2
Date: 17/12/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.	Policy No: D27389422TMP
Claimant Vehicle No: SKS2794Z	Insured Vehicle No: SFZ6825P
Date of Loss: 02/09/2018	Nature of Claim: TP
	Claim No: 569365

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKS2794Z	Engine No: 3ZRB459245
Make & Model: TOYOTA HARRIER, 2.0 Elegance (A)	Chassis No: ZSU600027246
Reg. Date: 02/04/2015 (Man. Year: 2014)	Odometer: 53252 km
Colour: Purple	
Engine Capacity: 1986 cc	
Market Value/New Car Price: N/A	
Sum Insured (S\$): Market Value/New Car Price	

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55 R17	Rear Tyre Size:	225/55 R17
Front Left Side:	Dunlop 7 mm	Rear Left Side:	Dunlop 7 mm
Front Right Side:	Dunlop 7 mm	Rear Right Side:	Dunlop 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,546.95	3,930.70	2,616.25	39.96
Miscellaneous Items	329.40	249.32	80.08	24.31
Labour	440.00	375.00	65.00	14.77
Paintwork Labour	600.00	555.00	45.00	7.50
Towing	0.00	0.00	0.00	
Gross Total (S\$)	7,916.35	5,110.02	2,806.33	35.45
+ GST 7.00/7.00% (S\$)	554.14	357.70	196.44	35.45
Nett Amount (S\$)	8,470.49	5,467.72	3,002.77	35.45

INSPECTION

Date of Assignment:	06/09/2018	Present Location:	Kan Fook Sing Motor Workshop (Defu)
Date Inspected:	06/09/2018	Inspected At:	Kan Fook Sing Motor Workshop (Defu) No. 61 Defu Lane 12 Singapore 539147
Estimated Period of Repair:	4.0 days		

Adjuster: MARCUS CHUA

Manager: CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 17 Dec 2018)
Parts: M1-SUV	TOYOTA HARRIER 2.0 Elegance (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKS2794Z)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*PARTS (WCP)		6,546.95 F	*3,343.00 F	
2	1		*FRONT BUMPER LOWER COVER (WCP)	Torn	-	*60.00 F	
3	10		*FRONT BUMPER CLIP (WCP)	Necessary	-	*15.00 F	
					Sub Total (S\$)	6,546.95	3,418.00
					+ Margin on L,N Items 0.00/15.00% (S\$)	0.00	512.70
					Total Parts (S\$)	6,546.95	3,930.70

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	MISCELLANEOUS	80.00	30.00
2	1	PAINTWORK MATERIALS	249.40	219.32
Sub Total (S\$)			329.40	249.32

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	SPRAYPAINTING CHARGES	New	600.00	555.00
<u>Labour Items</u>				
2	LABOUR CHARGES	New	440.00	375.00
Gross Labour Cost (S\$)			1,040.00	930.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >