Ah Lim Motor Company 10 Ang Mo Kio Industrial Park 2A

#01-09 AMK Autopoint Singapore 568047

SURVEYOR COPY

Claim Reference:

Assessment Number: AH000914

Version: AHLIM001/1

Date Calculated: 04/09/2018 04:40

Full Report - V1 Registration: EU2927T

Printed: 04/09/2018 12:57

Summary Information

Claim

Location:

Printed by:

Authorisation Status: Work Provider:

Interim

HONDA

HVE 01

2015

2015

%

EU2927T

November

Not Known

BASE MODEL

Vezel

Ltd

Claim Reference: Policy Number: Other Reference: Third Party:

Insured Amount: Under Warranty: Warranty Expired: Singapore (SG)

Ahlim ahlim

AXA Insurance S'pore Pte Repairs Authorised:

Estimated Repair Time: Ouote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Currency:

Date of Incident:

Vehicle Details

Vehicle

Manufacturer: Model:

Sub Model: Model Sheet Number:

Registration:

Registration Month: Registration Year:

VIN Number:

Manufacture Year:

Odometer:

Colour: Engine Number:

Fuel Level:

Vehicle Condition

Vehicle Status

Pre-Accident Condition:

Steering:

Brakes Pedal Travel: Place of Inspection: Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF: Tread Depth LHR:

Damage Areas:

Model Specs

REAR PARKING SYSTEM

PREPARE OFF VEHICLE

LKK Auto Consultants hence notify the Repairer of the following:

. To resurvey before/after spray painting

 To display damaged part(s) during resurvey · Parts prices are subject to confirmation

Third party survey is on a "Without Prejudice" basis

· No illegal modification(s) is allowed

· Sustevertity it of sl musia ctesurveyed and is Subject to final approval from Insurance Company

Acknowledged by Repairer Signature of Inspection:

Date:

Tread Depth RHF: Tread Depth RHR: Direction of Impact: SGD

Able to Authorise Repairs: TBA TBA

TWO COAT METALLIC

04/09/2018

Not Notheries
Renny Bepains
2 day,

Ah Lim Motor Company


Claim Reference:


Assessment Number: AH000914

Version: AHLIM001/1

Date Calculated: 04/09/2018 04:40

Full Report - V1 Registration: EU2927T Printed: 04/09/2018 12:57

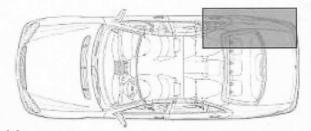

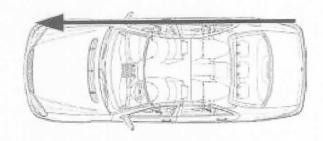

Addresses

Cost Summary

Total Labour	\$427.50
Total Paint/Material	\$73.12
Total Parts	\$1,034.43
Total of Additional Costs	\$80.00
Excess:	TBA
Grand Total Exc GST:	\$1,615.05
7 % GST:	\$113.05
Grand Total Inc GST:	\$1,728.10

Repair Information

LABOUR Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /				
Guide Nu	umber Repair Details		WU	Cost Price (\$)
7141A5	R + R RIGHT OUTER TAILLAMP		1.0	4.50
8131B8	REMOVE AND REFIT R/R S-PANEL MOULDING		2.0	9.00
8131A9	R + R RIGHT REAR WHEELHOUSE SHELL		3.0	13.50
8111C4B	R + R RIGHT REAR BUMPER CORNER		6.0	27.00
	INCLUDES: REMOVE AND REFIT REAR BUMPER			
	AND REQUIRED ATTACHED PARTS			
8571C9)	R + R R/R SIDE PANEL TRIM		2.0	9.00
848140	R + R REAR END PANEL TRIM		2.0	9.00
4211F4)	R + R R/R TYRE AND BALANCE		4.0	18.00
4211A6	R + R R/R WHEEL		2.0	9.00
3482	REPAIR R/R SIDE PANEL	na	10.0* X	45.00
	LABOUR COST			
	Total Work Units		32.0	
	Corrosion Protection External Labour		0.0HRS	0.00
	Corrosion Protection Internal Labour		0.0HRS	0.00
	Sub Total		3.2HRS	\$144.00
	Paint Labour		6.3HRS	\$283.50
	Total Labour		9.5HRS	\$427.50

PAINT W	ORK T	Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Nu	mber Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
2588	R/R BUMPER CORNER REPAIR PAINT P	ASTIC 10.0	
3482	R/R SIDE PANEL REPAIR PAINTING >5	0% 20.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	30.0	

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000914

Version: AHLIM001/1

Date Calculated: 04/09/2018 04:40

Full Report - V1 Registration: EU2927T Printed: 04/09/2018 12:57

a di maria Manda Blandia	8.0	
Preparation Main Work Plastic		
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	63.0	
Total Paintwork Labour	6.3HRS	\$283.50
MATERIAL COST - PAINT		Cost Price
Repair Painting		\$23.31
Repair Painting Plastic		\$8.51
Material-Const Main Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$73.12
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$73.12

PARIS				Pric	e Valid	d: 01/06/2015
Guide No.Qty 2588 1	Description R/R BUMPER CORNER	Part Number 71502T7JH00ZZ	Supplier	1	Bet. 0%	Au Price (\$) 60.00*
2620 1	R/R OUT BUMPER BRKT	71593T7A000			0%	12.00* ?
2650 8	RR BUMPER CLAMP KIT	91505TM8003			0%	37.50* X
3672 1	R/R S-PANEL MOULDING	74410T7MH01			0%	40.00*
9552 1	R/R WHEEL	42700T8CT91			0%	750.00* X
f: OEM Parts g: Original		Sub Total Mark Up Fro	om Cost	(15 %)		\$899.50 \$134.93
h: Secondhand		Total Parts	5			\$1,034.43

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

_		-		
	~	•	ra	-
	А	u	a	3

p: Parallel x: Exchange

Description	Betterment	Price
WHEEL ALIGNMENT SPECIALIST	0%	\$80.00
	Total Extras	\$80.00
Final Calculation		
Total Parts		\$1,034.43
Labour		
Total Panel/Mechanical	\$144.00	
Total Paintwork	\$283.50	
Total Labour		\$427.50
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$80.00	
Total of Additional Costs		\$80.00
Total Paint/Material Costs		\$73.12
Grand Total Excludes GST		\$1,615.05
GST @ 7 %		\$113.05
Grand Total Includes GST		\$1,728.10

Assessment Notes

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000914

Version: AHLIM001/1

Date Calculated: 04/09/2018 04:40

Full Report - V1 Registration: EU2927T Printed: 04/09/2018 12:57