51 Ubi Avenue 1, #01-25 **Paya Ubi Industrial Park** Singapore

408933

Claim Reference: SNM18D04519C01 **Assessment Number: CSKG9618**

Version: CHINATAI/2

Date Calculated: 21/09/2018 07:24

Full Report - V1 Registration: SKG9618S Printed: 21/09/2018 14:25

Summary Information

Claim

Location: Singapore (SG) LKK AUTO Printed by: **Authorisation Status:** Interim

Work Provider: China Taiping Insurance

(S) Pt

Claim Reference: SNM18D04519C01 Policy Number: DMPCSN1717471801

Other Reference: Third Party: Insured Amount: Under Warranty: Warranty Expired:

SGD Currency: Date of Incident: 17/09/2018

Able to Authorise Repairs: TBA Repairs Authorised: **TBA**

Quote Due Date: Actual Repair Days: Parts Ordered Date:

Estimated Repair Time:

Hire Car Start: Hire Car End: Vehicle Collected:

Model Specs

Vehicle Details

Vehicle

Manufacturer: **HYUNDAI** Model: Elantra Sub Model: A ELITE Model Sheet Number: 3032 03 Registration: SKG9618S October Registration Month: 2012 Registration Year:

VIN Number: KMHDH41CMDU648446

Manufacture Year: 2012 Odometer: Not Known Colour: Silver

Engine Number:

% Fuel Level:

FROM 08/2012

CENTRAL LOCKING **KEYLESS ENTRY** ELECT FOLDING MIRROR GRILLE CHROME/BLACK

ANTI THEFT ALARM REAR PARKING SYSTEM **AUTO GEARBOX 6 SPEED**

TWIN AIRBAGS

TYRES 205/55 HR 16 **EMISSION STD EURO 4**

4-DOOR

RIGHT HAND DRIVE TWO COAT PEARL/MICA

7 day(s)

AIR CONDITIONING REAR ELECT WINDOWS MIRROR W/NDICATOR FOG LAMPS

IMMOBILISER REAR BRAKE DRUM 1.6 LTR 97KW STRG COLUMN ADJUST

ABS

19/09/2018

WHEELS 6.5J X 16 ALU

D/MLDG BLACK BRIGHT PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Vehicle Status on Steering: Inspection:

Brakes Pedal Travel: Place of Inspection:

Date of Inspection:

Pre-Accident Damage:

Tyres Condition:


Tread Depth LHF: Tread Depth RHF: Tread Depth LHR: Tread Depth RHR: Direction of Impact: Damage Areas:


51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D04519C01 Assessment Number: CSKG9618

Version: CHINATAI/2

Date Calculated: 21/09/2018 07:24

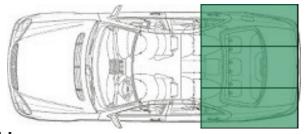

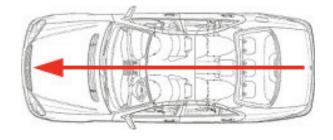

Full Report - V1

Registration: SKG9618S

Printed: 21/09/2018 14:25

Addresses

Repairer

Name: CHENG HOE MOTOR PTE LTD

Address:

NO 10, AMK IND PK 2A

01-04

Post Code: 568047 **Cost Summary**

Total Labour	\$932.40
Total Paint/Material	\$213.67
Total Parts	\$1,934.00
Total of Additional Costs	\$235.00
Excess:	- \$0.00
Grand Total Exc GST:	\$3,315.07
7 % GST:	\$232.05
Grand Total Inc GST:	\$3,547.12

10.5HRS

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR Price/Dent = \$42.00/HR		
Repair /		-	
Guide Numb	er Repair Details	WU	Cost Price (\$)
86520R00	RENEW COMPLETE REAR BUMPER	8.0	33.60
	INCLUDES: R + R OUTER TAIL LAMPS AND		
	NECESSARY TRIMS,		
	RENEW REAR BUMPER AND BUMPER CARRIER,		
	CONVERT ATTACHED PARTS, RENEW IF		
	NECESSARY		
69200R00	RENEW BOOTLID	11.0	46.20
	INCLUDES: R + R TRIM		
	ASSEMBLE ATTACHED PARTS IF NECESS RENEW		
79210R00)	R + R L/BOOTLID HINGE	4.0	16.80
81214R00	R + R BOOTLID LOCKING PLATE	2.0	8.40
87321R00	R + R BOOT LID RUBBER SEAL	2.0	8.40
NO NUMBER	RENEW END PANEL	45.0	189.00
2695	PANEL WORK REAR END	20.0*	84.00
3485	REPAIR L/R OUT QTR PANEL	10.0*	42.00
3901	REPAIR BOOTFLOOR	15.0*	63.00
LA	BOUR COST		
	Total Work Units	117.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	11.7HRS	\$491.40

Paint Labour

\$441.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D04519C01 **Full Report - V1 Assessment Number: CSKG9618 Registration: SKG9618S** Printed: 21/09/2018 14:25 **Version: CHINATAI/2**

Date Calculated: 21/09/2018 07:24

22.2HRS \$932.40 Total Labour____

PAINT WORK	Time	Time Basis 10 WU = 1 HR. Price = \$42.00/HR		
Guide Number D	escription	WU	Cost Price (\$)	
	 PREPARE OFF VEHICLE 			
	- TWO COAT PEARL/MICA			
2711 R	EAR PANEL NEW PART PAINTING	18.0		
2931 B	OOTLID NEW PART PAINTING	16.0		
2583 R	EAR BUMPER NEW PART PAINT K1R	13.0		
3485 L,	'R OUT QTR PANEL REPAIR PAINTING </td <td>13.0</td> <td></td>	13.0		
3901 B	OOTFLOOR SURFACE PAINT	15.0 *		
LABOU	IR COST - PAINT			
Т	IME(PAINT)	75.0		
P	reparation Main Work Plastic	5.0		
P	reparation Main Work Metal	25.0		
P	reparation Work Multi Layer Paint	0.0		
Т	otal Work Units (10WU/HR)	105.0		
Т	otal Paintwork Labour	10.5HRS	\$441.00	
MATER	RIAL COST - PAINT		Cost Price	
N	ew Part Painting		\$64.14	
N	ew Part Painting - Plastic K1R		\$63.96	
M	aterial-Constant Main Work Metal		\$28.60	
S	urface-/Blend Paint		\$29.88	
R	epair Painting		\$18.09	
M	aterial-Const Main Work Plastic		\$9.00	
Т	otal Excluding Pearlescent Uplift		\$213.67	
	earlescent Uplift @ 0.0%		\$0.00	
Т	otal Paint Material Cost		\$213.67	

PARTS

					Price Valid:	01/06/2015
Guide No	o. Qty	Description	Part Number	Supplier	Bet.	Price (\$)
3015	1	BADGE "HYUNDAI"	863203X000		0%	22.00*
3014	1	BADGE MODEL	863153X100		0%	30.00*
2931	1	BOOTLID	692003X120		0%	410.00*
2977	1	BOOTLID LOCK	812303X010		0%	85.00 *
2944	1	BOOTLID SEAL	873213X000		0%	50.00*
2953	1	L/BOOTLID HINGE	792103X000		0%	45.00*
3289	1	L/R INNER LAMP	924303X050		0%	130.00*
3287	1	L/R OUTER LAMP	924103X010		0%	170.00*
3013	1	MANUFACTURER BADGE	863213X000		0%	22.00*
3290	1	R/R INNER LAMP	924403X050		0%	130.00*
3288	1	R/R OUTER LAMP	924203X010		0%	170.00*
3296	1	R/R REFLECTOR	924063X000		0%	22.00*
2583	1	REAR BUMPER	866103X011		0%	195.00 *
2640	1	REAR BUMPER SUPPORT	866313X100		0%	130.00*
2711	1	REAR PANEL	691003X000		0%	160.00 *
4985	1	REAR PANEL TRIM	857703X000RY		0%	38.00*
2973	1	REAR STRIKER	812103L000		0%	25.00*
f: OEM Pa	arts		Sub Total			\$1,834.00
g: Origina	al		Sundry Par	rts (Fixed)	\$100.00
h: Second	dhand		Total Part	ts		\$1,934.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D04519C01 Full Report - V1
Assessment Number: CSKG9618 Registration: SKG9618S
Version: CHINATAI/2 Printed: 21/09/2018 14:25

Date Calculated: 21/09/2018 07:24

p: Parallelx: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

LAUGS			
Description		Betterment	Price
REAR NO PLATE	SPECIALIST	0%	\$35.00
REVERSE SENSORS	SPECIALIST		\$200.00
		Total Extras	\$235.00
Final Calculation			
Total Parts			\$1,934.00
Labour			
Total Panel/Mechanical		\$49	91.40
Total Paintwork		\$44	1.00
Total Labour			\$932.40
Additional Costs			
Corr Prot Materials Externa	al	\$	60.00
Corr Prot Materials Interna	ıl	\$	50.00
Cost of Specialist		\$23	35.00
Total of Additional Costs			\$235.00
Total Paint/Material Costs			\$213.67
Grand Total Excludes GST			\$3,315.07
GST @ 7 %	_		\$232.05
Grand Total Includes GST			\$3,547.12

Assessment Notes