

ASS. REC. BY:

REF: CS/SM018020935/N-10327 Special Instruction:

Surveyor: NAZ

ASSIGNMENT (Office)

Meinmen

From (Person): Thelma Choo

of SMO

Date/Time: 20/11/2018

Estimated Cost:

Bill to:

OD TP WS/TP RES / OD RES / EVA / INV / MV7CS

To Inspect Vehicle No:

SHB 1721R

Insured: YL 9326 S

at Workshop m/s

SMRT

Tel: 6866 2672

of

No-61 woodlands Ind. Park F9 #04-04

Policy No:

D18MTPCVE000637

Claim No:

CMTD1805035

Sun Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A. 09/11/2018

CA / REV / REP. / REV 24 HRS ^{up}

H.O.D. Endorsement:

Date/Time: 9:25am 20/11/18

Person Contacted:

Shanti

Vehicle ☒ IN ☐ OUT

Date/Time

Action/Instruction (✓) Estimate

SHB 1721R - HSL/INC17020412/S/b22

D.O.A: 20/10/17

YL 9326S - NA/FCI13006625/e1

D.O.A: 8/1/2013

REF: SMO

TAX/11/18/2045

ASSIGNMENT

From: Date: 20/11/2018

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB1721R

at Workshop m/s

SMRT

of

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Vch:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

X X X

Bal. or Market Value: \$56k

IDAC Accident Rpt: Consistent? Yes or No

GIA / PR Seen: Consistent? Yes or No

Est. Repair: 13 days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS 'up'

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SHB 1721R Yr Reg: 23 JULY/2014

Type: M/Car / M/Cycle / Bus / Van / Lorry (Taxi) / Prime Mover /

Truck / Trailer or

Make: TOYOTA PR1W3 CC: 1,798

Colour: MAROON A/C: Insured / Std / NI / NA

Sp Reading: 537,783 T/Radio: Insured / Std / NI / NA

Eng No:

CNo: JTDKN36U405997206

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tym Size: F: 195/65 R15

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FALKEN

Front

Rear

R/Bal: 6 mm R/Bal: 5 mm

L/Bal: 6 mm L/Bal: 5 mm

D.O.A: 9/11/18 D.O.I: 20/11/18

Survey held at: SMRT WOODLANDS

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time: Action / Instruction

Purchase Price \$111,799
Repair Limit \$24k - \$25k

SMO 2/5

18/3/19 FINALIZED LUMP SUM REPAIR \$20,550 / 13 DAYS
Cred: 18258.54 (47%)

RECEIVED 19 MAR 2019

Date/Time, File Pass to?

19/3 Typist

Date/Time, File Return to?

23

Report Format:

Lump Sum / I.B.I: 20,550

☐ : Preli. Report☒ : Final Report

Days Of Repair: 13

Resurvey No. of Trip: 2

Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech Invs (\$)☐ Weekend (\$)

Survey Fee:

Transportation

1. 5 + 10 = 15

2. Photos

3. Others

4. TOTAL

450

10

460

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	15 Nov 2018		20 Nov 2018 09:05 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	KIM SING SCAFFOLDING PTE LTD, Co. Reg. No.: 201221899M		
Main Claimant:	SMRT TAXIS PTE LTD, Co. Reg. No.: 198905369K		
Vehicle Reg. No.:	SHB1721R	Date of Loss:	09/11/2018 11:00 - :59 [51 Months and 17 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / CMTD1805035	Policy/Cover Note No.:	D18MTPCVE000637 (Third Party Only)
Vehicle Reg. No. (Insured):	YL9326S	Policy No. (Claimant):	
		Excess:	
Repairer:	Smrt Automotive Services Pte Ltd (HQ) No. 61 Woodlands Industrial Park E9, #04-04 Premium Building, 757047 Woodlands - Tel:		
Handling Insurer:	Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Thelma Choo - 6322 4681]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 29/11/2018]		
Driver/Custodian (Insured):	KARUPPIAH ALAGARSAMY (), NRIC: F8128905X, Tel: +6583790424		

ASSOCIATED MAIL RECEIVED

[View All](#)

[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)

[Search Tasks](#)

[Create New Task](#)

[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Teo, Grace

From: Shanti B Thaiyal Nayagi (Auto Svcs/Ext Biz Svcs/Claims & IA/Taxis/Claims)
<BThaiyalN@smrt.com.sg>
Sent: Monday, November 19, 2018 12:39 PM
To: 'motorsurvey@sompo.com.sg'
Cc: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)); Kok Tuck Foo (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)); Koo Yew Chung (Auto Svcs/Ext Biz Svcs/AR & SC); Phua Zhi Yang (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)); Grace Ng Siu Ching (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)); Lim Kha Chiew (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)); Lim Wei Siong (Auto Svcs/Ext Biz Svcs/Claims & IA/Taxis/Claims)
Subject: RE: SHB1721R - Sompo Insurance
Attachments: 2045 - 1721.pdf

Dear Sir /Mdm

Kindly arrange to survey the vehicle SHB1721R within 48 hours according to GIA guide line, involving your insured YL9326S

Vehicle in Woodlands Depot

Regards
Shanti
SMRT Automotive Services PTE LTD
Accident Reporting Center (Claims Dept)
6866 2671/2 | bthaiyaln@smrt.com.sg



> Back to OneMotoring

SMRT TAXIS (Repair Margin).

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHB1721R
Vehicle to be Exported:	No
Intended Deregistration Date:	01 Mar 2019
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2014
Engine No.:	2ZR6099902
Chassis No.:	JTDKN36U405747206
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$32,920.00
Original Registration Date:	23 Jul 2014
First Registration Date:	23 Jul 2014
Transfer Count:	0
Actual ARF Paid:	\$8,088.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	22 Jul 2022
PARF Rebate Amount:	\$6,066.00
Intended COE Rebate Details	
COE Expiry Date:	22 Jul 2022
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$53,269.00
COE Rebate Amount:	\$22,571.00
Total Rebate Amount:	\$28,637.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 01 Mar 2019

OK

Depreciation per mth : \$ 1164.50

(44 mths) Balance @ 20/11/18 : \$ 51,238

\$51,238 + 60% of ARF (4852.8) = \$56,090

Repair Margin : \$56,090 - \$28,637

: \$27,453.80

: \$26K - 27K

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: Sompo Insurance Singapore Pte. Ltd.
50 Raffles Place
#05-01/06, Singapore Land Tower
Singapore 048623From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Thelma Choo

Date: 30 Nov 2018

Preliminary Advice

Insured Vehicle No	: YL9326S	Accident Date	: 09/11/2018
TP Vehicle No	: SHB1721R	Assignment Date	: 20/11/2018
Make	: TOYOTA PRIUS	Est. Duration of Repair	: 8.00
Date of Inspection	: 20/11/2018		
Inspection At	: SMRT AUTOMOTIVE SERVICES PTE LTD (HQ) NO. 61 WOODLANDS INDUSTRIAL PARK E9, #04-04 PREMIUM BUILDING SINGAPORE 757047		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	38,808.54
Revised Amount	:S\$	14,786.39
Check Items (Estimated)	:S\$	18,026.71
Total	:S\$	32,813.10

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	
Salvage Value	:S\$	
Margin for Repair	:S\$	

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (x) Other comments : Survey on WP

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHB1721R
Vehicle to be Exported:	No
Intended Deregistration Date:	21 Dec 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2014
Engine No.:	2ZR6099902
Chassis No.:	JTDKN36U405747206
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$32,920.00
Original Registration Date:	23 Jul 2014
First Registration Date:	23 Jul 2014
Transfer Count:	0
Actual ARF Paid:	\$8,088.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	22 Jul 2022
PARF Rebate Amount:	\$6,066.00
Intended COE Rebate Details	
COE Expiry Date:	22 Jul 2022
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$53,269.00
COE Rebate Amount:	\$23,877.00
Total Rebate Amount:	\$29,943.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 21 Dec 2018

OK

$$\begin{aligned}
 \text{Depreciation per mth} &= \text{Purchase price} \div 96 \text{ mths (8 yrs COE)} \\
 &= \$111,799 \div 96 \\
 &= \$1164.50
 \end{aligned}$$

$$\begin{aligned}
 \text{Balance @ 20/11/18} &= 44 \text{ mths} \times \$1164.50 \\
 &= \$51,238
 \end{aligned}$$

$$\begin{aligned}
 \text{Book Value} &= \text{Balance} + 60\% \text{ of ARF} \\
 &= \$51,238 + \$8088 \times 0.6 \\
 &= \$56,090
 \end{aligned}$$

$$\begin{aligned}
 \text{Repair Margin} &= \text{Book Value} - \text{Rebate Amt} \\
 &= \$56,090 - \$29,943 \\
 &= \$26,147 \text{ (\$24k - \$25k)}
 \end{aligned}$$

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	10/11/2018 11:15
Date Of Accident	09/11/2018 11:30
Exact Location Of Accident	CLEMENTI ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB1721R
Insured/Policyholder	
Name Of Registered Owner	SMART TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	SIM GEK NOI
NRIC No	S7036937J
Date Of Birth	26/10/1970
Occupation	OUTDOOR
Date Of Driving Pass	21/03/1990
Driving Experience	28 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	489
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	LIGHT DRIZZLE
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	SEMPAWANG NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 4 SEMPAWANG CRESCENT , POSTCODE: 757633 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-5549999 - FAX NO: 68522499
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT - T/20181110/2058 On 09/11/2018 at about 1128hrs I was in my SMRT taxi SHB1721R along Clementi Road towards Sunset Way in the 5th lane when I stopped at the traffic light as it was already amber. Suddenly a blue lorry YL9326S hit onto my vehicle from the rear. The impact caused me to hit my nose and mouth into the steering wheel. I was then conveyed to NUH A&E by ambulance and got 7 days MC. I was discharged on 10/11/2018. My injuries are bottom lip cut, swollen and bleeding nose, neck stiff, both shoulders ache, right arm ache, backache, left leg ache. The rear of my taxi was severely dented. The incident location is a T-junction.

Attachment(s)

Are accident photos available for attachment?	NOT AVAILABLE DUE TO CIRCUMSTANCES OF ACCIDENT
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	FILE TOO LARGE
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YL9326S
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	

Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name	SIM GEK NOI
Approximate Age	
Injuries Sustain	
Injured person in which vehicle?	SHB1721R
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	YES
Address	
Postcode	

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

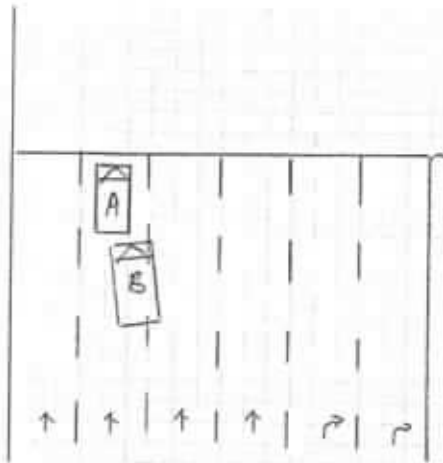

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO POLICE REPORT - 7/2018 1110/2058

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature _____
Date & Time: _____

Driver's Signature: _____
(If driver is not the policyholder)
Date & Time: 10/1/10

Reporting Centre Personnel's Signature
Name: _____
NRIC/FIN No.: _____



**SINGAPORE
POLICE FORCE**

Police Station Of Origin
Sembawang N.P.C
4 Sembawang Crescent SINGAPORE
757633
Tel No. 1800-5549999



1/201811102059

Report No. 1/201811102059

CONTINUATION OF REPORT

Driver			
Name	SIM GEK NOI	ID No.	S7036937J
Related Vehicle	SHB1721R (Car)	Contact No.	97548531
Hospital/Clinic	NATIONAL UNIVERSITY HOSPITAL	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	09/11/2018	Date Discharge	10/11/2018
No. of Days granted Medical Leave	07	Degree of Injury	Serious

Brief Details.

On 09/11/2018 at about 1128hrs I was in my SMRT taxi SHB1721R along Clementi road towards Sunset way in the 5th lane when I stopped at the traffic light as it was already amber. Suddenly a blue lorry YL9326S hit into my vehicle from the rear. The impact caused me to hit my nose and mouth into the steering wheel. I was then conveyed to NUH A&E by ambulance and got 7 days MC. I was discharged on 10/11/2018.

My injuries are bottom lip cut, swollen and bleeding nose, neck stiff, both shoulders ache, right arm ache, backache, left leg ache.

The rear of my taxi was severely dented. The incident location is a T-junction.

Weather clear.

Road surface wet.

Traffic flow one way.

Traffic light working.

Traffic volume moderate.

Type of collision between moving vehicles head to rear.



SINGAPORE
POLICE FORCE

Police Station Of Origin:
Sembawang N.P.C.
4 Sembawang Crescent SINGAPORE
757633
Tel No. 1800-5549999



112011011102000

1 of 3


Report No. 12011011102000

CONTINUATION OF REPORT

Sketch Plan



Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

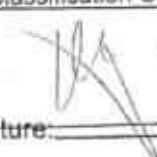Signature Of Officer Recording The Report: F / Staff Sgt KOH XIU MING	Signature Of Informant:
Signature Of Interpreter: Not applicable	Date/Time: 10/11/2018 13:22
Officer In Charge Of Case: TP / GIT / Sgt 3 MARIAH BINTE ZAKARIA Contact No.: 65476433	Classification Of Case: SN 085
Authentication Stamp NP168	Signature:  Singapore Police Force

Section A - Accident Details

Registration Number	SHB1721R
Case Reference Number	TAX/11/18/2045
Registration Date	23/07/14
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	SIM GEK NOI
Type of Accident	Head to Rear
Accident Date and Time	09/11/18 11:28 AM
Accident Reported Date and Time	10/11/18 11:18 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	Yes
Towed Back Date and Time	09/11/18 11:29 AM
Replacement Vehicle issued?	No
Job Card Number	24098884
Special Instruction to ARC, if any	TOWED TO TP COMPOUND / BACK FROM TP COMPOUND 16/11, 1510HRS / SOMPO
Prepared Date and Time	18/11/18 8:49 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

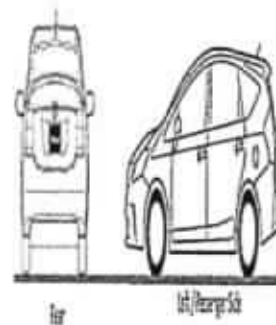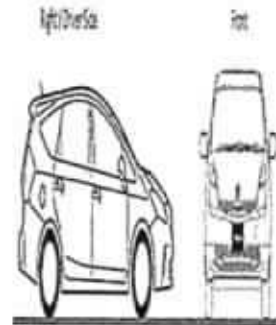

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$2,535.00	\$1,600.00
Total Spray Cost	\$4,230.00	\$1,610.00
Total Spare Part Cost	\$39,977.31	\$15,606.18
Total Other Cost	\$4,227.88	\$1,741.88
TOTAL COST	\$50,970.19	\$20,558.06
Lump Sum Total	\$50,950.00	\$20,550.00 (L/S)
Number of Repair Days	18.0	13.0
Prepared / Adjusted By	Zhi Yang Phua	Naz (LKK) / Sompo
ARC / Surveyor Sign Off Date	03/12/2018 1:14 PM	03/12/2018 11:27 AM
Signature		
Remarks	SUP = 5 DAYS	LUMP SUM REPAIR. 8 DAYS. CHECK ITEMS PHOTOS. AFTER REPAIR PHOTOS.

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1901-0292	Invoice Number	
Quotation Date	12.01.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	\$2,535.00	\$1,600.00
Total Labour	\$2,535.00	\$1,600.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY BUMPER BEAM	\$180.00	\$80.00
TO RESPRAY REAR PANEL	\$180.00	\$100.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$100.00
TO RESPRAY REAR MEMBER, LH	\$180.00	\$0.00
TO RESPRAY REAR MEMBER, RH	\$180.00	\$100.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	\$180.00	\$0.00
TO RESPRAY REAR FLOOR SIDE PANEL RH	\$180.00	\$100.00
TO RESPRAY REAR RH WHEEL HOUSE	\$180.00	\$100.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00
TO RESPRAY REAR SPOILER	\$180.00	\$80.00
TO RESPRAY PANEL ROOF	\$378.00	\$200.00
TO RESPRAY REAR FENDER RH	\$378.00	\$200.00
TO RESPRAY TROUGH BACK DOOR RH	\$180.00	\$50.00
TO RESPRAY RIM	\$180.00	\$0.00
TO RESPRAY REAR FENDER LH	\$378.00	\$0.00
TO RESPRAY TROUGH BACK DOOR LH	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$4,230.00	\$1,610.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$126.00	\$90.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$200.00	\$100.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$50.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$0.00
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	\$50.00
TO REMOVE / REFIT SEAT	\$120.00	\$30.00
TO REMOVE & REFIT EXHAUST	\$120.00	\$0.00

TO REMOVE & REFIT ROOF LINING	\$120.00	\$30.00	/
TO ALIGN CHASSIS	\$350.00	\$100.00	/
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$725.00	\$725.00	/
TO REMOVE & REFIT REAR QUARTER GLASS RH	\$120.00	\$30.00	/
TO REMOVE & REFIT REAR QUARTER GLASS LH	\$120.00	\$0.00	X NN
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$50.00	/
TO REMOVE AND REFIT WIRE HARDESS	\$250.00	\$0.00	X NN
TO REMOVE AND REFIX REAR WINDSCREEN	\$240.00	\$120.00	/
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$20.00	/
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	\$120.00	\$50.00	/
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$0.00	X NN
TO REMOVE AND REFIT BATTERY ASSY HV	\$250.00	\$0.00	X NN
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	\$296.88	\$296.88	/
TO WASH AND VACUUM	\$60.00	\$0.00	X NN
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00	X NN
Total Other Costs	\$4,227.88	\$1,741.88	

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved	
		52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$343.95	Replace	Replace	DEF
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace	NEC
			PIXEL STICKER	2.00	\$60.00 (136)	0.00	\$120.00	Replace	Replace	NEC
		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	25.00	\$154.28	Replace	Replace	BT
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	1.00	\$139.60	25.00	\$104.70	Replace	Replace	BT
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	0.00	\$139.60	0.00	\$0.00	Replace	Check	X SVL
		89997-30070	ANTENNA, ELECTRICAL LOWER REAR	1.00	\$157.40	10.00	\$141.66	Replace	Replace	NEC
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace	BT
		52578-47020	BUMPER SIDE RETAINER RR/LH	0.00	\$94.80	0.00	\$0.00	Replace	Check	X SVL
		52575-47020	BUMPER SIDE RETAINER RR/RH	1.00	\$94.80	25.00	\$71.10	Replace	Replace	CRK
		52592-47021	BUMPER SEAL, RR LH	1.00	\$86.90	25.00	\$65.68	Replace	Replace	NEC
		52591-47021	BUMPER SEAL, RR RH	1.00	\$85.70	25.00	\$64.28	Replace	Replace	NEC
		76088-47020	BUMPER LIP COVER RR/LH	1.00	\$72.20	25.00	\$54.15	Replace	Replace	CRK
		76087-47020	BUMPER LIP COVER RR/RH	1.00	\$118.10	25.00	\$88.58	Replace	Replace	CRK
		76891-47020	BUMPER LIP REAR	1.00	\$228.90	25.00	\$171.68	Replace	Replace	CRK
		58308-47011	UNDER COVER CENTER REAR	1.00	\$514.50	25.00	\$385.88	Replace	Replace	CRK
		58307-47060	END PANEL	1.00	\$602.10	25.00	\$451.58	Replace	Replace	DD
		64718-47031B0	END PANEL COVER, DECK TRIM HOLE	1.00	\$46.10	25.00	\$34.58	Replace	Replace	DEF
		64716-47031B0	END PANEL COVER, DECK TRIM, RR	1.00	\$121.10	25.00	\$90.83	Replace	Replace	DEF
			SEALANT SIKAFLEX	1.00	\$37.00	0.00	\$37.00	Replace	Replace	NEC
		64993-47020	BOX, DECK FLOOR, RR	1.00	\$649.70	25.00	\$487.28	Replace	Replace	DEF
		58416-47030B3	BOX RR FLOOR, BOARD	1.00	\$679.60	25.00	\$509.70	Replace	Replace	DEF

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Service Pte Ltd
88 Woodlands Industrial Park East, Singapore 757708
Fax Number: 63962282
Estimate Telephone Number: 69940923
Accident Reporting Number: 69962672

Date Generated: 15/11/2019

User ID: P000000

58415-47030	BOARD, RR FLOOR	1.00	\$392.30	25.00	\$294.23	Replace	Replace	DEF
58418-47070B0	BOX, DECK FLOOR, COVER LH	0.00	\$230.10	0.00	\$0.00	Replace	Check	X SUC
58497-47020	BOX, DECK FLOOR, LH	0.00	\$196.80	0.00	\$0.00	Replace	Check	X SUC
58427-47040	SPACER, RR FLOOR	0.00	\$130.60	0.00	\$0.00	Replace	Check	X SUC
58490-47140B0	BOARD ASSY, RR RH	0.00	\$379.20	0.00	\$0.00	Replace	Check	X SUC
58474-47031B2	PANEL ASSY, DECK LH	0.00	\$307.00	0.00	\$0.00	Replace	Check	X SUC
58473-47031B2	PANEL ASSY, DECK RH	1.00	\$307.00	25.00	\$230.25	Replace	Replace	DEF
58491-47020-B0	COVER ASSY, TONNEAU	0.00	\$802.10	0.00	\$0.00	Replace	Check	X SUC
58470-47110B0	GARNISH ASSY, ROOF RH	0.00	\$256.40	0.00	\$0.00	Replace	Check	X SUC
58480-47050-B0	GARNISH SIDE UPPER, LHR	0.00	\$261.70	0.00	\$0.00	Replace	Check	X SUC
58311-47071	SPARE TYRE PANEL	1.00	\$667.70	25.00	\$500.78	Replace	Replace	DEF
58477-47090	CUSHION, SPARE WHEEL	1.00	\$230.80	25.00	\$173.10	Replace	Replace	DEF
51931-47020	CARRIER, SPARE	0.00	\$19.70	0.00	\$0.00	Replace	Check	X SUC
58478-47050	PROTECTOR, SPARE	0.00	\$143.70	0.00	\$0.00	Replace	Check	X SUC
57604-47030	MEMBER SUB-ASSY, RR LH	0.00	\$174.10	0.00	\$0.00	Replace	Check	X SUC
57603-47030	MEMBER SUB-ASSY, RR RH	1.00	\$174.10	25.00	\$130.58	Replace	Replace	DEF
58302-47030	FLOOR PANEL RR/RH	1.00	\$209.80	25.00	\$157.43	Replace	Replace	DEF
58303-47301	FLOOR PANEL RR/LH	0.00	\$102.00	0.00	\$0.00	Replace	Check	X SUC
58336-12090	REINFORCEMENT, RR	0.00	\$34.60	0.00	\$0.00	Replace	Check	X SUC
61605-47010	PANEL SUB-ASSY, QTR	0.00	\$326.70	0.00	\$0.00	Replace	Check	X SUC
61607-47060	PANEL SUB-ASSY, QTR	0.00	\$588.40	0.00	\$0.00	Replace	Check	X SUC
61608-47061	PANEL SUB-ASSY, QTR WHEEL HOUSE	0.00	\$588.40	0.00	\$0.00	Replace	Check	X SUC
62940-16060	DUCT ASSY, QUARTER	0.00	\$70.40	0.00	\$0.00	Replace	Check	X SUC
82620-75010	BLOCK ASSY FUSIBLE	0.00	\$166.40	0.00	\$0.00	Replace	Check	X SUC
82161-47822	WIRE, FLOOR	0.00	\$1,675.00	0.00	\$0.00	Replace	Check	X SUC
82162-47820	WIRE, FLOOR, NO.2	0.00	\$1,305.40	0.00	\$0.00	Replace	Check	X SUC
82123-47040	WIRE, ENGINE, NO.3	0.00	\$74.00	0.00	\$0.00	Replace	Check	X SUC
88790-22131	THERMISTOR ASSY	0.00	\$107.00	0.00	\$0.00	Replace	Check	X SUC
G9510-47060	BATTERY ASSY, HV	0.00	\$5,544.40	0.00	\$0.00	Replace	Check	X SUC
	BATTERY	0.00	\$278.00	0.00	\$0.00	Replace	Check	X SUC
82675-47160	TERMINAL, JUNCTION	0.00	\$51.90	0.00	\$0.00	Replace	Check	X SUC
74481-47050	BATTERY CLAMP	0.00	\$16.10	0.00	\$0.00	Replace	Check	X SUC
74440-47030	BATTERY TRAY	0.00	\$42.80	0.00	\$0.00	Replace	Check	X SUC
82164-47070	WIRE, FRAME	0.00	\$1,680.90	0.00	\$0.00	Replace	Check	X SUC
58327-47020	EXHAUST HEAT SHIELD, REAR	0.00	\$107.40	0.00	\$0.00	Replace	Check	X SUC
17430-37380	EXHAUST TAIL PIPE	0.00	\$656.20	0.00	\$0.00	Replace	Check	X SUC
17565-22030	SUPPORT, EXHAUST REAR	0.00	\$33.60	0.00	\$0.00	Replace	Check	X SUC
67005-47241	TAILGATE ASY	1.00	\$1,007.90	25.00	\$755.93	Replace	Replace	DEF
75573-47080	TAIL GATE DOOR GLASS MOULDING, RH	1.00	\$29.40	25.00	\$22.05	Replace	Replace	DEF
75574-47020	TAIL GATE DOOR GLASS MOULDING, LH	1.00	\$29.40	25.00	\$22.05	Replace	Replace	DEF
68105-47122	TAILGATE DOOR GLASS	1.00	\$1,090.90	25.00	\$818.18	Replace	Replace	DEF

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
65 Woodlands Industrial Park S4, Singapore 757108
Fax Number : 63955982
Estimate Telephone Number : 68608233
Accident Reporting Number : 68608272

Date Generated : 16/11/2019

User ID : Pnduan

75575-47030	MOULDING BACK WINDOW, LOWER NO.1	1.00	\$29.40	25.00	\$22.05	Replace	Replace	✓	NEC
64821-47030	TAILGATE LOWER WINDOW GLASS	1.00	\$721.30	25.00	\$540.98	Replace	Replace	✓	CRC
	SEALANT W/SCREEN	3.00	\$37.00	0.00	\$111.00	Replace	Replace	✓	NEC
85241-47030	ARM, RR WIPER	1.00	\$84.70	25.00	\$63.53	Replace	Replace	✓	DEF
85130-47021	MOTOR ASSY, RR WIPER	0.00	\$734.60	0.00	\$0.00	Replace	Check	X	SVC
85242-47040	BLADE ASSY, REAR WIPER	1.00	\$55.00	25.00	\$41.25	Replace	Replace	✓	NEC
82184-47370	WIRE, BACK DOOR, NO.1	0.00	\$582.40	0.00	\$0.00	Replace	Check	X	SVC
88810-47010	TAILGATE DOOR HINGE LH/RH	2.00	\$58.30	25.00	\$87.45	Replace	Replace	✓	BT
88980-0W532	TAILGATE DOOR STAY LH	1.00	\$241.50	25.00	\$181.13	Replace	Replace	✓	BT
88950-0W542	TAILGATE DOOR STAY RH	1.00	\$241.50	25.00	\$181.13	Replace	Replace	✓	BT
69350-47030	TAILGATE DOOR LOCK	1.00	\$444.10	25.00	\$333.08	Replace	Replace	✓	DEF
69415-47020	TAILGATE LOCK COVER	1.00	\$15.70	25.00	\$11.78	Replace	Replace	✓	DEF
69431-47010	STRIKER, BACK DOOR	1.00	\$48.90	25.00	\$36.68	Replace	Replace	✓	DEF
67881-47022	TAILGATE DOOR WEATHER STRIP	1.00	\$353.40	25.00	\$265.05	Replace	Replace	✓	DEF
67938-47031C0	TAILGATE TRIM, LH	1.00	\$85.90	25.00	\$64.43	Replace	Replace	✓	DEF
67937-47031C0	TAILGATE TRIM, RH	1.00	\$88.30	25.00	\$66.23	Replace	Replace	✓	DEF
67751-47040C0	TAILGATE TRIM, LOWER	1.00	\$180.70	25.00	\$135.53	Replace	Replace	✓	DEF
64790-47030C0	TAILGATE TRIM, UPPER	1.00	\$49.60	25.00	\$37.20	Replace	Replace	✓	DEF
67750-47071C0	TAILGATE, BOARD ASSY	1.00	\$246.90	25.00	\$185.18	Replace	Replace	✓	DEF
76801-47070-B0	TAILGATE OUTSIDE GARNISH	1.00	\$504.90	25.00	\$378.68	Replace	Replace	✓	DEF
75310-47020	EMBLEM REAR	1.00	\$60.30	25.00	\$45.23	Replace	Replace	✓	NEL
81271-53011	LICENSE PLATE LAMP	2.00	\$35.70	10.00	\$64.26	Replace	Replace	✓	DEF
88790-47040	CAMERA ASSY, TELEVISION, RR	0.00	\$1,438.60	0.00	\$0.00	Replace	Check	X	SVC
84840-28040	SWITCH ASSY, BACK DOOR OPENER	0.00	\$146.10	0.00	\$0.00	Replace	Check	X	SVC
75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	✓	NEL
75442-47030	NAME PLATE (PRIUS)	1.00	\$60.80	25.00	\$45.60	Replace	Replace	✓	NEL
75443-47030	NAME PLATE (TOYOTA)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	✓	NEL
	NUMBER PLATE	1.00	\$15.00	0.00	\$15.00	Replace	Replace	✓	NEL
	NUMBER PLATE FRAME	1.00	\$12.00	0.00	\$12.00	Replace	Replace	✓	NEL
	STICKER DECAL SMRT	1.00	\$7.80	0.00	\$7.80	Replace	Replace	✓	NEL
	STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	✓	NEL
81008-47011	3RD BRAKE LAMP	1.00	\$231.30	10.00	\$208.17	Replace	Replace	✓	NEL
76085-47910	SPOILER REAR	1.00	\$953.70	25.00	\$715.25	Replace	Replace	✓	DEF
63111-47030	ROOF PANEL	1.00	\$1,102.80	25.00	\$827.10	Replace	Replace	✓	DEF
75556-47030	MLDG DRIP LH, ROOF	0.00	\$78.80	0.00	\$0.00	Replace	Check	X	SVC
75555-47030	MLDG DRIP RH, ROOF	1.00	\$78.80	25.00	\$59.10	Replace	Replace	✓	DEF
63310-47080B0	ROOF LINING ASSY,	1.00	\$1,877.60	25.00	\$1,408.20	Replace	Replace	✓	DEF
61604-47090	FENDER RR/RH	1.00	\$766.80	25.00	\$575.10	Replace	Replace	✓	DEF
	STICKER DECAL SMRT	1.00	\$7.80	0.00	\$7.80	Replace	Replace	✓	NEL
	STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	✓	NEL
62710-47130	QUARTER GLASS RR/RH	1.00	\$846.50	25.00	\$634.88	Replace	Replace	✓	NEL

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
55 Woodlands Industrial Park East, Singapore 757708
Fax Number: 63855522
Estimate Telephone Number: 65450023
Accident Reporting Number: 68662872

Date Generated: 16/01/2019

User ID: Petrus

		SEALANT W/SCREEN	1.00	\$37.00	0.00	\$37.00	Replace	Replace	✓	NEC
	65637-47021	FENDER LINER RR/RH	1.00	\$141.30	25.00	\$105.98	Replace	Replace	✓	DEF
	61621-47030	TROUGH, BACK DOOR	0.00	\$110.90	0.00	\$0.00	Replace	Check	X	SVC
	52562-47010	TAIL LAMP BRACKET, RH	1.00	\$30.70	25.00	\$23.03	Replace	Replace	✓	DEF
	81551-47180	TAIL LAMP RH	1.00	\$557.80	10.00	\$502.02	Replace	Replace	✓	CRK
	61737-47020	REINFORCEMENT, ROOF	0.00	\$60.30	0.00	\$0.00	Replace	Check	X	
	61743-47010	REINFORCEMENT, BACK	0.00	\$89.50	0.00	\$0.00	Replace	Check	X	
	61625-47040	EXTENSION, QUARTER	0.00	\$55.70	0.00	\$0.00	Replace	Check	X	
	61623-47010	EXTENSION, QUARTER	0.00	\$83.50	0.00	\$0.00	Replace	Check	X	
	61713-47020	REINFORCE, ROOF SIDE	0.00	\$91.90	0.00	\$0.00	Replace	Check	X	SVC
	61731-47020	PANEL, ROOF SIDE	0.00	\$134.80	0.00	\$0.00	Replace	Check	X	
	88300-47130	ANTENNA ASSY, AMPLIFIER, NO.1	0.00	\$223.60	0.00	\$0.00	Replace	Check	X	
	86101-47820	CORD SUB-ASSY, ANTENNA, NO.4	0.00	\$190.80	0.00	\$0.00	Replace	Check	X	
	61733-47020	PANEL, ROOF SIDE INNER FRONT RH	0.00	\$134.80	0.00	\$0.00	Replace	Check	X	
	61711-47020	PANEL, ROOF SIDE OUTER RH	0.00	\$134.80	0.00	\$0.00	Replace	Check	X	
	61766-47020	REINFORCEMENT, BELT	0.00	\$103.20	0.00	\$0.00	Replace	Check	X	
	42611-47140	WHEEL DISC	0.00	\$1,484.20	0.00	\$0.00	Replace	Not Given	X	
		TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X	
	42450-47040	WHEEL HUB REAR	0.00	\$489.40	0.00	\$0.00	Replace	Not Given	X	
	61602-47091	FENDER RR/LH	0.00	\$766.80	0.00	\$0.00	Replace	Not Given	X	
		STICKER DECAL SMRT	0.00	\$7.80	0.00	\$0.00	Replace	Not Given	X	
		STICKER DECAL 6555 8888	0.00	\$21.60	0.00	\$0.00	Replace	Not Given	X	NN
	62720-47031	QUARTER GLASS RR/LH	0.00	\$188.10	0.00	\$0.00	Replace	Not Given	X	NN
		SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Not Given	X	NN
	61622-47030	TROUGH, BACK DOOR LH	0.00	\$110.90	0.00	\$0.00	Replace	Not Given	X	SVC
	52563-47010	TAIL LAMP BRACKET, LH	0.00	\$30.70	0.00	\$0.00	Replace	Not Given	X	SVC
	81561-47170	TAIL LAMP LH	0.00	\$548.40	0.00	\$0.00	Replace	Not Given	X	SVC
Total				\$43,688.15		\$14,816.54			668.03	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	
		61625-47040	EXTENSION, QUARTER	1.00	\$55.70	25.00	\$41.78	Replace	Replace	✓ DEF
		61623-47010	EXTENSION, QUARTER	1.00	\$83.50	25.00	\$62.63	Replace	Replace	✓ DEF
		82675-47180	TERMINAL JUNCTION	1.00	\$51.90	25.00	\$38.93	Replace	Replace	✓ DEF
		64910-47020-B0	COVER ASSY, TONNEAU	1.00	\$602.10	25.00	\$451.58	Replace	Replace	✓ M/S
		58490-47140B0	BOARD ASSY, RR RH	1.00	\$379.20	25.00	\$284.40	Replace	Replace	✓ DEF
		52563-47010	TAIL LAMP BRACKET, LH	1.00	\$30.70	25.00	\$23.03	Replace	Replace	✓ DEF
		G92F1-47010	DUCT, HYBRID BATTERY EXHAUST, NO.1	1.00	\$113.90	25.00	\$85.43	Replace	Replace	✓ DEF
			BATTERY	1.00	\$278.00	10.00	\$250.20	Replace	Replace	✓ CRK
		74481-47050	BATTERY CLAMP	1.00	\$16.10	25.00	\$12.08	Replace	Replace	✓ BT
		74440-47030	BATTERY TRAY	1.00	\$42.80	25.00	\$32.10	Replace	Replace	✓ CRK

	66790-47040	CAMERA ASSY, TELEVISION, RR	1.00	\$1,438.60	10.00	\$1,292.94	Replace	Replace	OK
	62940-16060	DUCT ASSY, QUARTER	1.00	\$70.40	25.00	\$52.80	Replace	Replace	MIS
	58327-47020	EXHAUST HEAT SHIELD, REAR	1.00	\$107.40	25.00	\$80.55	Replace	Replace	TN
	52470-47110B0	GARNISH ASSY, ROOF RH	1.00	\$256.40	25.00	\$192.30	Replace	Replace	BT
	65130-47021	MOTOR ASSY, RR WIPER	1.00	\$734.60	10.00	\$661.14	Replace	Replace	BT
	61607-47060	PANEL SUB-ASSY, QTR	1.00	\$588.40	25.00	\$441.30	Replace	Replace	DEF
	61621-47030	TROUGH, BACK DOOR	1.00	\$110.90	25.00	\$83.18	Replace	Replace	DEF
	61605-47010	PANEL SUB-ASSY, QTR	1.00	\$326.70	25.00	\$245.03	Replace	Replace	DEF
	61731-47020	PANEL, ROOF SIDE, / RH SIDE	1.00	\$134.80	25.00	\$101.10	Replace	Replace	DEF
	61713-47020	REINFORCE, ROOF SIDE	1.00	\$91.90	25.00	\$68.93	Replace	Replace	BT
	61743-47010	REINFORCEMENT, BACK	1.00	\$89.50	25.00	\$67.13	Replace	Replace	BT
	61766-47020	REINFORCEMENT, BELT	1.00	\$103.20	25.00	\$77.40	Replace	Replace	DEF
	6173747020	REINFORCEMENT, ROOF	1.00	\$60.30	25.00	\$45.23	Replace	Replace	DEF
Total				5,765.00		4,691.19			

3409.03

19,507.73

- 202

15,606.18

+ 1,600.00

+ 3,351.88

20,558.06

L/S \$20,550/-

CONFIRMED LUMP SUM REPAIR \$20,550.00 / 13 DAYS

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	TAX/11/10/2045	Date of Collection :	1 / 1
Vehicle No	SIB 1721 R	Date of Request	23 / 11 / 2008
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (if any)	85

PHOTO

5118-5121

5123-5124

5125-5126

5129-5131

5132-5134

S/N	Part Number	Part Description	Quantity	Unit Price
		BATTERY	1pc	/ CRK
		BATTERY CLAMP	1pc	/ BT
		BATTERY TRAY	1pc	/ CRK
		BOARD ASSY, REAR RH	1pc	DEF
		CAMERA ASSY, TELEVISION	1pc	/ CRK
		COVER ASSY, TONNEAU	1pc	/ MESSIAH

<<Please submit photographs for damaged parts>>

I, (Name)

NAR UKH

(Position)

N/A

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 1/5

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	TAX/11/10/2045	Date of Collection :	1 / 1
Vehicle No	SMB 1721 R	Date of Request	23 / 11 / 2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	8

S/N	Part Number	Part Description	Quantity	Unit Price
5137/5140		DOCT ASSY, QUARTER RH	1pc	MISSING
5141/5143		EXHAUST HEAT SHIELD, REAR	1pc	T.N.
5162/5163		EXHAUST TAIL PIPE	1pc	X. S.V.C.
5167/5171		GARNISH ASSY, ROOF RH	1pc	BT
5156/5157		MOTOR ASSY, REAR WIPER	1pc	BT
	61607-47060	PANEC SUB ASSY, OTR RH	1pc	DEF

<<<Please submit photographs for damaged parts>>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff :

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 2/5

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	TAX/11/10/2045	Date of Collection :	1 / 1
Vehicle No	SHB 1721 R	Date of Request	23 / 11 / 2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (if any)	8

S/N	Part Number	Part Description	Quantity	Unit Price
5158-5159		TAILLAMP BRACKET LH	1pc	/ DEF
5152		TROUGH, BACK DOOR RH	1pc	/ DEF
5156-5157	61605-4A010	PANEL SUB ASSY, OTR INNER RH	1pc	✓ DEF
5153-5154	61731-4A020	PANEL, ROOF SIDE RH	1pc	/ DEF
5153-5154	61713-4A020	REINFORCE, ROOF SIDE RH	1pc	/ BT
5153-5154	61743-4A010	REINFORCEMENT BACLE	1pc	/ BT

<<Please submit photographs for damaged parts>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are used for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 3/5

REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/4/10/2045	Date of Collection :	1 / 1
Vehicle No	SMB 1721 R	Date of Request	23 / 11 / 2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	8

S/N	Part Number	Part Description	Quantity	Unit Price
5150/5151	61766-47020	REINFORCEMENT BELT RH	1pc	DEF
5150/5151	61737-47020	REINFORCEMENT ROOF RH	1pc	DEF
5150/5151	61625-47040	Extension / QUARTER REAR RH	1pc	DEF
5150/5151	61623-47010	Extension / QUARTER FRONT RH	1pc	DEF
5182, 5183, 5184	82625-47160	TERMINAL / JUNCTION	1pc	DEF
5173, 5174, 5175	67211-47010	DUCT, HYBRID BATTERY, EXHAUST NO.1	1pc	DUCT. DEF

<<Please submit photographs for damaged parts>>>

BATTERY. DEF

EXHAUST X SUC

I, (Name)

(Position)

do solemnly and sincerely declare that:- Supplementary Parts are used for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	TAX/11/10/2045	Date of Collection	1 / 1
Vehicle No	SHB 1721 R	Date of Request	23 / 11 / 2008
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	8

S/N	Part Number	Part Description	Quantity	Unit Price
	LABOUR	TO REMOVE & REFIX EXHAUST		\$ 120.30
	TO	REQUEST ADDITIONAL REPAIR DAYS		

<<Please submit photographs for damaged parts>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are used for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 5/5

~~TOP PLATED PURPOSE~~

(/en) » Genuine Parts Catalogs (/en/catalog/genuine) » Toyota (/en/catalog/genuine/locate?c=Toyota)
 » PRIUS ZVW30R-AHXEBW ZVW30 (/en/catalog/genuine/vehicle?c=Toyota&ssd=%24%2ANCUDVX18B...
 24&ssd=0&cid=38&=JTDKN36U405719180)
 » SIDE MEMBER

Catalog


Brand	Name	Code
 TOYOTA	Toyota	TOYOTA00

Model

Name	PRIUS
Model	ZVW30R-AHXEBW
Description	ZVW30
Date	11.2013
Framecolor	3R9
Trimcolor	FA20
ProdPeriod	04.2009 - 11.2015
Options	ATMATEM AUTOMATIC TRANSMISSION
Info	☐

SIDE MEMBER

Number	Name	Cod
6115147030 (/en/search/search?c=6115147030&q=1)	PILLAR, FRONT BODY, UPPER OUTER RH	6115
6121747010 (/en/search/search?c=6121747010&q=1)	RAIL, ROOF SIDE, OUTER NO.4 RH	6121
6177728030 (/en/search/search?c=6177728030&q=1)	RETAINER, BACK DOOR SIDE STOPPER, RH	6177
6098147020 (/en/search/search?c=6098147020&q=1)	RETAINER, BACK DOOR STAY, RH	6098
6274347020 (/en/search/search?c=6274347020&q=1)	PROTECTOR, QUARTER PANEL, FRONT RH	6274
6160147090 (/en/search/search?c=6160147090&q=1)	PANEL, QUARTER, RH	6160
6162347010 (/en/search/search?c=6162347010&q=1)	EXTENSION, QUARTER PANEL, FRONT RH	6162
6162547040 (/en/search/search?c=6162547040&q=1)	EXTENSION, QUARTER PANEL, REAR RH	6162
6171347020 (/en/search/search?c=6171347020&q=1)	REINFORCE, ROOF SIDE, OUTER RH	6171
6171147020 (/en/search/search?c=6171147020&q=1)	PANEL, ROOF SIDE, OUTER RH	6171
6167134010 (/en/search/search?c=6167134010&q=1)	PLATE, NOISE CONTROL, NO.1	6167
6120147020 (/en/search/search?c=6120147020&q=1)	RAIL, ROOF SIDE, OUTER RH	6120
6172047020 (/en/search/search?c=6172047020&q=1)	PANEL, ROOF SIDE, INNER FRONT RH	6172

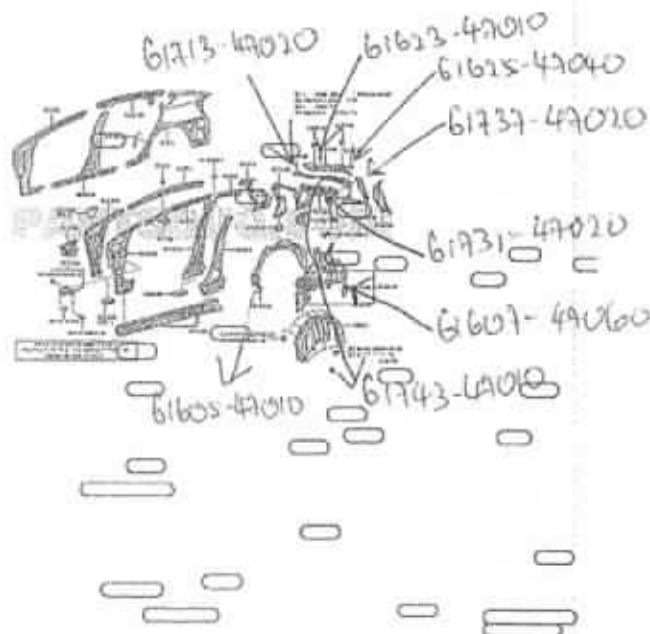



Case Details

Case Reference Number : TAX11182045

Type of Repair : Accident Repair

Vehicle Registration Number : SHB1721R

Company Type : SMRT Taxis Pte Ltd

Estimation ID : EST-4551-ID

Assigned By : Kok Wan Wing

Insurance Company Name : Sampo Insurance Singapore Pte

Ltd

Accident Date and Time : 09/11/2018 03:28 AM

Vehicle Age(In Months) : 52

Documents / Photographs

View Documents / Photographs

Total Documents : 1

Estimation Details

Spares Part's Cost Detail

BOM Type	Coating Type	Position	SMRT Recommendation					Surveyor Approval					Repair/Replace
			Material Number	Part Name	Qty	List Price Per Unit(S)	List Price(S)	Dis(%)	Final Price(S)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(S)	
One Time Key In	Main			BUMPER REAR	1	468.00	468.00	25.00	343.90	Replace	1	343.90	Replace • /DEF
One Time Key In	Main			BUMPER CLIPS	10	1.31	13.10	25.00	12.88	Replace	10	12.88	Replace • /NEC
One Time Key In	Main			PISEL STICKER	2	60.00	120.00	0.00	120.00	Replace	2	120.00	Replace • /NEC
One Time Key In	Main			BUMPER REINFORCEMENT REAR	1	206.70	206.70	25.00	154.27	Replace	1	154.27	Replace • /BT
One Time Key In	Main			ARM SUB-ASSY, RR BUMPER RH	1	139.80	139.80	25.00	104.70	Replace	1	104.70	Replace • /BT
One Time Key In	Main			ARM SUB-ASSY, RR BUMPER LH	1	139.80	139.80	25.00	104.70	Replace	0	0	Check • ? SWL
One Time Key In	Main			ANTENNA, ELECTRICAL LOWER REAR	1	147.40	147.40	15.00	124.66	Replace	1	124.66	Replace • /NEC
One Time Key In	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace • /BT
One Time Key In	Main			BUMPER SIDE RETAINER RSLH	1	94.80	94.80	25.00	71.10	Replace	0	0	Check • ? SWL
One Time Key In	Main			BUMPER SIDE RETAINER RHRR	1	94.80	94.80	25.00	71.10	Replace	1	71.10	Replace • /CRK
One Time Key In	Main			BUMPER SEAL, RR LH	1	85.80	85.80	25.00	65.58	Replace	1	65.58	Replace • /NEC
One Time Key In	Main			BUMPER SEAL, RR RH	1	85.70	85.70	25.00	65.28	Replace	1	65.28	Replace • /NEC
One Time Key In	Main			BUMPER LIP COVER RSLH	1	72.20	72.20	25.00	54.15	Replace	1	54.15	Replace • /CRK
One Time Key In	Main			BUMPER LIP COVER RHRR	1	116.10	116.10	25.00	88.57	Replace	1	88.57	Replace • /CRK
One Time Key In	Main			BUMPER LIP REAR	1	228.90	228.90	25.00	171.68	Replace	1	171.68	Replace • /CRK
One Time Key In	Main			UNDER COVER CENTER REAR	1	214.00	214.00	25.00	159.98	Replace	1	159.98	Replace • /CRK
One Time Key In	Main			END PANEL	1	602.10	602.10	25.00	451.58	Replace	1	451.58	Replace • /DD
One Time Key In	Main			END PANEL COVER, DECK TRIM HOLE	1	45.10	45.10	25.00	34.58	Replace	1	34.58	Replace • /DEF
One Time Key In	Main			END PANEL COVER, DECK TRIM RH	1	121.10	121.10	25.00	90.82	Replace	1	90.82	Replace • /DEF
One Time Key In	Main			SEALANT SHAPLEX	1	37.00	37.00	0.00	37.00	Replace	1	37.00	Replace • /NEC
One Time Key In	Main			BOX, DECK FLOOR, RH	1	448.70	448.70	25.00	337.28	Replace	1	337.28	Replace • /DEF
Total Spare Part Cost										35,285.18	Surveyor Total	18,907.89	
Lump Sum Discount (%)										30.00	Lump Sum Dis (%)	25	
Final Spare Part Cost										27,616.89	Final Sur Total	15,525.89	

SMRT Recommendation										Surveyor Approval			
BOM Type	Cooling Type	Position	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Disc(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace
One Time Key In	Main			BOX RR FLOOR BOARD	1	875.80	875.80	25.00	656.85	Replace			Replace + DEF
One Time Key In	Main			BOARD, RR FLOOR	1	288.20	288.20	25.00	216.15	Replace	1	216.15	Replace + DBP
One Time Key In	Main			BOX, DECK FLOOR, COVER LH	1	222.70	222.70	25.00	167.03	Replace	1	172.87	Replace + ?
One Time Key In	Main			BOX, DECK FLOOR, LH	1	186.80	186.80	25.00	140.10	Replace	2	2	Check + ?
One Time Key In	Main			SPACER, RR FLOOR	1	130.60	130.60	25.00	97.95	Replace	2	2	Check + ?
One Time Key In	Main			BOARD ASSY, RR RH	1	279.20	279.20	25.00	209.40	Replace	2	2	Check + ?
One Time Key In	Main			PANEL ASSY, DECK LH	1	327.00	327.00	25.00	245.25	Replace	2	2	Check + ?
One Time Key In	Main			PANEL ASSY, DECK RH	1	327.00	327.00	25.00	245.25	Replace	1	245.25	Replace + DEF
One Time Key In	Main			COVER ASSY, TONNEAU	1	402.10	402.10	25.00	301.58	Replace	2	2	Check + DEF?
One Time Key In	Main			GARNISH ASSY, ROOF RH	1	206.40	206.40	25.00	152.30	Replace	2	2	Check + ?
One Time Key In	Main			GARNISH SIDE UPPER, LHR	1	281.70	281.70	25.00	211.28	Replace	2	2	Check + ?
One Time Key In	Main			SPARE TYRE PANEL	1	667.70	667.70	25.00	500.78	Replace	1	500.78	Replace + DEF
One Time Key In	Main			CUSHION, SPARE WHEEL	1	236.80	236.80	25.00	177.60	Replace	1	172.18	Replace + DEF
One Time Key In	Main			CARRIER, SPARE	1	18.70	18.70	25.00	14.03	Replace	2	2	Check + ?
One Time Key In	Main			PROTECTOR, SPARE	1	143.20	143.20	25.00	107.40	Replace	2	2	Check + ?
One Time Key In	Main			MEMBER SUB-ASSY, RR LH	1	174.10	174.10	25.00	130.58	Replace	2	2	Check + ?
One Time Key In	Main			MEMBER SUB-ASSY, RR RH	1	174.10	174.10	25.00	130.58	Replace	1	130.58	Replace + ST
One Time Key In	Main			FLOOR PANEL, RRHH	1	276.80	276.80	25.00	207.60	Replace	1	157.42	Replace + DBP
One Time Key In	Main			FLOOR PANEL, RRHH	1	103.80	103.80	25.00	77.85	Replace	2	2	Check + ?
One Time Key In	Main			REINFORCEMENT, RR	2	24.80	49.60	25.00	37.20	Replace	2	2	Check + Agree?
One Time Key In	Main			PANEL SUB-ASSY, QTR	1	226.70	226.70	25.00	170.03	Replace	2	2	Check + ?
One Time Key In	Main			PANEL SUB-ASSY, QTR	1	396.40	396.40	25.00	297.30	Replace	2	2	Check + ?
One Time Key In	Main			PANEL SUB-ASSY, QTR WHEELHOUSE	1	588.40	588.40	25.00	441.30	Replace	1	441.30	Replace + ?
One Time Key In	Main			DUCT ASSY, QUARTER	1	75.40	75.40	25.00	56.55	Replace	1	56.55	Replace + ?
One Time Key In	Main			BLOCK ASSY, FURBULE	1	188.40	188.40	10.00	169.56	Replace	2	2	Check + ?
One Time Key In	Main			WIRE, FLOOR	1	1,675.00	1,675.00	10.00	1,507.50	Replace	2	2	Check + ?
One Time Key In	Main			WIRE, FLOOR, NO.2	1	1,305.40	1,305.40	10.00	1,174.86	Replace	2	2	Check + ?
One Time Key In	Main			WIRE, ENGINE, NO.2	1	74.00	74.00	10.00	66.60	Replace	2	2	Check + ?
Total Spare Part Cost											Surveyor Total	16,967.42	
Lump Sum Discount (%)										20.00	Lump Sum Dis (%)	20	
Final Spare Part Cost										27,215.88	Final Sur Total	13,325.98	

BOM Type	Coating Type	Portion	Material Number	SMRT Recommendation					Surveyor Approval			
				Part Name	Qty	List Price Per Unit(S)	List Price(S)	Qty(%)	Final Price(S)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(S)
One Time Key In	Main			THERMISTOR ASSY	1	107.00	107.00	10.00	96.00	Replace	0	0
One Time Key In	Main			BATTERY ASSY, HV	1	3,044.40	3,044.40	10.00	2,989.99	Replace	0	0
One Time Key In	Main			BATTERY	1	279.00	279.00	10.00	250.00	Replace	0	0
One Time Key In	Main			TERMINAL, JUNCTION	1	91.00	91.00	25.00	68.25	Replace	0	0
One Time Key In	Main			BATTERY CLAMP	1	16.10	16.10	25.00	12.08	Replace	0	0
One Time Key In	Main			BATTERY TRAY	1	42.90	42.90	25.00	32.18	Replace	0	0
One Time Key In	Main			WIRE FRAME	1	1,690.00	1,690.00	25.00	1,267.50	Replace	0	0
One Time Key In	Main			EXHAUST HEAT SHIELD, REAR	1	107.40	107.40	25.00	80.55	Replace	0	0
One Time Key In	Main			EXHAUST TAIL PIPE	1	696.20	696.20	25.00	522.15	Replace	0	0
One Time Key In	Main			SUPPORT, EXHAUST REAR	1	23.80	23.80	25.00	17.85	Replace	0	0
One Time Key In	Main			TAILGATE ASY	1	1,007.80	1,007.80	25.00	755.85	Replace	1	755.85
One Time Key In	Main			TAILGATE DOOR GLASS MOULDING, RH	1	22.40	22.40	25.00	16.80	Replace	1	22.00
One Time Key In	Main			TAILGATE DOOR GLASS MOULDING, LH	1	22.40	22.40	25.00	16.80	Replace	1	22.00
One Time Key In	Main			TAILGATE DOOR GLASS	1	1,090.00	1,090.00	25.00	817.50	Replace	1	816.18
One Time Key In	Main			MOULDING BACK WINDOW, LOWER NO.1	1	22.40	22.40	25.00	16.80	Replace	1	22.00
One Time Key In	Main			TAILGATE LOWER WINDOW GLASS	1	721.20	721.20	25.00	540.90	Replace	1	540.27
One Time Key In	Main			SEALANT W/SCREEN	2	27.00	111.00	25.00	111.00	Replace	2	111.00
One Time Key In	Main			ARM, RR WIPER	1	64.70	64.70	25.00	48.52	Replace	1	53.22
One Time Key In	Main			MOTOR ASY, RR WIPER	1	724.80	724.80	10.00	651.14	Replace	0	0
One Time Key In	Main			BLADE ASY, REAR WIPER	1	65.00	65.00	25.00	48.75	Replace	1	41.20
One Time Key In	Main			WIRE, BACK DOOR, NO.1	1	682.40	682.40	10.00	624.74	Replace	0	0
One Time Key In	Main			TAILGATE DOOR HINGE L/RHH	2	68.90	137.80	25.00	103.45	Replace	2	87.46
One Time Key In	Main			TAILGATE DOOR STAY LH	1	241.00	241.00	25.00	180.75	Replace	1	181.13
One Time Key In	Main			TAILGATE DOOR STAY RH	1	241.00	241.00	25.00	180.75	Replace	1	181.13
One Time Key In	Main			TAILGATE DOOR LOCK	1	444.10	444.10	25.00	333.08	Replace	1	332.08
One Time Key In	Main			TAILGATE LOCK COVER	1	15.70	15.70	25.00	11.77	Replace	1	11.77
One Time Key In	Main			STRIKER, BACK DOOR	1	48.90	48.90	25.00	36.67	Replace	1	36.27
One Time Key In	Main			TAILGATE DOOR WEATHER STRIP	1	353.40	353.40	25.00	265.05	Replace	1	265.05
Total Spare Part Cost: 35,280.18										Surveyor Total	16,907.49	
Lump Sum Discount (%) 20.00										Lump Sum Dis (%)	20	
Final Spare Part Cost: 27,813.66										Final Sur Total	15,525.99	

BOM Type	Cooling Type	Portion	Material Number	SMRT Recommendation						Surveyor Approval			
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace
One Time Bay In	Main			TAILGATE TRIM LH	1	\$5.50	\$5.50	25.00	\$4.13	Replace	1	\$4.13	Replace • DEF
One Time Key In	Main			TAILGATE TRIM RH	1	\$5.50	\$5.50	25.00	\$4.13	Replace	1	\$4.13	Replace • DEF
One Time Key In	Main			TAILGATE TRIM LOWER	1	185.70	185.70	25.00	139.28	Replace	1	139.28	Replace • DEF
One Time Key In	Main			TAILGATE TRIM UPPER	1	45.50	45.50	25.00	34.13	Replace	1	34.13	Replace • DEF
One Time Key In	Main			TAILGATE BOARD ASSEY	1	245.90	245.90	25.00	184.43	Replace	1	184.43	Replace • DEF
One Time Key In	Main			TAILGATE OUTSIDE GARNISH	1	\$24.50	\$24.50	25.00	18.38	Replace	1	18.38	Replace • DEF
One Time Key In	Main			EMBLEM REAR	1	\$5.20	\$5.20	25.00	\$3.90	Replace	1	\$3.90	Replace • NEC
One Time Key In	Main			LICENSE PLATE LAMP	2	\$5.70	11.40	15.00	\$9.69	Replace	2	\$19.38	Replace • DEF
One Time Key In	Main			CAMERA ASSEY, TELEVISION, AN	1	1,435.80	1,435.80	15.00	1,220.43	Replace	1	1,220.43	Replace • DEF?
One Time Key In	Main			SWITCH ASSEY, BACK DOOR OPENER	1	145.10	145.10	15.00	123.34	Replace	1	123.34	Replace • NEC?
One Time Key In	Main			NAME PLATE (HYBRID)	1	\$1.50	\$1.50	25.00	\$1.13	Replace	1	\$1.13	Replace • NEC
One Time Key In	Main			NAME PLATE (PHEV)	1	\$5.50	\$5.50	25.00	\$4.13	Replace	1	\$4.13	Replace • NEC
One Time Key In	Main			NAME PLATE (TOYOTA)	1	\$1.50	\$1.50	25.00	\$1.13	Replace	1	\$1.13	Replace • NEC
One Time Key In	Main			NUMBER PLATE	1	15.00	15.00	5.00	14.25	Replace	1	14.25	Replace • NEC
One Time Key In	Main			NUMBER PLATE FRAME	1	12.00	12.00	5.00	11.40	Replace	1	11.40	Replace • NEC
One Time Key In	Main			STICKER DECAL SWRT	1	7.50	7.50	5.00	7.13	Replace	1	7.13	Replace • NEC
One Time Key In	Main			STICKER DECAL 8888 8888	1	21.50	21.50	5.00	20.43	Replace	1	20.43	Replace • NEC
One Time Key In	Main			UND BRAKE LAMP	1	225.30	225.30	15.00	191.51	Replace	1	191.51	Replace • NEC
One Time Key In	Main			SPOILER REAR	1	\$53.70	\$53.70	25.00	40.28	Replace	1	40.28	Replace • DEF
One Time Key In	Main			ROOF PANEL	1	1,122.80	1,122.80	25.00	842.10	Replace	1	842.10	Replace • DEF
One Time Key In	Main			WLDG DRIP LH/ROOF	1	75.50	75.50	25.00	56.63	Replace	0	0	Check • ?
One Time Key In	Main			WLDG DRIP RH/ROOF	1	75.50	75.50	25.00	56.63	Replace	1	56.63	Replace • DEF
One Time Key In	Main			ROOF LINING ASSEY	1	1,477.50	1,477.50	25.00	1,108.13	Replace	1	1,108.13	Replace • DEF
One Time Key In	Main			FENDER RAMP	1	755.50	755.50	25.00	566.63	Replace	1	566.63	Replace • DEF
One Time Key In	Main			STICKER DECAL SWRT	1	7.50	7.50	5.00	7.13	Replace	1	7.13	Replace • NEC
One Time Key In	Main			STICKER DECAL 8888 8888	1	21.50	21.50	5.00	20.43	Replace	1	20.43	Replace • NEC
One Time Key In	Main			QUARTER GLASS RH/RH	1	\$54.50	\$54.50	25.00	\$40.88	Replace	1	\$40.88	Replace • NEC
One Time Key In	Main			SEALANT W/SCREEN	1	27.00	27.00	5.00	25.65	Replace	1	25.65	Replace • NEC
						Total Spare Part Cost	35,288.15			Surveyor Total	15,907.48		
						Lump Sum Discount (%)	20.00			Lump Sum Dis (%)	20		
						Final Spare Part Cost	27,512.92			Post Sur Total	15,925.85		

BOM Type	Coating Type	Portion	SMRT Recommendation										Surveyor Approval		Repair/Replace
			Material Number	Part Name	Qty	List Price Per Unit(S)	List Price(S)	Disc(S)	Final Price(S)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(S)			
One Time Key In	Main			FENDER LINER REAR	1	141.00	141.00	33.00	108.00	Replace	1	108.00	Replace		DEF
One Time Key In	Main			TROUGH BACK DOOR	1	110.00	110.00	33.00	77.00	Replace	0	0	Check		REAR ?
One Time Key In	Main			TAIL LAMP BRACKET, RH	1	33.00	30.70	33.00	33.00	Replace	1	33.00	Replace		DEF
One Time Key In	Main			TAIL LAMP RH	1	927.00	927.00	10.00	917.00	Replace	1	917.00	Replace		CON
One Time Key In	Main			REINFORCEMENT, ROOF	1	80.00	80.00	35.00	45.00	Replace	0	0	Check		?
One Time Key In	Main			REINFORCEMENT, BACK	1	86.00	86.00	35.00	51.00	Replace	0	0	Check		?
One Time Key In	Main			EXTENSION, QUARTER	1	55.00	55.00	35.00	20.00	Replace	0	0	Check		?
One Time Key In	Main			EXTENSION, QUARTER	1	45.00	45.00	35.00	10.00	Replace	0	0	Check		?
One Time Key In	Main			REINFORCE, ROOF SIDE	1	91.00	91.00	35.00	56.00	Replace	0	0	Check		?
One Time Key In	Main			PANEL, ROOF SIDE,	1	134.00	134.00	35.00	99.00	Replace	0	0	Check		?
One Time Key In	Main			ANTENNA ASBY, AMPLIFIER, NO.1	1	223.00	223.00	10.00	213.00	Replace	0	0	Check		?
One Time Key In	Main			CORD SUB-ASBY, ANTENNA, NO.4	1	190.00	190.00	10.00	180.00	Replace	0	0	Check		?
One Time Key In	Main			PANEL, ROOF SIDE INNER FRONT RH	1	104.00	104.00	35.00	69.00	Replace	0	0	Check		?
One Time Key In	Main			PANEL, ROOF SIDE OUTER RH	1	104.00	104.00	35.00	69.00	Replace	0	0	Check		?
One Time Key In	Main			REINFORCEMENT, BELT	1	103.00	103.00	35.00	68.00	Replace	0	0	Check		?
One Time Key In	Main			WHEEL DISC	1	1,494.00	1,494.00	25.00	1,469.00	Replace	0	0	Not Give		X 1000 LUL
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give		X 300
One Time Key In	Main			WHEEL HUB REAR	1	485.40	485.40	25.00	460.40	Replace	0	0	Not Give		X 300
One Time Key In	Main			FENDER BULB	1	790.00	790.00	33.00	757.00	Replace	0	0	Not Give		X 300
One Time Key In	Main			STICKER DECAL SMRT	1	7.00	7.00	0.00	7.00	Replace	0	0	Not Give		X 100
One Time Key In	Main			STICKER DECAL 855 855	1	21.00	21.00	0.00	21.00	Replace	0	0	Not Give		X 100
One Time Key In	Main			QUARTER GLASS RSLH	1	194.10	194.10	35.00	159.10	Replace	0	0	Not Give		X 100
One Time Key In	Main			SEALANT W/SCREEN	1	37.00	37.00	0.00	37.00	Replace	0	0	Not Give		X 100
One Time Key In	Main			TROUGH BACK DOOR LH	1	110.00	110.00	33.00	77.00	Replace	0	0	Not Give		X 100
One Time Key In	Main			TAIL LAMP BRACKET, LH	1	33.00	30.70	33.00	33.00	Replace	0	0	Not Give		X 300
One Time Key In	Main			TAIL LAMP LH	1	949.40	949.40	10.00	939.40	Replace	0	0	Not Give		X 300
Total Spare Part Cost											Surveyor Total	16,807.40			
Lump Sum Discount (%)											Lump Sum Dis (%)	30			
Final Spare Part Cost											Final Sum Total	11,765.18			

Labour's Cost Detail

S.No.	Job Scope	SMRT Recommendation(S)	Surveyor Adjustment(S)	Remarks
Total:		2,408.00	3,320.00	

S.No.	Job Scope	SMRT Recommendation(S)	Surveyor Adjustment(S)	Remarks
1	TO REPAIR REAR PORTION	2,820.00	1,600	
Total:		1,600.00	3,420.00	

Bumper Coat Detail

S.No.	Job Scope	SMRT Recommendation(S)	Surveyor Adjustment(S)	Remarks
1	TO RESPRAY REAR BUMPER	275.00	200	
2	TO RESPRAY BUMPER BEAM	180.00	80	
3	TO RESPRAY REAR PANEL	180.00	100	
4	TO RESPRAY REAR SPARE TYRE PANEL	180.00	100	
5	TO RESPRAY REAR MEMBER LH	180.00	0	CHECK
6	TO RESPRAY REAR MEMBER RH	180.00	100	
7	TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00	0	CHECK
8	TO RESPRAY REAR FLOOR SIDE PANEL RH	180.00	100	
9	TO RESPRAY REAR RH WHEEL HOUSE	180.00	100	
10	TO RESPRAY TAIL GATE	375.00	200	
11	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100	
12	TO RESPRAY REAR SPOILER	180.00	80	
13	TO RESPRAY PANEL ROOF	375.00	200	
14	TO RESPRAY REAR FENDER RH	275.00	200	
15	TO RESPRAY THROUGH BACK DOOR RH	180.00	50	
16	TO RESPRAY RM	180.00	0	RM
17	TO RESPRAY REAR FENDER LH	275.00	0	RM
18	TO RESPRAY THROUGH BACK DOOR LH	180.00	0	RM
Total:		4,320.00	1,810.00	

Other Cost Detail

S.No.	Job Scope	SMRT Recommendation(S)	Surveyor Adjustment(S)	Remarks
1	TOWING CHARGE	125.00	0	
2	TO APPLY RUST PROOFING ON AFFECTED AREA	200.00	100	
3	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	50	
4	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0	RM
5	TO CHECK & RESET SYSTEM FUNCTION	300.00	30	
6	TO REMOVE / REFIT SEAT	120.00	30	
7	TO REMOVE & REFIT EXHAUST	100.00	0	CHECK
8	TO REMOVE & REFIT ROOF LIVING	120.00	30	
9	TO ALIGN CHASSIS	360.00	100	
Total:		4,227.50	1,601.00	

S.No.	Job Scope	\$SMT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
10	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	755.00	755.00	NEC
11	TO REMOVE & REFIT REAR QUARTER GLASS RH	100.00	30	
12	TO REMOVE & REFIT REAR QUARTER GLASS LH	120.00	0	NH
13	TO TRANSFER REAR TAILGATE MECHANISM	120.00	80	
14	TO REMOVE AND REFIT WIRE HARNESS	350.00	0	CHECK
15	TO REMOVE AND REFIT REAR WINDSCREEN	340.00	120	
16	TO TEST AND REFIX REVERSE SENSOR SYSTEM	100.00	20	
17	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	100.00	80	
18	TO REMOVE AND REFIT TYRE BAR (SPRAYING PURPOSE)	120.00	0	NH
19	TO REMOVE AND REFIT BATTERY ASSEMBLY	350.00	0	CHECK
20	TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	296.88	296.88	NEC
21	TO WASH AND VACUUM	60.00	0	NH
22	TO REPLACE SUNSHY PARTS	100.00	0	NH
Total:		4,227.88	1,601.88	

Summary

	Estimator Assessment(\$)	Surveyor Assessment(\$)
Total Spare Part Detail	27,510.58	13,525.58
Total Labour Cost	2,538.50	2,585.00
Total Spray Painting	4,200.00	1,810.00
Other	4,227.88	1,601.88
Quoted Total	38,476.96	19,522.47
Lump Sum Repair Option	-	-
Lump Sum Total	38,476.96	19,522.47
Surveyor Approved Amount	-	18,900.00
No. of Repair Days*	18	8
Remarks		LUMP SUM REPAIR 8 DAYS CHECK ITEMS PHOTOS AFTER REPAIR PHOTOS
Surveyor Name		NH
Signature		

Survey Date

20/11/2018

NAZ LKK

20/11/18

LIS

8 DAYS

CHECK ITEMS PHOTOS

AFTER REPAIR PHOTOS

https://vacswb.smr.com.sg/Estimation.aspx

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	15 Nov 2018		20 Nov 2018 09:05 Edit Adj Rpt	S\$20,550.00 Edit Estimates	S\$20,550.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: KIM SING SCAFFOLDING PTE LTD , Co. Reg. No.: 201221899M									
Main Claimant: SMRT TAXIS PTE LTD , Co. Reg. No.: 198905369K									
Vehicle Reg. No.: SHB1721R		Date of Loss: 09/11/2018 11:00 - :59 [51 Months and 17 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / CMTD1805035		Policy/Cover Note No.: D18MTPCvE000637 (Third Party Only)							
Vehicle Reg. No. (Insured): YL93265		Policy No. (Claimant):							
		Excess:							
Repairer: Smrt Automotive Services Pte Ltd (HQ) No. 61 Woodlands Industrial Park E9, #04-04 Premium Building, 757047 Woodlands - Tel:									
Handling Insurer: Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Thelma Choo - 6322 4681]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Muhammad Nazril Bin Abdullah] ... [Final Rpt due 29/11/2018]									
Driver/Custodian (Insured): KARUPPIAH ALAGARSAMY () , NRIC: F8128905X, Tel: +6583790424 Email:									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SHB1721R (CMTD1805035)
[YL9326S]

TP

SMRT TAXIS PTE LTD

Nov 9 2018 11:00AM

[KIM SING SCAFFOLDING PTE LTD]
Smrt Automotive Services Pte Ltd

Upload Documents Upload Photos Compose New Letter

View View in Browser

Assessment Reports				1 per page	☒
No	Finalized On	Sompo Insurance Singapore Pte. Ltd. (HQ)		Thumbnail	Print
1	20/11/18 09:04	Accident Statement From: SC - Reg. No: YL9326S, Claimant: KIM SING SCAFFOLDING PTE LTD	1	Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	30/11/18 17:48	Adjuster Immediate Advice	1	Load HTM	
Photos/Images				3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	18/03/19 17:16	General View	1	Load JPG	☒
2	18/03/19 17:16	General View	1	Load JPG	☒
3	18/03/19 17:16	General View	1	Load JPG	☒
4	18/03/19 17:16	General View	1	Load JPG	☒
5	18/03/19 17:16	General View	1	Load JPG	☒
6	18/03/19 17:16	General View	1	Load JPG	☒
7	18/03/19 17:16	General View	1	Load JPG	☒
8	18/03/19 17:16	General View	1	Load JPG	☒
9	18/03/19 17:16	General View	1	Load JPG	☒
10	18/03/19 17:16	General View	1	Load JPG	☒
11	18/03/19 17:16	General View	1	Load JPG	☒
12	18/03/19 17:16	General View	1	Load JPG	☒
13	18/03/19 17:16	General View	1	Load JPG	☒
14	18/03/19 17:16	General View	1	Load JPG	☒
15	18/03/19 17:16	General View	1	Load JPG	☒
16	18/03/19 17:16	General View	1	Load JPG	☒
17	18/03/19 17:16	General View	1	Load JPG	☒
18	18/03/19 17:16	General View	1	Load JPG	☒
19	18/03/19 17:16	General View	1	Load JPG	☒
20	18/03/19 17:16	General View	1	Load JPG	☒
21	18/03/19 17:16	General View	1	Load JPG	☒
22	18/03/19 17:16	General View	1	Load JPG	☒
23	18/03/19 17:16	General View	1	Load JPG	☒
24	18/03/19 17:16	General View	1	Load JPG	☒
25	18/03/19 17:16	General View	1	Load JPG	☒
26	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
27	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
28	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
29	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
30	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
31	18/03/19 17:16	Dismantled Parts	1	Load JPG	☒
32	18/03/19 17:16	Dismantled Parts		Load JPG	

Assessment Reports			1 per page	☒
No	Finalized On	Sompo Insurance Singapore Pte. Ltd. (HQ)	Thumbnail	Print
				☒
33	18/03/19 17:16	Dismantled Parts	Load JPG	☒
34	18/03/19 17:16	Dismantled Parts	Load JPG	☒
35	18/03/19 17:16	Dismantled Parts	Load JPG	☒
36	18/03/19 17:16	Dismantled Parts	Load JPG	☒
37	18/03/19 17:16	Dismantled Parts	Load JPG	☒
38	18/03/19 17:17	Dismantled Parts	Load JPG	☒
39	18/03/19 17:17	Dismantled Parts	Load JPG	☒
40	18/03/19 17:17	Photo After Spray	Load JPG	☒
41	18/03/19 17:17	Photo After Spray	Load JPG	☒
42	18/03/19 17:17	Photo After Spray	Load JPG	☒
43	18/03/19 17:17	Photo After Spray	Load JPG	☒
44	18/03/19 17:17	Photo After Spray	Load JPG	☒
45	18/03/19 17:17	Photo After Spray	Load JPG	☒
46	18/03/19 17:17	Photo After Spray	Load JPG	☒
47	18/03/19 17:17	Photo After Spray	Load JPG	☒
48	18/03/19 17:17	Photo After Spray	Load JPG	☒
49	18/03/19 17:17	Photo After Spray	Load JPG	☒
50	18/03/19 17:17	Photo After Spray	Load JPG	☒
51	18/03/19 17:17	Photo After Spray	Load JPG	☒
52	18/03/19 17:17	Photo After Spray	Load JPG	☒
53	18/03/19 17:17	Photo After Spray	Load JPG	☒
54	18/03/19 17:17	Photo After Spray	Load JPG	☒
55	18/03/19 17:17	Photo After Spray	Load JPG	☒
56	18/03/19 17:17	Photo After Spray	Load JPG	☒
57	18/03/19 17:17	Photo After Spray	Load JPG	☒
58	18/03/19 17:17	Photo After Spray	Load JPG	☒
59	18/03/19 17:17	Photo After Spray	Load JPG	☒
60	18/03/19 17:17	Photo After Spray	Load JPG	☒
61	18/03/19 17:17	Photo After Spray	Load JPG	☒
62	18/03/19 17:17	Photo After Spray	Load JPG	☒
63	18/03/19 17:17	Photo After Spray	Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Sompo Insurance Singapore Pte. Ltd. (HQ)	Thumbnail	Print
1	19/11/18 14:36	TP - SMRT Automotive Services PTE LTD	Load PDF	
2	19/11/18 14:36	Third Party E-filed GIA report	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No.199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/SMO18020935/NTD3E2

Date: 20/03/2019

REFERENCE

Handling Insurer:	Sompo Insurance Singapore Pte. Ltd.	Policy No:	D18MTPCVE000637
Claimant Vehicle No :	SHB1721R	Insured Vehicle No :	YL9326S
Date of Loss:	09/11/2018	Nature of Claim:	TP
		Claim No:	CMTD1805035

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHB1721R	Engine No:	2ZR6099902
Make & Model:	TOYOTA PRIUS, 1.8 (A)	Chassis No:	JTDKN36U405747206
Reg. Date:	23/07/2014 (Man. Year: 2014)	Odometer:	537783 km
Colour:	Maroon		
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 5 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	49,695.64	19,507.73	30,187.91	60.75
Miscellaneous Items	0.00	0.00	0.00	
Labour	10,992.88	4,951.88	6,041.00	54.95
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	60,688.52	24,459.61	36,228.91	59.70
Approved Total (Overridden) (S\$)		20,550.00		
Nett Amount (S\$)	60,688.52	20,550.00	40,138.52	66.14

INSPECTION

Date of Assignment:	20/11/2018	Smt Automotive Services Pte Ltd (HQ) No. 61 Woodlands Industrial Park E9, #04-04 Premium Building Singapore 757047
Date Inspected:	20/11/2018 Inspected At:	
Estimated Period of Repair:	13.0 days	

Adjuster: Muhammad Nazril Bin Abdullah

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 20 Mar 2019)
Parts:	144	TOYOTA PRIUS 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHB1721R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*BUMPER REAR (DISC 25%)	Deformed	458.60 F	*343.95 F
2	1	*BUMPER CLIPS (DISC 25%) (10PCS)	Necessary	16.10 F	*12.08 F
3	1	*BUMPER REINFORCEMENT REAR (DISC 25%)	Bent	205.70 F	*154.28 F
4	1	*ARM SUB-ASSY, RR BUMPER RH (DISC 25%)	Bent	139.60 F	*104.70 F
5	1	*BUMPER SIDE RETAINER RR/RH (DISC 25%)	Cracked	94.80 F	*71.10 F
6	1	*BUMPER SEAL, RR LH (DISC 25%)	Necessary	88.90 F	*66.68 F
7	1	*BUMPER SEAL, RR RH (DISC 25%)	Necessary	65.70 F	*49.28 F
8	1	*BUMPER LIP COVER RR/LH (DISC 25%)	Cracked	72.20 F	*54.15 F
9	1	*BUMPER LIP COVER RR/RH (DISC 25%)	Cracked	118.10 F	*88.58 F
10	1	*BUMPER LIP REAR (DISC 25%)	Cracked	228.90 F	*171.68 F
11	1	*UNDER COVER CENTER REAR (DISC 25%)	Cracked	514.50 F	*385.88 F
12	1	*END PANEL (DISC 25%)	Dented	602.10 F	*451.58 F
13	1	*END PANEL COVER, DECK TRIM HOLE (DISC 25%)	Deformed	46.10 F	*34.58 F
14	1	*END PANEL COVER, DECK TRIM, RR (DISC 25%)	Deformed	121.10 F	*90.83 F
15	1	*BOX DECK FLOOR, RR (DISC 25%)	Deformed	649.70 F	*487.28 F
16	1	*BOX RR FLOOR, BOARD (DISC 25%)	Deformed	679.60 F	*509.70 F
17	1	*BOARD, RR FLOOR (DISC 25%)	Deformed	392.30 F	*294.23 F
18	1	*PANEL ASSY, DECK RH (DISC 25%)	Deformed	307.00 F	*230.25 F
19	1	*SPARE TYRE PANEL (DISC 25%)	Deformed	667.70 F	*500.78 F
20	1	*CUSHION, SPARE WHEEL (DISC 25%)	Deformed	230.80 F	*173.10 F
21	1	*MEMBER SUB-ASSY, RR RH (DISC 25%)	Bent	174.10 F	*130.58 F
22	1	*FLOOR PANEL RR/RH (DISC 25%)	Deformed	209.90 F	*157.43 F
23	1	*TAILGATE ASY (DISC 25%)	Deformed	1,007.90 F	*755.93 F
24	1	*TAIL GATE DOOR GLASS MOULDING, RH (DISC 25%)	Necessary	29.40 F	*22.05 F
25	1	*TAIL GATE DOOR GLASS MOULDING, LH (DISC 25%)	Necessary	29.40 F	*22.05 F
26	1	*TAILGATE DOOR GLASS (DISC 25%)	Necessary	1,090.90 F	*818.18 F
27	1	*MOULDING BACK WINDOW, LOWER NO.1 (DISC 25%)	Necessary	29.40 F	*22.05 F
28	1	*TAILGATE LOWER WINDOW GLASS (DISC 25%)	Cracked	721.30 F	*540.98 F
29	1	*ARM, RR WIPER (DISC 25%)	Deformed	84.70 F	*63.53 F
30	1	*BLADE ASSY, REAR WIPER (DISC 25%)	Necessary	55.00 F	*41.25 F
31	1	*TAILGATE DOOR HINGE LH/RH (DISC 25%) (2PCS)	Bent	116.60 F	*87.45 F
32	1	*TAILGATE DOOR STAY LH (DISC 25%)	Bent	241.50 F	*181.13 F
33	1	*TAILGTE DOOR STAY RH (DISC 25%)	Bent	241.50 F	*181.13 F
34	1	*TAILGATE DOOR LOCK (DISC 25%)	Deformed	444.10 F	*333.08 F
35	1	*TAILGATE LOCK, COVER (DISC 25%)	Deformed	15.70 F	*11.78 F
36	1	*STRIKER, BACK DOOR (DISC 25%)	Deformed	48.90 F	*36.68 F
37	1	*TAILGATE DOOR WEATHER STRIP (DISC 25%)	Deformed	353.40 F	*265.05 F
38	1	*TAILGATE TRIM, LH (DISC 25%)	Deformed	85.90 F	*64.43 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
39	1		*TAILGATE TRIM, RH (DISC 25%)	Deformed	88.30 F	*66.23 F
40	1		*TAILGATE TRIM, LOWER (DISC 25%)	Deformed	180.70 F	*135.53 F
41	1		*TAILGATE TRIM, UPPER (DISC 25%)	Deformed	49.60 F	*37.20 F
42	1		*TAILGATE, BOARD ASSY (DISC 25%)	Deformed	246.90 F	*185.18 F
43	1		*TAILGATE OUTSIDE GARNISH (DISC 25%)	Deformed	504.90 F	*378.68 F
44	1		*EMBLEM REAR (DISC 25%)	Necessary	60.30 F	*45.23 F
45	1		*NAME PLATE (HYBRID) (DISC 25%)	Necessary	51.90 F	*38.93 F
46	1		*NAME PLATE (PRIUS) (DISC 25%)	Necessary	60.80 F	*45.60 F
47	1		*NAME PLATE (TOYOTA) (DISC 25%)	Necessary	51.90 F	*38.93 F
48	1		*SPOILER REAR (DISC 25%)	Deformed	953.70 F	*715.28 F
49	1		*ROOF PANEL (DISC 25%)	Deformed	1,102.80 F	*827.10 F
50	1		*MLDG DRIP RH, ROOF (DISC 25%)	Deformed	78.80 F	*59.10 F
51	1		*ROOF LINING ASSY (DISC 25%)	Deformed	1,877.60 F	*1,408.20 F
52	1		*FENDER RR/RH (DISC 25%)	Deformed	766.80 F	*575.10 F
53	1		*QUARTER GLASS RR/RH (DISC 25%)	Necessary	846.50 F	*634.88 F
54	1		*FENDER LINER RR/RH (DISC 25%)	Deformed	141.30 F	*105.98 F
55	1		*TAIL LAMP BRACKET, RH (DISC 25%)	Deformed	30.70 F	*23.03 F
56	1		*EXTENSION, QUARTER (DISC 25%)	Deformed	55.70 F	*41.78 F
57	1		*EXTENSION, QUARTER (DISC 25%)	Deformed	83.50 F	*62.63 F
58	1		*TERMINAL, JUNCTION (DISC 25%)	Deformed	51.90 F	*38.93 F
59	1		*COVER ASSY, TONNEAU (DISC 25%)	Missing	602.10 F	*451.58 F
60	1		*BOARD ASSY, RR RH (DISC 25%)	Deformed	379.20 F	*284.40 F
61	1		*TAIL LAMP BRACKET, LH (DISC 25%)	Deformed	30.70 F	*23.03 F
62	1		*DUCT, HYBRID BATTERY EXHAUST, NO.1 (DISC 25%)	Deformed	113.90 F	*85.43 F
63	1		*BATTERY CLAMP (DISC 25%)	Bent	16.10 F	*12.08 F
64	1		*BATTERY TRAY (DISC 25%)	Cracked	42.80 F	*32.10 F
65	1		*DUCT ASSY, QUARTER (DISC 25%)	Missing	70.40 F	*52.80 F
66	1		*EXHAUST HEAT SHIELD, REAR (DISC 25%)	Torn	107.40 F	*80.55 F
67	1		*GARNISH ASSY, ROOF RH (DISC 25%)	Bent	256.40 F	*192.30 F
68	1		*PANEL SUB-ASSY, QTR (DISC 25%)	Deformed	588.40 F	*441.30 F
69	1		*TROUGH, BACK DOOR (DISC 25%)	Deformed	110.90 F	*83.18 F
70	1		*PANEL SUB-ASSY, QTR (DISC 25%)	Deformed	326.70 F	*245.03 F
71	1		*PANEL, ROOF SIDE, / RH SIDE (DISC 25%)	Deformed	134.80 F	*101.10 F
72	1		*REINFORCE, ROOF SIDE (DISC 25%)	Bent	91.90 F	*68.93 F
73	1		*REINFORCEMENT, BACK (DISC 25%)	Bent	89.50 F	*67.13 F
74	1		*REINFORCEMENT, BELT (DISC 25%)	Deformed	103.20 F	*77.40 F
75	1		*REINFORCEMENT, ROOF (DISC 25%)	Deformed	60.30 F	*45.23 F
76	1		*ANTENNA, ELECTRICAL LOWER REAR (DISC 10%)	Necessary	157.40 F	*141.66 F
77	2		*LICENSE PLATE LAMP (DISC 10%)	Deformed	71.40 F	*64.26 F
78	1		*3RD BRAKE LAMP (DISC 10%)	Cracked	231.30 F	*208.17 F
79	1		*TAIL LAMP RH (DISC 10%)	Cracked	557.80 F	*502.02 F
80	1		*BATTERY (DISC 10%)	Cracked	278.00 F	*250.20 F
81	1		*CAMERA ASSY, TELEVISION, RR (DISC 10%)	Cracked	1,436.60 F	*1,292.94 F
82	1		*MOTOR ASSY, RR WIPER (DISC 10%)	Bent	734.60 F	*661.14 F
83	2		*PIXEL STICKER (SN)	Necessary	120.00 F	*120.00 F
84	1		*SENSOR REVERSE (SN)	Bent	180.00 F	*180.00 F
85	1		*SEALANT SIKAFLEX (SN)	Necessary	37.00 F	*37.00 F
86	3		*SEALANT W/SCREEN (SN)	Necessary	111.00 F	*111.00 F
87	1		*NUMBER PLATE (SN)	Necessary	15.00 F	*15.00 F
88	1		*NUMBER PLATE FRAME (SN)	Necessary	12.00 F	*12.00 F
89	1		*STICKER DECAL SMRT (SN)	Necessary	7.80 F	*7.80 F
90	1		*STICKER DECAL 6555 8888 (SN)	Necessary	21.60 F	*21.60 F
91	1		*STICKER DECAL SMRT (SN)	Necessary	7.80 F	*7.80 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
92	1		*STICKER DECAL 6555 8888 (SN)	Necessary	21.60 F	*21.60 F
93	1		*SEALANT W/SCREEN (SN)	Necessary	37.00 F	*37.00 F
94	1		*ARM SUB-ASSY, RR BUMPER LH	Serviceable	139.60 F	*- F
95	1		*BUMPER SIDE RETAINER RR/LH	Serviceable	94.80 F	*- F
96	1		*BOX, DECK FLOOR, COVER LH	Serviceable	230.10 F	*- F
97	1		*BOX, DECK FLOOR, LH	Serviceable	196.80 F	*- F
98	1		*SPACER, RR FLOOR	Serviceable	130.60 F	*- F
99	1		*BOARD ASSY, RR RH	Serviceable	379.20 F	*- F
100	1		*PANEL ASSY, DECK LH	Serviceable	307.00 F	*- F
101	1		*COVER ASSY, TONNEAU	Serviceable	602.10 F	*- F
102	1		*GARNISH ASSY, ROOF RH	Serviceable	256.40 F	*- F
103	1		*GARNISH SIDE UPPER, LHR	Serviceable	261.70 F	*- F
104	1		*CARRIER, SPARE	Serviceable	19.70 F	*- F
105	1		*PROTECTOR, SPARE	Serviceable	143.70 F	*- F
106	1		*MEMBER SUB-ASSY, RR LH	Serviceable	174.10 F	*- F
107	1		*FLOOR PANEL RR/LH	Serviceable	102.00 F	*- F
108	1		*REINFORCEMENT, RR	Serviceable	34.60 F	*- F
109	1		*PANEL SUB-ASSY, QTR	Serviceable	326.70 F	*- F
110	1		*PANEL SUB-ASSY, QTR	Serviceable	588.40 F	*- F
111	1		*PANEL SUB-ASSY, QTR WHEEL HOUSE	Serviceable	588.40 F	*- F
112	1		*DUCT ASSY, QUARTER	Serviceable	70.40 F	*- F
113	1		*BLOCK ASSY FUSIBLE	Serviceable	166.40 F	*- F
114	1		*WIRE, FLOOR	Serviceable	1,675.00 F	*- F
115	1		*WIRE, FLOOR, NO.2	Serviceable	1,305.40 F	*- F
116	1		*WIRE, ENGINE, NO.3	Serviceable	74.00 F	*- F
117	1		*THERMISTOR ASSY	Serviceable	107.00 F	*- F
118	1		*BATTERY ASSY, HV	Serviceable	5,544.40 F	*- F
119	1		*BATTERY	Serviceable	278.00 F	*- F
120	1		*TERMINAL, JUNCTION	Serviceable	51.90 F	*- F
121	1		*BATTERY CLAMP	Serviceable	16.10 F	*- F
122	1		*BATTERY TRAY	Serviceable	42.80 F	*- F
123	1		*WIRE, FRAME	Serviceable	1,680.90 F	*- F
124	1		*EXHAUST HEAT SHIELD, REAR	Serviceable	107.40 F	*- F
125	1		*EXHAUST TAIL PIPE	Serviceable	656.20 F	*- F
126	1		*SUPPORT, EXHAUST REAR	Serviceable	33.60 F	*- F
127	1		*MOTOR ASSY, RR WIPER	Serviceable	734.60 F	*- F
128	1		*WIRE, BACK DOOR, NO.1	Serviceable	582.40 F	*- F
129	1		*CAMERA ASSY, TELEVISION, RR	Serviceable	1,436.60 F	*- F
130	1		*SWITCH ASSY, BACK DOOR OPENER	Serviceable	146.10 F	*- F
131	1		*MLDG DRIP LH, ROOF	Serviceable	78.80 F	*- F
132	1		*TROUGH, BACK DOOR	Serviceable	110.90 F	*- F
133	1		*REINFORCEMENT, ROOF	Serviceable	60.30 F	*- F
134	1		*REINFORCEMENT, BACK	Serviceable	89.50 F	*- F
135	1		*EXTENSION, QUARTER	Serviceable	55.70 F	*- F
136	1		*EXTENSION, QUARTER	Serviceable	83.50 F	*- F
137	1		*REINFORCE, ROOF SIDE	Serviceable	91.90 F	*- F
138	1		*PANEL, ROOF SIDE	Serviceable	134.80 F	*- F
139	1		*ANTENNA ASSY, AMPLIFIER, NO.1	Serviceable	223.60 F	*- F
140	1		*CORD SUB-ASSY, ANTENNA, NO.4	Serviceable	190.80 F	*- F
141	1		*PANEL, ROOF SIDE INNER FRONT RH	Serviceable	134.80 F	*- F
142	1		*PANEL, ROOF SIDE OUTER RH	Serviceable	134.80 F	*- F
143	1		*REINFORCEMENT, BELT	Serviceable	103.20 F	*- F
144	1		*WHEEL DISC	Serviceable	1,484.20 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
145	1		*TYRE	Serviceable	126.74 F	* F
146	1		*WHEEL HUB REAR	Serviceable	489.40 F	* F
147	1		*FENDER RR/LH	Serviceable	766.80 F	* F
148	1		*TROUGH, BACK DOOR LH	Serviceable	110.90 F	* F
149	1		*TAIL LAMP BRACKET, LH	Serviceable	30.70 F	* F
150	1		*TAIL LAMP LH	Serviceable	548.40 F	* F
151	1		*STICKER DECAL SMRT	Not Necessary	7.80 F	* F
152	1		*STICKER DECAL 6555 8888	Not Necessary	21.60 F	* F
153	1		*QUARTER GLASS RR/LH	Not Necessary	168.10 F	* F
154	1		*SEALANT W/SCREEN	Not Necessary	37.00 F	* F

F=Franchise part.

Total Parts (\$\$) **49,695.64** **19,507.73**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING & BODY WORK	New	2,535.00	1,600.00
2	SPRAY PAINT	New	4,230.00	1,610.00
3	TOWING CHARGE	New	126.00	90.00
4	TO APPLY RUST-PROOFING ON AFFECTED AREA	New	200.00	100.00
5	TO CHECK WIRING AND SYSTEM FUNCTION	New	80.00	50.00
6	TO DO WHEEL ALIGNMENT / TYRE BALANCING	New	120.00	0.00
7	TO CHECK & RESET SYSTEM FUNCTION	New	350.00	50.00
8	TO REMOVE & REFIT SEAT	New	120.00	30.00
9	TO REMOVE & REFIT EXHAUST	New	120.00	0.00
10	TO REMOVE & REFIT ROOF LINING	New	120.00	30.00
11	TO ALIGN CHASSIS	New	350.00	100.00
12	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM	New	725.00	725.00
13	TO REMOVE & REFIT REAR QUARTER GLASS RH	New	120.00	30.00
14	TO REMOVE & REFIT REAR QUARTER GLASS LH	New	120.00	0.00
15	TO TRANSFER REAR TAILGATE MECHANISM	New	120.00	50.00
16	TO REMOVE AND REFIT WIRE HARDESS	New	250.00	0.00
17	TO REMOVE AND REFIX REAR WINDSCREEN	New	240.00	120.00
18	TO TEST AND REFIX REVERSE SENSOR SYSTEM	New	120.00	20.00
19	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	New	120.00	50.00
20	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	New	120.00	0.00
21	TO REMOVE AND REFIT BATTERY ASSY HV	New	250.00	0.00
22	TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER	New	296.88	296.88
23	TO WASH AND VACUUM	New	60.00	0.00
24	TO REPLACE SUNDRY PARTS	New	100.00	0.00
Gross Labour Cost (\$\$)			10,992.88	4,951.88

Report was unsubmitted during this print-out.

< END OF ESTIMATES >