51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore 408933

Claim Reference: OD

Assessment Number: GS001836

Version: SMEMOT01/1

Date Calculated: 04/12/2018 02:06

Full Report - V1 Registration: SKV988D

Printed: 04/12/2018 10:07

Summary Information

Claim

Location: Singapore (SG) LKK AUTO Printed by: Interim

Authorisation Status: Work Provider:

AXA Insurance S'pore Pte Repairs Authorised:

Ltd

Claim Reference: OD

Policy Number: Other Reference: Third Party: Insured Amount: Under Warranty: Warranty Expired:

SGD Currency: 28/11/2018

Date of Incident: Able to Authorise Repairs: TBA **TBA**

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer: **JAGUAR** Model:

Sub Model: Model Sheet Number: Registration: Registration Month:

Registration Year: VIN Number:

Odometer: Colour:

Engine Number:

Fuel Level:

XF **BASE MODEL** F21 01 SKV988D March 2015

SAJAC05K7FDU54383

Not Known

%

Model Specs

FROM U 13911/T 01220 ELECTRIC DOOR MIRROR ELEC INTERIOR MIRROR KEYLESS ENTRY/START D/MIRROR WITH MEMORY BLUETOOTH INTERFACE RADIO WITH CD XENON HEADLAMP L/6-WAY SEAT ADJUSTM PEDESTRIAN PROTECT DESIGN RADIAT GRILLE REAR PARKING SYSTEM

8-GEAR AUTOMATIC TYRES 245/45 WR 18 WHEELS 8.5J X 18 ALU

TWO COAT METALLIC

ACOUSTIC WINDSCREEN FOLDING DOOR MIRRORS REARVIEW CAMERA DAYTIME RUNNING LIGH R/6-WAY SEAT ADJUSTM FRONT PARKING SYSTEM FRT BUMPER MLDG CHR

2.2 LTR 140KW CRUISE CONTROL **EMERGENCY WHEEL 18"**

SALOON

PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:

Steering:

Brakes Pedal Travel: Place of Inspection:

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF: Tread Depth LHR: Damage Areas:

Severity of Impact: Vehicle Status on

Inspection:

Date of Inspection:

30/11/2018


Tread Depth RHF: Tread Depth RHR: Direction of Impact:


51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: OD

Full Report - V1 Registration: SKV988D Assessment Number: GS001836 Printed: 04/12/2018 10:07 **Version: SMEMOT01/1**

Date Calculated: 04/12/2018 02:06

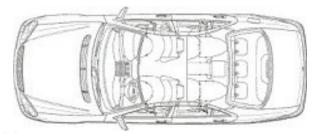

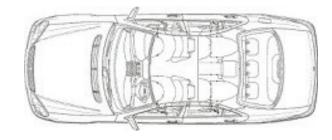

Addresses

Cost	Sum	mary
------	-----	------

Total Labour	\$441.00
Total Paint/Material	\$120.28
Total Parts	\$13,060.53
Excess:	TBA
Grand Total Exc GST:	\$13,621.81
7 % GST:	\$953.53
Grand Total Inc GST:	\$14,575.34

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR

		Price/Dent	= \$0.00/HR
Repair /			
Guide Numbe	r Repair Details	WU	Cost Price (\$)
NO NUMBER	BODYSHELL PANEL WORK PREPARATION TIME	3.0	13.50
10-10-10	PREPARATION TIME	1.0	4.50
76-22-83	R + R FRONT BUMPER	5.0	22.50
76-22-78)	R + R ATTACHED PARTS OF THE BUMPER	13.0	58.50
86-41-33	R + R LEFT HEADLAMP	2.0	9.00
036(1) TTS	R + R R/F WING	19.0	85.50
	INCLUDES: R + R HEADLAMP AND WHEELARCH		
	TRIM		
74-20-05)	R + R RIGHT FRONT WHEEL	1.0	4.50
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
LAE	SOUR COST		
	Total Work Units	46.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	4.6HRS	\$207.00
	Paint Labour	5.2HRS	\$234.00
	Total Labour	9.8HRS	\$441.00
		·	

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR		
Guide Nu	umber Description	WU	Cost Price (\$)	
	- TWO COAT METALLIC			
	- PREPARE OFF VEHICLE			
742	R/F WING NEW PART PAINTING	10.0		
281	FRONT BUMPER NEW PART PAINT K1	.R 12.0		
	LABOUR COST - PAINT			
	TIME(PAINT)	22.0		
	Preparation Main Work Plastic	5.0		
	Preparation Main Work Metal	25.0		

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: OD **Full Report - V1 Registration: SKV988D Assessment Number: GS001836**

Version: SMEMOT01/1 Printed: 04/12/2018 10:07

Date Calculated: 04/12/2018 02:06

GRILLE

R/LWR TRIM INSERT

RAD GRILLE BADGE

Preparation Work Multi Layer Paint

	Total W	ork Units (10WU/	'HR)		52.0	
	Total Pa	aintwork Labour			5.2HRS	\$234.00
M	ATERIAL C	OST - PAINT				Cost Price
	New Pa	rt Painting				\$21.67
	New Pa	rt Painting - Plast	ic K1R			\$61.01
	Materia	I-Constant Main W	Vork Metal			\$28.60
		I-Const Main Worl				\$9.00
	Total Ex	ccluding Pearlesce	ent Uplift			\$120.28
	Pearles	cent Uplift @ 0.0%	6			\$0.00
	Total Pa	aint Material Cost				\$120.28
PARTS						
					Price Va	llid: 01/01/2001
Guide No.Qt	ty Descrip	tion	Part Number	Supplier	Bet.	Price (\$)
300 1	FR LWR	BUMPER GRILLE	C2Z13213		0%	200.00*
281 1	FRONT E	BUMPER	C2Z13208XXX		0%	1,500.00*
337 1		1PER ABSORBER	C2Z16554		0%	350.00*
350 6	FRT BUN	1PER MNTG KIT	C2C32665		0%	55.00*
343 1	FRT LWI	R BUMPER COVER	C2Z23088		0%	650.00*

0.0

0%

0%

0%

900.00*

220.00*

110.00*

\$0.00

2677	1	L/F INN SENSOR BRKT	C2Z25706	0%	250.00*
770	1	L/F WING BADGE	C2Z30927	0%	230.00*
347	1	L/LWR TRIM INSERT	C2Z13454	0%	88.21 U
561	1	LEFT HEADLAMP ASSY	C2Z31444	0%	2,500.00*
352	1	R/F BUMPER BRACKET	C2Z16531	0%	65.00*
294	1	R/F BUMPER STRUT	C2Z13205	0%	250.00*
2678	1	R/F INN SENSOR BRKT	C2Z25706	0%	250.00*
2676	1	R/F OUT SENSOR BRKT	C2Z3838	0%	250.00*
842	1	R/F WHEELHOUSE COVER	C2Z22403	0%	350.00*
742	1	R/F WING	C2Z16958	0%	1,100.00*
790	9	R/F WING CLAMP KIT	C2C22174	0%	55.00 *

C2Z13199

562 1	L	RIGHT HEADLAMP ASSY	C2Z31444	0%	2,500.00*
f: OEM Parts	S		Sub Total		\$11,873.21
a: Original			Mark Up From Cost	(10 %)	\$1,187.32

C2Z13177

C2D45429

h: Secondhand \$13,060.53 **Total Parts**

p: Parallel x: Exchange

1

348

431

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Total Extras

Final Calculation	
Total Parts	\$13,060.53
Labour	
Total Panel/Mechanical	\$207.00
Total Paintwork	\$234.00
Total Labour	\$441.00
Total Paint/Material Costs	\$120.28
Grand Total Excludes GST	\$13,621.81
GST @ 7 %	\$953.53
Grand Total Includes GST	\$14,575.34

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: OD Full Report - V1

Assessment Number: GS001836 Registration: SKV988D Version: SMEMOT01/1 Printed: 04/12/2018 10:07

Date Calculated: 04/12/2018 02:06

Assessment Notes