







Service Request Details

Claim

S8M0155T

Reference

None 

Loss Date

December 1, 2018

Request Date

December 4, 2018

Due Date

December 11, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (TP)

Type of Loss

Third Party Vehicle Damage

Services

Pending verification - Direct Settlement

04.12.2018 @ 9.10am
Pila veh in
Accid

Actions

Next Step

Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #

SLE5993H

Make

TPVD HONDA

Model

VEZEL

Service Address

...

Primary Contact/Insured

LIM ENG MOY

903 TAMPINES AVENUE 4, #06-302, 520903, Singapore

90663388

Claim Handler

WANG Peter

peter.wang@axa.com.sg

Additional Instructions

Messages

Invoices

History

Documents

Assessment

Metrics

Notes

New Message



<MANDATE IA> -S8M0155T [ACCIDENT INVOLVING
SLD 4042P(OI) / SLE 5993H(TP) / OTHERS ON
01/12/2018]

Type

🔗 Question

Message

Liability: 100%. 3 vehicles chain collision whereby our Insured driver was the last car. Inform OI about third party claim. Agreed to settle at best and aware NCD issue. We seek your mandate at \$19,577.49(if claim LOU) -\$20,497.49(if claim LOR). Mandate IA had been uploaded in Smartclaims. Kindly let us have your approval/instruction. Hsiao Tong - 08 Feb 2019

Reply



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 08/02/2019

Survey Details:

Date of loss	1-Dec-18
Date of appointment	4-Dec-18
Date of survey	4-Dec-18
Location of survey	VERMOGEN ACE PTE LTD

Vehicle Details:

Claim Type:	Third party
Vehicle number	SLE 5993H
Make and Model	HONDA VEZEL 1.5X CVT
Date of registration	27/7/2016
Excess	
Market Value	\$71,000
Parf Rebate	\$44,113
Nett Loss	\$26,887

Repair details:

Initial Estimate	\$ 63,139.04
------------------	--------------

Proposed/Revised repair cost:

Parts	\$ 15,855.92
Check items (estimate)	NIL
Labour	\$ 5,550.00
Supplementary	\$ 100.00
Total	\$ 21,505.92
Lump Sum(if applicable)	\$ 17,000.00

Number of days for repair	19
---------------------------	----



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Remarks:

Recommnded 19 repair days + 3Sunday + 1PH = 23days

Mandate:

Liability(TP)	100%	
Proposed repair cost (w/GST)	\$ 18,190.00	\$ 18,190.00
Loss of use (23days x \$60.00)	\$ 1,380.00	NIL
Loss of rental (23days x \$100.00)	NIL	\$ 2,300.00
Loss of income	NIL	NIL
LTA search fees	\$ 7.49	\$ 7.49
Others	NIL	NIL
Proposed Total	\$ 19,577.49	\$ 20,497.49



Pls proceed DS with quantum as proposed

Type

🔔 Question

Message

LOR is subject to rental receipt.

Reply

Hsiao Tong (LKKAUTO)

From: Pila Ng <pila@vermogen-group.com>
Sent: Monday, 29 April 2019 11:54 AM
To: Hsiao Tong (LKKAUTO)
Cc: Minoko Chan; Tezano Exequiel Dawal; Baldoz Juan Paulo Bongon; desmond; Vmg admin; Vermogen Ace; Rasul (LKKAUTO); Admin A
Subject: Re: SLE5993H FINALISE //LKK REF: CC4/ASM18021806/R1pb3
Attachments: doc12846220190429114627.pdf

Without Prejudice

Dear Hsiao Tong,

Above attach with LOD, could we settle as below:

COR - \$ 17,655.00
LOU - \$ 2,400.00 (\$100 x 24 days)
Towing fee - \$ 100.00
GIA - \$ 2.00
\$ 20,157.00

23x \$60 = 1380.00

Kindly check and revert to us as soon as possible.

Thanks & regards,

Pila

Vermogen Ace Pte Ltd

1 Bukit Batok Crescent

#05-23 Wcega Plaza

Singapore 658064

Tel: 6904 4596

Fax: 6694 4929

On Sat, Apr 27, 2019 at 1:31 PM Hsiao Tong (LKKAUTO) <chewht@lkkauto.com> wrote:

Without Prejudice

Dear Sirs/Mdm,

Thank you for your patience.

For COR, recommended amount at **L/sum \$16,500.00(before GST)** with **19repair days**.

Kindly confirm.

**** Kindly forward your LOD with all the relevant documents(ie: final repair bill, authorisation to act, rental receipt) to us (LKK) for our necessary action.**

Please note that all the finalisation subject to insurer approval.

"Kindly note that this negotiation between parties on this matter is purely on a without prejudice basis with the sole intention of resolving the matter amicably without parties resorting to legal proceedings. No admission of liability, whatsoever, should be deemed / inferred from this negotiation of terms/settlement.

In the event of new evidence being discovered or subsequently produced by either party that will materially affect/influence on the issues of liability/damages, either party is not bound, thereafter, by the negotiation terms/settlement."

Best Regards,

Hsiao Tong, Chew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6742-3197 | email: chewht@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Minoko Chan <minoko@vermogen-group.com>

Sent: Tuesday, 15 January 2019 8:29 PM

To: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Cc: Hsiao Tong (LKKAuto) <chewht@lkkauto.com>; Pila Ng <pila@vermogen-group.com>; Tezano Exequiel Dawal <ezel.t@vermogen-group.com>; Baldoz Juan Paulo Bongon <paulo.b@vermogen-group.com>; desmond <desmond@vermogen-group.com>; Vmg admin <vmg@vermogen-group.com>; Vermogen Ace <ace@vermogen-group.com>; Rasul (LKKAuto) <Rasul@lkkauto.com>; SUR <sur@lkkauto.com>

Subject: Re: SLE5993H FINALISE

Dear Rasul,

1st reminder.

Refer to attachment, kindly confirm & acceptance finalise @ COR \$16,500.00 & 19 repair days (excluding PRS/RS/Weekend & PH).

please revert.ASAP

Thank you

Best Regards,

Minoko

Vermogen Ace Pte Ltd

1 Bukit Batok Crescent

#05-23 Wcega Plaza

Singapore 658064

Tel: 6904 4596

Fax: 6694 4929

On Wed, Jan 2, 2019 at 1:38 PM Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com> wrote:

Hi Hsiao Tong,

[CC4/ASM18021806/R1pb3](#)

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Minoko Chan [<mailto:minoko@vermogen-group.com>]

Sent: Wednesday, 2 January 2019 12:40 PM

To: Rasul (LKKAuto) <Rasul@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: Pila Ng <pila@vermogen-group.com>; Tezano Exequiel Dawal <ezel.t@vermogen-group.com>; Baldoz Juan Paulo Bongon <paulo.b@vermogen-group.com>; desmond <desmond@vermogen-group.com>; Vmg admin <vmg@vermogen-group.com>; Vermogen Ace <ace@vermogen-group.com>

Subject: SLE5993H FINALISE

Dear Rasul,

Refer to attachment, kindly confirm & acceptance finalise @ COR \$16,500.00 & 19 repair days (excluding PRS/RS/Weekend & PH).

please revert.ASAP

Thank you

Best Regards,

Minoko

Vermogen Ace Pte Ltd

1 Bukit Batok Crescent

#05-23 Wcega Plaza

Singapore 658064

Tel: 6904 4596

Fax: 6694 4929




















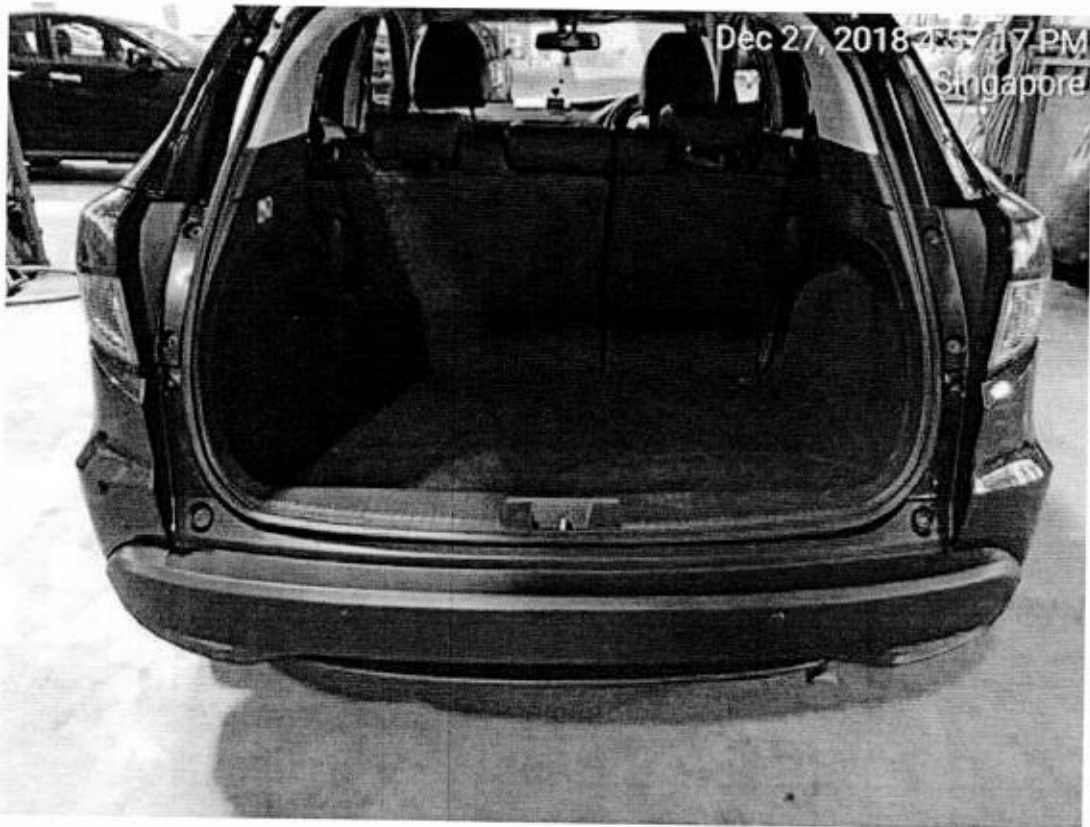



Hsiao Tong (LKKAuto)

From: Hsiao Tong (LKKAuto)
Sent: Friday, 3 May 2019 9:07 AM
To: 'Pila Ng'
Cc: Minoko Chan; Tezano Exequiel Dawal; Baldoz Juan Paulo Bongon; desmond; Vmg admin; Vermogen Ace; Rasul (LKKAuto); Admin A
Subject: RE: SLE5993H FINALISE //LKK REF: CC4/ASM18021806/R1pb3

Without Prejudice
(save as to costs)

Dear Sirs/Mdm,

We refer to the above matter.

We have our principal instruction to offer at a global sum of \$19,030.00(all-in).

Please confirm acceptance.

"Please note that our proposal and correspondence with you is strictly on a without prejudice basis and should not be construed as an admission of liability on our part and/or that of our policyholder and/or the authorised driver. The terms of our without prejudice engagement should not be disclosed in any other related matter(s) in respect of this accident nor should it be binding in any other related claims."

Best Regards,

Hsiao Tong, Chew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6742-3197 | email: chewht@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Pila Ng <pila@vermogen-group.com>
Sent: Monday, 29 April 2019 11:54 AM
To: Hsiao Tong (LKKAuto) <chewht@lkkauto.com>
Cc: Minoko Chan <minoko@vermogen-group.com>; Tezano Exequiel Dawal <ezel.t@vermogen-group.com>; Baldoz Juan Paulo Bongon <paulo.b@vermogen-group.com>; desmond <desmond@vermogen-group.com>; Vmg admin <vmg@vermogen-group.com>; Vermogen Ace <ace@vermogen-group.com>; Rasul (LKKAuto) <Rasul@lkkauto.com>; Admin A <admin-a@lkkauto.com>
Subject: Re: SLE5993H FINALISE //LKK REF: CC4/ASM18021806/R1pb3

Without Prejudice

Dear Hsiao Tong,

Above attach with LOD, could we settle as below:

COR	- \$ 17,655.00
LOU	- \$ 2,400.00 (\$100 x 24 days)

Hsiao Tong (LKKAUTO)

From: Pila Ng <pila@vermogen-group.com>
Sent: Friday, 3 May 2019 9:14 AM
To: Hsiao Tong (LKKAUTO)
Cc: Vermogen Ace; Rasul (LKKAUTO); Admin A
Subject: Re: SLE5993H FINALISE //LKK REF: CC4/ASM18021806/R1pb3

Without Prejudice

Dear Hsiao Tong,

We accepted your offer with settlement amount **\$19,030.00** (Global sum).

Kindly send us the DV as soon as possible.

Thanks & regards,
Pila

On Fri, May 3, 2019 at 9:07 AM Hsiao Tong (LKKAUTO) <chewht@lkkauto.com> wrote:

Without Prejudice
(save as to costs)

Dear Sirs/Mdm,

We refer to the above matter.

We have our principal instruction to offer at a global sum of \$19,030.00(all-in).

Please confirm acceptance.

"Please note that our proposal and correspondence with you is strictly on a without prejudice basis and should not be construed as an admission of liability on our part and/or that of our policyholder and/or the authorised driver. The terms of our without prejudice engagement should not be disclosed in any other related matter(s) in respect of this accident nor should it be binding in any other related claims."

Best Regards,

Hsiao Tong, Chew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6742-3197 | email: chewht@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



Efficient Towing Services

403 Sin Ming Avenue #13-307, Sin Ming Garden, Singapore 570403

Ah Di Mobile: 8588 8877

Email: efficienttowing.sg@gmail.com

Business Reg. No.: 53349344K

NO. 23078

CASH SALE / JOB ORDER

Date: 01/12/18

Messrs: Vernoyen Ave
车牌 3LE5993H 车型 Honda Vezel
Vehicle No. 3LE5993H Model No. Honda Vezel
时间 (日/夜) Day 联络号码 612822
Time (day/night): Day Contact No: 612822
由 Turf club Road
Location: Turf club Road
到 6 Benoi Sector
To: 6 Benoi Sector
银额 100 其他
Cash \$ 100 Others:
经手人 Tow Truck RH
Authorised By: Driver Name: RH

- ☐ Jump Start/Changing of battery
- ☐ Tyre Replacement
- ☒ Accident/Breakdown
- ☐ Multi/Basement
- ☐ With Load/Cargo Box
- ☐ King Dolly
- ☐ Transport Charge
- ☐ Low Body Kit
- ☐ Door Opening Service
- ☐ Crane Up/Winch Out
- ☐ Collect Doc/Key
- ☐ Repo
- ☐ Woodlands and Tuas Checkpoint

注意: 本公司对所拖之车辆, 在进行中如有任何损失或破坏, 一概由车主自行负责。

Note: Vehicle is towed at owner's risk. The company accepts no responsibility for damages or other misdemeanour to your vehicle whilst being towed.

E. & O. E.



Vermogen ACE Pte Ltd

1 Bukit Batok Crescent
#05-23 Wcega Plaza
Singapore 658064
Co. Reg No.:201606023C GST Reg No.:201606023C
Tel:6694 4919 Fax:6694 4929
Email:vermogenace@gmail.com

Yr Ref : SLD4042P

Our Ref : SLE5993H

29 APRIL 2019

Without Prejudice

Attn: Motor Claim Dept

AXA INSURANCE (S) PTE LTD

8 Shenton Way,
#27-01/02 AXA Tower
Singapore 068811

Dear Sir/Mdm,

Accident involving SLE5993H & SLD4042P on 1/12/2018 16:20 hrs at along PIE TOWARDS TUAS

We refer to the above said accident.

As instructed, we are claiming the following as stated below:-

1. Cost of repair	\$	17,655.00
2. Loss of use (\$100 x 24 days)	\$	2,400.00
3. Towing fee	\$	100.00
4. GIA search fee	\$	2.00
Total	\$	20,157.00

We enclosed herewith relevant document as stated below:-

1. Accident report
2. Final Repair Bill
3. Letter of authority
4. Towing receipt
5. GIA search receipt

We do not have the survey report and photographs as our client's motor vehicle was surveyed by your appointed surveyor.

Please kindly let us know whether you are prepared to settle our client's claim & we look forward to hear from you soonest.

Thank you.

Best Regards,



Pila (Claim Dept)

Vermogen ACE PTE LTD

Tel: 6358 3031 | Fax: 6694 4929

Email: pila@vermogen-group.com

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SLD 4042P (Insd veh)	Model:	HONDA VEZEL 1.5X CVT
	SLE 5993H (TP veh)		
Date of Accident:	01/12/2018		

Global Sum Settlement	:	☒ Yes	☐ No
Repair Estimate	:	\$	67,826.27
Final Repair Cost	:	\$	17,655.00
Loss of Use	:	\$	1,380.00
Rental (if any)	:	\$	23 days at \$60.00 per day
LTA / GIA Search Fee	:	\$	2.00

Others:	:	\$	
---------	---	----	--

	:	\$	
Final Settlement Sum (GLOBAL SUM)	:	\$	19,030.00

Is Third Party Workshop GIA Registered? ☒ YES ☐ NO (Kindly indicate below)

A) For Non GIA Registered Workshop: Agreed Liability _____ (%)

B) For GIA Registered Workshop: BOLA Applicable: Yes/ No BOLA Scenario No: _____
 BOLA Liability: _____ 100 _____ (%) Assessed Liability (*): _____ 100 _____ (%)
 * Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.

Remarks

Payment Instruction: Payee's Breakdown			
1)	VERMOGEN ACE PTE LTD	:	\$ 19,030.00

NUR SHAQILAH BTE ABDOL
WAHAB

03/06/2019
Date

Please attach all the supporting documents to the form.
 (Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CC4/ASM18021806/R1pb3s2

8 SHENTON WAY #24-01
AXA TOWERS SINGAPORE 068811
ATTN: PETER WANG

Date : 03-06-2019



Code : ASM

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLD 4042P	Veh. Inspected	SLE 5993H
Policy No.	GA306602	Coverage (\$)	0.00
Claim No.	S8M0155T	Excess (\$)	0.00
Assign From	PETER WANG	Assign Date	04/12/2018

2. Vehicle Particulars & Condition

Make & Model	HONDA VEZEL 1.5X CVT	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	RU11201466	Colour	BLUE
Odometer	189615	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60R16	ROADSTONE	6 mm
L/H Front Tyre	215/60R16	ROADSTONE	6 mm
R/H Rear Tyre	215/60R16	ROADSTONE	6 mm
L/H Rear Tyre	215/60R16	ROADSTONE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	01/12/2018	Inspection Date	04/12/2018
Survey held at	6 BENOI SECTOR		
Repairer	VERMOGEN ACE PTE LTD		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	19 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 7

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLE 5993H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR NUMBER PLATE LAMP LH/RH (CONSISTENT)	SERVICEABLE	250.00	-
1	TAILGATE (CONSISTENT)	BUCKLED	1,860.00	1,100.00
1	SET TAILGATE OUTER GARNISH (CONSISTENT)	CRACKED	285.00	285.00
1	SET TAILGATE OUTER GARNISH CLIPS (CONSISTENT)	NECESSARY	40.00	40.00
1	TAILGATE LOGO (CONSISTENT)	NECESSARY	52.00	52.00
1	TAILGATE EMBLEM "VEZEL" (CONSISTENT)	NECESSARY	56.20	56.20
2	TAILGATE LAMP LH/RH (CONSISTENT)	CRACKED	980.00	504.00
2	SET TAILGATE LAMP CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
1	TAILGATE OUTER HANDLE SWITCH (CONSISTENT)	NOT NECESSARY	180.00	-
2	TAILGATE DAMPER LH/RH (CONSISTENT)	NOT NECESSARY	424.00	-
1	TAILGATE WIPER MOTOR (CONSISTENT)	NOT NECESSARY	250.00	-
1	TAILGATE WIPER BLADE (CONSISTENT)	NOT NECESSARY	75.00	-
1	TAILGATE BUZZER (CONSISTENT)	CRACKED	150.00	150.00
1	TAILGATE INNER HANDLE (CONSISTENT)	SERVICEABLE	74.00	-
1	TAILGATE INNER LOCK (CONSISTENT)	BENT	245.00	245.00
1	TAILGATE LOCK SENSOR (CONSISTENT)	CRACKED	220.00	220.00
1	TAILGATE STRIKER (CONSISTENT)	BENT	32.00	32.00
1	SET TAILGATE TRIMBOARD (CONSISTENT)	DEFORMED	295.00	295.00
1	SET TAILGATE TRIMBOARD CLIPS (CONSISTENT)	NECESSARY	45.00	45.00
1	SET TAILGATE WEATHERSTRIP (CONSISTENT)	NECESSARY	145.00	145.00
1	TAILGATE WINDSCREEN MOULDING (CONSISTENT)	NECESSARY	164.00	164.00
1	TAILGATE HINGE LH/RH (CONSISTENT)	SERVICEABLE	100.00	-
2	TAIL LAMP LH/RH (CONSISTENT)	CRACKED	978.00	920.00
1	SET TAIL LAMP CLIPS (CONSISTENT)	NECESSARY	36.00	36.00
2	TAIL LAMP PANEL LH/RH (CONSISTENT)	N/S BENT / O/S TO REPAIR SEE LABOUR	1,100.00	155.00
1	REAR BUMPER (CONSISTENT)	DEFORMED	950.00	680.00
1	SET REAR BUMPER CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
2	REAR BUMPER RETAINER LH/RH (CONSISTENT)	N/S NECESSARY / O/S NOT NECESSARY	144.00	72.00

Report Ref No. CC4/ASM18021806/R1pb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BUMPER BRACKET LH/RH (CONSISTENT)	N/S NECESSARY / O/S NOT NECESSARY	116.00	58.00
2	REAR BUMPER REFLECTOR LH/RH (CONSISTENT)	N/S DEFORMED / O/S NOT NECESSARY	334.00	131.00
2	REAR BUMPER COVER LH/RH (CONSISTENT)	N/S DEFORMED / O/S NOT NECESSARY	420.00	198.00
2	SET REAR BUMPER COVER CLIPS (CONSISTENT)	N/S NECESSARY / O/S NOT NECESSARY	100.00	50.00
2	REAR BUMPER COVER RETAINER LH/RH (CONSISTENT)	N/S NECESSARY / O/S NOT NECESSARY	84.00	42.00
1	REAR END PANEL OUTER (CONSISTENT)	BUCKLED	585.00	415.00
1	REAR END PANEL INNER (CONSISTENT)	SERVICEABLE	396.00	-
1	REAR END PANEL TOP GARNISH (CONSISTENT)	DEFORMED	184.00	184.00
1	SET REAR END PANEL TOP GARNISH CLIPS (CONSISTENT)	NECESSARY	25.00	25.00
1	SPARE TYRE PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	1,230.00	-
1	SPARE TYRE PANEL INSULATOR (CONSISTENT)	NOT NECESSARY	240.00	-
1	SPARE TYRE PANEL TOP BOARD (CONSISTENT)	DEFORMED	420.00	306.00
1	SPARE TYRE TOOL TRAY (CONSISTENT)	CRACKED	430.00	215.00
2	REAR FENDER PANEL LH/RH (CONSISTENT)	N/S BUCKLED / O/S TO REPAIR SEE LABOUR	1,900.00	950.00
2	REAR FENDER LOWER INNER TRIM LH/RH (CONSISTENT)	DEFORMED	480.00	480.00
2	REAR FENDER LOWER INNER TRIM CLIP LH/RH (CONSISTENT)	NECESSARY	100.00	100.00
2	REAR FENDER ARCH GARNISH LH/RH (CONSISTENT)	N/S DEFORMED / O/S NOT NECESSARY	330.00	165.00
2	SET REAR FENDER ARCH GARNISH CLIPS (CONSISTENT)	N/S NECESSARY / O/S NOT NECESSARY	80.00	40.00
2	REAR FENDER INNER WATER SHIELD LH/RH (CONSISTENT)	NOT NECESSARY	320.00	-

Report Ref No. CC4/ASM18021806/R1pb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	SET REAR FENDER INNER WATER SHIELD CLIPS (CONSISTENT)	NOT NECESSARY	100.00	-
2	REAR FENDER AIR DUCT LH/RH (CONSISTENT)	N/S NOT NECESSARY / O/S SERVICEABLE	150.00	-
1	EXHAUST MUFFLER (CONSISTENT)	NOT NECESSARY	855.00	-
1	EXHAUST MUFFLER MOUNTING (CONSISTENT)	NOT NECESSARY	79.50	-
1	EXHAUST MUFFLER HEAT SHIELD (CONSISTENT)	NOT NECESSARY	165.00	-
2	REAR DOOR (CONSISTENT)	N/S TO REPAIR SEE LABOUR / O/S NOT NECESSARY	2,084.00	-
2	REAR DOOR FRONT RUBBER (CONSISTENT)	NOT NECESSARY	80.00	-
2	REAR DOOR BOTTOM RUBBER (CONSISTENT)	NOT NECESSARY	80.00	-
2	REAR DOOR BACK RUBBER (CONSISTENT)	NOT NECESSARY	64.00	-
2	REAR DOOR STICKER (CONSISTENT)	NOT NECESSARY	92.00	-
2	REAR DOOR MOULDING (CONSISTENT)	NOT NECESSARY	170.00	-
2	REAR DOOR WEATHER STRIP (CONSISTENT)	NOT NECESSARY	190.00	-
2	REAR DOOR REGULATOR (CONSISTENT)	NOT NECESSARY	954.00	-
2	REAR DOOR LOCK MECHANISM (CONSISTENT)	NOT NECESSARY	754.00	-
1	REAR DOOR LOCK CATCH (CONSISTENT)	NOT NECESSARY	66.00	-
1	BONNET (CONSISTENT)	BENT	1,130.00	819.00
2	BONNET HINGE LH/RH (CONSISTENT)	NOT NECESSARY	124.00	-
1	FRONT TOW HOOK COVER (CONSISTENT)	NOT NECESSARY	62.00	-
1	BONNET INSULATOR (CONSISTENT)	NOT NECESSARY	160.00	-
1	SET BONNET INSULATOR CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
2	BONNET RUBBER SIDE (CONSISTENT)	NECESSARY	66.80	66.80
1	BONNET RUBBER CENTRE (CONSISTENT)	NECESSARY	35.20	35.20
1	BONNET LOCK MECHANISM (CONSISTENT)	SERVICEABLE	75.00	-
1	BONNET LOCK MECHANISM CABLE (CONSISTENT)	NOT NECESSARY	36.00	-
1	FRONT GRILLE BASE (CONSISTENT)	CRACKED	250.00	250.00
1	FRONT GRILLE GARNISH (CONSISTENT)	CRACKED	285.00	285.00
1	FRONT GRILLE CHROME (CONSISTENT)	NOT NECESSARY	1,150.00	-
1	FRONT GRILLE SIDE BRACKET (CONSISTENT)	CRACKED	279.00	279.00
1	FRONT GRILLE CENTRE BRACKET (CONSISTENT)	CRACKED	139.50	139.50
1	SET FRONT GRILLE CLIPS (CONSISTENT)	NECESSARY	50.00	50.00

Report Ref No. CC4/ASM18021806/R1pb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT GRILLE LOGO (CONSISTENT)	NECESSARY	28.20	28.20
1	FRONT SUPPORT PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	576.20	-
1	FRONT SUPPORT PANEL TOP GARNISH (CONSISTENT)	NOT NECESSARY	185.00	-
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS (CONSISTENT)	NOT NECESSARY	35.00	-
1	FRONT SUPPORT LOWER PANEL (CONSISTENT)	NOT NECESSARY	422.20	-
1	AIR INTAKE DUCT (CONSISTENT)	NOT NECESSARY	115.00	-
1	WASHER TANK (CONSISTENT)	NOT NECESSARY	120.00	-
1	WASHER TANK MOTOR (CONSISTENT)	NOT NECESSARY	59.60	-
2	HEADLAMP LH/RH (CONSISTENT)	CRACKED	5,080.00	3,568.00
2	HEADLAMP LOWER BRACKET LH/RH (CONSISTENT)	CRACKED	140.00	140.00
1	FRONT BUMPER (CONSISTENT)	DEFORMED	927.50	801.00
1	FRONT BUMPER LOWER RUBBER (CONSISTENT)	NOT NECESSARY	200.00	-
1	SET FRONT BUMPER CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
2	FRONT BUMPER RETAINER LH/RH (CONSISTENT)	NECESSARY	92.00	92.00
1	FRONT BUMPER REINFORCEMENT (CONSISTENT)	BENT	321.00	290.00
2	FRONT BUMPER REINFORCEMENT GARNISH (CONSISTENT)	NOT NECESSARY	60.00	-
1	FRONT BUMPER LOWER LIP (CONSISTENT)	CRACKED	351.00	195.00
1	SET FRONT BUMPER LOWER LIP CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
2	FRONT BUMPER FOG LAMP GARNISH LH/RH (CONSISTENT)	CUT	180.00	180.00
2	FRONT BUMPER FOG LAMP LH/RH (CONSISTENT)	NOT NECESSARY	775.40	-
2	FRONT LOWER SPLASH COVER LH/RH (CONSISTENT)	NOT NECESSARY	210.00	-
1	SET FRONT LOWER SPLASH COVER CLIPS (CONSISTENT)	NOT NECESSARY	50.00	-
1	FRONT LOWER SPLASH COVER CENTRE (CONSISTENT)	NOT NECESSARY	249.00	-
1	SET FRONT LOWER SPLASH COVER CENTRE CLIPS (CONSISTENT)	NOT NECESSARY	30.00	-
2	RADIATOR SIDE GARNISH LH/RH (CONSISTENT)	NOT NECESSARY	150.00	-
1	A/C CONDENSER (CONSISTENT)	BENT	538.50	538.50
1	A/C FAN ASSY (CONSISTENT)	SERVICEABLE	392.00	-
1	RADIATOR (CONSISTENT)	BENT	1,220.00	1,220.00
1	RADIATOR FAN ASSY (CONSISTENT)	NOT NECESSARY	483.00	-

Report Ref No. CC4/ASM18021806/R1pb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR SPARE TANK (CONSISTENT)	NOT NECESSARY	55.00	-
1	AIR RESONATOR (CONSISTENT)	NOT NECESSARY	173.00	-
2	FRONT DOOR (CONSISTENT)	NOT NECESSARY	2,284.00	-
1	HORN (CONSISTENT)	NOT NECESSARY	64.00	-
2	FRONT FENDER INNER SHIELD LH/RH (CONSISTENT)	NOT NECESSARY	302.00	-
2	FRONT FENDER INNER SHIELD (CONSISTENT)	NOT NECESSARY	80.00	-
2	FRONT FENDER ARCH GARNISH LH/RH (CONSISTENT)	NOT NECESSARY	330.00	-
2	FRONT FENDER ARCH GARNISH CLIPS (CONSISTENT)	NOT NECESSARY	80.00	-
2	FRONT FENDER LH/RH (CONSISTENT)	NOT NECESSARY	1,320.00	-
2	REAR FENDER INNER UPPER TRIM (CONSISTENT)	NOT NECESSARY	146.00	-
1	ROOF LINING (CONSISTENT)	DEFORMED	1,250.00	1,250.00
2	REAR CHASSIS MEMBER (CONSISTENT)	TO REPAIR SEE LABOUR	1,440.00	-
2	REAR WHEEL HOUSE LH/RH (CONSISTENT)	NOT NECESSARY	1,396.40	-
2	REAR FLOOR SIDE PANEL LH/RH (CONSISTENT)	TO REPAIR SEE LABOUR	320.00	-
1	REAR TOW HOOK PANEL CENTER (CONSISTENT)	NOT NECESSARY	95.00	-
1	REAR CROSSMEMBER (CONSISTENT)	NOT NECESSARY	250.00	-
1	EDCL MODULE (CONSISTENT)	NOT NECESSARY	1,043.30	-
1	TAILGATE WINDSCREEN (CONSISTENT)	NOT NECESSARY	1,150.10	-
1	TAILGATE SPOILER (CONSISTENT)	NOT NECESSARY	430.20	-
1	THIRD BRAKE LIGHT (CONSISTENT)	NOT NECESSARY	280.00	-
1	ROOF PANEL (CONSISTENT)	NOT NECESSARY	915.40	-
2	REAR SEAT BELT (CONSISTENT)	NOT NECESSARY	1,360.00	-
2	SIDE SKIRT (CONSISTENT)	NOT NECESSARY	755.00	-
2	SET SIDE SKIRT CLIPS (CONSISTENT)	NOT NECESSARY	70.00	-
2	ROCKER PANEL (CONSISTENT)	NOT NECESSARY	1,321.20	-
1	TAILGATE WIRE HARNESS (CONSISTENT)	NOT NECESSARY	891.10	-
1	REAR WIRE HARNESS (CONSISTENT)	NOT NECESSARY	963.80	-
	LESS 20% DISCOUNT		-11,727.26	-3,806.48
			46,909.04	15,225.92
	SPECIAL NETT ITEMS			
1	REAR NUMBER PLATE WITH FRAME (SN) (CONSISTENT)	BENT	55.00	35.00

Report Ref No. CC4/ASM18021806/R1pb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE WINDSCREEN SEALANT (SN) (CONSISTENT) }	NECESSARY	80.00	100.00
1	TAILGATE WINDSCREEN INNER SEAL (SN) (CONSISTENT) }		80.00	-
1	REAR END PANEL SEALANT (SN) (CONSISTENT)	NECESSARY	80.00	60.00
1	REVERSE SENSOR (SN) (CONSISTENT)	NOT WORKING	300.00	200.00
1	SPARE TYRE PANEL SEALANT (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	SPARE TYRE PANEL PADDING (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	SUNDRIES (SN) (CONSISTENT)	NECESSARY	80.00	40.00
1	REVERSE CAMERA (SN) (CONSISTENT)	NOT NECESSARY	300.00	-
1	RADIATOR COOLANT (SN) (CONSISTENT)	NECESSARY	80.00	60.00
1	FRONT NUMBER PLATE WITH CASING (SN) (CONSISTENT)	CRACKED	55.00	35.00
1	TOP UP GAS (SN) (CONSISTENT)	NECESSARY	150.00	100.00
2	REAR SEAT CUSHION (SN) (CONSISTENT)	NOT NECESSARY	800.00	-
			2,220.00	630.00
	LABOUR			
	TO STRAIGHTEN AND PANEL BEATING ACCIDENT AREA. REAR PORTION. TAILGATE, TAILGATE GARNISH, RR BUMPER, RR BUMPER SIDE COVER X2, RR END PANEL, SPARE TYRE PANEL, TAIL LAMP PANEL X2, RR FENDER X2, RR DOOR X2, RR WHEEL HOUSE X2, REAR FLOOR SIDE PANEL X2, RR CROSSMEMBER. INCLUSIVE OF THE REPAIR OF O/S TAIL LAMP PANEL LH/RH, SPARE TYRE PANEL, O/S REAR FENDER PANEL LH/RH, N/S REAR DOOR, REAR CHASSIS MEMBER AND REAR FLOOR SIDE PANEL LH/RH.		3,500.00	1,800.00
	TO PUTTY, RESPRAY PAINTING AND POLISH ACCIDENT AREA. REAR PORTION. TAILGATE, TAILGATE GARNISH, RR BUMPER, RR BUMPER SIDE COVER X2, RR END PANEL, SPARE TYRE PANEL, TAILLAMP PANEL X2, REAR FENDER X2, RR DOOR X2, RR WHEEL HOUSE X2, RR FLOOR SIDE PANEL X2, RR CROSSMEMBER, RR CHASSIS MMEMBER X2.		2,600.00	1,600.00
	TO REMOVE AND TRANSFER TAILGATE COMPONENTS.		180.00	80.00
	TO REMOVE AND REFIT TAILGATE WINDSCREEN.		180.00	120.00
	TO REMOVE AND REFIT REVERSE SENSOR.		150.00	60.00
	TO RUST PROOF AFFECTED AREAS.		300.00	150.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK AND RECTIFY WIRING AFTER DISCONNECT AND CONNECT.		180.00	60.00
	TO REMOVE AND REFIT INTERIOR PARTS TO GIVE WAY THE REPAIR.		180.00	80.00
	TO REMOVE AND ALIGNED EXHAUST PIPE.	NOT NECESSARY	180.00	-
	TO MOUNT VEHICLE ON CHASSIS MEMBER.		350.00	150.00
	TO REMOVE AND TRANSFER REAR DOOR LH COMPONENTS.	NOT NECESSARY	180.00	-
	TO STRAIGHTEN AND PANEL BEATING ACCIDENT AREA. FRONT PORTION. BONNET, FRT BUMPER, FRT BUMPER REINFORCEMENT, FRT SUPPORT PANEL, FRT FENDER LH/RH. INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL.		2,400.00	600.00
	TO PUTTY, RESPRAY PAINTING AND POLISH ACCIDENT AREA. FRONT PORTION. BONNET, FRT BUMPER, FRT BUMPER REINFORCEMENT, FRT SUPPORT PANEL, FRT FENDER LH/RH.		2,400.00	600.00
	TO REMOVE AND REFIT RADIATOR, CONDENSER AND TOP UP AIRCON GAS.		250.00	120.00
	TO RESET CHECK LIGHT ON.		350.00	30.00
	TO REMOVE & REFIT UNDERCARRIAGE TO ASSIST WORK LOAD.	NOT NECESSARY	280.00	-
	TO REMOVE & REFIT EDCL MODULE.		350.00	100.00
	TO REMOVE & REFIT ROOF LINING. (ADDITIONAL)		250.00	100.00
			14,260.00	5,650.00
GRAND TOTAL			63,389.04	21,505.92
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				16,500.00

Report Ref No. CC4/ASM18021806/R1pb3s2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.