

ASS. REC. BY:

REF:

CS/FCT18022494/Kqd3n2

Special Instruction:

Surveyor:

Kenneth

ASSIGNMENT (Office)

From (Person):

CWS

May Chua

of

FCT

Date/Time: 8:20pm @ 14/12/18

Estimated Cost:

Bill to:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHC 5612R

Insured:

SHD 3060R

at Workshop m/s

Trans-cab

Tel:

6287 6666

of

No. 2 AMK St-63

Policy No:

Claim No:

D18068822MFSH

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

11/12/2018

CA / REV / REP. / REV 24 HRS 'wp'

H.O.D. Endorsement:

Date/Time:

8:20pm @ 14/12/18

Person Contacted:

Candy

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SHC 5612R - NA / INC 09 00 / 339 / 01 DOA: 12/01/2009
	SHD 3060R - CC3 / AIG 18005342 / R / hb392 DOA: 18/03/2018
17/12/18 @ 2:30pm	NOTED to May Chua by email.
	L1 Sm @ 9200 (Rad @ 79501.63, 76%)

REF: FCI

ASSIGNMENT

From:

Date:

14/12/2018

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

SHC 5612R

at Workshop no/s:

Transcarb

or:

No. 2 AMK sf-63

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.



Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

10 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS 'up'

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHC 5612R

Vt Regn:

10 14

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Peract Latitude

C.C.

1985

Colour:

M. White / Red

A/C

Insured / Std / NI / NA

Sp. Reading:

437639

T/Ratio: Insured / Std / NI / NA

Eng/No:

C/No:

VF 1 ABL 15 AUG 279 412

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Giti

Front

Rear

R/Bal.

8 mm

R/Bal.

4 mm

L/Bal.

8 mm

L/Bal.

4 mm

D.O.A.

11/12/18

D.O.I.

14/12/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

17/12 File pass to Customer

RECEIVED 15 JAN 2019

Date/Time, File Pass to?

☐

Preli. Report

1) 18/12/18

☐

Final Report

Date/Time, File Return to?

2)

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Days Of Repair:

10

Resurvey No. of Trip:

1

Survey Fee:

Transportation

) S + RS \$

) Photos

) Others

TOTAL

Report Format:

T.O

Lump Sum / I.D. (\$

9200

350



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D18008822MFSH

Date: 17 December 2018

Our Ref: CS/FCI18022494/Kqd3

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SHC 5612R.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 14/12/2018 at the premises of M/s TRANSCAB, and have the following to report:-

Workshop Estimate Amount	: S\$ 38,701.63 .
Revised Estimate Amount	: S\$ 11,525.83 .
"Check" Items Amount	: S\$ - .
Market Value	: S\$ - .
LTA Reimbursement Value	: S\$ - .
Nett Value	: S\$ - .

Description of Damage:

The vehicle sustained damages
at the n/s body.

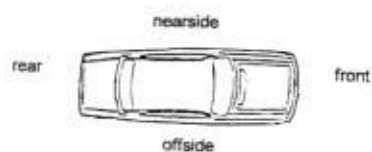

Yours faithfully

KONG SENG CHEONG
Licensed Appraiser

MOTOR SURVEY ASSIGNMENT

Date	13-12-2018	Our Ref No.	D18008822MFSH
Accident Date	11-12-2018	Claim Type.	Third Party
Insured Vehicle	SHD3060R	Third Party Vehicle.	SHC5612R
Survey Location	NO. 2 ANG MO KIO STREET 63		
Contact Person.	CANDY KONG		
Contact No.	62876666/ 0	Fax No.	62571330
Survey Type	WITHOUT PREJUDICE: LIABILITY UNCLEAR:		
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD		
Contact Person	NA	Fax No.	68416315
Contact Number.	NA		

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS-CAB AUTO SERVICES PTE LTD	Attention.	NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No.	NA
Officer Incharge	MAY CHUA		

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Monday, 17 December 2018 2:30 PM
To: 'CWS Motor Claims'; assignments
Cc: 'May Chua Hui Chin'; SUR
Subject: RE: SURVEY ASSESSMENT - D18008822MFSH/1
Attachments: CSFCI18022494Kqd3.pdf

Dear May,

Enclosed herewith preliminary advice of SHC 5612R.

Best Regards,

Shiau Chan (Ms) | Case Handler
LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Friday, 14 December 2018 8:13 AM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'May Chua Hui Chin' <maychua@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D18008822MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Friday, 14 December 2018 8:12 AM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; May Chua Hui Chin <maychua@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D18008822MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Note: All the accident reports are uploaded into CWS for your perusal.

Best Regards,
Admin Team

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHC5612R

Vehicle to be Exported: Yes

Intended Deregistration Date: 12 Dec 2018

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2014

Engine No.: M9R8839C001862

Chassis No.: VF1ABL15AUC279412

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 14 Oct 2014

First Registration Date: 14 Oct 2014

Transfer Count: 0

Actual ARF Paid: \$12,498.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 13 Oct 2022

PARF Rebate Amount: \$9,373.00

Intended COE Rebate Details

COE Expiry Date: 13 Oct 2022

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 8

PQP Paid: \$50,938.00

COE Rebate Amount: \$24,424.00

Total Rebate Amount: \$33,797.00**Message**

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 12 Dec 2018

OK

Trans-cab Auto Services Pte Ltd

AAD1812-102

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5612R

Not Notarised

L1 Pump @ 9200h

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHC 5612R

VF1ABL15AUC279412

RENAULT

LATITUDE

11.12.2018

FCIL

PART**LIST**

1	FENDER PANEL FRT LH	\$	N	783.83	X
1	WHEELARCH FRT LH	\$	Sn	278.84	X
1	FENDER BRACKET LOWER LH	\$	Sn	15.79	X
1	FENDER INSULATOR LH	\$	Sn	130.84	X
1	DOOR PANEL FRT LH	\$	B	2,844.66	✓
1	DOOR HINGE UPPER LH	\$	N	261.28	X
1	DOOR HINGE LOWER LH	\$	N	300.55	X
1	DOOR CHECK FRT LH	\$	Sn	194.77	X
1	DOOR LOCK FRT LH	\$	N	908.75	X
1	DOOR CATCH FRT LH	\$	Sn	131.23	X
1	DOOR HANDLE OUTER FRT LH	\$	Sn	477.76	X
1	DOOR HANDLE COVER FRT LH	\$	Sn	13.22	X
1	DOOR HANDLE MODULE FRT LH	\$	Sn	133.60	X
1	DOOR REGULATOR FRT LH	\$	N	505.19	200 X
1	DOOR REGULATOR MOTOR FRT LH	\$	N	796.46	200 X
1	DOOR REGULATOR GUIDE FRT LH	\$	Sn	120.97	X
1	DOOR PANEL REAR LH	\$	B	2,844.66	✓
1	DOOR GUIDE REAR LH	\$	Sn	176.82	} X
1	DOOR HINGE UPPER LH	\$	N	274.50	
1	DOOR HINGE LOWER LH	\$	N	300.55	
1	DOOR CHECK REAR LH	\$	Sn	203.06	
1	DOOR LOCK REAR LH	\$	N	908.75	
1	DOOR HANDLE OUTER REAR LH	\$	Sn	126.49	
1	DOOR HANDLE CAP REAR LH	\$	Sn	35.52	
1	DOOR HANDLE SEAL REAR LH	\$	Sn	7.89	
1	DOOR HANDLE COVER REAR LH	\$	Sn	13.22	}
1	DOOR HANDLE MODULE REAR LH	\$	Sn	133.60	
1	DOOR REGULATOR REAR LH	\$	N	1,135.10	X
1	DOOR REGULATOR MOTOR REAR LH	\$	Sn	893.75	X

Trans-cab Auto Services Pte Ltd**AAD1812-102**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5612R

1	DOOR REGULATOR NUT REAR LH	\$	S _h 12.43	} X
1	DOOR REGUALTOR MOTOR SCREW REAR L70Y	\$	S _h 6.31	
1	DOOR FINISHER REAR LH	\$	S _h 423.10	
1	DOOR MOULDING REAR LH	\$	S _h 176.82	
1	DOOR MOULDING CLIP L70Y	\$	na 5.92	
1	DOOR MOULDING SCREW L70Y	\$	S _h 6.91	
1	DOOR CASING REAR LH	\$	S _h 1,509.06	
1	DOOR WATER SHIELD REAR LH	\$	S _h 30.39	
1	DOOR CASING CLIP	\$	na 12.63	
1	DOOR CASING LIGHT L70Y	\$	S _h 48.74	
1	DOOR FINISHER INNER REAR LH	\$	S _h 323.44	
1	DOOR FINISHER BRACKET INNER REAR LH	\$	na 46.97	
1	DOOR FINISHER BRACKET INNER REAR LH	\$	na 20.33	
1	DOOR FINISHER BRACKET INNER REAR LH	\$	na 20.33	
1	DOOR FINISHER BRACKET INNER REAR LH	\$	na 20.33	
1	DOOR GRAB HANDLE REAR LH	\$	S _h 210.96	
1	DOOR BLIND REAR LH	\$	S _h 741.80	
1	DOOR WHEATHESTRIIP REAR LH	\$	S _h 410.66	
1	DOOR SEAL REAR LH	\$	S _h 162.02	
1	DOOR GLASS RUNNER SEAL REAR LH	\$	S _h 229.31	
1	DOOR WAIST SEAL OUTER REAR LH	\$	S _h 334.69	
1	DOOR WAIST SEAL INNER REAR LH	\$	S _h 115.64	
1	FENDER PANEL REAR LH	\$	B _h 3,299.13 ✓	
1	FENDER PANEL INNER TRIM REAR	\$	S _h 671.45 X	
1	WHEELARCH REAR LH	\$	S _h 543.47 X	
1	DOOR MIRROR ASSY LH	\$	S _h 1,483.40 X	
1	ROCKER PANEL INNER GARNISH LH	\$	S _h 466.51 X	
1	ROCKER PANEL INNER LH	\$	na 1,024.79 X	
1	ROCKER PANEL CENTER LH	\$	B _h 990.25 ✓	

\$	28,299.44
----	------------------

10% \$	2,829.94
--------	-----------------

\$	25,469.50
----	------------------

Trans-cab Auto Services Pte Ltd**AAD1812-102**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5612R**Specical Nett**

1SET	FRAME FULL SUPPORT PANEL CLIP	\$	na	70.00	X
2	FRAME FULL SUPPORT PANEL NUT	\$	na	20.00	X
2	FRAME FULL SUPPORT PANEL STUD	\$	na	30.00	X
1SET	WHEELARCH CLIP FRT LH	\$	na	30.50	X
1	FRONT DOOR STICKER 'Trans-cab'	\$	na	80.00	60na
1	FRONT DOOR STICKER 'Chassis'	\$	na	50.00	15na
1	REAR DOOR STICKER '6555 3333'	\$	na	80.00	60na
1	DOOR CHECK BOLT	\$	sn	22.69	} X
1	DOOR GUIDE SCREW	\$	sn	10.85	
1	DOOR HINGE BOLT	\$	sn	10.85	
1	DOOR HINGE NUT RH	\$	sn	14.60	
1	DOOR CHECK BOLT	\$	sn	22.69	
1	DOOR CHECK NUT	\$	sn	3.75	
1	DOOR LOCK SCREW L70Y	\$	sn	6.12	
1	DOOR CATCH SCREW L70Y	\$	sn	10.06	

11
TOTAL \$ 462.13

TOTAL PARTS \$ 25,931.63

LABOUR

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	4,500.00	1200h
Putty and spray painting of the affected portion.	\$	4,500.00	880h
To rust-proofing of the affected areas.	\$	170.00	90h
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	100h

Trans-cab Auto Services Pte Ltd

AAD1812-102

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5612R

To check steering geometry and computer wheel alignment	\$	nn 220.00 X
To transfer of front bumper fittings, attachment and perform water seepage test.	\$	nn 380.00 X
To transfer of Rear fender fittings, attachment and perform water seepage test.	\$	nn 380.00 X
To transfer of tire, rim and on wheel balancing.	\$	nn 170.00 X
To Check Electrical Lighting Concerned.	\$	170.00 201
To transfer of front fender fittings, attachment and perform water seepage test.	\$	nn 380.00 X
To transfer of front door fittings, attachment and perform water seepage test.	\$	380.00 601
To transfer of Rear door fittings, attachment and perform water seepage test.	\$	380.00 601
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	nn 380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	nn 380.00 X

TOTAL \$ 12,770.00**Over All Total \$ 38,701.63**

LKK Auto Consultants hence notify

the Repairer of **LUMP SUM (REPAIR DAY)**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

20 DAYS

10 days

61



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI18022494/Kqd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 21-01-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 3060R	Veh. Inspected	SHC 5612R	
Policy No.		Coverage (\$)	0.00	
Claim No.	D18008822MFSH	Excess (\$)	0.00	
Assign From	MAY CHUA	Assign Date	14/12/2018	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	VF1ABL15AUC279412	Colour	METALLIC WHITE / RED	
Odometer	437639	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	8 mm	
L/H Front Tyre	215/60 R16	GITI	8 mm	
R/H Rear Tyre	215/60 R16	GITI	4 mm	
L/H Rear Tyre	215/60 R16	GITI	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/12/2018	Inspection Date	14/12/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		10 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5612R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FENDER PANEL FRT LH	TO REPAIR SEE LABOUR	783.83	-
1	WHEELARCH FRT LH	SERVICEABLE	278.84	-
1	FENDER BRACKET LOWER LH	SERVICEABLE	15.79	-
1	FENDER INSULATOR LH	SERVICEABLE	130.84	-
1	DOOR PANEL FRT LH	BENT	2,844.66	2,844.66
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	261.28	-
1	DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRT LH	SERVICEABLE	194.77	-
1	DOOR LOCK FRT LH	TO REPAIR SEE LABOUR	908.75	-
1	DOOR CATCH FRT LH	SERVICEABLE	131.23	-
1	DOOR HANDLE OUTER FRT LH	SERVICEABLE	477.76	-
1	DOOR HANDLE COVER FRT LH	SERVICEABLE	13.22	-
1	DOOR HANDLE MODULE FRT LH	SERVICEABLE	133.60	-
1	DOOR REGULATOR FRT LH	TO REPAIR SEE LABOUR	505.19	-
1	DOOR REGULATOR MOTOR FRT LH	TO REPAIR SEE LABOUR	796.46	-
1	DOOR REGULATOR GUIDE FRT LH	SERVICEABLE	120.97	-
1	DOOR PANEL REAR LH	BENT	2,844.66	2,844.66
1	DOOR GUIDE REAR LH	SERVICEABLE	176.82	-
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK REAR LH	SERVICEABLE	203.06	-
1	DOOR LOCK REAR LH	TO REPAIR SEE LABOUR	908.75	-
1	DOOR HANDLE OUTER REAR LH	SERVICEABLE	126.49	-
1	DOOR HANDLE CAP REAR LH	SERVICEABLE	35.52	-
1	DOOR HANDLE SEAL REAR LH	SERVICEABLE	7.89	-

Report Ref No. CS/FCI18022494/Kqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR HANDLE COVER REAR LH	SERVICEABLE	13.22	-
1	DOOR HANDLE MODULE REAR LH	SERVICEABLE	133.60	-
1	DOOR REGULATOR REAR LH	TO REPAIR SEE LABOUR	1,135.10	-
1	DOOR REGULATOR MOTOR REAR LH	SERVICEABLE	893.75	-
1	DOOR REGULATOR NUT REAR LH	SERVICEABLE	12.43	-
1	DOOR REGULATOR MOTOR SCREW REAR L70Y	SERVICEABLE	6.31	-
1	DOOR FINISHER REAR LH	SERVICEABLE	423.10	-
1	DOOR MOULDING REAR LH	SERVICEABLE	176.82	-
1	DOOR MOULDING CLIP L70Y	NOT NECESSARY	5.92	-
1	DOOR MOULDING SCREW L70Y	SERVICEABLE	6.91	-
1	DOOR CASING REAR LH	SERVICEABLE	1,509.06	-
1	DOOR WATER SHIELD REAR LH	SERVICEABLE	30.39	-
1	DOOR CASING CLIP	NOT NECESSARY	12.63	-
1	DOOR CASING LIGHT L70Y	SERVICEABLE	48.74	-
1	DOOR FINISHER INNER REAR LH	SERVICEABLE	323.44	-
1	DOOR FINISHER BRACKET INNER REAR LH	TO REPAIR SEE LABOUR	46.97	-
1	DOOR FINISHER BRACKET INNER REAR LH	TO REPAIR SEE LABOUR	20.33	-
1	DOOR FINISHER BRACKET INNER REAR LH	TO REPAIR SEE LABOUR	20.33	-
1	DOOR FINISHER BRACKET INNER REAR LH	TO REPAIR SEE LABOUR	20.33	-
1	DOOR GRAB HANDLE REAR LH	SERVICEABLE	210.96	-
1	DOOR BLIND REAR LH	SERVICEABLE	741.80	-
1	DOOR WEATHERSTRIP REAR LH	SERVICEABLE	410.66	-
1	DOOR SEAL REAR LH	SERVICEABLE	162.02	-
1	DOOR GLASS RUBBER SEAL REAR LH	SERVICEABLE	229.31	-
1	DOOR WAIST SEAL OUTER REAR LH	SERVICEABLE	334.69	-
1	DOOR WAIST SEAL INNER REAR LH	SERVICEABLE	115.64	-
1	FENDER PANEL REAR LH	BENT	3,299.13	3,299.13
1	FENDER PANEL INNER TRIM REAR	SERVICEABLE	671.45	-
1	WHEELARCH REAR LH	SERVICEABLE	543.47	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	1,483.40	-

Report Ref No. CS/FC118022494/Kqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ROCKER PANEL INNER GARNISH LH	SERVICEABLE	466.51	-
1	ROCKER PANEL INNER LH	TO REPAIR SEE LABOUR	1,024.79	-
1	ROCKER PANEL CENTER LH	BENT	990.25	990.25
	LESS 10% DISCOUNT		-2,829.94	-997.87
			25,469.50	8,980.83
	SPECIAL NETT ITEMS			
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	SET WHEELARCH CLIP FRT LH (SN)	NOT NECESSARY	30.50	-
1	FRONT DOOR STICKER "TRANS-CAB" (SN)	NECESSARY	80.00	60.00
1	FRONT DOOR STICKER "CHASSIS" (SN)	NECESSARY	50.00	15.00
1	REAR DOOR STICKER "65553333" (SN)	NECESSARY	80.00	60.00
1	DOOR CHECK BOLT (SN)	SERVICEABLE	22.69	-
1	DOOR GUIDE SCREW (SN)	SERVICEABLE	10.85	-
1	DOOR HIBGE BOLT (SN)	SERVICEABLE	10.85	-
1	DOOR HINGE NUT RH (SN)	SERVICEABLE	14.60	-
1	DOOR CHECK BOLT (SN)	SERVICEABLE	22.69	-
1	DOOR CHECK NUT (SN)	SERVICEABLE	3.75	-
1	DOOR LOCK SCREW L70Y (SN)	SERVICEABLE	6.12	-
1	DOOR CATCH SCREW L70Y (SN)	SERVICEABLE	10.06	-
			462.11	135.00
	LABOUR			
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME. }		4,500.00	1,200.00
	INCLUSIVE OF THE REPAIR OF FENDER PANEL FRT LH,DOOR HINGE UPPER LH,DOOR HINGE LOWER LH,DOOR LOCK FRT LH,DOOR REGULATOR FRT LH,DOOR REGULATOR MOTOR FRT LH,DOOR HINGE UPPER LH,DOOR HINGE LOWER LH,DOOR LOCK REAR LH,DOOR REGULATOR REAR LH,DOOR FINISHER BRACKET INNER REAR LH AND ROCKER PANEL INNER LH. }		-	-

Report Ref No. CS/FCI18022494/Kqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		4,500.00	880.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	90.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.		380.00	100.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF FRONT BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO TRANSFER OF FRONT FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF FRONT DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		380.00	60.00
	TO TRANSFER OF REAR DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		380.00	60.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC ONEUMATIC JACK.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
			12,770.00	2,410.00
	GRAND TOTAL		38,701.61	11,525.83
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			9,200.00

Report Ref No. CS/FC18022494/Kqd3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.