

ASS. REC. BY:

REF:

CS/FCL18037714/D1b2

Special Instruction:

Surveyor:

ASSIGNMENT (Office)

From (Person):

LWS Serene Lee

of

FCL

Date/Time:

18/12/2018 5:55pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHD 4107J

Insured:

SHD 3499J

at Workshop m/s

Chunni Motor

Tel:

6542 519

of

Blk 10 Amk Ind Park 2A #03-19

Policy No:

Claim No:

D18008893MFSH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

15-12-2018

(Client's Record)

CA / REV / REP. / REV 24 HRS 'DS'

19-12-2018

H.O.D. Endorsement:

Date/Time:

Person Contacted:

Lynn

Vehicle ☒ IN / OUT

Date/Time

Action/Instruction (✓) Estimate

SHD 4107J - NS / INC 17012620 / M111111

DAF: 230617

SHD 3499J - NS / INC 8017784 / K111111

DAF: 300918


28/12@1:46pm revised via email preli advise

REF:

ASSIGNMENT

COE August 2020

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No. _____
 at Workshop m/s _____
 of _____
 Insured _____
 Policy No _____
 Claims No. _____
 Sum Insured _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

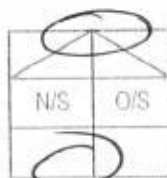

(Policy Condition)
 Remark: The veh had commenced its
 repair at the time of inspection.

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 16 days Res.: Yes or No
 Lump Sum: 20 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: BHD 4107J Yr Regn: 2012 August
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Truck / Prime Mover /
 Truck / Trailer or
 Make: Hyundai Sonata C.C. 1991
 Colour: Blue A/C Insured / Std / NI / NA
 Sp. Reading: 379799 T/Radio: Insured / Std / NI / NA
 Eng/No: D4EAC076184
 C/No: KMHBT41VMCA823522
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 215/60 R16
 R: — " —
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Pluskool
 Front: _____ Rear: _____
 R/Bal: 5 mm R/Bal: 5 mm
 L/Bal: 5 mm L/Bal: 5 mm
 D.O.A: 19/12/2018 D.O.I: 19/12/2018
 Survey held at 15 Chunni Amk
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Front & Rev
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	First Cptd BHD 3499J
	Vehicle belongs 20 months at time of loss.
18/11/19	Insured 2/3 15900/- with 16 days of rev (Red: 19109.78, 54%)

RECEIVED 21 JAN 2019

Date/Time: File Pass to?

24/1 Typist

Date/Time: File Return to?

2)

Report Format :

Lump Sum / I.B.I. (\$



Preli. Report



Final Report

Days Of Repair: 16Resurvey No. of Trip: 2Add Fee: ☐ Site Insp (\$☐ Interview (\$☐ Tech. Invs (\$☐ Weekend (\$

Survey Fee:

Transportation:

S + RS: \$

Photos

Others

OTR

21/1/19

25x15 = 375

170 + 375

50

50 + 50

208

903



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D18008893MFSH

Date: 28/12/2018

Our Ref: CS/FCI18022724/Dtb

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SHD 4107J

Please be informed that we had conducted the inspection of the abovementioned vehicle 19/12/2018 at the premises of M/s Chun Ni have the following to report: -

Workshop Estimate Amount	: S\$ <u>35,009.78</u>
Revised Estimate Amount	: S\$ <u>13,921.54</u>
"Check" Items Amount	: S\$ <u>-</u>
Market Value	: S\$ <u>-</u>
LTA Reimbursement Value	: S\$ <u>-</u>
Nett Value	: S\$ <u>-</u>

Description of Damage:

The vehicle sustained damages at the front and rear portion.

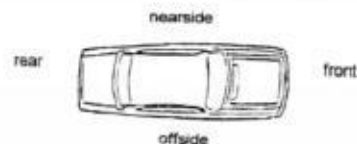

Comments/ Present Status:

Damages Consistent.

Yours faithfully

Bryan Ang
Automotive Assessor

MOTOR SURVEY ASSIGNMENT

Date	17-12-2018	Our Ref No. D18008893MFSH
Accident Date	15-12-2018	Claim Type. Third Party
Insured Vehicle	SHD3499J	Third Party Vehicle. SHD4107J
Survey Location	AMK AUTOPOINT, SOON HOCK MOTOR, #01-05/06	
Contact Person.	LYNN OR IRENE	
Contact No.	65427162/ 65425119	Fax No. 65426039
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	CHUNNI MOTOR WORK PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	SERENE	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Friday, 28 December 2018 1:46 PM
To: Admin-D (LKKAuto); 'CWS Motor Claims'; assignments
Cc: 'Serene Ler'; SUR
Subject: RE: SURVEY ASSESSMENT - D18008893MFSH/1
Attachments: PRELI ADVISED SHD 4107J.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SHD 4107J**

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Tuesday, 18 December 2018 6:01 PM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Serene Ler' <Sereneler@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D18008893MFSH/1

Dear Sir / Madam,

Thank you for the assignment.

Best Regards,

Catherine Chong | Admin

LKK Auto Consultants Pte Ltd

Phone: 6741-8434 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Tuesday, 18 December, 2018 5:35 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Serene Ler <Sereneler@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D18008893MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Note: All the accident reports are uploaded into CWS for your perusal.

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHD 4107J

DATE : 17.12.2018

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI SONATA

FAX : 6542 6039


FCI

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Radiator Grille broken			\$ 282.10	✓
	Radiator Grille U Moulding broken			\$ 108.90	✓
	Front Bumper Cover crack			\$ 538.80	✓
	Front Bumper Sponge 2 ton			\$ 136.30	2 ✓
	Front Bumper Reinforcement Bar			\$ 504.10	✓
	Front Bumper Bracket Top (LH/RH) Svc	S	22.40	\$ 44.80	X
	Front Bumper Protector (LH/RH) Svc	S	29.20	\$ 58.40	X
	Front Bumper Bracket (LH/RH) Svc	S	20.10	\$ 40.20	X
	Headlamp Support Panel Assy deformed			\$ 1,023.00	✓
	Headlamp (LH/RH) broken cover top	S	797.90	\$ 1,595.80	✓ photo
	Radiator 2 set			\$ 814.80	2 ✓
	Radiator Fan Blade, Cowling, Motor Assy 2 broken			\$ 651.30	2 ✓
	Radiator Bracket NH	S	6.20	\$ 12.40	X
	Horn Unit (RH) Svc			\$ 83.10	X
	Horn Wire NH			\$ 150.00	X
	Aircon Condenser 2 set			\$ 1,089.90	2 ✓
	Aircon Suction & Liquid Hose NH			\$ 631.40	X
	Aircon Discharge Hose NH			\$ 223.50	X
	Oil Cooler - Tube Assy-P/Stg 2 set mounting NH 84 mounting			\$ 256.00	✓
	Inter Cooler 2 set			\$ 771.50	2 ✓
	Inter Cooler Mounting (2 PCS) NH			\$ 24.80	X
	Oil Cooler Assy-Gearbox 2 set mounting NH			\$ 272.00	2 ✓ X
	Wiring-ECM NH			\$ 3,107.80	X
	Wiring-Engine NH broken mounting			\$ 3,187.40	2 ✓
	SUB TOTAL		10959.90	\$ 15,608.30	
	LESS 20%		8767.92	\$ 3,121.66	
	DISCOUNTED TOTAL			\$ 12,486.64	
	Front Number Plate crack			\$ 25.00	Nett ✓
	Front No Plate Trim Cover crack			\$ 30.00	Nett ✓
	Front Fender Advertisement Logo (RH) NH		55.00	\$ 100.00	Nett X
				\$ 155.00	
	Labour Charge				
	Panel Beating			\$ 1,000.00	600/-
	Spray Painting Charge			\$ 500.00	200/-
	Wiring Charge			\$ 50.00	30/-
	Towing Charge			\$ 50.00	NH
	Remove/Refix Aircon & Refill Gas		1110.00	\$ 150.00	80/-
	Remove/Refix Dashboard			\$ 450.00	2 150/-
	Remove/Refix Fuse Box			\$ 180.00	2 50/-
	TOTAL LABOUR			\$ 2,380.00	

SHD 4107J

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Boot Lid Lt			\$ 1,349.50	✓
	Boot Lid Rubber <i>deformed</i>			\$ 110.90	✓
	Boot Lid Lock Upper Lt			\$ 132.10	✓
	Boot Lid Lock Lower Lt			\$ 30.30	✓
	Boot Lid Key Lock H/L			\$ 78.20	X
	Boot Lid Sonata Plate H/L			\$ 43.60	✓
	Boot Lid Hyundai Plate H/L			\$ 24.20	✓
	Boot Lid 'H' Emblem H/L			\$ 26.10	✓
	Boot Lid CRDI Plate H/L			\$ 22.70	✓
	Boot Lid Lamp (LH/RH) <i>broken</i>	\$	230.20	\$ 460.40	✓
	Boot Lid Trimboard <i>deformed</i>			\$ 165.40	✓
	Boot Lid Trimboard Clips (11pcs) H/L			\$ 11.00	✓
	Rear Bumper <i>Dented</i>			\$ 578.40	✓
	Rear Bumper Reinforcement <i>broken</i>			\$ 483.30	✓ <i>photo</i>
	Rear Bumper Clip H/L			\$ 22.00	✓
	Rear Bumper Bracket <i>S/L</i>	\$	49.00	\$ 980.00	X
	Rear Bumper Sponge <i>broken</i>			\$ 137.40	✓ <i>photo</i>
	Rear Bumper Under Cover <i>broken</i>			\$ 185.80	✓
	Rear Bumper Protector (LH/RH) Lt	\$	38.00	\$ 76.00	✓
	Tail Lamp (LH/RH) <i>broken</i>	\$	344.00	\$ 688.00	✓
	Rear Panel <i>Dented</i>			\$ 391.80	✓
	Rear Panel Garnish <i>deformed mounting</i>			\$ 95.80	✓
	Spare Tyre Holder H/L			\$ 27.60	X
	Tail Lamp Panel <i>Top</i> (RH) <i>Dented</i>			\$ 217.40	✓
	Spare Tyre Panel <i>Dented</i>			\$ 863.00	✓
	Spare Tyre Panel Cushion <i>S/L</i>			\$ 200.30	X
	Rear Towing Hook H/L			\$ 135.30	X
	Member Assy- Rear Floor Centre H/L			\$ 163.60	X
	Panel Assy-Rear Floor Side (LH/RH) H/L	\$	88.55	\$ 177.10	X
	Rear Floor Chassis Member H/L			\$ 1,280.50	X
	Exhaust Pipe Insulator <i>2</i> H/L			\$ 56.10	X
	Exhaust Silencer <i>2</i> Lt			\$ 723.00	<i>2</i> ✓
	Exhaust Pipe Hanger H/L			\$ 56.10	X
	Rear Fender (LH/RH) <i>O/S Dented</i> H/L H/L	\$	1,935.90	\$ 3,871.80	✓
	Rear Fender Inner Panel (RH) H/L			\$ 1,255.00	X
	Rear Fender Inner Lining (LH/RH) H/L	\$	74.10	\$ 148.20	X
	Rear Fender Trim Board (RH) <i>deformed</i>			\$ 180.90	✓
	Rear Windscreen Moulding H/L			\$ 60.00	✓
	Rear Wiring Assy H/L			\$ 1,458.00	X
	Fire Extinguisher Holder H/L			\$ 35.00	X
			9014.90	\$ 17,001.80	
			7211.92	\$ 3,400.36	
				\$ 13,601.44	
	SUB TOTAL				
	LESS 20%				
	DISCOUNTED TOTAL				

SHD 4107J

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Boot Lid Comfort Logo & Tel No. Sticker H/c			\$ 30.00	Nett ✓
	Boot Lid Advertisement Logo H/c			\$ 100.00	Nett ✓
	Rear No. Plate Chg			\$ 25.00	Nett ✓
	Rear Bumper Reverse Sensor D-m			\$ 135.70	Nett ✓
	Rear Bumper Advertisement Logo H/c			\$ 50.00	Nett ✓
	Rear Fender Advertisement Logo (LH/RH) H/c		\$ 100.00	\$ 200.00	Nett ✓
	Rear Fender Comfort Sticker (LH/RH) H/c		\$ 30.00	\$ 60.00	Nett ✓
	Rear Windscreen Sealant H/c			\$ 46.00	Nett ✓
			646.70	\$ 646.70	
	Labour Charge				
	Panel Beating			\$ 2,600.00	1000/-
	Spray Painting Charge			\$ 1,800.00	800/-
	Wiring Charge			\$ 100.00	30/-
	Tuff Kote			\$ 150.00	40/-
	Rear Chassis Alignment Charge			\$ 400.00	40/-
	Remove/Refix Cushion & Upholstery Rear			\$ 150.00	80/-
	Remove/Refix Rear Windscreen Glass			\$ 120.00	80/-
	Remove/Refix Reverse Sensor			\$ 120.00	40/-
	Remove/Refix Fuel Tank			\$ 150.00	40/-
	Remove/Refix Exhaust Pipe			\$ 150.00	60/-
			2130.00		
	TOTAL LABOUR			\$ 5,740.00	
	ESTIMATE TOTAL			\$ 35,009.78	
	19/12/2018 @ 1130h			19921.54	
	H/A Antm 16			4515900/-	
	2/Jan 12 days.				
					
	LKK Auto				
					
	LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company Acknowledged by Repairer Signature: Date:				
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.					



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI18022724/Dtbn2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 22-01-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 3499J	Veh. Inspected	SHD 4107J	
Policy No.		Coverage (\$)	0.00	
Claim No.	D18008893MFSH	Excess (\$)	0.00	
Assign From	SERENE	Assign Date	18/12/2018	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI SONATA	c.c	1991	
Engine No.	HIDDEN	Year of Reg.	2012	
Chassis No.	KMHET41VMCA823522	Colour	BLUE	
Odometer	379799	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	HANKOOK	5 mm	
L/H Front Tyre	215/60 R16	HANKOOK	5 mm	
R/H Rear Tyre	215/60 R16	HANKOOK	5 mm	
L/H Rear Tyre	215/60 R16	HANKOOK	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	15/12/2018	Inspection Date	19/12/2018	
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND. PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		16 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 4107J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	RADIATOR GRILLE	BROKEN	282.10	282.10
1	RADIATOR GRILLE U MOULDING	BROKEN	108.90	108.90
1	FRONT BUMPER COVER	CRACKED	538.80	538.80
1	FRONT BUMPER SPONGE	TORN	136.30	136.30
1	FRONT BUMPER REINFORCEMENT	BUCKLED	504.10	504.10
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$22.40	SERVICEABLE	44.80	-
2	FRONT BUMPER PROTECTOR (LH/RH) @\$29.20	SERVICEABLE	58.40	-
2	FRONT BUMPER BRACKET (LH/RH) @\$20.10	SERVICEABLE	40.20	-
1	HEADLAMP SUPPORT PANEL ASSY	DEFORMED	1,023.00	1,023.00
2	HEADLAMP (LH/RH) @\$797.90	COVER TOP BROKEN	1,595.80	1,595.80
1	RADIATOR	BENT	814.80	814.80
1	RADIATOR FAN BLADE,COWLING,MOTOR ASSY	BROKEN	651.30	651.30
2	RADIATOR BRACKET @\$6.20	NOT NECESSARY	12.40	-
1	HORN UNIT (RH)	SERVICEABLE	83.10	-
1	HORN WIRE	NOT NECESSARY	150.00	-
1	AIRCON CONDENSER	BENT	1,089.90	1,089.90
1	AIRCON SUCTION & LIQUID HOSE	NOT NECESSARY	631.40	-
1	AIRCON DISCHARGE HOSE	NOT NECESSARY	223.50	-
1	OIL COOLER-TUBE ASSY-P/STG	MOUNTING BENT	256.00	256.00
1	INTER COOLER	BENT	771.50	771.50
1	INTER COOLER MOUNTING (2 PCS)	NOT NECESSARY	24.80	-
1	OIL COOLERS ASSY-GEARBOX	NOT NECESSARY	272.00	-
1	WIRING-ECM	NOT NECESSARY	3,107.80	-
1	WIRING-ENGINE	MOUNTING BROKEN	3,187.40	3,187.40
1	BOOT LID	BENT	1,349.50	1,349.50
1	BOOT LID RUBBER	DEFORMED	110.90	110.90
1	BOOT LID LOCK UPPER	BENT	132.10	132.10
1	BOOT LID LOCK LOWER	BENT	30.30	30.30
1	BOOT LID KEY LOCK	NOT NECESSARY	78.20	-

Report Ref No. CS/FCI18022724/Dtbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT LID SONATA PLATE	NECESSARY	43.60	43.60
1	BOOT LID HYUNDAI PLATE	NECESSARY	24.20	24.20
1	BOOT LID "H" EMBLEM	NECESSARY	26.10	26.10
1	BOOT LID CRDI PLATE	NECESSARY	22.70	22.70
2	BOOT LID LAMP (LH/RH) @\$230.20	BROKEN	460.40	460.40
1	BOOT LID TRIMBOARD	DEFORMED	165.40	165.40
11	BOOT LID TRIMBOARD CLIPS	NECESSARY	11.00	11.00
1	REAR BUMPER	DENTED	578.40	578.40
1	REAR BUMPER REINFORCEMENT	BROKEN	483.30	483.30
10	REAR BUMPER CLIP	NECESSARY	22.00	22.00
2	REAR BUMPER BRACKET @\$49.00	SERVICEABLE	980.00	-
1	REAR BUMPER SPONGE	BROKEN	137.40	137.40
1	REAR BUMPER UNDER COVER	BROKEN	185.80	185.80
2	REAR BUMPER PROTECTOR (LH/RH) @\$38.00	BENT	76.00	76.00
2	TAIL LAMP (LH/RH) @\$344.00	BROKEN	688.00	688.00
1	REAR PANEL	DENTED	391.80	391.80
1	REAR PANEL GARNISH	MOUNTING DEFORMED	95.80	95.80
1	SPARE TYRE HOLDER	NOT NECESSARY	27.60	-
1	TAIL LAMP PANEL (RH)	DENTED	217.40	217.40
1	SPARE TYRE PANEL	DENTED	863.00	863.00
1	SPARE TYRE PANEL CUSHION	SERVICEABLE	200.30	-
1	REAR TOWING HOOK	NOT NECESSARY	135.30	-
1	MEMBER ASSY-REAR FLOOR CENTRE	NOT NECESSARY	163.60	-
2	PANEL ASSY-REAR FLOOR SIDE (LH/RH) @\$88.55	NOT NECESSARY	177.10	-
1	REAR FLOOR CHASSIS MEMBER	NOT NECESSARY	1,280.50	-
1	EXHAUST PIPE INSULATOR	NOT NECESSARY	56.10	-
1	EXHAUST SILENCER	BENT	723.00	723.00
1	EXHAUST PIPE HANGER	NOT NECESSARY	56.10	-
2	REAR FENDER (LH/RH) @\$1935.90	O/S DENTED / N/S NOT NECESSARY	3,871.80	1,935.90
1	REAR FENDER INNER PANEL (RH)	NOT NECESSARY	1,255.00	-
2	REAR FENDER INNER LINING (LH/RH) @\$74.10	NOT NECESSARY	148.20	-
1	REAR FENDER TRIM BOARD (RH)	DEFORMED	180.90	180.90

Report Ref No. CS/FC118022724/Dtbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN MOULDING	NECESSARY	60.00	60.00
1	REAR WIRING ASSY	NOT NECESSARY	1,458.00	-
1	FIRE EXTINGUISHER HOLDER	NOT NECESSARY	35.00	-
	LESS 20% DISCOUNT		-6,522.02	-3,994.96
			26,088.08	15,979.84
	SPECIAL NETT ITEMS			
1	FRONT NUMBER PLATE (SN)	CRACKED	25.00	25.00
1	FRONT NO PLATE TRIM COVER (SN)	CRACKED	30.00	30.00
1	FRONT FENDER ADVERTISEMENT LOGO (RH)(SN)	NOT NECESSARY	100.00	-
1	BOOT LID COMFORT LOGO & TEL NO STICKER (SN)	NECESSARY	30.00	30.00
1	BOOT LID ADVERTISEMENT LOGO (SN)	NECESSARY	100.00	100.00
1	REAR NO PLATE (SN)	CRACKED	25.00	25.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	135.70	135.70
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
2	REAR FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	NECESSARY	200.00	200.00
2	REAR FENDER COMFORT STICKER (LH/RH) @\$30.00 (SN)	NECESSARY	60.00	60.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
			801.70	701.70
	LABOUR			
	PANEL BEATING.		3,600.00	1,600.00
	SPRAY PAINTING CHARGE.		2,300.00	1,000.00
	WIRING CHARGE.		150.00	60.00
	TOWING CHARGE.	NOT NECESSARY	50.00	-
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	80.00
	REMOVE/REFIX DASHBOARD.		450.00	150.00
	REMOVE/REFIX FUSE BOX.		180.00	50.00
	TUFF KOTE.		150.00	40.00
	REAR CHASSIS ALIGNMENT CHARGE.	NOT NECESSARY	400.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR.		150.00	80.00
	REMOVE/REFIX REAR WINDSCREEN GLASS.		120.00	80.00
	REMOVE/REFIX REVERSE SENSOR.		120.00	40.00

Report Ref No. CS/FC118022724/Dtbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE/REFIX FUEL TANK.	NOT NECESSARY	150.00	-
	REMOVE/REFIX EXHAUST PIPE.		150.00	60.00
			8,120.00	3,240.00
GRAND TOTAL			35,009.78	19,921.54
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				15,900.00

Report Ref No. CS/FCI18022724/Dtbn2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.