

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

SURVEYOR COPY

Claim Reference:
Assessment Number: AH000998
Version: AHLIM001/1
Date Calculated: 26/12/2018 06:40

Full Report - V1
Registration: SGY1133D
Printed: 26/12/2018 14:41

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer: HONDA
Model: City
Sub Model: ZX CVT
Model Sheet Number: H40 13
Registration: SGY1133D
Registration Month: November
Registration Year: 2005
VIN Number: MRHGD86506P040038
Manufacture Year: 2005
Odometer: Not Known
Colour:
Engine Number:
Fuel Level: %

Model Specs

TWO COAT METALLIC PREPARE OFF VEHICLE

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

*Not Authorised
6/1/2019
Resurvey After Paint
3 days*

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Acknowledged by Repairer
Signature:
Date:

Severity of Impact:
Vehicle Status on
Inspection:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Date of Inspection: 26/12/2018

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:



Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:



Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000998
Version: AHLIM001/1
Date Calculated: 26/12/2018 06:40

Full Report - V1
Registration: SGY1133D
Printed: 26/12/2018 14:41

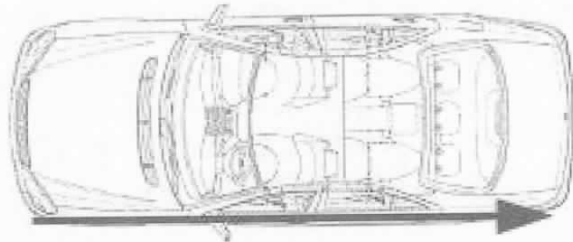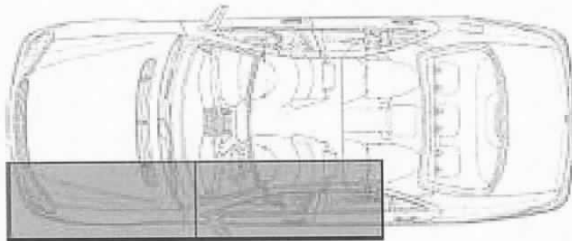

Addresses

Cost Summary

Total Labour	\$472.50
Total Paint/Material	\$103.78
Total Parts	\$309.93
Total of Additional Costs	\$30.00
Excess:	TBA
Grand Total Exc GST:	\$916.21
7 % GST:	\$64.13
Grand Total Inc GST:	\$980.34

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
71140-SEL)	R + R L/F BUMPER BRACKET	2.0	9.00
71140-SEL)	R + R R/F BUMPER BRACKET	2.0	9.00
71101-SEN)	R + R FRONT BUMPER	3.0	13.50
71101-SAA	RENEW FRONT BUMPER (REMOVED)	2.0	9.00
71130-SEL)	R + R FRONT BUMPER BRACKET	1.0	4.50
33151-SEL)	R + R LEFT HEADLAMP UNIT (BUMPER REMOVED)	3.0	13.50
	INCLUDES: ADJUST HEADLAMP		
33151-SEL)	R + R R/HEADLAMP (L/HEADLAMP REMOVED)	3.0	13.50
	INCLUDES: ADJUST R/HEADLAMP		
74151-SEN	R + R LEFT FRONT WHEELHOUSE INSERT	2.0	9.00
NO NUMBER	R + R L/F WHEELHOUSE PROTECTION	1.0	4.50
0741	REPAIR L/F WING	15 30.0*	135.00

LABOUR COST

Total Work Units	49.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	4.9HRS	\$220.50
Paint Labour	5.6HRS	\$252.00
Total Labour	10.5HRS	\$472.50

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
283	FRONT BUMPER NEW PART PAINT K1R	11.0	



Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000998
Version: AHLIM001/1
Date Calculated: 26/12/2018 06:40

Full Report - V1
Registration: SGY1133D
Printed: 26/12/2018 14:41

741	L/F WING REPAIR PAINTING >50%	15.0	
LABOUR COST - PAINT			
	TIME(PAINT)	26.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	56.0	
	Total Paintwork Labour	5.6HRS	\$252.00
MATERIAL COST - PAINT			
	New Part Painting - Plastic K1R		\$53.14
	Material-Constant Main Work Metal		\$28.60
	Repair Painting		\$13.04
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$103.78
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$103.78

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)	
283	1	FRONT BUMPER	71101SEMK00ZZ		0%	130.00*	✓
319	1	L/BUMPER CARRIER	71190SELT01		0%	10.00*	✓
321	1	L/F BUMPER BRACKET	71198SELT01		0%	7.00*	✓
350	1	FRT BUMPER CLAMP KIT			0%	22.50*	✓
365	2	MOUNTING CLAMP	9390325320		0%	0.00F	
366	6	MOUNTING CLAMP	90140SELT00		0%	0.00F	
367	2	MOUNTING CLAMP	9390345480		0%	0.00F	
561	1	L/F HEADLAMP	33151SEMK01		0%	100.00*	?
f: OEM Parts		Saving				\$17.80	
g: Original		Sub Total				\$269.50	
h: Secondhand		Mark Up From Cost (15 %)				\$40.43	
p: Parallel		Total Parts				\$309.93	
x: Exchange							

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
CHK WIRING	0%	\$30.00
SPECIALIST		20%
Total Extras		\$30.00

Final Calculation

Total Parts	\$309.93
Labour	
Total Panel/Mechanical	\$220.50
Total Paintwork	\$252.00
Total Labour	\$472.50
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$30.00
Total of Additional Costs	\$30.00
Total Paint/Material Costs	\$103.78
Grand Total Excludes GST	\$916.21



Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000998

Version: AHLIM001/1

Date Calculated: 26/12/2018 06:40

Full Report - V1

Registration: SGY1133D

Printed: 26/12/2018 14:41

GST @ 7 %

Grand Total Includes GST

\$64.13

\$980.34

Assessment Notes

