

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### **TAX INVOICE**

CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWER

SINGAPORE 079909

INV No. AC2006738

INV Date 29/09/2020

Reference CC6/CTI19001153/Aba3q2

Code

### **PROFESSIONAL SERVICE FEE**

Vehicle No. SKA 8162C

Insured Veh. SFP 4407D

Claim No. SNM19D201061/C02

Policy No. DMPCSN3002161801

Accident Date 15/01/2019

Inspection Date 17/01/2019

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

**LKK Auto Consultants Pte Ltd** 





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile			
CHIN	HINA TAIPING INSURANCE (S) PTE LTD Ref: CC6/CTI19001153/Aba3q2			
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date: 29-09-2020 Code: CTI		
1.		Policy Particulars	:- THIRD PARTY CLAIM	
	Insured Veh.	SFP 4407D	Veh. Inspected	SKA 8162C
	Policy No.	DMPCSN3002161801	Coverage (\$)	0.00
	Claim No.	SNM19D201061/C02	Excess (\$)	0.00
	Assign From		Assign Date	17/01/2019
2.		Vehicle Partic	culars & Condition	
	Make & Model HONDA CIVIC c.c 1799		1799	
	Engine No.	HIDDEN	Year of Reg.	2006
	Chassis No.	JHMFD16306S210564	Colour	BLACK
	Odometer	228136	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3.		Condition	ons of Tyres	
		Size	Make	Balance
	R/H Front Tyre	225/40 R18	FALKEN	6 mm
	L/H Front Tyre	225/40 R18	FALKEN	6 mm
	R/H Rear Tyre	225/40 R18	FALKEN	6 mm
	L/H Rear Tyre	225/40 R18	FALKEN	6 mm
4.	,	Description	on of Damages	
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.	
	DAMAGES SEE DI	ETAILS.		
5.		General	Information	
	Accident Date	15/01/2019	Inspection Date	17/01/2019
	Survey held at	MG SOLUTION PTE LTD		
		23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		
5a.		Re	emarks	
		ON WAS CONDUCTED ON A"WIT CE TO YOUR INSTRUCTIONS, W		REPAIRS.
5b.	b. Estimate Days of Repair			
	ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days			



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKA 8162C

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BOOTLID	BUCKLED	868.50	693.00
1	BOOTLID LOGO	NECESSARY	78.00	78.00
1	BOOTLID 'CIVIC' EMBLEM	NECESSARY	65.00	65.00
1	BOOTLID 'I-VTEC' EMBLEM	NECESSARY	58.00	58.00
2	BOOTLID HINGE @\$78.60	NOT NECESSARY	157.20	-
2	BOOTLID REFLECTOR @\$169.90	O/S CRACKED	339.80	169.90
1	BOOTLID LOCK	DAMAGED	254.50	115.00
1	BOOTLID LOCK CATCH	NOT NECESSARY	95.50	-
1	BOOTLID WEATHERSTRIP	CUT	148.60	148.60
1	REAR BUMPER	DEFORMED	785.00	638.00
2	REAR BUMPER SIDE RETAINER @\$58.50	NECESSARY	117.00	62.00
2	REAR TAIL LAMP @\$458.00	CRACKED	916.00	690.00
2	REAR TAIL LAMP PANEL @\$87.50	TO REPAIR SEE LABOUR	175.00	-
2	REAR TAIL LAMP LOWER BRACKET @\$36.80	NOT NECESSARY	73.60	-
2	REAR FENDER @\$941.50	NOT NECESSARY	1,883.00	-
2	REAR FENDER INNER TRIM @\$225.00	O/S DEFORMED	450.00	225.00
1	REAR END PANEL	DENTED	540.50	355.00
1	REAR END PANEL TOP GARNISH	DEFORMED	88.70	88.70
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	965.00	-
1	REAR FLOOR PANEL TOP BOARD	DEFORMED	138.70	138.70
	LESS 20% DISCOUNT		-1,639.52	-704.98
			6,558.08	2,819.92
1	REAR EXHAUST CHROME PIPE (SN)	BENT	865.00	120.00
	LESS 20% DISCOUNT		-173.00	-
			692.00	120.00
	SPECIAL NETT ITEMS			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	20.00	20.00

Report Ref No. CC6/CTI19001153/Aba3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
2	TAILLAMP PANEL SEALANT @\$60.00 (SN)	NOT NECESSARY	120.00	-
2	REAR FENDER SEALANT @\$80.00 (SN)	NOT NECESSARY	160.00	-
1	SET REAR FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	20.00	-
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REAR FLOOR PANEL INSULATION SEAL (SN)	NOT NECESSARY	200.00	-
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			1,040.00	300.00
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR TAIL LAMP PANEL AND REAR FLOOR PANEL .		1,600.00	1,000.00
	TO SPRAY PAINT AFFECTED AREA.		1,400.00	800.00
	TUFF COAT.		250.00	50.00
	WIRING CHECK .		180.00	30.00
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR.		180.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	TRANFER BOOTLID MECHANISM .		80.00	80.00
	REMOVE AND REFIX REAR WINDSCREEN .	NOT NECESSARY	120.00	-
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	80.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .		180.00	30.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			-	-
			-	-
			_	
			4,330.00	2,100.00
	GRAND TOTAL		12,620.08	5,339.92

RECOMMENDED COST OF LUMP SUM REPAIRS		4,200.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CC6/CTI19001153/Aba3q2





Report Ref No. CC6/CTI19001153/Aba3q2



**ADRIAN LING WAI PING** 

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

# PHOTOGRAPHS FOR VEHICLE NO. SKA 8162C















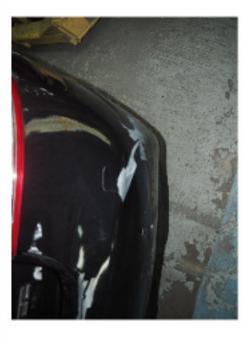



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933


TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No: 19-9607198-R

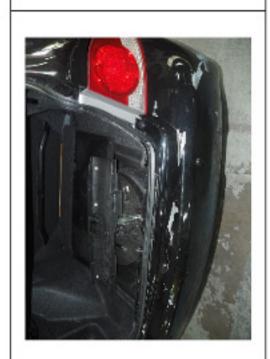








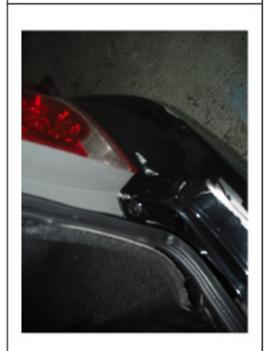

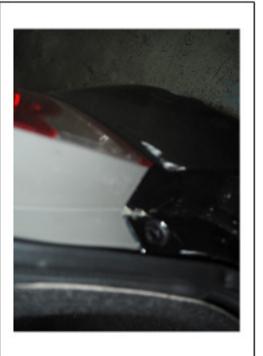



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Sngapore 408933
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315







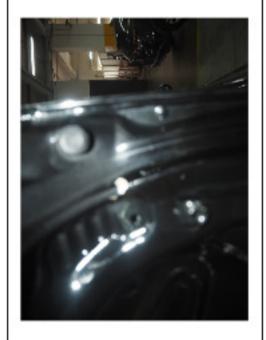








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933










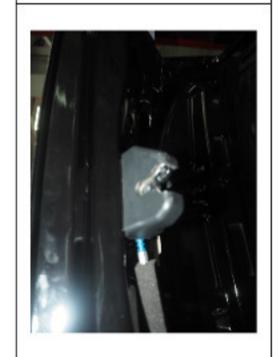





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315

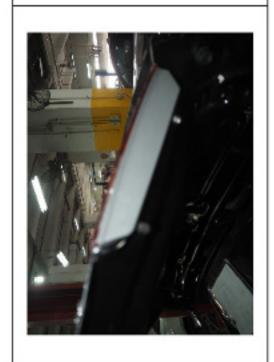













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

# PHOTOGRAPHS FOR VEHICLE NO. SKA 8162C

















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Sngapore 408933











