

ASS. REC. BY:

REF

CS/FCI19001588/Dt d3

n2

Special Instruction:

Surveyor

ASSIGNMENT (Office)

From (Person):

May chua

of

FCI

Date/Time:

12:18pm @ 24/01/2019

Estimated Cost:

Bill to:

OD / TP WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHD 65604

Insured:

SHA 3550J

at Workshop in/s

Chunni Motor

Tel:

65425119

of

Amk Appointment #01-05/06

Policy No:

Claim No:

D19000620MPSTH

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

19/01/2019

CA / REV / REP. / REV 24 HRS 'DS'

25/01/19

H.O.D. Endorsement:

Date/Time:

1:03pm @ 24/1/19

Person Contacted:

Lynn

Vehicle IN/OUT

Date/Time

Action/Instruction

(✓)

Estimate

SHD 65604 - X

SHA 3550J - CS/FCI19000537/Kvd3

D.O.A. 5/1/2019

24/1/2019 @ 10:33am

Revised via preli advise via email

REF:

ASSIGNMENT

OE 2022 Dec

Dec 2014

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No. _____

at Workshop m/s _____

of _____

Insured _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

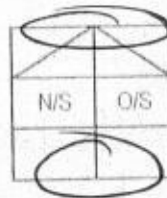

Bal. or Market Value: _____

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

18

days

Res.: Yes or No

Lum Sum: _____

20

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SHD 6560U** Yr Regn: **Dec 2014**
 Type: M.Car / M.Cycle / Bus / Van / Lorry / ☒ Prime Mover /

Truck / Trailer or _____

Make: **Hyundai I40** C.C. **1685**Colour: **Blue** A/C: **Insured / Std / NI / NA**Sp Reading: **N.A.** T/Radio: **Insured / Std / NI / NA**Eng/No: **D4FDDUR31727**C/No: **KMHLB41UMB061440**Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ S/Rim / STD A/Rim orTyre Size: F: **205/60 R 16**R: **- 11 -**

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or **Campeon**

Front

Rear

R/Bal. **5** mmR/Bal. **5** mmL/Bal. **5** mmL/Bal. **5** mmD.O.A. **19/01/2019**D.O.I. **25/01/2019**Survey held at **Chunni AMK**

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Front y Rev

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

First Capital SHH 35505

14/03/2019 **gnar** **215 35,000/-** with **18 days 8 rev**
Ured: 49344.02, 58%

RECEIVED 15 MAR 2019

Date/Time, File Pass to?



Preli. Report

153 Typist



Final Report

Date/Time, File Return to?

(2)

Days Of Repair: **18**Resurvey No. of Trip: **2**

Add Fee:



Site Insp (\$)



Interview (\$)



Tech Invs (\$)



Week-end (\$)

Report Format:

Lump Sum / I.B.I. (\$ **35,000/-**)

Survey Fee:

Transportation

G + RS 31

Photos **580**Other **580**TOTAL **153/115**

74x 15=1110

1704 1110

50

50450

332

1762



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19000620MFSH

Date: 29/01/2018

Our Ref: CS/FCI19001588/Dtd3

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SHD 6560U

Please be informed that we had conducted the inspection of the abovementioned vehicle 25/01/2019 at the premises of M/s Teamwork Garage have the following to report: -

Workshop Estimate Amount	: S\$ 84,344.02
Revised Estimate Amount	: S\$ 41,726.46
"Check" Items Amount	: S\$ 0.00
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the front and rear portion.

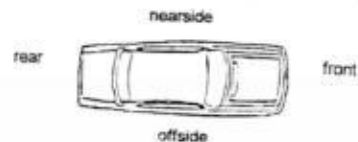

Comments/ Present Status:

Damages Consistent.

Yours faithfully

Bryan

Automotive Assessor

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Tuesday, 29 January 2019 10:28 AM
To: Admin-D (LKKAuto); 'CWS Motor Claims'; assignments
Cc: 'May Chua Hui Chin'; SUR
Subject: RE: SURVEY ASSESSMENT - D19000620MFSH/1
Attachments: PRELI ADVISED SHD 6560U.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SHD 6560U**

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Thursday, 24 January 2019 1:06 PM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'May Chua Hui Chin' <maychua@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19000620MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Thursday, 24 January 2019 12:18 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; May Chua Hui Chin <maychua@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D19000620MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

MOTOR SURVEY ASSIGNMENT

Date	22-01-2019	Our Ref No. D19000620MFSH
Accident Date	19-01-2019	Claim Type. Third Party
Insured Vehicle	SHA3550J	Third Party Vehicle. SHD6560U
Survey Location	AMK AUTOPOINT, SOON HOCK MOTOR, #01-05/06.	
Contact Person.	LYNN OR IRENE - 65421726	
Contact No.	65427162/ 65427162	Fax No. 65426039
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	CHUNNI MOTOR WORK PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	MAY CHUA	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHD 6560U

DATE : 23.01.2019

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

FCI

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Bonnet <i>bnc</i>			\$ 2,265.90	✓
	Bonnet Hinge (LH/RH) <i>bt</i>		\$ 41.00	\$ 82.00	✓
	Bonnet Lock <i>bt</i>			\$ 36.90	✓
	Bonnet Absorber <i>HH</i>		\$ 58.10	\$ 116.20	X
	Bonnet Insulator <i>bt</i>			\$ 196.50	✓
	Bonnet Insulator Clips <i>Huc</i>			\$ 8.40	✓
	Radiator Grille <i>broken</i>			\$ 251.00	✓
	Radiator Grille H Emblem <i>broken</i>			\$ 27.50	✓
	Front Bumper Cover <i>broken</i>			\$ 544.50	✓
	Front Bumper Sponge <i>broken</i>			\$ 99.20	✓
	Front Bumper Reinforcement <i>Detached</i>			\$ 402.10	✓
	Front Bumper Grille (LH/RH) <i>o/s HH n/s cut</i>		\$ 41.60	\$ 83.20	✓
	Front Bumper Centre Grille <i>broken</i>			\$ 178.60	✓
	Front Bumper Centre Grille Top Garnish <i>cut</i>		\$ 80.00	\$ 160.00	✓
	Front Bumper Bracket Top (LH/RH) <i>HH</i>		\$ 22.40	\$ 44.80	X
	Front Bumper Bracket (LH/RH) <i>o/s HH n/s broken</i>		\$ 24.60	\$ 49.20	✓
	Headlamp Support Top Cover <i>broken</i>			\$ 222.60	✓
	Headlamp Support Panel Assy <i>bnc</i>			\$ 907.40	✓
	Headlamp (LH/RH) <i>broken / mounty broken</i>		\$ 1,388.00	\$ 2,776.00	✓
	Radiator <i>punctured</i>			\$ 698.30	✓
	Radiator Fan Blade, Cowling, Motor Assy <i>broken</i>			\$ 792.95	✓
	Radiator Bracket (RH/LH) <i>HH</i>		\$ 6.50	\$ 13.00	X
	Radiator Hose Upper <i>detuned</i>			\$ 105.80	✓
	Radiator Hose Lower <i>detuned</i>			\$ 52.70	✓
	Radiator Expansion Tank <i>HH</i>			\$ 28.30	X
	Radiator Guard <i>HH</i>		\$ 20.00	\$ 40.00	X
	Horn Unit (LH/RH) <i>broken</i>		\$ 73.80	\$ 147.60	✓
	Horn Wire <i>detuned</i>			\$ 156.50	✓
	Front Fender (LH/RH) <i>bnc / Detached</i>		\$ 566.30	\$ 1,132.60	✓
	Front Fender Apron Panel (LH) <i>bnc</i>			\$ 637.00	✓
	Front Fender Shield (LH/RH) <i>o/s HH n/s detuned</i>		\$ 174.90	\$ 349.80	✓
	Air Cleaner Assy <i>broken</i>			\$ 118.60	✓
	Air Duct <i>broken</i>			\$ 134.60	✓
	Air Flow Sensor <i>Detuned</i>			\$ 502.20	✓
	Air Cleaner Bottom Assy <i>broken</i>			\$ 325.00	✓
	Aircon Condenser <i>punctured</i>			\$ 927.50	✓
	Aircon Suction & Liquid Hose <i>broken</i>			\$ 624.00	✓
	Aircon Discharge Hose <i>broken</i>			\$ 162.60	✓
	Aircon Compressor <i>detuned</i>			\$ 2,578.00	✓
	Battery Tray <i>broken</i>			\$ 52.00	✓
	Fit Safety Belt (Assy) (LH/RH) <i>Detached</i>		\$ 475.40	\$ 950.80	✓
	Rocker Panel Outer Garnish, LH <i>HH</i>			\$ 341.40	X
	Front Pillar Upper Cover/Garnish <i>HH</i>			\$ 83.50	X
	Wiper Container <i>HH</i>			\$ 61.90	X
	Wiper Container Motor <i>HH</i>			\$ 75.00	X
	Front Wheel Rim (LH) <i>HH</i>			\$ 325.30	X
	Front Wheel Hub Cap (LH) <i>HH</i>			\$ 107.10	X

SHD 6560U

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Front Wheel Bearing NH			\$ 540.50	X
	Front Shock Absorber (Assy) (LH) NH			\$ 342.20	X
	Front Shock Absorber Mounting (LH) NH			\$ 108.80	X
	Front Drive Shaft (LH) NH			\$ 1,030.80	X
	Rack & Pinion Assy NH			\$ 969.60	X
	STG Tie End NH			\$ 62.60	X
	Stabilizer Bracket NH			\$ 24.00	X
	Front Suspension Lower Arm (LH) NH			\$ 529.30	X
	Front Chasis Member 2 <i>1</i>			\$ 1,060.70	X
	Knuckle Arm (LH) NH			\$ 552.00	X
	Engine Mounting NH			\$ 456.30	X
	Engine Under Cover NH			\$ 334.60	X
	Engine Crossmember NH			\$ 2,094.40	X
	Engine Mtg (Rear) NH			\$ 279.60	X
	Gearbox NH			\$ 14,808.00	X
	Gearbox Mounting NH			\$ 215.40	X
	Steering Wheel Horn Button Assy NH			\$ 864.00	X
	Inter Cooler <i>punctured 1st</i>			\$ 1,032.50	✓
	Inter Cooler Mounting (2 PCS) NH			\$ 25.90	X
	Hose B To Inter Cooler NH			\$ 229.70	X
	Hose C To Inter Cooler Inlet 2 <i>defined 1st</i>			\$ 294.50	X ✓
	Pipe To Inter Cooler NH			\$ 167.05	X
	Pipe To Inter Cooler Outlet NH			\$ 244.55	X
	ABS Sensor NH			\$ 234.00	X
	Wiring-Engine 2 <i>1</i>			\$ 3,326.00	X
	Wiring-FEM 2 <i>1</i>			\$ 168.00	X
	Actuator - Swirl Control <i>broken</i>			\$ 814.60	X ✓
	Auto Gear Oil NH			\$ 110.40	X
	Engine Top Cover NH			\$ 386.00	X
	Throttle Body Assy 2 <i>1</i>			\$ 1,096.60	X ✓
	Intake Manifold Assy 2 <i>1</i>			\$ 1,141.10	X ✓
	Airbag Complete <i>activated</i>			\$ 2,948.50	✓
	Airbag Control Module <i>activated</i>			\$ 1,140.40	✓
	Steering Angle Assy NH			\$ 1,150.60	X
	Sensor Assy Impact -Frt Impact NH			\$ 198.30	X
	Airbag Sensor 2 <i>1</i>	\$	580.00	\$ 1,160.00	X ✓
	Electric Power Steering NH			\$ 4,880.50	X
			<i>28126.65</i>		
			<i>22501.32</i>		
				\$ 64,998.05	
				\$ 12,999.61	
				\$ 51,998.44	
	Front Number Plate <i>dislodged</i>			\$ 25.00	Nett ✓
	Front No Plate Trim Cover <i>broken</i>			\$ 30.00	Nett ✓
	Front Fender Advertisement Logo (LH/RH) <i>new</i>	\$	100.00	\$ 200.00	Nett ✓
	New Battery NH			\$ 207.00	Nett X
	Front Door Comfort Logo (LH) <i>new</i>			\$ 75.00	Nett ✓
	Front Door Advertisement Logo (LH) <i>new</i>			\$ 100.00	Nett ✓
	Front Tyre (LH) NH			\$ 216.00	Nett X
			<i>430.00</i>		
				\$ 853.00	

SHD 6560U

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Labour Charge			
	Panel Beating			\$ 2,400.00 1400/-
	Spray Painting Charge			\$ 1,750.00 800/-
	Wiring Charge			\$ 50.00 30/-
	Tuff Kote			\$ 100.00 40/-
	Towing Charge			\$ 50.00 4H
	Front Chassis Alignment Charge			\$ 400.00 150/-
	Remove/Refix Undercarriage (FRT)			\$ 200.00 4H
	FRT Wheel Alignment			\$ 120.00 60/-
	Remove/Refix Aircon & Refill Gas			\$ 150.00 80/-
	Remove/Refix Engine/Gearbox			\$ 650.00 200/-
	Remove/Refix Dashboard			\$ 450.00 180/- 4H
	Remove/Refix Fuse Box			\$ 180.00 50/-
	Re-set Frt ABS System			\$ 200.00
	R/Refix Air Bag/Steering Wheel/Dashboard/Seat			\$ 550.00 } 180/-
	Diagnostic & Resetting To Erase Fault Code			\$ 480.00
	TOTAL LABOUR			\$ 7,730.00
	Boot Lid Bolt			\$ 2,174.90 ✓
	Boot Lid Rubber deformed			\$ 96.50 ✓
	Boot Lid Lock Upper Bolt			\$ 102.60 ✓
	Boot Lid Lock Lower Bolt			\$ 31.70 ✓
	Boot Lid 'H' Emblem H/c			\$ 28.70 ✓
	Boot Lid CRDI Plate H/c			\$ 27.90 ✓
	Boot Lid Lamp (LH/RH) Crack	\$	565.60	\$ 1,131.20 ✓
	Boot Lid Trimboard torn			\$ 116.40 ✓
	Boot Lid Trimboard Clips (10pcs) H/c			\$ 11.00 ✓
	Bootlid Moulding S/C			\$ 85.00 X
	Bootlid i40 Emblem S/C			\$ 27.90 X
	Bootlid Lower Garnish S/C			\$ 227.90 X
	Rear Bumper distorted / Dented			\$ 553.00 ✓
	Rear Bumper Reinforcement 2 work / broken			\$ 428.40 2 ✓
	Rear Bumper Reinforcement Bracket (LH/RH) 2 Bolt	\$	80.30	\$ 160.60 2 ✓
	Rear Bumper Clip 10 pcs H/c			\$ 22.00 ✓
	Rear Bumper Bracket 4H	\$	35.60	\$ 71.20 X
	Rear Bumper Sponge 2 torn			\$ 118.40 2 ✓
	Rear Bumper Under Cover distorted / deformed			\$ 228.00 ✓
	Rear Bumper Reflector Lamp (LH/RH) 4H	\$	30.60	\$ 61.20 X
	Tail Lamp (LH/RH) 2 work	\$	697.80	\$ 1,395.60 2 ✓
	Rear Panel Dented			\$ 526.70 ✓
	Rear Panel Garnish mounting deformed			\$ 57.70 ✓
	Rear Panel Lower Panel Dented			\$ 495.50 ✓
	Spare Tyre Holder 4H			\$ 248.00 X
	Spare Tyre Panel Dented			\$ 852.80 ✓
	Spare Tyre Panel Cushion 4H			\$ 209.05 X
	Rear Towing Hook 4H			\$ 94.60 X
	Member Assy- Rear Floor Centre 4H			\$ 570.40 X

SHD 6560U

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Exhaust Pipe Insulator 2 NH		\$ 58.55	\$ 117.10	X
	Exhaust Silencer 2 BT		\$ 967.70	\$ 1,935.40	✓
	Exhaust Pipe Hanger 4H		\$ 58.55	\$ 117.10	X
	Exhaust Pipe Centre 4H BT distributed			\$ 730.10	X ✓
	Rear Fender With Housing (LH) Dented			\$ 4,236.80	✓ 2020.00
	Rear Fender Inner Lining (LH) 4H			\$ 169.30	X
	Rear Windscreen Moulding 4H			\$ 28.30	✓
			13273.40		
			10618.72		
	SUB TOTAL			\$ 17,988.95	
	LESS 20%			\$ 3,597.79	
	DISCOUNTED TOTAL			\$ 14,391.16	
	Boot Lid Comfort Logo & Tel No. Sticker 4H			\$ 30.00	Nett ✓
	Boot Lid Advertisement Logo 4H			\$ 100.00	Nett ✓
	Rear No. Plate 4H			\$ 25.00	Nett X
	Rear Bumper Reverse Sensor 2H			\$ 135.70	Nett ✓
	Rear Bumper Advertisement Logo 4H			\$ 50.00	Nett ✓
	Rear Bumper Rubber Mat 4H damaged			\$ 50.00	Nett ✓
	Rear Fender Advertisement Logo (LH/RH) 4H		\$ 100.00	\$ 200.00	Nett ✓
	Rear Windscreen Sealant 4H			\$ 46.00	Nett ✓
			611.70		
				\$ 636.70	
	Labour Charge				
	Panel Beating			\$ 2,000.00	1200/-
	Spray Painting Charge			\$ 1,500.00	800/-
	Wiring Charge			\$ 50.00	30/-
	Tuff Kote			\$ 100.00	40/-
	Remove/Refix Cushion & Upholstery Rear			\$ 150.00	80/-
	Remove/Refix Rear Windscreen Glass			\$ 120.00	80/-
	Remove/Refix Reverse Sensor			\$ 120.00	40/-
	Remove/Refix Exhaust Pipe			\$ 300.00	60/-
			2330.00		
	TOTAL LABOUR			\$ 4,340.00	
	ESTIMATE TOTAL			\$ 79,949.30	24344.02
	25/01/2019 @ 1045Hr				
	4H Antenna				
	2/5mm 18 dgs.				
	7/Jan				
	LKK Auto				
			39481.74		
		Supp	4394.72		
			43876.46		
			45	35000	
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.					

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19001588/Dtd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 18-03-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 3550J	Veh. Inspected	SHD 6560U	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19000620MFSH	Excess (\$)	0.00	
Assign From	MAY CHUA	Assign Date	24/01/2019	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI I40	c.c	1685	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	KMHLB41UMEU061440	Colour	BLUE	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	CAMPEON	5 mm	
L/H Front Tyre	205/60 R16	CAMPEON	5 mm	
R/H Rear Tyre	205/60 R16	CAMPEON	5 mm	
L/H Rear Tyre	205/60 R16	CAMPEON	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	19/01/2019	Inspection Date	25/01/2019	
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND. PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		18 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 6560U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET	BUCKLED	2,265.90	2,265.90
2	BONNET HINGE (LH/RH) @\$41.00	BENT	82.00	82.00
1	BONNET LOCK	BENT	36.90	36.90
2	BONNET ABSORBER @\$58.10	NOT NECESSARY	116.20	-
1	BONNET INSULATOR	BENT	196.50	196.50
1	BONNET INSULATOR CLIPS	NECESSARY	8.40	8.40
1	RADIATOR GRILLE	BROKEN	251.00	251.00
1	RADIATOR GRILLE H EMBLEM	BROKEN	27.50	27.50
1	FRONT BUMPER COVER	BROKEN	544.50	544.50
1	FRONT BUMPER SPONGE	BROKEN	99.20	99.20
1	FRONT BUMPER REINFORCEMENT	DENTED	402.10	402.10
2	FRONT BUMPER GRILLE (LH/RH) @\$41.60	N/S CUT / O/S NOT NECESSARY	83.20	41.60
1	FRONT BUMPER CENTRE GRILLE	BROKEN	178.60	178.60
2	FRONT BUMPER CENTRE GRILLE TOP GARNISH @\$80.00	CUT	160.00	160.00
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$22.40	NOT NECESSARY	44.80	-
2	FRONT BUMPER BRACKET (LH/RH) @\$24.60	N/S BROKEN / O/S NOT NECESSARY	49.20	24.60
1	HEADLAMP SUPPORT TOP COVER	BROKEN	222.60	222.60
1	HEADLAMP SUPPORT PANEL ASSY	BUCKLED	907.40	907.40
2	HEADLAMP (LH/RH) @\$1388.00	MOUNTING BROKEN / BROKEN	2,776.00	2,776.00
1	RADIATOR	PUNCTURE	698.30	698.30
1	RADIATOR FAN BLADE,COWLING,MOTOR ASSY	BROKEN	792.95	792.95
2	RADIATOR BRACKET (RH/LH) @\$6.50	NOT NECESSARY	13.00	-
1	RADIATOR HOSE UPPER	DEFORMED	105.80	105.80
1	RADIATOR HOSE LOWER	TORN / DEFORMED	52.70	52.70
1	RADIATOR EXPANSION TANK	NOT NECESSARY	28.30	-
2	RADIATOR GUARD @\$20.00	NOT NECESSARY	40.00	-
2	HORN UNIT (LH/RH) @\$73.80	BROKEN	147.60	147.60
1	HORN WIRE	TORN	156.50	156.50

Report Ref No. CS/FCI19001588/Dtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT FENDER (LH/RH) @\$566.30	BUCKLED / DENTED	1,132.60	1,132.60
1	FRONT FENDER APRON PANEL (LH)	BUCKLED	637.00	637.00
2	FRONT FENDER SHIELD (LH/RH) @\$174.90	N/S DEFORMED / O/S NOT NECESSARY	349.80	174.90
1	AIR CLEANER ASSY	BROKEN	118.60	118.60
1	AIR DUCT	BROKEN	134.60	134.60
1	AIR FLOW SENSOR	DAMAGED	502.20	502.20
1	AIR CLEANER BOTTOM ASSY	BROKEN	325.00	325.00
1	AIRCON CONDENSER	PUNCTURE	927.50	927.50
1	AIRCON SUCTION & LIQUID HOSE	BENT	624.00	624.00
1	AIRCON DISCHARGE HOSE	BENT	162.60	162.60
1	AIRCON COMPRESSOR	DISTORTED	2,578.00	2,578.00
1	BATTERY TRAY	BROKEN	52.00	52.00
2	FRT SAFETY BELT (ASSY)(LH/RH) @\$475.40	ACTIVATED	950.80	950.80
1	ROCKER PANEL OUTER GARNISH,LH	NOT NECESSARY	341.40	-
1	FRONT PILLAR UPPER COVER/GARNISH	NOT NECESSARY	83.50	-
1	WIPER CONTAINER	NOT NECESSARY	61.90	-
1	WIPER CONTAINER MOTOR	NOT NECESSARY	75.00	-
1	FRONT WHEEL RIM (LH)	NOT NECESSARY	325.30	-
1	FRONT WHEEL HUB CAP (LH)	NOT NECESSARY	107.10	-
1	FRONT WHEEL BEARING	NOT NECESSARY	540.50	-
1	FRONT SHOCK ABSORBER (ASSY)(LH)	NOT NECESSARY	342.20	-
1	FRONT SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	108.80	-
1	FRONT DRIVE SHAFT (LH)	NOT NECESSARY	1,030.80	-
1	RACK & PINION ASSY	NOT NECESSARY	969.60	-
1	STG TIE END	NOT NECESSARY	62.60	-
1	STABILIZER BRACKET	NOT NECESSARY	24.00	-
1	FRONT SUSPENSION LOWER ARM (LH)	NOT NECESSARY	529.30	-
1	FRONT CHASIS MEMBER	TO REPAIR SEE LABOUR	1,060.70	-
1	KNUCKLE ARM (LH)	NOT NECESSARY	552.00	-
1	ENGINE MOUNTING	NOT NECESSARY	456.30	-

Report Ref No. CS/FCI19001588/Dtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE UNDER COVER	NOT NECESSARY	334.60	-
1	ENGINE CROSSMEMBER	NOT NECESSARY	2,094.40	-
1	ENGINE MTG (REAR)	NOT NECESSARY	279.60	-
1	GEARBOX	NOT NECESSARY	14,808.00	-
1	GEARBOX MOUNTING	NOT NECESSARY	215.40	-
1	STEERING WHEEL HORN BUTTON ASSY	NOT NECESSARY	864.00	-
1	INTER COOLER	PUNCTURE / BENT	1,032.50	1,032.50
1	INTER COOLER MOUNTING (2PCS)	NOT NECESSARY	25.90	-
1	HOSE B TO INTER COOLER	NOT NECESSARY	229.70	-
1	HOSE C TO INTER COOLER INLET	DEFORMED / TORN	294.50	294.50
1	PIPE TO INTER COOLER	NOT NECESSARY	167.05	-
1	PIPE TO INTER COOLER OUTLET	NOT NECESSARY	244.55	-
1	ABS SENSOR	NOT NECESSARY	234.00	-
1	WIRING-ENGINE	NOT NECESSARY	3,326.00	-
1	WIRING-FEM	NOT NECESSARY	168.00	-
1	ACTUATOR-SWIRL CONTROL	BROKEN	814.60	814.60
1	AUTO GEAR OIL	NOT NECESSARY	110.40	-
1	ENGINE TOP COVER	NOT NECESSARY	386.00	-
1	THROTTLE BODY ASSY	DENTED	1,096.60	1,096.60
1	INTAKE MANIFOLD ASSY	DAMAGED	1,141.10	1,141.10
1	AIRBAG COMPLETE	ACTIVATED	2,948.50	2,948.50
1	AIRBAG CONTROL MODULE	ACTIVATED	1,140.40	1,140.40
1	STEERING ANGLE ASSY	NOT NECESSARY	1,150.60	-
1	SENSOR ASSY IMPACT-FRT IMPACT	NOT NECESSARY	198.30	-
2	AIRBAG SENSOR @\$580.00	ACTIVATED	1,160.00	1,160.00
1	ELECTRIC POWER STEERING	NOT NECESSARY	4,880.50	-
1	BOOT LID	BENT	2,174.90	2,174.90
1	BOOT LID RUBBER	DEFORMED	96.50	96.50
1	BOOT LID LOCK UPPER	BENT	102.60	102.60
1	BOOT LID LOCK LOWER	BENT	31.70	31.70
1	BOOT LID "H" EMBLEM	NECESSARY	28.70	28.70
1	BOOT LID CRDI PLATE	NECESSARY	27.90	27.90
2	BOOT LID LAMP (LH/RH) @\$565.60	CRACKED	1,131.20	1,131.20

Report Ref No. CS/FCI19001588/Dtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOTLID TRIMBOARD	TORN	116.40	116.40
10	BOOTLID TRIMBOARD CLIPS	NECESSARY	11.00	11.00
1	BOOTLID MOULDING	SERVICEABLE	85.00	-
1	BOOTLID I40 EMBLEM	SERVICEABLE	27.90	-
1	BOOTLID LOWER GARNISH	SERVICEABLE	227.90	-
1	REAR BUMPER	DISTORTED / DENTED	553.00	553.00
1	REAR BUMPER REINFORCEMENT	CRACKED / BROKEN	428.40	428.40
2	REAR BUMPER REINFORCEMENT BRACKET (LH/RH) @\$80.30	BENT	160.60	160.60
10	REAR BUMPER CLIP	NECESSARY	22.00	22.00
2	REAR BUMPER BRACKET @\$35.60	NOT NECESSARY	71.20	-
1	REAR BUMPER SPONGE	TORN	118.40	118.40
1	REAR BUMPER UNDER COVER	DISTORTED / DEFORMED	228.00	228.00
2	REAR BUMPER REFLECTOR LAMP (LH/RH) @\$30.60	NOT NECESSARY	61.20	-
2	TAIL LAMP (LH/RH) @\$697.80	CRACKED	1,395.60	1,395.60
1	REAR PANEL	DENTED	526.70	526.70
1	REAR PANEL GARNISH	MOUNTING DEFORMED	57.70	57.70
1	REAR PANEL LOWER PANEL	DENTED	495.50	495.50
1	SPARE TYRE HOLDER	NOT NECESSARY	248.00	-
1	SPARE TYRE PANEL	DENTED	852.80	852.80
1	SPARE TYRE PANEL CUSHION	NOT NECESSARY	209.05	-
1	REAR TOWING HOOK	NOT NECESSARY	94.60	-
1	MEMBER ASSY-REAR FLOOR CENTRE	NOT NECESSARY	570.40	-
2	EXHAUST PIPE INSULATOR @\$58.55	NOT NECESSARY	117.10	-
2	EXHAUST SILENCER @\$967.70	BENT	1,935.40	1,935.40
2	EXHAUST PIPE HANGER @\$58.55	NOT NECESSARY	117.10	-
1	EXHAUST PIPE CENTRE	BENT / DISTORTED	730.10	730.10
1	REAR FENDER (LH)	DENTED	4,736.80	2,020.00
1	REAR FENDER INNER LINING (LH)	NOT NECESSARY	169.30	-
1	REAR WINDSCREEN MOULDING	NECESSARY	28.30	28.30
1	IDLE PULLEY (ADDITIONAL)	BROKEN	189.50	189.50

Report Ref No. CS/FCI19001588/Dtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ERG VALVE & PIPE ASSY (ADDITIONAL)	BROKEN	2,480.50	2,480.50
1	SOLENOID VALVE (ADDITIONAL)	BROKEN	585.40	585.40
1	RAIL ASY-FUEL (ADDITIONAL)	DAMAGED	2,238.00	2,238.00
	LESS 20% DISCOUNT		-17,696.08	-9,378.69
			70,784.32	37,514.76
	SPECIAL NETT ITEMS			
1	FRONT NUMBER PLATE (SN)	DISLODGE	25.00	25.00
1	FRONT NO PLATE TRIM COVER (SN)	BROKEN	30.00	30.00
2	FRONT FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	NECESSARY	200.00	200.00
1	NEW BATTERY (SN)	NOT NECESSARY	207.00	-
1	FRONT DOOR COMFORT LOGO (LH)(SN)	NECESSARY	75.00	75.00
1	FRONT DOOR ADVERTISEMENT LOGO (LH)(SN)	NECESSARY	100.00	100.00
1	FRONT TYRE (LH)(SN)	NOT NECESSARY	216.00	-
1	BOOT LID COMFORT LOGO & TEL NO STICKER (SN)	NECESSARY	30.00	30.00
1	BOOT LID ADVERTISEMENT LOGO (SN)	NECESSARY	100.00	100.00
1	REAR NO PLATE (SN)	NOT NECESSARY	25.00	-
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	135.70	135.70
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
1	REAR BUMPER RUBBER MAT (SN)	NECESSARY / DEFORMED	50.00	50.00
2	REAR FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	NECESSARY	200.00	200.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
			1,489.70	1,041.70
	LABOUR			
	PANEL BEATING INCLUSIVE OF THE REPAIR OF FRONT CHASSIS MEMBER.		4,400.00	2,600.00
	SPRAY PAINTING CHARGE.		3,250.00	1,600.00
	WIRING CHARGE.		100.00	60.00
	TUFF KOTE.		200.00	80.00
	TOWING CHARGE.	NOT NECESSARY	50.00	-
	FRONT CHASSIS ALIGNMENT CHARGE.		400.00	150.00
	REMOVE/REFIX UNDERCARRIAGE (FRT).	NOT NECESSARY	200.00	-

Report Ref No. CS/FCI19001588/Dtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	FRT WHEEL ALIGNMENT.	NOT NECESSARY	120.00	60.00
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	80.00
	REMOVE/REFIX ENGINE/GEARBOX.		650.00	200.00
	REMOVE/REFIX DASHBOARD.		450.00	-
	REMOVE/REFIX FUSE BOX.		180.00	50.00
	RE-SET FRT ABS SYSTEM. }		200.00	180.00
	R/REFIX AIR BAG/STEERING WHEEL/DASHBOARD/SEAT. }		550.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE. }		480.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR.		150.00	80.00
	REMOVE/REFIX REAR WINDSCREEN GLASS.		120.00	80.00
	REMOVE/REFIX REVERSE SENSOR.		120.00	40.00
	REMOVE/REFIX EXHAUST PIPE.		300.00	60.00
			12,070.00	5,320.00
GRAND TOTAL			84,344.02	43,876.46
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				35,000.00

Report Ref No. CS/FCI19001588/Dtd3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.