

REF CS3/AG17017473/E v08-1 DAA & Days

menmen Wilson

Lee Ming Yao

ASSIGNMENT (Office)

Al G

Bill to

Date/Time 28012019

OD (TP/VS/TP RES/OD RES/EVA/INV/MV/CS

Insured SKV-78095

Tel 68420051 98575300 Neo

Sabrina

2 kaki Bukit Ave 2 # 01-18, 417921

Claim No 5053513536S6-003

Excess

Sum Insured

Make of Veh

(Client's Record)

CA / REV / REP / REV 24 HRS 'up'

Date/Time 11/9/17 10:25am Person Contacted Melody

R.O.D. Endorsement

Vehicle IN/OUT

Date/Time Action/Instruct (X) Estimate

SST9379A-NA/INC17016 57/k4 D & A 26/8/17

SKV78-75-NA/INC17016 51/k4-D & A 26/8/17

Dismantle Part: 11.09.2017

After repair: 19.09.2017

* Contact N-SI Sabrina, mentioned pass to VISION low firm, don't want discuss repair cost
30/1/19 11:30am

11/2/19 Submit LS \$3000 (Red 4000, 57%), 4 days.

RECEIVED 12 FEB 2019


11/2/2019

PRI
J. Lee

REF AIG

ASSIGNMENT

Date 11/9/17

Surveyed By:

OD (TP) WS TP RES / OD RES / EVA / INV / MV

To Report Vehicle No. SJT 9379A

At Workshop No. N-51 Automotive

At 2 kaki Bukit Ave 2 # 01-18

Notes:

Policy No.

Claims No.

Sum Insured

Excess

Claims Record:

Make of van

Repair Condition

Remark: The veh had commenced its repair at the time of inspection.

Sal. or Market Value

QAC Accident Report

Consistent? Yes or No

Sal. PR Clear

Consistent? Yes or No

Est. Repairs

days Res Yes or No

Lump Sum

3 Val Yes or No

CA / REV / REP / 24 HRS 'wp'

Date

Person Contacted

Vehicle IN / OUT

Date Time Action Instruction

Ref No. SJT 9379A Reg. 10/11/2009

Type (M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover)

Truck / Trailer or

Make Hyundai Avante 1591

Colour black Insured Std / NI / NA

Bo Reading 153112 - Radio Insured / Std / NI / NA

Eng No.

C No. KMHDU4HBMAU896821

Gen Cond Good / Fair / Poor / Burnt

Steering Inorder / Jammed / Leaked / Burnt or

Brake Inorder / Jammed / Leaked / Burnt or

Mod. N/A (S/Rim) / STD A/Rim or

Tyre Size F. 205 / 60 R16

R. 205 / 60 R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI

TOYO / YOKO or

Front

Rear

R. Bal 3 mm

F. Bal 3

L. Bal 3 mm

L. Bal 3

D.O.A.

D.O.A.

Survey held at 2 kaki Bukit Ave 2 # 01-18 11/9/2017 @ 12-14pm

Des. of Damages Frt / Rear / DIS / N/S / UIC / Rooftop or

Left Front

The UIC / Chassis frame / Body Structure affected due to collision

[Signature]
11/11/2017

Pass / Fail / Pass / Fail

01-11-2017

Task Time & Returning

☐

: Prelim. Report

☐

: Final Report

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

Site Insp. IS

☐

Interview IS

☐

Tech. Invs IS

☐

Weekend IS

Report Format : PRS

Lump Sum / I.B.I. (S)

Survey Fee

Transportation

Food & Drink

Other

Chassis

Paint

Other

180

20

200

Catherine Chong (LKK Auto)

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: Monday, 28 January, 2019 10:37 AM
To: assignments
Subject: FW: Our Ref : 5053513536SG-003 | Paper Survey on TPV's COR
Attachments: Adjustment - 5053513536SG-003.pdf

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Lee, Ming-Yao <MingYao.Lee@aig.com>
Sent: Monday, 28 January 2019 9:32 AM
To: SUR <sur@lkkauto.com>
Cc: Admin A <admin-a@lkkauto.com>
Subject: Our Ref : 5053513536SG-003 | Paper Survey on TPV's COR

Hi LKK,

Understand PRI was conducted by Mr. Wilson Teo.

Attached surveyor report provided by TP Solicitor, for your kind review on the reasonable COR of TPV please.

Thanks,
George Lee
AIG
Complex Claims Examiner
Claims | AIG Asia Pacific Insurance Pte. Ltd

AIG Building, 78 Shenton Way, #08-16 Singapore 079120
Tel +(65) 6419 1769

Ming-Yao.Lee@aig.com | www.aig.sg



AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards.
[Click here to find out more.](#)

Follow us:



IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by AIG for any loss or damage arising in any way from its use.

MOTOR CAR (UC)

Undercarriage

NAC	INC	Item	CON	AC	Qty
1372	995163	Frt LH Shock Absorber	BT	✓	25
1373	991944	Frt LH Shock Absorber Mounting	NEC	✓	35
1374	990632	Frt LH Coil Spring			
1375	995198	Frt LH Knuckle Arm	BT	✓	36
1376	995199	Frt LH Knuckle Arm Bearing	NEC	✓	100
1377	995178	Frt LH Lower Arm	BT	✓	262
1378	995169	Frt LH Upper Arm			
1379	995183	Frt LH Tie Rod	BT	✓	52
1380	995143	Frt LH Drive Shaft	BT	✓	938
1381	990661	Frt LH Control Arm			
1382	992062	Frt LH Trailing Arm			
1383	991848	Frt LH Leaf Spring			
1384	991293	Frt LH Brake Disc Rotor			
1385	991281	Frt LH Brake Caliper			
1386	991292	Frt LH Brake Pipe			
1387	991287	Frt LH Brake Hose			
1388	991295	Frt LH Brake Sensor Wire			
1389	991989	Frt Stay Bar Bracket			
1390	994455	Steering Rack & Pinion			
1391	994435	Steering Cross Member			
1392	994519	Frt Sub Frame			
1393	992003	Frt Sub Frame Mounting			
1394	991217	Frt Anti Roll Bar			
1395	991219	Frt Anti Roll Bar Linkage (LH)	BT	✓	88
1396	990887	Engine Block			
1397	990890	Engine Block Gasket			
1398	990972	Engine Oil Sump			
1399	990960	Engine Oil			
1400	992224	Gear Box Assy			
1401	992229	Gear Box Gasket			
1402	992241	Gear Box Oil Sump			
1403	992257	Gear Oil			
1404	990534	Centre Exhaust Pipe Assy			
1405	990532	Centre Exhaust Mounting			
1406	991134	Floor Panel			
1407	993719	Rear LH Shock Absorber			
1408	993723	Rear LH Shock Absorber Mounting			
1409	993170	Rear LH Coil Spring			
1410	993550	Rear LH Knuckle Arm			
1411	993551	Rear LH Knuckle Arm Bearing			
1412	993597	Rear LH Lower Arm			
1413	993884	Rear LH Upper Arm			
1414	995161	Rear LH Drive Shaft			
1415	995216	Rear LH Control Arm			
1416	993881	Rear LH Trailing Arm			
1417	993573	Rear LH Leaf Spring			
1418	992941	Rear LH Brake Disc Rotor			
1419	992937	Rear LH Brake Caliper Assy			
1420	990434	Rear LH Brake Pipe			
1421	992946	Rear LH Brake Hose			
1422	993819	Rear Sub Frame			
1423	993820	Rear Sub Frame Mounting			
1424	992813	Rear Anti Roll Bar			
1425	990168	Rear Anti Roll Bar Linkage			
1426	990202	Axle Beam			
1427	990170	Rear Axle Panhard Rod			
1428	990810	Differential Assy			
1429	992706	Propeller Shaft			

Vehicle No:

NAC	INC	Item	CON	AC	Qty
1428	991935	Frt RH Shock Absorber			
1429	991944	Frt RH Shock Absorber Mounting			
1430	990632	Frt RH Coil Spring			
1431	991844	Frt RH Knuckle Arm			
1432	991845	Frt RH Knuckle Arm Bearing			
1433	991851	Frt RH Lower Arm			
1434	992064	Frt RH Upper Arm			
1435	992040	Frt RH Tie Rod			
1436	991692	Frt RH Drive Shaft			
1437	990661	Frt RH Control Arm			
1438	992062	Frt RH Trailing Arm			
1439	991848	Frt RH Leaf Spring			
1440	991293	Frt RH Brake Disc Rotor			
1441	991281	Frt RH Brake Caliper			
1442	991292	Frt RH Brake Pipe			
1443	991287	Frt RH Brake Hose			
1444	991295	Frt RH Brake Sensor Wire			
1445	993720	Rear RH Shock Absorber			
1446	993723	Rear RH Shock Absorber Mounting			
1447	993173	Rear RH Coil Spring			
1448	993550	Rear RH Knuckle Arm			
1449	993551	Rear RH Knuckle Arm Bearing			
1450	993601	Rear RH Lower Arm			
1451	993885	Rear RH Upper Arm			
1452	993322	Rear RH Drive Shaft			
1453	993178	Rear RH Control Arm			
1454	995117	Rear RH Trailing Arm			
1455	995110	Rear RH Leaf Spring			
1456	992942	Rear RH Brake Disc Rotor			
1457	992938	Rear RH Brake Caliper Assy			
1458	990434	Rear RH Brake Pipe			
1459	992947	Rear RH Brake Hose			

No of Items: _____ Assessor: _____

Parts → \$4342
 D.P → \$600
 Labour → \$900
 Total → \$5842

Original copy
 No. of Repair Day → 5 Days

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG17017473/WBE2

Date: 02/11/2017

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:
 Claimant Vehicle No : SJT9379A Insured Vehicle No : SKV7809S
 Date of Loss: 26/08/2017 Nature of Claim: TP Claim No: 5053513536SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SJT9379A
 Make & Model: HYUNDAI AVANTE, 1.6 ABS AIRBAG 2WD 4DR (A) Engine No: G4FC9U749929
 Reg. Date: 10/11/2009 (Man. Year: 2009) Chassis No: KMHDU41BMAU896821
 Colour: Black Odometer: 153112 km
 Engine Capacity: 1591 cc
 Market Value/New Car Price: N/A
 Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
 Front Left Side: Bridgestone 3 mm Rear Left Side: Bridgestone 3 mm
 Front Right Side: Bridgestone 3 mm Rear Right Side: Bridgestone 3 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 11/09/2017
 Date Inspected: 11/09/2017 Inspected At: N-51 Automotive Pte Ltd (HQ)
 BLK 2 KAKI BUKIT, #01-17/18 KAKI
 BUKIT AUTOHUB
 Singapore 417921
 Estimated Period of Repair: 5.0 days

Adjuster: Teo Cheng Ming Wilson

Manager: CATHERINE CHONG KAI LING

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Dented	0.00 F	*-F
2	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*-F
3	1		*FRT BUMPER SIDE RETAINER LH	Necessary	0.00 F	*-F
4	1		*FRT BUMPER SPONGE	Damaged	0.00 F	*-F
5	1		*FRT BUMPER GRILLE	Cracked	0.00 F	*-F
6	1		*FRT LH BUMPER FOG LAMP COVER	Cracked	0.00 F	*-F
7	1		*FRT GRILLE	Cracked	0.00 F	*-F
8	1		*FRT GRILLE EMBLEM	Necessary	0.00 F	*-F
9	1		*FRT LH HEADLAMP ASSY	Cracked	0.00 F	*-F
10	1		*FRT LH FENDER	Dented	0.00 F	*-F
11	1		*FRT LH FENDER VVT LOGO	Necessary	0.00 F	*-F
12	1		*FRT LH FENDER INNER SHIELD	Warped	0.00 F	*-F
13	1		*FRT LH CLIP	Necessary	0.00 F	*-F
14	1		*FRT LH SPORT RIM	Scratched	0.00 F	*-F
15	1		*FRT LH SHOCK ABSORBER	Bent	0.00 F	*-F
16	1		*FRT LH SHOCK ABSORBER MOUNTING	Necessary	0.00 F	*-F
17	1		*FRT LH KNUCKLE ARM	Bent	0.00 F	*-F
18	1		*FRT LH KNUCKLE ARM BEARING	Necessary	0.00 F	*-F
19	1		*FRT LH LOWER ARM	Bent	0.00 F	*-F
20	1		*FRT LH TIE ROD	Bent	0.00 F	*-F
21	1		*FRT LH DRIVE SHAFT	Bent	0.00 F	*-F
22	1		*FRT ANTI ROLL BAR LINKAGE (LH)	Bent	0.00 F	*-F
Total Parts (S\$)					0.00	0.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >

PAR Automotive Consultancy

Regn No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0156-18-N51

28 March 2018

PHOTOCOPY

Goh Siew Li
Blk 433 Hougang Ave 8 #06-932
Singapore 530433

INVOICE No. 0156-18-N51


Vehicle No. SJT9379A

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$711.00
Total amount payable		\$711.00

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

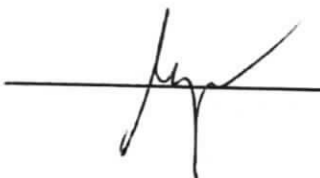

Report No: 0156-18-N51

28 March 2018

ACCIDENT VEHICLE SURVEY REPORT

Goh Siew Li
Blk 433 Hougang Ave 8 #06-932
Singapore 530433

VEHICLE INFORMATION:

Vehicle Reg No.:	SJT9379A	Odometer:	153112km
Make & Model:	Hyundai Avante 1.6AT	Colour:	Black
Chassis number:	KHMDU41BMAU896821	Date of accident:	26/08/2017
Year of Regn.:	10/11/2009	Date inspected:	11/09/2017
Repairer at:	N-51 Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-18 Kaki Bukit Auto Hub Singapore 417921	Date inspected (After Repair):	19/09/2017

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	5mm/Bridgestine	5mm/Bridgestine	205/60R16
Rear:	5mm/Bridgestine	5mm/Bridgestine	205/60R16

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front LH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
FRONT BONNET	1	repair	1,017.00	0.00 X
FRONT BONNET HINGES L/R	2	reuse	130.00	0.00 X
FRONT BONNET MECHANISM LOCK	1	reuse	44.00	0.00 X
FRONT BONNET RUBBER GUIDE STOPPER	4	reuse	32.00	0.00 X
FRONT BONNET WEATHERSTRIP	1	reuse	28.00	0.00 X
FRONT BUMPER	1	squashed	432.00	432.00 /
FRONT BUMPER FOGLAMP COVER L/R	2	L-warped	50.00	25.00 /
FRONT BUMPER INNER SPONGE	1	fractured	113.00	113.00 /
FRONT BUMPER LOWER CENTER GRILLE	1	fractured	47.00	47.00 X NN
FRONT BUMPER LOWER UNDER RUBBER SEAL	1	deformed	44.00	44.00 X NN
FRONT BUMPER REINFORCEMENT	1	bent	254.00	254.00 X NN
FRONT BUMPER SIDE RETAINER L/R	2	necessary	52.00	52.00 /
FRONT GRILLE	1	fractured	420.00	420.00 X NN
FRONT GRILLE 'LOGO' EMBLEM	1	necessary	21.00	21.00 X NN
FRONT GRILLE CLIPS	4	necessary	26.00	26.00 X NN
FRONT LH ABS SENSOR	1	shorted	227.00	227.00 X NN
FRONT LH DRIVE SHAFT ASSY	1	bent	936.00	936.00 X NN
FRONT LH FENDER	1	buckled	402.00	402.00 /
FRONT LH FENDER 'VVT' EMBLEM	1	necessary	20.00	20.00 /
FRONT LH FENDER BRACKET	1	bent	35.00	35.00 X NN
FRONT LH FENDER INNER PANEL	1	repair	493.00	0.00 X
FRONT LH FENDER INNER SHIELD	1	fractured	57.00	57.00 /
FRONT LH FENDER INNER SPONGE	1	reuse	51.00	0.00 X
FRONT LH HEADLAMP	1	fractured	480.00	480.00 /
FRONT LH HEADLAMP CLIPS	3	necessary	19.50	19.50 /
FRONT LH HEADLAMP LOWER BRACKET	1	bent	37.00	37.00 X NN
FRONT LH KNUCKLE ARM	1	distorted	363.00	363.00 /
FRONT LH KNUCKLE ARM BEARING	1	dislodged	113.00	113.00 /
FRONT LH LOWER ARM	1	bent	282.00	282.00 /
FRONT LH LOWER BALL JOINT	1	dislodged	77.00	77.00 /
FRONT LH POWER STEERING RACK	1	bent	913.00	913.00 X NN
FRONT LH POWER STEERING RACK END	1	dislodged	112.00	112.00 X NN
FRONT LH POWER STEERING TIE ROD	1	reuse	65.00	0.00 X
FRONT LH SHOCK ABSORBER	1	bent	194.00	194.00 X NN
FRONT LH SHOCK ABSORBER TOP MOUNTING	1	necessary	96.00	96.00 X NN
FRONT LH STABILIZER BAR LINK	1	bent	69.00	69.00 X NN
FRONT RH FENDER 'VVT' EMBLEM	1	reuse	20.00	0.00 X
FRONT RH FENDER INNER SHIELD	1	reuse	57.00	0.00 X
FRONT SUPPORT PANEL	1	reuse	791.00	0.00 X
Subtotal before discount			S\$ 8,619.50	S\$ 5,866.50
Percentage discount 20% and 20%			S\$ 1,723.90	S\$ 1,173.30
Sub-total 1			S\$ 6,895.60	S\$ 4,693.20

2435.50

1948.40

FRONT BONNET INSULATOR MAT CLIPS - SET	1	necessary	30.00	30.00	X NN
FRONT BUMPER CLIPS - SET	1	necessary	30.00	30.00	/
FRONT BUMPER NUMBER PLATE	1	reuse	25.00	0.00	X
FRONT BUMPER NUMBER PLATE HOLDER	1	reuse	50.00	0.00	X
FRONT LH 16" SPORT RIM	1	abraded	550.00	550.00	/ 300
FRONT LH 205/60 R16 92V TYRE	1	abraded	450.00	450.00	X NN
FRONT LH FENDER INNER SHIELD CLIPS - SET	1	necessary	30.00	30.00	/
FRONT RH FENDER INNER SHIELD CLIPS - SET	1	reuse	30.00	0.00	X
RADIATOR COOLANT - BOT	1	reuse	80.00	0.00	X
Subtotal before discount			S\$ 1,275.00	S\$ 1,090.00	360
Sub-total 2			S\$ 1,275.00	S\$ 1,090.00	
Parts-total			S\$ 8,170.60	S\$ 5,783.20	

LABOUR

To remove, reinstall air con parts, vacuums, refill air con gas. (to FR)	180.00	0.00	X
To remove, reinstall electrical wiring harness, check lighting, resetting headlamp focussing and rewire for parking sensor.	120.00	60.00	/
To remove, change front suspension parts, absorber, lower arm, knuckle arm, wheel bearing, bearing hub, drive shaft, anti-roll bar, top-arm and steering rack and pinion.	550.00	450.00	300/
To road test driving, check and resetting wheel alignments system.	180.00	180.00	60/
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,250.00	800.00	600/
To provide labour, workmanship to change the above damaged bodyparts, repair, reconstruct and re-align body structure, body alignments and damaged consistent to the accident.	1,500.00	880.00	400/
To apply anti-rust chemical on repaired and replaced panel.	120.00	30.00	/
Labour Total	SS 3,900.00	SS 2,400.00	
Parts & Labour Total	SS 12,070.60	SS 8,183.20	1450

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : S\$ 7,000.00
and the recommended number of working days for the repairs is within 7 day(s).

h

B J Loi (I Eng., MIMI, AIRTE)
Automotive Appraiser

3758.40
415-3,006.72
= 3000
4 days

Kaki Bukit AutoHub
2 Kaki Bukit Ave 2
#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27
Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510
E-Mail : sales@n51.com.sg
Company Reg. No. : 200616038C
GST Registration No. : 200616038C

PHOTOCOPY

GOH SIEW LI
BLK 433 HOUGANG AVE 8 #06-932
SINGAPORE 530433

Contact : 96430310

TAX INVOICE

Date : 24/04/2018

Date in : 08/09/2017

Vehicle Num. : SJT9379A

Make/Model : HYUNDAI AVANTE 1.6 AT ABS D/AB 2WD 4DR-2009

Chassis/Eng# : KMHU41BMAU896821/G4FC9U749929

Accident Date : 26/08/2017

Claim No : CLM14189

Reference : SEPT-12/2017

Policy No. : 5091039589 (09/05/2018)

LUMPSUM REPAIR BILL
AS PER SURVEYOR REPORT
REF : 0156-18-N51 DATED 28/03/2018
BY PAR AUTOMOTIVE CONSULTANCY

Amount S\$

7,000.00



E. & O.E. Sub S\$: 7,000.00

Add GST (7 %) S\$: 490.00

Total Amount S\$: 7,490.00

for N-51 AUTOMOTIVE PTE LTD

**bizSAFE₃**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AIG ASIA PACIFIC INSURANCE PTE LTD			Ref : CS3/AIG17017473/Evd3e2-1	
78 SHENTON WAY #08-16 CHARTIS BUILDING SINGAPORE 079120			Date : 12-02-2019	
ATTN : LEE MING YAO			Code : AIG	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKV 7809S	Veh. Inspected	SJT 9379A	
Policy No.		Coverage (\$)	0.00	
Claim No.	5053513536SG-003	Excess (\$)	0.00	
Assign From	LEE MING YAO	Assign Date	28/01/2019	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI AVANTE	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	KMH DU41BMAU896821	Colour	BLACK	
Odometer	153112	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	BRIDGESTONE	3 mm	
L/H Front Tyre	205/60 R16	BRIDGESTONE	3 mm	
R/H Rear Tyre	205/60 R16	BRIDGESTONE	3 mm	
L/H Rear Tyre	205/60 R16	BRIDGESTONE	3 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/08/2017	Inspection Date	11/09/2017	
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 9379A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BONNET	TO REPAIR SEE LABOUR	1,017.00	-
2	FRONT BONNET HINGES L/R	REUSE	130.00	-
1	FRONT BONNET MECHANISM LOCK	REUSE	44.00	-
4	FRONT BONNET RUBBER GUIDE STOPPER	REUSE	32.00	-
1	FRONT BONNET WEATHERSTRIP	REUSE	28.00	-
1	FRONT BUMPER	SQUASHED	432.00	432.00
2	FRONT BUMPER FOGLAMP COVER L/R	N/S WARPED	50.00	25.00
1	FRONT BUMPER INNER SPONGE	FRACTURED	113.00	113.00
1	FRONT BUMPER LOWER CENTER GRILLE	NOT NECESSARY	47.00	-
1	FRONT BUMPER LOWER UNDER RUBBER SEAL	NOT NECESSARY	44.00	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	254.00	-
2	FRONT BUMPER SIDE RETAINER L/R	NECESSARY	52.00	52.00
1	FRONT GRILLE	NOT NECESSARY	420.00	-
1	FRONT GRILLE 'LOGO' EMBLEM	NOT NECESSARY	21.00	-
4	FRONT GRILLE CLIPS	NOT NECESSARY	26.00	-
1	FRONT LH ABS SENSOR	NOT NECESSARY	227.00	-
1	FRONT LH DRIVE SHAFT ASSY	NOT NECESSARY	936.00	-
1	FRONT LH FENDER	BUCKLED	402.00	402.00
1	FRONT LH FENDER 'VVT' EMBLEM	NECESSARY	20.00	20.00
1	FRONT LH FENDER BRACKET	NOT NECESSARY	35.00	-
1	FRONT LH FENDER INNER PANEL	TO REPAIR SEE LABOUR	493.00	-
1	FRONT LH FENDER INNER SHIELD	FRACTURED	57.00	57.00
1	FRONT LH FENDER INNER SPONGE	REUSE	51.00	-
1	FRONT LH HEADLAMP	FRACTURED	480.00	480.00
3	FRONT LH HEADLAMP CLIPS	NECESSARY	19.50	19.50
1	FRONT LH HEADLAMP LOWER BRACKET	NOT NECESSARY	37.00	-
1	FRONT LH KNUCKLE ARM	DISTORTED	363.00	363.00
1	FRONT LH KNUCKLE ARM BEARING	DISLODGE	113.00	113.00
1	FRONT LH LOWER ARM	BENT	282.00	282.00

Report Ref No. CS3/AIG17017473/Evd3e2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LH LOWER BALL JOINT	DISLODGE	77.00	77.00
1	FRONT LH POWER STEERING RACK	NOT NECESSARY	913.00	-
1	FRONT LH POWER STEERING RACK END	NOT NECESSARY	112.00	-
1	FRONT LH POWER STEERING TIE ROD	REUSE	65.00	-
1	FRONT LH SHOCK ABSORBER	NOT NECESSARY	194.00	-
1	FRONT LH SHOCK ABSORBER TOP MOUNTING	NOT NECESSARY	96.00	-
1	FRONT LH STABILIZER BAR LINK	NOT NECESSARY	69.00	-
1	FRONT RH FENDER 'VVT' EMBLEM	REUSE	20.00	-
1	FRONT RH FENDER INNER SHIELD	REUSE	57.00	-
1	FRONT SUPPORT PANEL	REUSE	791.00	-
	LESS 20% DISCOUNT		-1,723.90	-487.10
			6,895.60	1,948.40
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BONNET INSULATOR MAT CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	FRONT BUMPER NUMBER PLATE (SN)	REUSE	25.00	-
1	FRONT BUMPER NUMBER PLATE HOLDER (SN)	REUSE	50.00	-
1	FRONT LH 16" SPORT RIM (SN)	ABRADED	550.00	300.00
1	FRONT LH 205/60 R16 92V TYRE (SN)	NOT NECESSARY	450.00	-
1	SET FRONT LH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT RH FENDER INNER SHIELD CLIPS (SN)	REUSE	30.00	-
1	BOT RADIATOR COOLANT (SN)	REUSE	80.00	-
			1,275.00	360.00
	<u>LABOUR</u>			
	TO REMOVE, REINSTALL AIR CON PARTS, VACUUMS, REFILL AIR CON GAS. (TO FR)	NOT NECESSARY	180.00	-
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING, RESETTING HEADLAMP FOCUSING AND REWIRE FOR PARKING SENSOR.		120.00	60.00
	TO REMOVE, CHANGE FRONT SUSPENSION PARTS, ABSORBER, LOWER ARM, KNUCKLE ARM, WHEEL BEARING, BEARING HUB, DRIVE SHAFT, ANTI-ROLL BAR, TOP-ARM AND STEERING RACK AND PINION.		550.00	300.00
	TO ROAD TEST DRIVING, CHECK AND RESETTING WHEEL ALIGNMENTS SYSTEM.		180.00	60.00

Report Ref No. CS3/AIG17017473/Evd3e2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		1,250.00	600.00
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF FRONT BONNET AND FRONT LH FENDER INNER PANEL.		1,500.00	400.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	30.00
			3,900.00	1,450.00
GRAND TOTAL			12,070.60	3,758.40
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,000.00

Report Ref No. CS3/AIG17017473/Evd3e2-1

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.