

22/03/2019

ASS. REC. BY:

REF: CS3/MSG18022111/Gtd3/51 Special Instruction:

Surveyor: Sub Qian
Meimian

ASSIGNMENT (Office)

14/3/2019

From (Person): Katherine Wongof MSGDate/Time: 10/12/18 @ 9:31am

Estimated Cost:

Bill to:

OD/TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLE 4477MInsured: GBF 10832

at Workshop m/s

Car DoctorTel: 8687 3233

of

B1k3, 391A Woodlands Rd Yew Tee

Policy No:

A2907694AMKF

Claim No:

577662

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A. 30/11/2018

CA / REV / REP. / REV 24 HRS

up

H.O.D. Endorsement:

Date/Time: 9:31am @ 10/12/18

Person Contacted:

Mr. HenVehicle IN / OUT

Date/Time

Action/Instruction (x) Estimate

SLE 4477M - XGBF 10832 - X\$4100, 6 Days.(Red: 4200, 50%)913 - File pass to typist

URGENT

RECEIVED 08 MAR 2019

8/3/2019

0706f /
(2023)
04 Apr 2018

ASSIGNMENT

Form Date 10/12/18

Estimated Cost

OD TP WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No. SLE 4477M

at Workshop n/a M/s Car Doctor

at Blk 3, 391A Woodlands Rd Yew Tee Ind.

Insured Estate

Policy No

Claims No

Sum Insured Excess

(Client's Record)

Make of Veh Mr. Han @ 8687 3233

N/S	O/S

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: \$28K

IDAC Accident Rpt. Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 7 days Res.: Yes or No

Turn Sum: 20 % 3 Val. Yes or No

GA / REV / REP. / 24 HRS^{up}

Veh No: SLC 4477M Yr: 1994 Apr 2
 Type: Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Honda Civic C.C. 1595
 Colour: black A/O: Insured / Std / Nil / NA
 Sp. Reading: - T/Radio: Insured / Std / Nil / NA
 Eng/No:
 C/Nr: JHMFD 462085201031
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modl: Nil / SRM / STD A/Rim or
 Tyre Size: F: 225/45 R17
 R:

GSJ / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front
R/Bal 6
L/Bal 6
D.O.A.
Survey held at
Des. of Damages: Frt / Rear / O/S / W/S / UIC / Rooftop or

Rear
R/Bal 6
L/Bal 6
D.O.A. 10-1.2-18
4pm

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	\$7 ⁰⁰⁰ - \$8 ⁰⁰⁰

RECEIVED 11 DEC 2018

Date/Time: File Path to? ☐: Prel. Report

ii) : Final Report

Date/Time, File Return to?

5

Report Format : PRS-

Lump Sum / I.B.I: (\$)

Days Of Repair: 7

Resurvey No. of Trip:

Add Fee: ☐ Site Insp (\$☐ Interview (\$)

Tech. Inven. (\$)

Wool end (\$)

Survey Fee

Transportation

) 3 + P5 51

) 176/40%

2. Criteria

10346

S K AUTO CONSULTANTS

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/018/0651SK

Your Reference: TBA

Date: 30/12/2018

TO: Muhammad Hazlan Bin Kamriwah
c/o Car Doctor Pte Ltd
Blk 3, 391A Woodlands Road
Yew Tee Industrial Estate
Singapore 677964

Assessment of Vehicle No : SLE 4477M
Date of Accident : 30/11/2018
Date of Inspection : 06/12/2018

We have carried out a physical assessment of SLE 4477M at Car Doctor Pte Ltd according to your instructions on 06/12/2018 and are pleased to submit our report as follows;

1.VEHICLE PARTICULARS

Registration No.	:	SLE 4477M
Make & Model	:	HONDA CIVIC
Year of Registration	:	2008 (COE EXP 2023)
Engine Capacity (cc)	:	1597
Chassis No.	:	JHMF046208S201031
Engine No.	:	R16A13003295
Colour	:	Black
Mileage (km)	:	126030

2.VEHICLE CONDITION

Body Paint:	:	Good
Steering	:	Serviceable
Foot Brake	:	Serviceable
Parking Brake	:	Serviceable

3.TYRE PARTICULARS & CONDITION

Front

RH Make/Size	:	Bridgestone 225/45R17 - 50%
LH Make/Size	:	Bridgestone 225/45R17 - 50%

Rear

RH Make/Size	:	Bridgestone 225/45R17 - 50%
LH Make/Size	:	Bridgestone 225/45R17 - 50%

Note: % denotes the remaining percentage of the tyre

S K AUTO CONSULTANTS


Page No. 2

Our Reference TP/018/0651SK
Vehicle No. SLE 4477M

4.DESRIPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the Left side front to rear portion

Please see attached schedule for details.

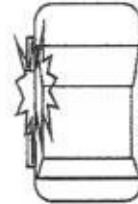

Estimated Amount : S\$11,697.20
Adjusted Amount : S\$8,300/-
Estimated Repair Days : 6 days

Pursuant to your instruction, we have NOT AUTHORIZED repair.
The assessment was conducted on a "Without Prejudice" basis.

If we are not notified of anything to the contrary within 14 Days from the date hereof, this report shall be treated as correct

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by S K AUTO CONSULTANTS for any reliance on this report by any third party.

S K AUTO CONSULTANTS

Page No. 3

Our Reference TP/018/0651SK
Vehicle No. SLE 4477M

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)		OUR ASSESSMENT(\$\$)	
<u>PARTS (LIST ITEMS)</u>						
1	Front Door LH	Distorted	1280.00		841.3	1280.00 /
1	Front Door Inner Lock LH	Damaged	250.00		250.00	/
1	Front Door LH outer lock handle	Damaged	240.00		144.9	240.00 /
1	Front Door Check Strap LH	Bent	42.00		X 42.00	X NN
1	Front Door LH Window Regulator Motor	Damaged	430.00		430.00	/
1	Front Door LH inner door board	Deformed	520.00		X 520.00	X NN
1	Front Door LH lower moulding	Necessary	142.00		107	142.00 /
1	Front Door LH upper moulding	Necessary	178.00		85.8	178.00 /
1	Front Door LH side black tape	Necessary	72.00		43.8	72.00 /
1	Rear Door LH	Distorted	1220.00		841.3	1220.00 /
2	Rear Door hinges @\$128	Bent	256.00		X 256.00	X
1	Rear Door Inner Lock LH	Damaged	250.00		X 250.00	X NN
1	Rear Door LH outer lock handle	Damaged	240.00		X 240.00	X
1	Rear Door Check Strap LH	Bent	42.00		X 42.00	X
1	Rear Door LH Window Regulator Motor	Damaged	430.00		X 430.00	X
1	Rear Door inner door board	Damaged	520.00		X 520.00	X
1	Rear Door LH lower moulding	Necessary	142.00		126.5	142.00 /
1	Rear Door LH upper moulding	Necessary	178.00		X 178.00	X NN
1	Rear Door LH side black tape	Necessary	72.00		43.8	72.00 /
1	LH Side view mirror assembly	Broken	698.00		531.3	698.00 /
1	LH Front fender	Distorted	780.00		537.5	780.00 /
1	LH Front fender inner splash shield	Deformed	243.00		94.8	243.00 /
1	LH Front fender signal lamp	Broken	72.00		18.2	72.00 /
1	LH Rear fender	Repair	982.00			0.00
1	LH Lower sill (rocker panel)	Grazed	780.00		X 780.00	X NN
				10059.00		9077.00
			less 20%	2011.80	20%	1815.40
				8047.20		7261.60
<u>SPECIAL NETT ITEMS</u>						
1 set	Front fender Inner Shield Clips	Necessary	60.00		30	40.00 /
1set	Front & Rear doors board clips	Necessary	120.00		60	80.00 /
TOTAL PARTS			8227.20			7381.60

90

S K AUTO CONSULTANTS

Page No. 4

Our Reference TP/018/0651SK
Vehicle No. SLE 4477M

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$\$)	OUR ASSESSMENT (\$\$)
	LABOUR		
1	To remove the affected parts to commence repairs; replace damaged parts	1400.00	1200.00 600
2	To supply paint materials, expandable items & putty, respray paint on parts replaced	1200.00	1000.00 ✓
3	To remove, refix wiring system at accident damaged areas and check for proper function	180.00	150.00 30
4	To perform anti rust treatment on affected areas	270.00	240.00 60
5	To conduct full computerised wheel alignment test	120.00	100.00 X 120
6	To remove and refix both doors components, fittings etc.	300.00	240.00 120
	Labour Total :	3470.00	2930.00
	TOTAL (PARTS & LABOUR):	11697.20	10311.60

Note: (For Lump Sum Repair)

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or the use of ex stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements.

The final adjusted Lump Sum contract amount is S\$8,300/-



 S. Kumanan
 Motor Surveyor

5176.96
20% = 4100

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	01 Dec 2018		10 Dec 2018 09:31	S\$4,100.00 Edit Adj Rpt	S\$4,100.00 Edit Estimates		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	LIANG YUAN PTE LTD, Co. Reg. No.: 200821822D		
Main Claimant:	Muhammad Hazlan Bin Kamriwah, ID: S8930706F		
Vehicle Reg. No.:	SLE4477M	Date of Loss:	30/11/2018 13:00 - :59 [127 Months and 26 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 577662	Policy/Cover Note No.:	A29076944MKF (Comprehensive) Coverage: 01/04/2018 - 31/03/2019
Vehicle Reg. No. (Insured):	GBF1083Z	Policy No. (Claimant):	
		Excess:	
Repairer:	M/s Car Doctor Pte Ltd (HQ) BLK3, 391A Woodlands Road Yew Tee, industrial estate, 677695 Woodlands - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Katherine Wong Chew Shong - 6594 2544]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by XING GUO QIANG] ... [Final Rpt due 18/02/2019]		
Driver/Custodian (Insured):	DOU XIAOPENG (), NRIC: G8737729L, Tel: +6581611402 Email:		
Adj Asg. Remarks:	Liability 100%, SJE disagree - assign LKK, Contact : Mr Sylvester Han at 8687 3233 or 6635 5773		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- MSIG_SG (14/02/2019): Report Send Back Alerts - SLE4477M (TP)

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SLE4477M (577662)**
[GBF1083Z]

TP

Muhammad Hazlan Bin Kamriwah

Nov 30 2018 1:00PM

[LIANG YUAN PTE LTD]

M/s Car Doctor Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View
[View in Browser](#)

Assessment Reports

No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	07/12/18 11:53	Accident Statement From:OD - Reg. No: GBF1083Z, Claimant: LIANG YUAN PTE LTD	Load HTM	☒

Photos/Images

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	11/12/18 16:14	General View	Load JPG	☒
2	11/12/18 16:14	General View	Load JPG	☒
3	11/12/18 16:14	General View	Load JPG	☒
4	11/12/18 16:14	General View	Load JPG	☒
5	11/12/18 16:14	General View	Load JPG	☒
6	11/12/18 16:14	General View	Load JPG	☒
7	11/12/18 16:14	General View	Load JPG	☒
8	11/12/18 16:14	General View	Load JPG	☒
9	11/12/18 16:14	General View	Load JPG	☒
10	11/12/18 16:14	General View	Load JPG	☒
11	11/12/18 16:14	General View	Load JPG	☒
12	11/12/18 16:14	General View	Load JPG	☒
13	11/12/18 16:14	General View	Load JPG	☒
14	11/12/18 16:14	General View	Load JPG	☒
15	11/12/18 16:14	General View	Load JPG	☒
16	11/12/18 16:14	General View	Load JPG	☒
17	11/12/18 16:14	General View	Load JPG	☒
18	11/12/18 16:14	General View	Load JPG	☒
19	11/12/18 16:14	General View	Load JPG	☒
20	11/12/18 16:14	General View	Load JPG	☒
21	11/12/18 16:14	General View	Load JPG	☒
22	11/12/18 16:14	General View	Load JPG	☒
23	11/12/18 16:14	General View	Load JPG	☒
24	11/12/18 16:14	General View	Load JPG	☒
25	11/12/18 16:14	General View	Load JPG	☒
26	11/12/18 16:14	General View	Load JPG	☒
27	11/12/18 16:14	General View	Load JPG	☒
28	11/12/18 16:14	General View	Load JPG	☒
29	11/12/18 16:14	General View	Load JPG	☒
30	11/12/18 16:14	General View	Load JPG	☒
31	11/12/18 16:14	General View	Load JPG	☒

Assessment Reports			1 per page ▼	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail Print
32	11/12/18 16:14	General View		Load JPG ☒
Documentation			1 per page ▼	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail Print
1	07/12/18 11:53	SLE4477M E-FILE REPORT From:OD - Reg. No: GBF1083Z, Claimant: LIANG YUAN PTE LTD		Load PDF
2	07/12/18 11:58	PRI from Chia S Arul LLC		Load PDF
3	07/12/18 16:46	Survey Disagree on SJE - assign LKK		Load PDF
4	14/02/19 10:52	Survey report & Photos		Load PDF
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail Print
1	08/03/19 17:20	PRS INVOICE		Load PDF

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer
Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG18022111/GTD3S2-1

Date: 08/03/2019

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: A29076944MKF

Claimant Vehicle No : SLE4477M

Insured Vehicle No : GBF1083Z

Date of Loss: 30/11/2018

Nature of Claim: TP

Claim No: 577662

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLE4477M

Make & Model: HONDA CIVIC, 1.6 L VTI (A)

Engine No: R16A13003295

Reg. Date: 04/04/2008 (Man. Year: 2008)

Chassis No: JHMF46208S201031

Colour: Black

Odometer: 0 km

Engine Capacity: 1595 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size: 225/45R17

Rear Tyre Size: 225/45R17

Front Left Side: Bridgestone 6 mm

Rear Left Side: Bridgestone 6 mm

Front Right Side: Bridgestone 6 mm

Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,227.20	3,366.96	4,860.24	59.08
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,470.00	1,810.00	1,660.00	47.84
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	11,697.20	5,176.96	6,520.24	55.74
Approved Total (Overridden) (S\$)		4,100.00		
Nett Amount (S\$)	11,697.20	4,100.00	7,597.20	64.95

INSPECTION

Date of Assignment: 10/12/2018

Date Inspected: 10/12/2018 Inspected At:

Car Doctor Pte Ltd (HQ)
BLK3, 391A Woodlands Road Yew Tee, industrial
estate
Singapore 677695

Estimated Period of Repair: 6.0 days

Adjuster: XING GUO QIANG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 08 Mar 2019)
Parts:	143	HONDA CIVIC 1.6 L VTI (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLE4477M)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT DOOR LH	Distorted	1,280.00 FL	*841.30 FL
2	1		*FRONT DOOR INNER LOCK LH	Damaged	250.00 FL	*250.00 FL
3	1		*FRONT DOOR LH OUTER LOCK HANDLE	Damaged	240.00 FL	*144.90 FL
4	1		*FRONT DOOR CHECK STRAP LH	Not Necessary	42.00 FL	*- FL
5	1		*FRONT DOOR LH WINDOW REGULATOR MOTOR	Damaged	430.00 FL	*430.00 FL
6	1		*FRONT DOOR LH INNER DOOR BOARD	Not Necessary	520.00 FL	*- FL
7	1		*FRONT DOOR LH LOWER MOULDING	Necessary	142.00 FL	*107.00 FL
8	1		*FRONT DOOR LH UPPER MOULDING	Necessary	178.00 FL	*85.80 FL
9	1		*FRONT DOOR LH SIDE BLACK TAPE	Necessary	72.00 FL	*43.80 FL
10	1		*REAR DOOR LH	Distorted	1,220.00 FL	*841.30 FL
11	2		*REAR DOOR HINGES	Not Necessary	256.00 FL	*- FL
12	1		*REAR DOOR INNER LOCK LH	Not Necessary	250.00 FL	*- FL
13	1		*REAR DOOR LH OUTER LOCK HANDLE	Not Necessary	240.00 FL	*- FL
14	1		*REAR DOOR CHECK STRAP LH	Not Necessary	42.00 FL	*- FL
15	1		*REAR DOOR LH WINDOW REGULATOR MOTOR	Not Necessary	430.00 FL	*- FL
16	1		*REAR DOOR INNER DOOR BOARD	Not Necessary	520.00 FL	*- FL
17	1		*REAR DOOR LH LOWER MOULDING	Necessary	142.00 FL	*126.50 FL
18	1		*REAR DOOR LH UPPER MOULDING	Not Necessary	178.00 FL	*- FL
19	1		*REAR DOOR LH SIDE BLACK TAPE	Necessary	72.00 FL	*43.80 FL
20	1		*LH SIDE VIEW MIRROR ASSEMBLY	Broken	698.00 FL	*531.30 FL
21	1		*LH FRONT FENDER	Distorted	780.00 FL	*537.50 FL
22	1		*LH FRONT FENDER INNER SPLASH SHIELD	Deformed	243.00 FL	*94.80 FL
23	1		*LH FRONT FENDER SIGNAL LAMP	Broken	72.00 FL	*18.20 FL
24	1		*LH REAR FENDER	Repair	982.00 FL	*- FL
25	1		*LH LOWER SILL (ROCKER PANEL)	Not Necessary	780.00 FL	*- FL
26	1		*SET FRONT FENDER INNER SHIELD CLIPS	Necessary	60.00 FS	*30.00 FS
27	1		*SET FRONT & REAR DOORS BOARD CLIPS	Necessary	120.00 FS	*60.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	10,239.00	4,186.20
- List Item Discount on L Items 20.00/20.00% (\$\$)	2,011.80	819.24
Total Parts (\$\$)	8,227.20	3,366.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE THE AFFECTED PARTS TO COMMENCE REPAIRS; REPLACE DAMAGED PARTS.	New	1,400.00	600.00
2	TO SUPPLY PAINT MATERIALS, EXPANDABLE ITEMS & PUTTY, RESPRAY PAINT ON PARTS REPLACED.	New	1,200.00	1,000.00
3	TO REMOVE, REFIX WIRING SYSTEM AT ACCIDENT DAMAGED AREAS AND CHECK FOR PROPER FUNCTION.	New	180.00	30.00
4	TO PERFORM ANTI RUST TREATMENT ON AFFECTED AREAS.	New	270.00	60.00
5	TO CONDUCT FULL COMPUTERISED WHEEL ALIGNMENT TEST.	New	120.00	0.00
6	TO REMOVE AND REFIX BOTH DOORS COMPONENTS, FITTINGS ETC.	New	300.00	120.00
Gross Labour Cost (S\$)			3,470.00	1,810.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >