

15/02/19

INS. CASE OWNER:

vale oh

CC 3 AXA1900

3988, Khb 352

LKK:

IDAC:

Surveyor:

Kenneth

DOI:

ASSIGNMENT

1/2/19

Date / Time:

1/2/19

Registered in Merimen:

Pre-assign / CCU / FTE



Insured Vehicle No.:

SME 6253L

Claim No.:

5 AMOIPHW / 102230

Name of Insured:

Policy No.:

Insured Tel No.:

HP:

Make / Model:

Excess Sec II :SS

D.O.A.:

1/2/19

Place of Accident:

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

Driver Tel No.:

(V/L: YES / NO)

OI GIA REPORT: YES / NO : TP GIA REPORT: YES / NO

Insured Liability:

%

Final ? Yes / No

SHP 6570



INSRS:

WSP:

Tel:

Liability:

RMKS:

Trans
amb.

INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date/Time

SHP 6570 - X

SME 6253L - Y

STAGE

DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI:

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice:

LTA / GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD:

Payment Breakdown Form:

Post-Repair Photos:

Others:

02/04/19

Amount claimed

OINR under investigation

AXA instruction "no need write to OI"

AXA HRO REJECTED CLAIM.

EMAIL TO TP TO INFORM REJECTION.

SUBMIT WP REPORT.

TO CLOSE.

PRELIMINARY ADVICE Date/Time:

Sent By:

FINALIZATION

Date/Time:

Confirm with:

Confirm by:

Repair Cost:

S\$

(days) Reduction:

%

Email ☐ Call ☐

FINAL SETTLEMENT

Date/Time:

Confirm with:

Email ☐ Call ☐

Final Liability:

%

(Agreed / Assessed) BOLA S/N No.:

If NO or B 28, Ass. Lia:

Repair Cost:

S\$

Loss of Rental (LOR):

S\$

(days)

Loss of Use (LOU):

S\$

(\$ x days)

Loss of Income (LOI):

S\$

(\$ x days)

LOR only ☐LOU only ☐LOR + LOU ☐LOR + LO ☐

[Tick only one]

GIA/LTA Search

S\$

Medical:

S\$

Disbursement:

S\$

(e.g. Tow/ Independent)

Legal Cost

S\$

Total:

S\$

Global Sum S\$:

FINAL PAYMENT

Date/Time:

Confirm with:

Email ☐ Call ☐

Payee 1:

S\$

Name 1:

Payee 2: (Strike if N.A.)

S\$

Name 2:

Payee 3: (Strike if N.A.)

S\$

Name 3:

REJECTED
NO SETTLEMENTCOPY SENT
7/4/19

1) Claim status: Normal/Reject/Private Settle

2) Report Format:

3) Survey fee:

WP REPORT
\$250.00

ASS. REC. BY:

REF:

ALA/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

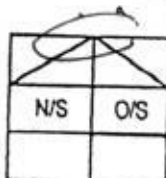
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 3 1/2 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: S11F 657D Yr Regn: 06, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or _____

Make: Renault Latitude C.C. 1798Colour: M. White / R A/C: Insured / Std / NI / NASp. Reading 481263 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VFIABL15AUC 278711

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: NI / S/Rim / STD A/Rim orTyre Size: F: 215/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Giti

Front

R/Bal. 9 mmL/Bal. 9 mmD.O.A. 27/2/19

Survey held at _____

Des. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1. File pass to

UNCOMPROMISED LG: d11,000.00

CASH RATIO: 4,022.60

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 657D**AAD1902-236***Not Attached*
1/1 Sep 8

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

SHF 657D

VF1ABL15AUC278711

RENAULT

LATITUDE

27.2.2019

AXA

30/6/2014

PART**LIST**

1	1	BUMPER COVER FRT	\$	<i>Bz</i> 1,259.42 ✓
2	1	BUMPER SPOILER FRT	\$	<i>Dij/Da</i> 181.75 ✓
3	1	BUMPER ABSORBER FRT	\$	<i>SL</i> 394.68 X
4	1	BUMPER RETAINER FRT LH	\$	<i>D11</i> 151.41 ✓
5	1	BUMPER SUPPORT FRT	\$	<i>SL</i> 123.88 X
6	1	BUMPER RETAINER FRT RH	\$	<i>D11</i> 150.77 ✓
7	1	BUMPER SUPPORT FRT	\$	<i>SL</i> 123.88 X
8	1	BUMPER UNDERTRAY FRT	\$	<i>SL</i> 472.83 X
9	1	BUMPER GRILLE LOWER FRT	\$	<i>CM</i> 266.80 ✓
10	1	BUMPER FOG LAMP GRILLE LH	\$	<i>SL</i> 207.21 X
11	1	BUMPER FOG LAMP GRILLE RH	\$	<i>SL</i> 207.21 X
12	1	BUMPER BEAM FRT	\$	<i>Bz</i> 914.08 ✓
13	1	TOW COVER FRT	\$	<i>SL</i> 28.61 X
14	1	RADIATOR GRILLE	\$	<i>CM</i> 1,707.78 ✓
15	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	<i>SL</i> 225.36 ✓
16	1	RADIATOR GRILLE FRAME	\$	<i>CM</i> 1,353.75 ✓
17	1	FRAME FULL SUPPORT PANEL	\$	<i>CM</i> 615.90 ✓
18	1	FRAME FULL SUPPORT BRACKET	\$	<i>SL</i> 89.79 X
19	1	FRONT BRACE PANEL	\$	<i>Bz</i> 177.22 ✓
20	1	HORN	\$	<i>SL</i> 314.17 X
21	1	HORN BRACKET	\$	<i>SL</i> 40.45 X
22	1	HEADLAMP LH	\$	<i>M3/CM</i> 1,184.43 ✓
23	1	HEADLAMP HARNESS	\$	<i>SL</i> 928.29 X
24	1	HEADLAMP PANEL FRT LH	\$	<i>SL</i> 152.15 X
25	1	BONNET	\$	<i>Bz</i> 1,941.63 ✓
26	1	BONNET INSULATOR	\$	<i>SL</i> 405.73 X
27	1	BONNET STRUT LH	\$	<i>SL</i> 88.61 X
28	1	BONNET STRUT RH	\$	<i>SL</i> 88.61 X
29	1	BONNET HINGE LH	\$	<i>SL</i> 348.31 X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

AAD1902-236**SHF 657D**

30	1	BONNET HINGE RH	\$	348.31	X
31	1	BONNET LOCK	\$	305.48	✓
32	1	BONNET CABLE	\$	119.19	X
33	1	BONNET CABLE COVER	\$	161.03	X
34	1	BONNET SEAL OUTER	\$	92.36	X
35	1	BONNET SEAL INNER	\$	157.28	X
36	1	FENDER PANEL FRT LH	\$	783.83	—
37	1	WHEELARCH FRT LH	\$	278.84	} X
38	1	FENDER BRACKET LOWER LH	\$	15.79	
39	1	FENDER INSULATOR LH	\$	130.84	
40	1	FENDER PANEL INNER FRT LH	\$	1,693.77	
41	1	FENDER PANEL REINFORCEMENT FRT LH	\$	1,096.22	
42	1	WHEEL HOUSING PANEL FRT LH	\$	5,173.47	
43	1	TURBO DUCT	\$	1,027.80	
44	1	A/C HEATER VALVE	\$	484.50	
45	1	SUBFRAME OUTER FRT	\$	2,652.45	
46	1	SUBFRAME BRACKET OUTER LH	\$	92.36	
47	1	SUBFRAME BRACKET OUTER RH	\$	92.36	} X
48	1	ENGINE UNDERTRAY	\$	564.98	
49	1	A/C CONDENSER	\$	2,020.37	
50	1	A/C CONDENSER GARNISH LH UPPER	\$	39.67	
51	1	A/C CONDENSER GARNISH RH UPPER	\$	39.67	
52	1	A/C CONDENSER GARNISH LH	\$	58.81	
53	1	A/C CONDENSER GARNISH RH	\$	59.60	
54	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	208.39	
55	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	658.72	
74	1	A/C PIPE COMPRESSOR	\$	334.29	} X
75	1	A/C PIPE	\$	658.72	
76	1	A/C COMPRESSOR	\$	2,684.61	
77	1	AIR COOLER	\$	792.60	
78	1	AIR INTERCOOLER HOSE (LONG)	\$	1,014.13	
79	1	AIR INTERCOOLER HOSE (Short)	\$	375.14	
80	1	TRANSMISSION COOLER	\$	1,219.30	
81	1	TRANSMISSION COOLER PAD	\$	17.96	
82	1	RADIATOR	\$	1,202.20	?
83	2	RADIATOR STUD UPPER	\$	14.41	X
84	2	RADIATOR BUSH UPPER	\$	50.12	X
85	2	RADIATOR MTG LOWER	\$	55.85	X

Trans-cab Auto Services Pte Ltd

AAD1902-236

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 657D

86	1	RADIATOR FAN COWLING	\$	820.54	7
87	1	RADIATOR FAN MOTOR LH	\$	967.36	7
88	1	RADIATOR FAN MOTOR RH	\$	1,479.46	7
89	1	RADIATOR TANK	\$	324.62	X
90	1	RADIATOR HOSE UPPER	\$	240.56	X
91	1	RADIATOR HOSE LOWER	\$	491.18	X
92	1	RADIATOR TANK HOSE	\$	61.18	X

TOTAL	\$	45,305.01
10%	\$	4,530.50
	\$	40,774.51

Specical Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	52.00	X
2	1SET	BUMPER CLIP FRT	\$	66.00	X
3	1	BUMPER BRACKET CLIP FRT LH	\$	12.00	}
4	1	BUMPER SUPPORT CLIP FRT LH	\$	10.50	
5	1	BUMPER BRACKET CLIP FRT RH	\$	12.00	
6	1	BUMPER SUPPORT CLIP FRT RH	\$	10.50	
7	1	TOW COVER FRT	\$	14.50	
8	1SET	RADAIOR GRILLE SCREW	\$	16.00	
9	1SET	BUMPER GRILLE LOWER CLIP	\$	69.00	}
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	70.00	
11	2	FRAME FULL SUPPORT PANEL NUT	\$	20.00	
12	2	FRAME FULL SUPPORT PANEL STUD	\$	30.00	}
13	1	Windscreen moulding	\$	100.00	
14	1	FRONT NUMBER PLATE WITH HOLDER	\$	200.00	45.00

TOTAL	\$	682.50
TOTAL PARTS	\$	41,457.01

Panel beating, knocking and straightening the
necessary portion, remove and renewal of parts,
adjust and realign the same

\$ 4,000.00 *5000*

Towing Fees.

\$ 120.00 *500*

Trans-cab Auto Services Pte Ltd

AAD1902-236

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 657D

To apply paint protection system (PPS) maintain and enhancement	\$	na 380.00 X
Putty and spray painting of the affected portion.	\$	4,000.00 8800
To rust-proofing of the affected areas.	\$	170.00 600
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	na 380.00 X
To check steering geometry and computer wheel alignment	\$	na 220.00 X
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	na 380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	na 380.00 X
To lift-up engine with gear box and refit.	\$	na 440.00 X
To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	na 440.00 X
To remove and refit air bag system and reset.	\$	na 480.00 X
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	na 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	380.00 1000
To replace, refix and top up coolant for radiator	\$	170.00 500

Trans-cab Auto Services Pte Ltd

AAD1902-236

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 657D

To vacuum, replace, refix and recharge Air
Intercooler

\$ 170.00 *501*

To Transfer Of Fender Fittings, Attachments And
Perform Water Seepage Test.

\$ *na* 170.00 *X*

To Transfer Of Bonnet Fittings, Attachments And
Perform Water Seepage Test.

\$ *na* 170.00 *X*

To Transfer Of Door Fittings, Attachments And
Perform Water Seepage Test.

\$ *na* 170.00 *X*

TOTAL \$ **13,000.00**

Over All Total \$ **54,457.03**

Repair Days (Lump Sum)

~~20 days~~

3 1/2 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis.
- No illegal modification(s) is allowed
- Supplementary work(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



Re:NON REPORTING - UNDER INVESTIGATION-VO

Type

🔗 Question

Message

Hi We have repudiated the claim and hence, pls close off your file and let us have your bill-VO

Reply

Vic (LKKAUTO)

From: Vic (LKKAUTO)
Sent: Tuesday, 2 April, 2019 5:46 PM
To: Ng Wai Yin
Cc: Admin A; Vic (LKKAUTO); claims@transcab.com.sg
Subject: Your Ref: AAD1902-236_ACCIDENT INVOLVING VEHICLES SME 6353L AND SHF 657D ON 27/02/2019 LKK REF CC3/ASM19003988/Khb3

Your Ref: AAD1902-236
Our Ref: CC3/ASM19003988/Khb3

Dear Wai Yin,

ACCIDENT INVOLVING VEHICLES SME 6353L AND SHF 657D ON 27/02/2019

We refer to the above matter.

Please be informed that our principal had repudiated the claim.

As such, kindly redirect you claim towards our Insured / policy holder instead.

We will now close file in our end.

Thank you.

Best Regards,

Vic Alpeh | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6841-2096 | email: vicalpeh@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



AUTO
CONSULTANTS
PTE LTD

Save the Earth. Print only when necessary.

This e-mail contain confidential and privileged material, and are for the sole use of the intended recipient. Use or distribution by an unintended recipient is prohibited, and may be a violation of law. If you believe that you received this e-mail in error, please do not read this e-mail or any attached items. Please delete the e-mail and all attachments, including any copies thereof, and inform the sender that you have deleted the e-mail, all attachments and any copies thereof. Thank you.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CC3/ASM19003988/Khb3s2

8 SHENTON WAY #24-01
AXA TOWERS SINGAPORE 068811
ATTN: VALE OH

Date : 10-04-2019



Code : ASM

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SME 6353L	Veh. Inspected	SHF 657D
Policy No.	P2189696	Coverage (\$)	0.00
Claim No.	S9M01FHW	Excess (\$)	0.00
Assign From		Assign Date	01/03/2019

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VF1ABL15AUC278711	Colour	METALLIC WHITE / RED
Odometer	461263	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60R16	GITI	9 mm
L/H Front Tyre	215/60R16	GITI	9 mm
R/H Rear Tyre	215/60R16	GITI	9 mm
L/H Rear Tyre	215/60R16	GITI	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	27/02/2019	Inspection Date	01/03/2019
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3.500 Working Days
-------------------------------------	--------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 657D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BUMPER COVER FRT (CONSISTENT)	BENT	1,259.42	1,259.42
1	BUMPER SPOILER FRT (CONSISTENT)	DISTORTED / DENTED	181.75	181.75
1	BUMPER ABSORBER FRT (CONSISTENT)	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH (CONSISTENT)	DISTORTED	151.41	151.41
1	BUMPER SUPPORT FRT (CONSISTENT)	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH (CONSISTENT)	DISTORTED	150.77	150.77
1	BUMPER SUPPORT FRT (CONSISTENT)	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT (CONSISTENT)	SERVICEABLE	472.83	-
1	BUMPER GRILLE LOWER FRT (CONSISTENT)	CRACKED	266.80	266.80
1	BUMPER FOG LAMP GRILLE LH (CONSISTENT)	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH (CONSISTENT)	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT (CONSISTENT)	BENT	914.08	914.08
1	TOW COVER FRT (CONSISTENT)	SERVICEABLE	28.61	-
1	RADIATOR GRILLE (CONSISTENT)	CRACKED	1,707.78	1,707.78
1	RADIATOR GRILLE BADGE 'RENAULT' (CONSISTENT)	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME (CONSISTENT)	CRACKED	1,353.75	1,353.75
1	FRAME FULL SUPPORT PANEL (CONSISTENT)	CRACKED	615.90	615.90
1	FRAME FULL SUPPORT BRACKET (CONSISTENT)	TO REPAIR SEE LABOUR	89.79	-
1	FRONT BRACE PANEL (CONSISTENT)	BENT	177.22	177.22
1	HORN (CONSISTENT)	SERVICEABLE	314.17	-
1	HORN BRACKET (CONSISTENT)	TO REPAIR SEE LABOUR	40.45	-
1	HEADLAMP LH (CONSISTENT)	MTG CRACKED	1,184.43	1,184.43
1	HEADLAMP HARNESS (CONSISTENT)	SERVICEABLE	928.29	-
1	HEADLAMP PANEL FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	152.15	-
1	BONNET (CONSISTENT)	BUCKLED	1,941.63	1,941.63
1	BONNET INSULATOR (CONSISTENT)	SERVICEABLE	405.73	-
1	BONNET STRUT LH (CONSISTENT)	SERVICEABLE	88.61	-
1	BONNET STRUT RH (CONSISTENT)	SERVICEABLE	88.61	-

Report Ref No. CC3/ASM19003988/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No..2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET HINGE LH (CONSISTENT)	TO REPAIR SEE LABOUR	348.31	-
1	BONNET HINGE RH (CONSISTENT)	TO REPAIR SEE LABOUR	348.31	-
1	BONNET LOCK (CONSISTENT)	DISTORTED	305.48	305.48
1	BONNET CABLE (CONSISTENT)	SERVICEABLE	119.19	-
1	BONNET CABLE COVER (CONSISTENT)	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER (CONSISTENT)	SERVICEABLE	92.36	-
1	BONNET SEAL INNER (CONSISTENT)	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH (CONSISTENT)	BUCKLED	783.83	783.83
1	WHEELARCH FRT LH (CONSISTENT)	SERVICEABLE	278.84	-
1	FENDER BRACKET LOWER LH (CONSISTENT)	SERVICEABLE	15.79	-
1	FENDER INSULATOR LH (CONSISTENT)	SERVICEABLE	130.84	-
1	FENDER PANEL INNER FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	1,693.77	-
1	FENDER PANEL REINFORCEMENT FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	1,096.22	-
1	WHEEL HOUSING PANEL FRT LH (CONSISTENT)	TO REPAIR SEE LABOUR	5,173.47	-
1	TURBO DUCT (CONSISTENT)	SERVICEABLE	1,027.80	-
1	A/C HEATER VALVE (CONSISTENT)	SERVICEABLE	484.50	-
1	SUBFRAME OUTER FRT (CONSISTENT)	SERVICEABLE	2,652.45	-
1	SUBFRAME BRACKET OUTER LH (CONSISTENT)	TO REPAIR SEE LABOUR	92.36	-
1	SUBFRAME BRACKET OUTER RH (CONSISTENT)	TO REPAIR SEE LABOUR	92.36	-
1	ENGINE UNDERTRAY (CONSISTENT)	SERVICEABLE	564.98	-
1	A/C CONDENSER (CONSISTENT)	BENT	2,020.37	2,020.37
1	A/C CONDENSER GARNISH LH UPPER (CONSISTENT)	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH RH UPPER (CONSISTENT)	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH LH (CONSISTENT)	SERVICEABLE	58.81	-
1	A/C CONDENSER GARNISH RH (CONSISTENT)	SERVICEABLE	59.60	-
1	A/C PIPE CONDENSER TO COMPRESSOR (CONSISTENT)	SERVICEABLE	208.39	-
1	A/C PIPE CONDENSER TO EXPANSION VALVE (CONSISTENT)	SERVICEABLE	658.72	-
1	A/C PIPE COMPRESSOR (CONSISTENT)	SERVICEABLE	334.29	-

Report Ref No. CC3/ASM19003988/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	A/C PIPE (CONSISTENT)	SERVICEABLE	658.72	-
1	A/C COMPRESSOR (CONSISTENT)	SERVICEABLE	2,684.61	-
1	AIR COOLER (CONSISTENT)	SERVICEABLE	792.60	-
1	AIR INTERCOOLER HOSE (LONG) (CONSISTENT)	SERVICEABLE	1,014.13	-
1	AIR INTERCOOLER HOSE (SHORT) (CONSISTENT)	SERVICEABLE	375.14	-
1	TRANSMISSION COOLER (CONSISTENT)	SERVICEABLE	1,219.30	-
1	TRANSMISSION COOLER PAD (CONSISTENT)	SERVICEABLE	17.96	-
1	RADIATOR (CONSISTENT)	* CHECK	1,202.20	-
2	RADIATOR STUD UPPER (CONSISTENT)	SERVICEABLE	14.41	-
2	RADIATOR BUSH UPPER (CONSISTENT)	SERVICEABLE	50.12	-
2	RADIATOR MTG LOWER (CONSISTENT)	SERVICEABLE	55.85	-
1	RADIATOR FAN COWLING (CONSISTENT)	* CHECK	820.54	-
1	RADIATOR FAN MOTOR LH (CONSISTENT)	* CHECK	967.36	-
1	RADIATOR FAN MOTOR RH (CONSISTENT)	* CHECK	1,479.46	-
1	RADIATOR TANK (CONSISTENT)	SERVICEABLE	324.62	-
1	RADIATOR HOSE UPPER (CONSISTENT)	SERVICEABLE	240.56	-
1	RADIATOR HOSE LOWER (CONSISTENT)	SERVICEABLE	491.18	-
1	RADIATOR TANK HOSE (CONSISTENT)	SERVICEABLE	61.18	-
	LESS 10% DISCOUNT		-4,530.50	-1,324.00
			40,774.53	11,915.98
SPECIAL NETT ITEMS				
1	SET RADIATOR GRILLE FRAME CLIP (SN) (CONSISTENT)	NECESSARY	52.00	52.00
1	SET BUMPER CLIP FRT (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN) (CONSISTENT)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN) (CONSISTENT)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN) (CONSISTENT)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN) (CONSISTENT)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN) (CONSISTENT)	SERVICEABLE	14.50	-
1	SET RADIATOR GRILLE SCREW (SN) (CONSISTENT)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN) (CONSISTENT)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN) (CONSISTENT)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN) (CONSISTENT)	NOT NECESSARY	20.00	-

Report Ref No. CC3/ASM19003988/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRAME FULL SUPPORT PANEL STUD (SN) (CONSISTENT)	NOT NECESSARY	30.00	-
1	WINDSCREEN MOULDING (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	FRONT NUMBER PLATE WITH HOLDER (SN) (CONSISTENT)	BENT	200.00	45.00
			682.50	163.00
	LABOUR			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF FRAME FULL SUPPORT BRACKET, HORN BRACKET, HEADLAMP PANEL FRT LH, BONNET HINGE LH, BONNET HINGE RH, FENDER PANEL INNER FRT LH, FENDER PANEL REINFORCEMENT FRT LH, WHEEL HOUSING PANEL FRT LH, SUBFRAME BRACKET OUTER LH AND SUBFRAME BRACKET OUTER RH, TOWING FEES.		4,000.00	500.00
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.		120.00	50.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.	NOT NECESSARY	380.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.		4,000.00	880.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.		170.00	60.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	380.00	-
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRUALIC PNEUMATIC JACK.	NOT NECESSARY	220.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.	NOT NECESSARY	440.00	-
	TO DROP DIESEL TANK, PIPES, HOSES TO FACILITATE BODYWORK REPAIR, FINAL CHECKING AND TESTING.	NOT NECESSARY	480.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	NOT NECESSARY	380.00	-
			380.00	100.00

Report Ref No. CC3/ASM19003988/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.		170.00	50.00
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF BONNET FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			13,000.00	1,690.00
GRAND TOTAL			54,457.03	13,768.98
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$4,022.60 NETT)				11,000.00

Report Ref No. CC3/ASM19003988/Khb3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.