



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2004806
INV Date 08/07/2020
Reference CC6/CTI19004654/Aba3n2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SLV 5541P
Insured Veh. GX 1172X
Claim No. SNM19D201184C02/2
Policy No. DMCVSN3009171900
Accident Date 12/03/2019
Inspection Date 13/03/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI19004654/Aba3n2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 08-07-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GX 1172X	Veh. Inspected	SLV 5541P
Policy No.	DMCVSN3009171900	Coverage (\$)	0.00
Claim No.	SNM19D201184C02/2	Excess (\$)	0.00
Assign From		Assign Date	13/03/2019

2. Vehicle Particulars & Condition

Make & Model	HONDA JAZZ	c.c	1498
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JHMGK5850JX201443	Colour	BLUE
Odometer	25917	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/55 R16	DUNLOP	6 mm
L/H Front Tyre	185/55 R16	DUNLOP	6 mm
R/H Rear Tyre	185/55 R16	DUNLOP	6 mm
L/H Rear Tyre	185/55 R16	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	12/03/2019	Inspection Date	13/03/2019
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLV 5541P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAIL GATE	DENTED	1,122.00	716.00
1	TAIL GATE LOGO	NOT NECESSARY	45.00	-
1	TAIL GATE EMBLEM "JAZZ"	NECESSARY	45.00	45.00
1	TAIL GATE DETECTOR	CRACKED	155.30	155.30
1	TAIL GATE BUZZEL	CRACKED	180.00	180.00
1	TAIL GATE INNER LOCK	DAMAGED	225.80	225.80
1	TAIL GATE WEATHER STRIP	CUT	128.00	128.00
1	TAIL GATE INNER TRIM	DEFORMED	118.20	118.20
1	TAIL GATE WINDSCREEN MOULDING	NECESSARY	190.00	85.00
1	REAR BUMPER	DEFORMED	730.00	530.00
2	REAR BUMPER SIDE RETAINER @\$42.00	NECESSARY	84.00	84.00
2	TAIL LAMP @\$330.00	NOT NECESSARY	660.00	-
2	TAIL LAMP LOWER BRACKET @\$62.00	NOT NECESSARY	124.00	-
2	TAIL LAMP PANEL @\$230.00	NOT NECESSARY	460.00	-
1	REAR END PANEL	DENTED	520.00	435.00
1	REAR END PANEL TOP GARNISH	DEFORMED	190.00	190.00
	LESS 20% DISCOUNT		-995.46	-578.46
			3,981.84	2,313.84
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	TAIL GATE SEALANT (SN)	NOT NECESSARY	80.00	-
1	SET TAIL GATE INNER TRIM CLIP (SN)	NECESSARY	20.00	20.00
1	TAIL GATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	30.00
1	TAIL GATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	30.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	20.00	20.00
1	REAR BUMPER LOWER LID (SN)	DEFORMED	1,100.00	750.00
1	REAR BUMPER LOWER LID STICKER (SN)	NECESSARY	90.00	30.00
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	20.00	-
1	TAIL LAMP PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
1	REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00

Report Ref No. CC6/CTI19004654/Aba3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	120.00	60.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			1,960.00	1,160.00
	LABOUR			
	PANEL BEATING,REMOVAL AND REPLACING PARTS.		1,600.00	800.00
	TO SPRAY PAINT AFFECTED AREA.		1,400.00	800.00
	TUFF COAT.		250.00	60.00
	WIRING CHECK.		80.00	30.00
	REMOVE AND REFIX CUSHION SEAT/UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR.		180.00	80.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	60.00
	REMOVE AND REFIX TAILGATE WINDSCREEN.		120.00	120.00
	TRANSFER TAILGATE MECHANISM.		80.00	80.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			3,970.00	2,030.00
GRAND TOTAL			9,911.84	5,503.84
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,400.00

Report Ref No. CC6/CT119004654/Aba3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 5541P

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

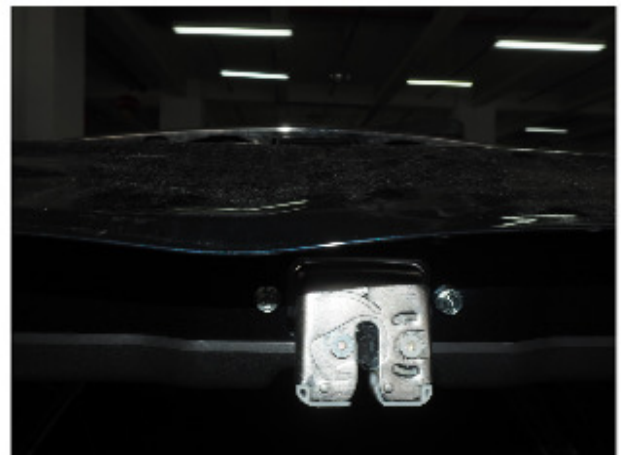



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 5541P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

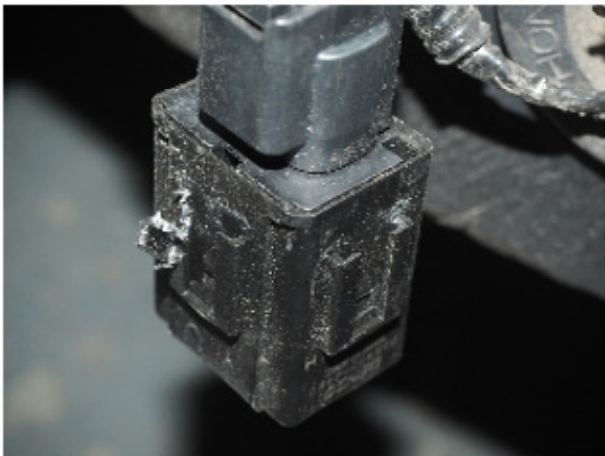



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

