

Surveyor Rasul REI CS3/LPC19000997/R143-1
 From Person Orng Ki Ki of JPC Date/Time 19/03/2019
 To Inspect Vehicle No. SKT 5480D Insured: GY 3826A
 at Workshop m/s Willy Motor Tel 927 67180
 of 27A Jurong Port Road #01-32
 Policy No. SKT 5480D/WM/ms/wt Claim No. SKT 5480D/WM/ms/wt
 Sum Insured 15/01/2019 Excess
 Make of Veh (Client's Record) D.O.A 15/01/2019
 CA / REV / REP. / REV 24 HRS ^{up}
 Date/Time 236pm 16/1/19 Person Contacted Ms. Khoo H.O.D. Endorsement
 Vehicle IN OUT

Date/Time	Action/Instruction (X) Estimate
	GY 3826A - NA/TMI/60/4861/s
	SKT 5480D - X
<u>22/1/2019</u>	<u>Submit PRC Report.</u>
	<u>Rasul,</u>

Pls check parts prices & see my
 remarks.

Submit US 95007 Cred: 7941.20

(45%)

Pls file pass to typist.

8/5/2019

RECEIVED 09 MAY 2019

Signature: *[Signature]*

REF:

0507 F

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop n/s

of

Insured:

Policy No

Claims No

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res: Yes or No

Lmt Sum

%

3 Val: Yes or No

CA / REV / REP / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No: **SKT 5480D** Yr Regn: **2015 Jan**

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **Honda Vezel 1-SX A** C.C. **1496**

Colour: **WHITE** A/C Insured / Std / NI / NA

Sp. Reading: **099010** T/Radio: Insured / Std / NI / NA

Eng/No:

C.No: **Ru11022268**

Gen. Cond: Good / Fair / Poor / Burnt

Steering: ☒ Good / Jammed / Leaked / Burnt or

Brake: ☒ Good / Jammed / Leaked / Burnt or

Modi: **Nil** / S/Rim / STD A/Rim or

Tyre Size: F: **205/60R16**

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MID / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. **6** mm R/Bal. **6** mm

L/Bal. **6** mm L/Bal. **6** mm

D.O.A. **15/01/19**

D.O.L. **16/01/19**

Survey held at **Willy more** **4:47pm**

Des. of Damages: ☒ Front / ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision:

RECEIVED 22 JAN 2019

Date/Time, File Pass to?

22/1 Typist

Date/Time, File Return to?

☐ : Preli. Report
☐ : Final Report

Days Of Repair: **-**

Resurvey No. of Trip: **1**

Survey Fee

Transportation:

1 - \$ + PS. 51

1 Photo

1 1/2 hrs.

1

5474

3)

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Insp (\$

☐ : Weekend (\$

Report Format :

TP-PRI

Lump Sum / L.B. (\$

450

Nivitha (LKK Auto)

From: ONG LI LI <llong@lonpac.com>
Sent: Tuesday, 19 March 2019 12:51 PM
To: Admin-D (LKKAuto); assignments
Cc: MT_Claim_SG; SUR
Subject: RE: Our Ref: 18/19/19/VC05/021332 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl) [External General]
Attachments: 21332 TP survey report 1.pdf


Lonpac External - General

Hi Nivitha

Attached is the TP survey report (part 1 of 3).

Please let us have your surveyor's review and report.

Regards,
Ong Li Li
Senior Claims Executive | Lonpac Insurance Bhd
300 Beach Road #17-04/07 The Concourse Singapore 199555
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

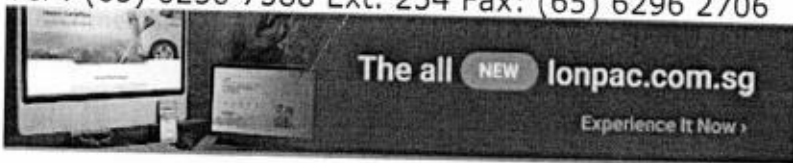


Lonpac External - General data is for internal / external use.

From: ONG LI LI
Sent: Wednesday, 23 January, 2019 4:27 PM
To: 'Admin-D (LKKAuto)'; assignments
Cc: MT_Claim_SG; SUR
Subject: RE: Our Ref: TBA RE: 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Hi Catherine

Our Claim no. is 18/19/19/VC05/021332.

Regards,
Ong Li Li
Senior Claims Executive | Lonpac Insurance Bhd
300 Beach Road #17-04/07 The Concourse Singapore 199555
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

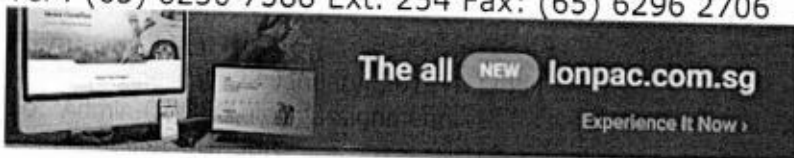

From: Admin-D (LKKAuto) [mailto:admin-d@lkkauto.com]
Sent: Wednesday, 23 January, 2019 4:18 PM
To: ONG LI LI; assignments
Cc: MT_Claim_SG; SUR

Subject: RE: Our Ref: TBA RE: 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Dear Li Li,

Kindly assist provide us the claim number.

Best Regards,

Catherine Chong | Admin

LKK Auto Consultants Pte Ltd

Phone: 6741-8434 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto) [<mailto:admin-d@lkkauto.com>]

Sent: Wednesday, 16 January, 2019 2:46 PM

To: 'ONG LI LI' <long@lonpac.com>; assignments <assignments@lkkauto.com>

Cc: 'MT_Claim_SG' <mt_claim@lonpac.com>; SUR <sur@lkkauto.com>

Subject: RE: Our Ref: TBA RE: 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: ONG LI LI [<mailto:long@lonpac.com>]

Sent: Wednesday, 16 January 2019 12:40 PM

To: Accident@kscgp.com; MT_Claim_SG <mt_claim@lonpac.com>; assignments@lkkauto.com; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>

Subject: Our Ref: TBA RE: 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Without Prejudice
Save as to Costs

Dear Wei Lin


We are not agreeable to your proposed list of surveyor and we shall appoint LKK Auto Consultants Pte Ltd to conduct the pre-repair survey.

Dear Catherine/Nivitha

Fya

Regards,

Ong Li Li
Senior Claims Executive | Lonpac Insurance Bhd
300 Beach Road #17-04/07 The Concourse Singapore 199555
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

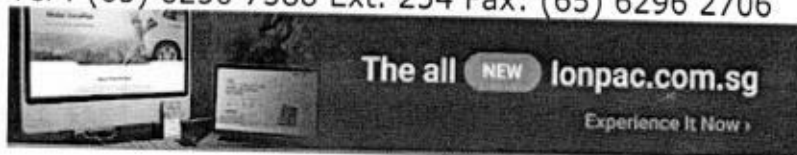

From: Accident@kscgp.com [mailto:Accident@kscgp.com]
Sent: Wednesday, 16 January, 2019 12:34 PM
To: ONG LI LI; MT_Claim_SG
Subject: 2nd Notice to conduct Pre- Repair Survey (Your Ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Dear Sirs,

Please find enclosed herein the 2nd Notice to conduct Pre-Repair Survey for your immediate attention and necessary action. Our client is not agreeable to your proposed list of motor surveyors.

Thank you.

Regards,
Wei Lin
for and on behalf of Mr Gurdeep Singh Sekhon
KSCGP Juris LLP
10 Hoe Chiang Road
#13-03A Keppel Towers
Singapore 089315
Tel: 6538 3611 / DID: 3152 0983 / Fax: 6538 3708
Email: accident@kscgp.com

KSCGP Juris LLP (UEN/Registration No: T10LL1855L) is registered in Singapore under the Limited Liability Partnerships Act (Chapter 163A) with limited liability. This message is intended only for the use of the individual or entity to whom it is addressed (including any attachments) and is confidential and may be protected by legal privilege. If you are not the intended recipient, please notify the sender immediately by return email, delete this message and you should not disseminate, distribute or copy any information contained herein. Please note that e-mails are susceptible to change and we shall not be liable for the improper or incomplete transmission of the information contained in this communication nor for any delay in its receipt or damage to your system. We do not guarantee that the integrity of this communication has been maintained nor that this communication is free of viruses, interceptions or interference.

----- Original Message -----

From: ONG LI LI [mailto:llong@lonpac.com]
To: Accident@kscgp.com, mt_claim@lonpac.com
Sent: Wed, 16 Jan 2019 04:17:32 +0000
Subject:

Without Prejudice
Save as to Costs

Dear Sir/Mdm

We intend to conduct a pre-repair survey of the damage to your client's/your customer's vehicle jointly with your client/your motor workshop. We propose to use one of the motor surveyors named in the following list to conduct the joint pre-repair survey as a single joint expert.

No.	Name	Please tick <input type="checkbox"/>
1	Kalvin Ang	
2	Xing Guo Qiang	
3	Mohamad Taufikh	
4	Bryan Ang	
5	Adrian Ling	
6	Mohammed Rasul	
7	Marcus Chua	
8	Kenneth Kong	
9	Muhammad Nazril Bin Abdullah	
10	Sathya Sai Kathirrasen	

Please let us know within two (2) working days whether you agree to the appointment of any of these motor surveyors as a single joint expert.

Regards,

Ong Li Li

Senior Claims Executive | Lonpac Insurance Bhd

300 Beach Road #17-04/07 The Concourse Singapore 199555

Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

From: Accident@kscgp.com [mailto:Accident@kscgp.com]

Sent: Tuesday, 15 January, 2019 6:15 PM

To: MT_Claim_SG

Subject: Notice to conduct Pre-Repair Survey (Your ref: GY 3826A Our Ref: SKT 5480D/WM/ms/wl)

Dear Sirs,

Please find enclosed herein the Notice to conduct Pre-Repair Survey, for your immediate attention and necessary action.

Thank you.

Regards,

Wei Lin

for and on behalf of Mr Gurdeep Singh Sekhon

KSCGP Juris LLP

10 Hoe Chiang Road

#13-03A Keppel Towers

Singapore 089315

Tel: 6538 3611 / DID: 3152 0983 / Fax: 6538 3708

Email: accident@kscgp.com

KSCGP Juris LLP (UEN/Registration No: T10LL1855L) is registered in Singapore under the Limited Liability Partnerships Act (Chapter 163A) with limited liability. This message is intended only for the use of the individual or entity to whom it is addressed (including any attachments) and is confidential and may be protected by legal privilege. If you are not the intended recipient, please notify the sender immediately by return email, delete this message and you should not disseminate, distribute or copy any information contained herein. Please note that e-mails are susceptible to change and we shall not be liable for the improper or incomplete transmission of the information contained in this communication nor for any delay in its receipt or damage to your system. We do not guarantee that the integrity of this communication has been maintained nor that this communication is free of viruses, interceptions or interference.



This email has been checked for viruses by AVG antivirus software.
www.avg.com

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/ Adjusters Cargo Surveyors & Licensed Appraisers
27 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



AUTOMOBILE INSPECTION REPORT

To:

WEE ENG CHOON

C/O 27A Jurong Port #01-32

Singapore 619101

INSURANCE DETAILS

Insured : -
Policy No. / Claim No. : -
Sum Insured : -
Excess Clause : -
Windscreen Coverage : -
Type of Claims : Third Party Claims
Third Party Insurer : -
Third Party Policy No. : -

REFERENCE

Assigned By : As above
Accident Date : 15 January 2019
Assignment Date : 16 January 2019
Inspection Date : 16 January 2019
Our Reference No. : PAS/WM/190210/TP

Inspection Report Date : 28 February 2019

Workshop Name :

WILLY MOTOR COMPANY

Inspection Address :

27A Jurong Port #01-32 Singapore 619101

PARTICULARS OF VEHICLE

Registration No. : SKT 5480 D
Make/Model : HONDA VEZEL 1.5X A
Yr of Manuf/Regn : 2015
Carrying Capacity : 4 Seater
Chassis No. : RU11022268
Engine No. : L15B352284
Colour : Metallic White
Class : Passenger (Private)

Mileage : 99010 Km/h
Radio/Casette : Fitted
CD Disc Player : Fitted
Air Conditioner : Fitted
Clock : Fitted
Seat Belt : Fitted
Wing Mirror Other : Fitted
Accessories : Fitted

PRE-ACCIDENT CONDITION (Static Check Only)

Body Work : Good
Paint Work : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Any Apparent : None
Eng Modifications

VEHICLE VALUE

Market Value : Approximately \$60,000.00
Wreck Value (Parf) : Approximately \$49,000.00

TYRE SIZE & CONDITION

Front N/s Size : 215/60R16 80 %
Make : MICHELIN
Rear N/s size : 215/60R16 80 %
Make : MICHELIN
Spare Size : 215/60R16 80 %
Make : MICHELIN

Front O/s Size : 215/60R16 80 %
Make : MICHELIN
Rear O/s Size : 215/60R16 80 %
Make : MICHELIN
Spare Size :
Make :
Jack & Tools : Intact/ Missing

Type of Wheel Rims: Alloy

Note: The above percentage % represent the estimated remaining tyre threads.

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/Adjusters Cargo Surveyors & Licensed Appraisers



VEHICLE REGISTRATION NO. : SKT 5480 P


APPENDIX A

POINT OF IMPACT

Direction of impact/damage marked (→) (X)


The vehicle sustained impact on its Front & Rear Portion. (see Diagram B)

(Diagram A)
FRONT

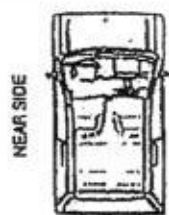


REAR

(Diagram B)
FRONT

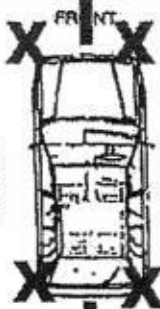

REAR

(Diagram C)
FRONT

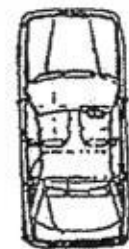

REAR

(Diagram D)
FRONT



REAR

GENERAL DESCRIPTION OF DAMAGES

Parts damaged were :

The bootlid, rear bumper and panel, spare tyre well, bonnet, front bumper and reinforcement, both front and rear fenders, both front and rear chassis were dented.

ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 16/01/2019 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s Willy Motor Company as per attached Appraisalment Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Part - By - Part Repair Basis of \$ 17,441.80 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts	15406	40	11701	80
Towing Charges	X	X	X	X
PB Labour Charges	2800	00	2400	00
Others Misc	1900	00	1340	00
Charges Paintwork	2400	00	2000	00
Total	\$ 22506	40	\$ 17441	80

Under normal circumstances, the duration of repairs should not exceed Nine (09) days excluding Pre-Repair Inspection (PRI) / Pre - Repair Survey (PRS) waiting time frame and Public Holidays.

Attached photographs taken during inspection One Hundred & Sixty (160) Photographs.

SPECIAL REMARKS

1. The inspection was conducted on a 'without prejudice' basis
2. On 17/01/2019, we examined the extent of damages
3. On 23/01/2019, we examined the new replacement parts
4. On 25/01/2019, we examined the repaired vehicle.

Yours Faithfully,



TF NG PHILIP FOO
ACII CAE, AMIMI
AIAME, AMSAE-A
Licensed Appraiser/Adjuster

Inspection Report Date: 28 February 2019

VEHICLE REGN NO : SKT 5480 P
 OUR REFERENCE : PAS/WM/190210/TP
 INSPECTION REPORT DATE : 28-Feb-19

APPRAISEMENT SCHEDULE

CONTINUATION SHEET NO : 1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount	Recommendation / Revised Amount
PARTS SUPPLY - LIST ITEMS					
1	1pc	Bootlid	Badly dented	\$ 1100.90 cts	\$ 1100.90 cts
2	1pc	Bootlid centre logo	Necessary	33.40	33.40 X
3	1pc	Bootlid 'Vezel' emblem	Necessary	58.50	58.50
4	2pcs	Bootlid shock absorber@\$180	Bent	360.00	360.00 X
5	1pc	Bootlid outer handle	Serviceable	175.50	- X
6	1pc	Bootlid trimboard	Bent	153.40	153.40
7	1set	Bootlid top lamp nut	Necessary	10.50	10.50 X
8	1pc	Bootlid upper lock	Bent/Jammed	151.70	151.70
9	2pcs	Bootlid hinges@\$17.50	Serviceable	35.00	- X
10	2pcs	Bootlid hinges bolt/nut@\$4.5	Necessary	9.00	9.00 X
11	2pcs	Bootlid lamp@\$264.60	N/s Cracked	529.20	264.60
12	4pcs	Bootlid lamp nut@\$4.5	Necessary	18.00	18.00 X
13	1pc	Boot rubber	Torn	96.80	96.80
14	2pcs	Rear no. plate lamp@\$38.50	Cracked	77.00	77.00 X
15	1pc	Wiper Motor nut	Necessary	5.00	5.00 X
16	1set	Rear windscreen rubber	Necessary	198.00	198.00
17	1pc	Wiper Motor	Serviceable	205.10	- X
18	1pc	Bootlid striker	Bent	58.10	58.10
19	1pc	Tool Tray garnish	Bent/Warped	226.90	226.90 X
20	1pc	Rear panel lining	Necessary	92.30	92.30
21	1pc	Rear panel	Badly dented	819.00	819.00 X
22	1pc	Rear tow hook panel, centre	Badly dented	95.00	95.00
23	1pc	Rear bumper	Badly dented	463.70	463.70
24	2pcs	Rear bumper side retainer@\$17.50	Bent	35.00	35.00
25	8pcs	Rear bumper clips@\$3.9	Necessary	31.20	31.20
26	2pcs	Rear bumper reflector@\$148.35	O/s Cracked	296.70	148.35
27	1pc	Rear bumper corner n/s	Dented	195.00	Repair
28	1pc	Rear bumper corner o/s	Badly dented	195.00	195.00 X
29	3pcs	Rear bumper corner o/s clip@\$3.90	Necessary	11.70	11.70 X
30	1pc	Rear bumper under cover	Bent/Warped	190.00	190.00
31	10pcs	Rear bumper under cover clip@\$3.5	Necessary	35.00	35.00 X
32	2pcs	Taillamp@\$428.70	Defaced/Bent	857.40	857.40
33	8pcs	Taillamp clips@\$3.50	Necessary	28.00	28.00 X
34	1pc	Rear o/s fender arch garnish	Cracked	172.10	172.10 X
35	10pcs	Rear fender arch garnish clips@\$4	Necessary	40.00	40.00 X
36	1pc	Rear n/s fender arch garnish	Cracked	172.10	172.10 X
37	1pc	Rear exhaust pipe silencer	Bent/Dented	528.00	528.00
38	1pc	Rear exhaust pipe rubber	Bent	16.50	16.50
39	1pc	Rear exhaust pipe mtg	Bent	16.50	16.50
40	1pc	Rear exhaust pipe outer plate	Dented	55.00	55.00 X
41	1pc	Spare tyre well	Badly Dented	662.30	662.30
42	1pc	Spare tyre well box sponge assy	Warped/Torn	186.00	186.00
43	1pc	Rear panel centre switch	Bent/Dented	58.10	892.30 X
44	1pc	Rear Buzzer	Bent	80.00	80.00
45	1pc	Bonnet	Badly dented	892.30	892.30
46	8pcs	Bonnet insulator clips@\$3.5	Necessary	28.00	28.00 X
47	1pc	Bonnet insulator	Serviceable	122.30	- X
48	1pc	O/s Headlamp	Cracked	1820.20	1820.20
49	2pcs	O/s Headlamp clip@\$4.50	Necessary	9.00	9.00 X
50	1pc	Front grille cover	Cracked	85.00	85.00
51	1pc	Front grille upper beam centre	Badly Dented	38.70	38.70 X
52	1pc	Front grille, base	Cracked	268.90	268.90
53	1pc	Front grille, outer	Cracked	203.40	203.40
SUB / GRAND TOTAL				12301.40	11989.75

PRECISION APPRAISAL SERVICE

9349.05

[Handwritten signature and stamp]

VEHICLE REGN NO : SKT 5480 P
 OUR REFERENCE : PAS/WM/190210/TP
 INSPECTION REPORT DATE : 28-Feb-19

APPRAISEMENT SCHEDULE

CONTINUATION SHEET NO : 1412-90
 1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount	Recommendation / Revised Amount
			B/F	\$ 12301.40 ^{cts}	\$ 11989.75 ^{cts}
54	2pcs	Front grille chrome@\$56.90	Cracked	113.80	113.80
55	1pc	Front grille logo	Necessary	23.40	23.40
56	8pcs	Front grille clips@\$3.9	Necessary	31.20	31.20
57	2pcs	Front grille upper side beam@\$19.60	Badly Dented	39.20	39.20
58	1pc	Front grille	Cracked	268.90	268.90
59	1pc	Front bumper grille	Badly Dented	77.50	77.50
60	1pc	Front grille centre bracket	Cracked	38.70	38.70
61	1pc	Front bumper lower cover	Torn	351.00	351.00
62	10pcs	Front bumper lower cover clips@\$3.9	Necessary	39.00	39.00
63	1pc	Front bumper lower cover rubber	Torn	84.90	84.90
64	2pcs	Front bumper beam@\$35	Badly Dented	70.00	70.00
65	1pc	Front bumper bracket N/s	Cracked	35.00	35.00
66	1pc	Front bumper	Badly Dented	459.80	459.80
67	8pcs	Front bumper clips@\$3.9	Necessary	31.20	31.20
68	1pc	Front bumper reinforcement	Badly Dented	321.00	321.00
69	2pcs	Front bumper reinforcement garnish@\$24.20	Badly Dented	48.40	48.40
70	4pcs	Front bumper reinforcement nut@\$10.50	Necessary	42.00	42.00
				14376.40	14064.75
			Less: 20% Discount	-	2812.95
				14376.40	11251.80
		SPECIAL NETT ITEMS			
1	1set	Rear bumper sensor	Dented/Cracked	350.00	280.00
2	1set	Rear windscreen sealant	Necessary	50.00	50.00
3	1set	Front no. plate	Dented	50.00	40.00
4	1set	Reverse camera	Serviceable	480.00	-
5	1set	Rear panel sealant	Necessary	50.00	40.00
6	1set	Spare tyre well sealant	Necessary	50.00	40.00
		Total spare parts		15406.40	11701.80
		LABOUR & MISC. CHARGES			
1		Remove the necessary affected parts, cut/weld rear panel, spare tyre well, straighten both front and rear chassis, both headlamp panels, both front & rear fenders, front support panel and replace parts		2800.00	2400.00
2		Straighten using Korek Chassis alignment bench		400.00	300.00
3		Check and Reset complete electrical system		100.00	80.00
4		Remove and refit rear bumper sensors		100.00	60.00
5		Remove and refit rear reverse camera		100.00	60.00
6		Remove and refit rear cctv-in-car camera		100.00	60.00
7		Rewire rear portlon		50.00	30.00
8		Rewire reverse camera		50.00	30.00
9		Rewire rear cctv-in-car camera		50.00	30.00
10		Remove and refit rear windscreen		150.00	120.00
11		Putty and Spraypaint		2400.00	2000.00
12		Tuff Kote		200.00	150.00
13		Remove and refit rear seat and trimming		200.00	150.00
14		Rewire front portion and refocus o/s headlamp beams		50.00	30.00
15		Remove and refit bootlid components		100.00	60.00
16		Remove and refit bonnet components		100.00	60.00
17		Remove and refit rear exhaust pipe		150.00	120.00
			SUB / GRAND TOTAL	22506.40	17441.80

8609.56
 325.00
 2960.00
 11,894.56
 20% - 9515.64

10,761.95
 20%
 8609.56

325

2960

PRECISION APPRAISAL SERVICE
 6 days
 45,950.00




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD		Ref : CS3/LPC19000997/R1td3n2-1		
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Date : 10-05-2019		
		Code : LPC2		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GY 3826A	Veh. Inspected	SKT 5480D	
Policy No.		Coverage (\$)	0.00	
Claim No.	18/19/19/VC05/021332	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	19/03/2019	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL 1.5X A	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	RU11022268	Colour	WHITE	
Odometer	99010	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	MICHELIN	6 mm	
L/H Front Tyre	215/60 R16	MICHELIN	6 mm	
R/H Rear Tyre	215/60 R16	MICHELIN	6 mm	
L/H Rear Tyre	215/60 R16	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	15/01/2019	Inspection Date	16/01/2019	
Survey held at	WILLY MOTOR COMPANY 27A JURONG PORT ROAD #01-32 SINGAPORE 619101			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKT 5480D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BOOTLID	BADLY DENTED	1,100.90	1,100.90
1	BOOTLID CENTRE LOGO	NOT NECESSARY	33.40	-
1	BOOTLID "VEZEL" EMBLEM	NECESSARY	58.50	58.50
2	BOOTLID SHOCK ABSORBER @\$180.00	SERVICEABLE	360.00	-
1	BOOTLID OUTER HANDLE	SERVICEABLE	175.50	-
1	BOOTLID TRIMBOARD	BENT	153.40	153.40
1	SET BOOTLID TOP LAMP NUT	NOT NECESSARY	10.50	-
1	BOOTLID UPPER LOCK	BENT / JAMMED	151.70	151.70
2	BOOTLID HINGES @\$17.50	NOT NECESSARY	35.00	-
2	BOOTLID HINGES BOLT/NUT @\$4.50	NOT NECESSARY	9.00	-
2	BOOTLID LAMP @\$264.60	N/S CRACKED	529.20	264.60
4	BOOTLID LAMP NUT @\$4.50	SERVICEABLE	18.00	-
1	BOOTLID RUBBER	TORN	96.80	96.80
2	REAR NO PLATE LAMP @\$38.50	SERVICEABLE	77.00	-
1	WIPER MOTOR NUT	NOT NECESSARY	5.00	-
1	SET REAR WINDSCREEN RUBBER	NECESSARY	198.00	198.00
1	WIPER MOTOR	NOT NECESSARY	205.10	-
1	BOOTLID STRIKER	BENT	58.10	58.10
1	TOOL TRAY GARNISH	NOT NECESSARY	226.90	-
1	REAR PANEL LINING	NECESSARY	92.30	92.30
1	REAR PANEL	BADLY DENTED	819.00	595.00
1	REAR TOW HOOK PANEL,CENTRE	BADLY DENTED	95.00	95.00
1	REAR BUMPER	BADLY DENTED	463.70	463.70
2	REAR BUMPER SIDE RETAINER @\$17.50	BENT	35.00	35.00
8	REAR BUMPER CLIPS @\$3.90	NECESSARY	31.20	31.20
2	REAR BUMPER REFLECTOR @\$148.35	O/S CRACKED	296.70	148.35
1	REAR BUMPER CORNER N/S	TO REPAIR SEE LABOUR	195.00	-
1	REAR BUMPER CORNER O/S	TO REPAIR SEE LABOUR	195.00	-
3	REAR BUMPER CORNER O/S CLIPS @\$3.90	SERVICEABLE	11.70	-

Report Ref No. CS3/LPC19000997/R1td3n2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER UNDER COVER	BENT / WARPED	190.00	190.00
10	REAR BUMPER UNDER COVER CLIPS @\$3.50	SERVICEABLE	35.00	-
2	TAILLAMP @\$428.70	DEFACED / BENT	857.40	857.40
8	TAILLAMP CLIPS @\$3.50	SERVICEABLE	28.00	-
1	REAR O/S FENDER ARCH GARNISH	NOT NECESSARY	172.10	-
10	REAR FENDER ARCH GARNISH CLIPS @\$4.00	NOT NECESSARY	40.00	-
1	REAR N/S FENDER ARCH GARNISH	NOT NECESSARY	172.10	-
1	REAR EXHAUST PIPE SILENCER	BENT / DENTED	528.00	528.00
1	REAR EXHAUST PIPE RUBBER	BENT	16.50	16.50
1	REAR EXHAUST PIPE MTG	BENT	16.50	16.50
1	REAR EXHAUST PIPE OUTER PLATE	SERVICEABLE	55.00	-
1	SPARE TYRE WELL	BADLY DENTED	662.30	662.30
1	SPARE TYRE WELL BOX SPONGE ASSY	WARPED / TORN	186.00	186.00
1	REAR PANEL CENTRE SWITCH	SERVICEABLE	58.10	-
1	REAR BUZZER	BENT	80.00	80.00
1	BONNET	BADLY DENTED	892.30	892.30
8	BONNET INSULATOR CLIPS @\$3.50	SERVICEABLE	28.00	-
1	BONNET INSULATOR	NOT NECESSARY	122.30	-
1	O/S HEADLAMP	CRACKED	1,820.20	1,820.20
2	O/S HEADLAMP CLIP @\$4.50	SERVICEABLE	9.00	-
1	FRONT GRILLE COVER	CRACKED	85.00	85.00
1	FRONT GRILLE UPPER BEAM CENTRE	NOT NECESSARY	38.70	-
1	FRONT GRILLE BASE	CRACKED	268.90	268.90
1	FRONT GRILLE OUTER	CRACKED	203.40	203.40
2	FRONT GRILLE CHROME @\$56.90	CRACKED	113.80	113.80
1	FRONT GRILLE LOGO	NECESSARY	23.40	23.40
8	FRONT GRILLE CLIPS @\$3.90	SERVICEABLE	31.20	-
2	FRONT GRILLE UPPER SIDE BEAM @\$19.60	NOT NECESSARY	39.20	-
1	FRONT GRILLE	REPEATED	268.90	-
1	FRONT BUMPER GRILLE	SERVICEABLE	77.50	-
1	FRONT GRILLE CENTRE BRACKET	CRACKED	38.70	38.70
1	FRONT BUMPER LOWER COVER	TORN	351.00	351.00
10	FRONT BUMPER LOWER COVER CLIPS @\$3.90	NECESSARY	39.00	39.00

Report Ref No. CS3/LPC19000997/R1td3n2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER LOWER COVER RUBBER	NOT NECESSARY	84.90	-
2	FRONT BUMPER BEAM @\$35.00	SERVICEABLE	70.00	-
1	FRONT BUMPER BRACKET N/S	CRACKED	35.00	35.00
1	FRONT BUMPER	BADLY DENTED	459.80	459.80
8	FRONT BUMPER CLIPS @\$3.90	NECESSARY	31.20	31.20
1	FRONT BUMPER REINFORCEMENT	BADLY DENTED	321.00	321.00
2	FRONT BUMPER REINFORCEMENT GARNISH @\$24.20	SERVICEABLE	48.40	-
4	FRONT BUMPER REINFORCEMENT NUT @\$10.50	NOT NECESSARY	42.00	-
	LESS 20% DISCOUNT		-	-2,152.39
			14,376.40	8,609.56
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER SENSOR (SN)	DENTED / CRACKED	350.00	200.00
1	SET REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	30.00
1	SET FRONT NO PLATE (SN)	DENTED	50.00	35.00
1	SET REVERSE CAMERA (SN)	SERVICEABLE	480.00	-
1	SET REAR PANEL SEALANT (SN) }	NECESSARY	50.00	60.00
1	SET SPARE TYRE WELL SEALANT (SN) }	NECESSARY	50.00	-
			1,030.00	325.00
	LABOUR			
	REMOVE THE NECESSARY AFFECTED PARTS,CUT/WELD REAR PANEL,SPARE TYRE WELL,STRAIGHTEN BOTH FRONT AND REAR CHASSIS,BOTH HEADLAMP PANELS,BOTH FRONT & REAR FENDERS,FRONT SUPPORT PANEL AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER CORNER N/S AND REAR BUMPER CORNER O/S.		2,800.00	1,200.00
	STRAIGHTEN USING KOREK CHASSIS ALIGNMENT BENCH.	NOT NECESSARY	400.00	-
	CHECK AND RESET COMPLETE ELECTRICAL SYSTEM.		100.00	30.00
	REMOVE AND REFIT REAR BUMPER SENSORS.		100.00	60.00
	REMOVE AND REFIT REAR REVERSE CAMERA.		100.00	40.00
	REMOVE AND REFIT REAR CCTV-IN-CAR CAMERA.	NOT NECESSARY	100.00	-
	REWIRE REAR PORTION.	NOT NECESSARY	50.00	-

Report Ref No. CS3/LPC19000997/R1td3n2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REWIRE REVERSE CAMERA.	NOT NECESSARY	50.00	-
	REWIRE REAR CCTV-IN-CAR CAMERA.	NOT NECESSARY	50.00	-
	REMOVE AND REFIT REAR WINDSCREEN.		150.00	120.00
	PUTTY AND SPRAYPAINT.		2,400.00	1,200.00
	TUFF KOTE.		200.00	80.00
	REMOVE AND REFIT REAR SEAT AND TRIMMING.		200.00	80.00
	REWIRE FRONT PORTION AND REFOCUS O/S HEADLAMP BEAMS.		50.00	30.00
	REMOVE AND REFIT BOOTLID COMPONENTS.		100.00	60.00
	REMOVE AND REFIT BONNET COMPONENTS.	NOT NECESSARY	100.00	-
	REMOVE AND REFIT REAR EXHAUST PIPE.		150.00	60.00
			7,100.00	2,960.00
GRAND TOTAL			22,506.40	11,894.56
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,500.00

Report Ref No. CS3/LPC19000997/R1td3n2-1

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.