

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWER

SINGAPORE 079909

INV No. AC2005657

INV Date 18/08/2020

Reference CC6/CTI19005977/Uda3n2

Code CT



PROFESSIONAL SERVICE FEE

Vehicle No. SLB 5228A

Insured Veh. SLB 8992G

Claim No. SNM19D201513/C02/2

Policy No. DMPCSN1624101802

Accident Date 03/04/2019

Inspection Date 04/04/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

HYN



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile				
CHIN	CHINA TAIPING INSURANCE (S) PTE LTD Ref : CC6/CTI19005977/Uda3n2				
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date: 18-08-2020 Code: CTI			
1.		Policy Particulars	- THIRD PARTY CLAIM		
	Insured Veh.	SLB 8992G	Veh. Inspected	SLB 5228A	
	Policy No.	DMPCSN1624101802	Coverage (\$)	0.00	
	Claim No.	SNM19D201513/C02/2	Excess (\$)	0.00	
	Assign From		Assign Date	04/04/2019	
2.		Vehicle Partic	culars & Condition		
	Make & Model	TOYOTA ISIS (A)	c.c	1794	
	Engine No.	HIDDEN	Year of Reg.	2008	
	Chassis No.	ZNM100056124	Colour	WHITE	
	Odometer	184994	Steering	IN ORDER	
	Brakes	IN ORDER	Modification	SPORTS RIM	
	General	GOOD			
3.		Condition	ons of Tyres		
		Size	Make	Balance	
	R/H Front Tyre	195/65 R15	MEMBAT	6 mm	
	L/H Front Tyre	195/65 R15	MEMBAT	6 mm	
	R/H Rear Tyre	195/65 R15	MEMBAT	6 mm	
	L/H Rear Tyre	195/65 R15	MEMBAT	6 mm	
4.		•	on of Damages		
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.		
	DAMAGES SEE DI	ETAILS.			
5.		General	Information		
	Accident Date	03/04/2019	Inspection Date	04/04/2019	
	Survey held at	FASTECH AUTO PTE LTD			
		1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a.		Re	emarks		
		ON WAS CONDUCTED ON A"WIT CE TO YOUR INSTRUCTIONS, W		REPAIRS.	
5b.	b. Estimate Days of Repair				
	ESTIMATED NORI	MAL PERIOD FOR REPAIR:	5 Working Days		



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLB 5228A

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR WINDSCREEN MOULDING	NECESSARY	110.10	110.10
1	TAILGATE	BADLY DENTED	1,685.10	1,665.10
1	TAILGATE REAR LOGO	NECESSARY	66.50	66.50
1	TAILGATE OUTER HANDLE	BENT / CRACKED	345.10	345.10
2	TAILGATE REFLECTORS @\$450.10	NOT FITTED	900.20	-
1	TAILGATE INNER LOCK	DENTED / SHORTED	305.50	305.50
1	TAILGATE INNER TRIM BOARD	DEFORMED / TORN	322.10	322.10
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	50.00	50.00
1	TAILGATE WEATHERSTRIP	TWISTED	329.50	329.50
2	TAILGATE DAMPERS @\$280.10	NOT NECESSARY	560.20	-
2	TAILGATE HINGES @\$65.50	NOT NECESSARY	131.00	-
1	REAR BUMPER	DISTORTED	1,255.10	945.10
1	REAR BUMPER OUTER PROTECTOR	NO SUCH PARTS	485.50	-
2	REAR BUMPER SIDE LAMPS @\$650.10	O/S CRACKED	1,300.20	285.50
2	REAR BUMPER SIDE PROTECTORS @\$210.00	NO SUCH PARTS	420.00	-
2	REAR BUMPER SIDE REFLECTORS @\$60.00	NOT FITTED	120.00	-
2	REAR BUMPER SIDE RETAINERS @\$98.10	NOT NECESSARY	196.20	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	TAILGATE INNER POCKET HOLDER	NOT NECESSARY	48.00	-
1	REAR END PANEL OUTER	BADLY DENTED	899.10	899.10
1	REAR END PANEL TOP GARNISH	TWISTED	302.20	302.20
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,140.50	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	488.20	-
1	REAR SPARE TYRE BRACKET	BENT / TWISTED	660.50	355.10
2	REAR FENDERS @\$1205.10	TO REPAIR SEE LABOUR	2,410.20	-
2	REAR FENDER INNER TRIM BOARDS @\$699.10	O/S TORN	1,398.20	699.10
2	TAILLAMPS @\$685.10	NOT NECESSARY	1,370.20	-
1	REAR END PANEL SMART SENSOR	NOT NECESSARY	285.50	-

Report Ref No. CC6/CTI19005977/Uda3n2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	REAR EXHAUST	TO REPAIR SEE LABOUR	899.50	-
1	REAR EXHAUST HEAT SHIELD	NOT NECESSARY	215.10	-
2	REAR EXHAUST MOUNTINGS @\$60.00	NOT NECESSARY	120.00	-
	LESS 25% DISCOUNT		-	-1,682.50
			18,869.50	5,047.50
	SPECIAL NETT ITEMS			
1	REAR BUMPER SENSOR (SN)	SHORTED	280.00	200.00
1	REAR REVERSE CAMERA (SN)	DAMAGED / SHORTED	500.00	380.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE W/HOLDER (SN)	BENT	50.00	40.00
1	REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	300.00	-
			1,230.00	710.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		80.00	30.00
	TO DISMENTLE & REPLACING REVERSE SENSOR.		80.00	50.00
	TO DISMENTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMENTLE & REFIX REAR EXHAUST.	NOT NECESSARY	100.00	-
	TO TRANSFER TAILGATE MECHANISM.		100.00	60.00
	TO MOUNT VEHICLE ON CAR O-LINER.	NOT NECESSARY	380.00	-
	TO DISMENTLE & REFIX SEAT, CUSHION UPHOLSTERY.		120.00	80.00
	TO SPRAY RUST PROOFING.		120.00	80.00
	LABOUR FOR PANEL		1,500.00	880.00
	BEATING,CUT,WELD,STRAIGHTENED & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL,REAR FENDERS AND REAR EXHAUST.			
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,080.00
			4,130.00	2,380.00
	GRAND TOTAL		24,229.50	8,137.50

RECOMMENDED COST OF LUMP SUM REPAIRS		6,500.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CC6/CTI19005977/Uda3n2





Report Ref No. CC6/CTI19005977/Uda3n2

CHUA KANG SENG
Licensed Appraiser




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLB 5228A

INSPECTION



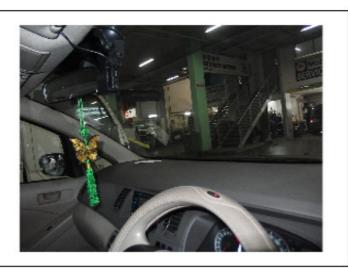












51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315







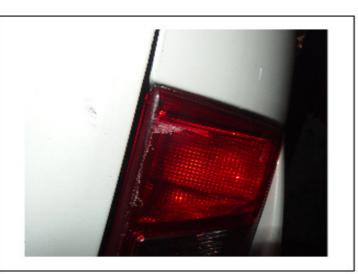








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315





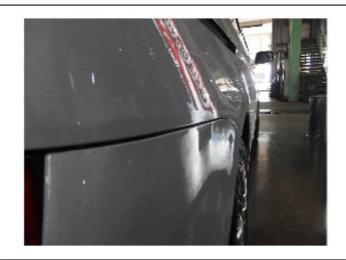









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315









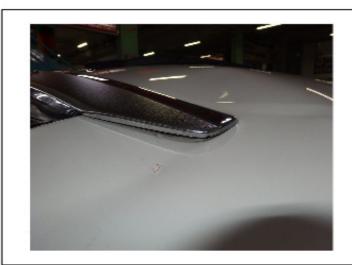





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315



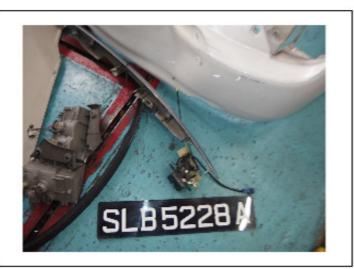











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315











