



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2006464
INV Date 18/09/2020
Reference CC4/EQI19006259/Kga3s2
Code EQI



PROFESSIONAL SERVICE FEE

Vehicle No. SME 5452R
Insured Veh. GBA 4910T
Claim No. DM19HO00868-JG
Policy No. DMCPHQ18-004517
Accident Date 26/03/2019
Inspection Date 17/04/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD		Ref : CC4/EQI19006259/Kga3s2		
5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Date : 18-09-2020		
		Code : EQI		
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBA 4910T	Veh. Inspected	SME 5452R
	Policy No.	DMCPHQ18-004517	Coverage (\$)	0.00
	Claim No.	DM19HO00868-JG	Excess (\$)	0.00
	Assign From	JOEL GOH	Assign Date	09/04/2019
2. Vehicle Particulars & Condition				
	Make & Model	SUBARU XV (A)	c.c	1995
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	JF1GT7KL5JG045909	Colour	METALLIC DARK BLUE
	Odometer	15034	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/55 R18	BRIDGESTONE	8 mm
	L/H Front Tyre	225/55 R18	BRIDGESTONE	8 mm
	R/H Rear Tyre	225/55 R18	BRIDGESTONE	8 mm
	L/H Rear Tyre	225/55 R18	BRIDGESTONE	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	26/03/2019	Inspection Date	17/04/2019
	Survey held at	MOTOR IMAGE ENTERPRISES PTE LTD 19 TOA PAYOH LORONG 8 SINGAPORE 319255		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 5452R

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	EXH PIPE ASSY R (N)	SERVICEABLE	540.00	-
1	MUFFLER ASSY W20 (N)	TO REPAIR SEE LABOUR	576.00	-
1	FLOOR PAN R R CP 5D (N)	TO REPAIR SEE LABOUR	432.00	-
1	SKIRT COMPL R 5D (N)	BENT	432.00	432.00
1	BUMPER FACE R XV (N)	BUCKLED	401.00	401.00
1	BRKT SD R KV RH (N)	TO REPAIR SEE LABOUR	12.10	-
1	BRKT SD R XV LH (N)	TO REPAIR SEE LABOUR	12.10	-
1	BRKT CORNER R 5D RH (N)	TO REPAIR SEE LABOUR	21.60	-
1	BRKT CORNER R 5D LH (N)	TO REPAIR SEE LABOUR	21.60	-
1	BRKT LWR R (N)	BUCKLED	50.40	50.40
1	BEAM COMPL R EU (N)	BENT	203.00	203.00
1	COVER HOOK R XV (N)	DENTED	6.50	6.50
1	MUDGUARD RRH (N)	SERVICEABLE	64.80	-
1	MUDGUARD RLH (N)	SERVICEABLE	64.80	-
1	PANEL COMPL R GAT (N)	BENT	940.00	940.00
1	GLASS ASSY R G (N)	NECESSARY	1,062.00	1,062.00
1	LATCHAACT ASSY RG (N)	TO REPAIR SEE LABOUR	144.00	-
1	STRIKER R/G (N)	TO REPAIR SEE LABOUR	21.60	-
1	WSTR DR R G (N)	TO REPAIR SEE LABOUR	108.00	-
1	DAM RUBBER (N)	NECESSARY	18.00	18.00
1	LENS & BODY COMPLLH (N)	TO REPAIR SEE LABOUR	378.00	-
1	LENS & BODY COMPLRRH (N)	TO REPAIR SEE LABOUR	129.60	-
1	LENS & BODY COMPLRLH (N)	SERVICEABLE	64.80	-
1	GARNISH SC (N)	SERVICEABLE	173.90	-

Report Ref No. CC4/EQI19006259/Kga3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	ORNAMENT ASSY F SIX (N)	NECESSARY	68.40	68.40
1	PROTECTOR UP FHL (N)	NOT NECESSARY	7.20	-
1	PROTECTOR SD RH FHI (N)	NOT NECESSARY	3.60	-
1	PROTECTOR SD LH FHI (N)	NOT NECESSARY	3.60	-
1	PROTECTOR LWR A FHI (N)	NOT NECESSARY	3.60	-
1	PROTECTOR LWR B FHI (N)	NOT NECESSARY	3.60	-
1	LETTER MK R (N)	NECESSARY	90.00	90.00
1	LETTER MK R XV (N)	NECESSARY	36.00	36.00
1	TRIM PNL AY SKIRT (N)	TO REPAIR SEE LABOUR	108.00	-
1	EYE SIGHT EMBLEM (N) (ADDITIONAL)	NECESSARY	43.20	43.20
	LESS 20% DISCOUNT		-1,249.00	-670.10
			4,996.00	2,680.40
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	SERVICEABLE	45.00	-
1	REVERSE SENSOR - 2 EYES (SN)	DENTED	300.00	300.00
1	REAR TINTED FILM (SN)	NECESSARY	145.00	145.00
1	SUNDRIES (SN)	NECESSARY	100.00	30.00
			590.00	475.00
	<u>LABOUR</u>			
	REPAIR / REPLACE RR BUMPER, RR TAILGATE, RR FLOORPAN & PANEL. INCLUSIVE OF THE REPAIR OF MUFFLER ASSY W20, FLOOR PAN R R CP 5D, BRKT SD R KV RH, BRKT SD R XV LH, BRKT CORNER R 5D RH, BRKT CORNER R 5D LH, LATCHA ACT ASSY RG, STRIKER R/G, WSTR DR R G, LENS & BODY COMPL LH, LENS & BODY COMPLRRH AND TRIM PNL AY SKIRT.		3,360.00	1,680.00
	RESPRAY RR BUMPER, RR TAILGATE, RR FLOORPAN & PANEL.		2,520.00	1,260.00
	DISMANTLE & REFIX UNDERCARRIAGE TO FACILITATE REPAIRS.	NOT NECESSARY	900.00	-
	REMOVE & REFIX EXHAUST.	NOT NECESSARY	150.00	-
	TO CONDUCT WATER SEEPAGE TEST.		100.00	20.00
	TRANSFER TAILGATE MECHANISM.		150.00	120.00
	TO CONDUCT 4 WHEEL ALIGNMENT.	NOT NECESSARY	200.00	-

Report Ref No. CC4/EQ19006259/Kga3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REFIX CARPET, SEATS TO FACILITATE REPAIRS.		400.00	250.00
	FAULT DIAGNOSTIC AND RESET SYSTEMS.	NOT NECESSARY	280.00	-
	REMOVE & INSTALL REAR WINDSCREEN.		300.00	300.00
	TO REMOVE & REFIX FUEL TANK.	NOT NECESSARY	200.00	-
	TO CONDUCT REAR LIGHTING TEST.		50.00	30.00
	TO CONDUCT PROTECTANT COATING.		500.00	250.00
	TO CONDUCT ANTI-RUST COATING.		580.00	290.00
	REMOVE & REFIX REAR BOOT GARNISH & TRIM TO FACILITATE REPAIRS.		150.00	120.00
			9,840.00	4,320.00
GRAND TOTAL			15,426.00	7,475.40

RECOMMENDED COST OF REPAIRS				7,475.40
------------------------------------	--	--	--	-----------------

Report Ref No. CC4/EQ19006259/Kga3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 5452R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

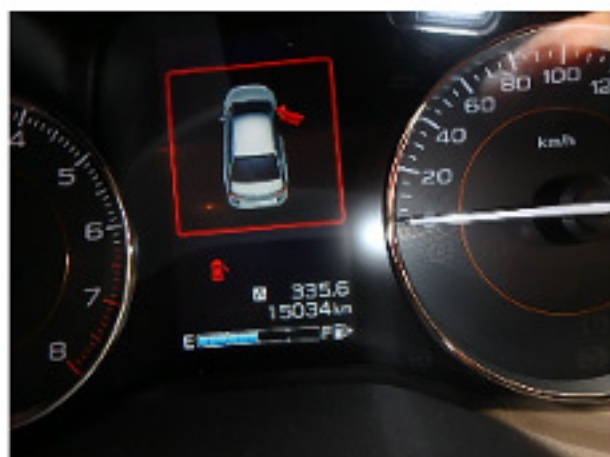



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 5452R

RE-INSPECTION

