



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2004456
INV Date 23/06/2020
Reference CC3/CTI19007706/Kka3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SHC 5600A
Insured Veh. PA 8365A
Claim No. SNM19D202271C02/8
Policy No. DMB1SN3001491901
Accident Date 28/04/2019
Inspection Date 30/04/2019

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD	Ref : CC3/CTI19007706/Kka3q2
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909	Date : 23-06-2020
	Code : CTI



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	PA 8365A	Veh. Inspected	SHC 5600A
Policy No.	DMB1SN3001491901	Coverage (\$)	0.00
Claim No.	SNM19D202271C02/8	Excess (\$)	0.00
Assign From		Assign Date	30/04/2019

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VF1ABL15AUC279401	Colour	METALLIC WHITE / RED
Odometer	589393	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	GITI	8 mm
L/H Front Tyre	215/60 R16	GITI	8 mm
R/H Rear Tyre	215/60 R16	GITI	8 mm
L/H Rear Tyre	215/60 R16	GITI	8 mm

4. Description of Damages

	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.
--	--

5. General Information

Accident Date	28/04/2019	Inspection Date	30/04/2019
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

5b. Estimate Days of Repair

	ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
--	-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5600A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR	BENT	1,108.46	1,108.46
1	BUMPER LOWER REAR	DENTED / CUT	768.84	768.84
1	BUMPER BRACKET CTR REAR	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR	DISTORTED	135.97	135.97
1	BUMPER RETAINER LH REAR	CRACKED	44.99	44.99
1	BUMPER REFLECTOR LH	CRACKED	43.61	43.61
1	BUMPER BEAM REAR	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BUMPER BEAM BRACKET RH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BOOT REAR	BENT	2,872.68	2,872.68
1	BOOT FINISHER	SERVICEABLE	470.06	-
1	BOOT REFLECTOR LAMP LH	CRACKED	493.35	493.35
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	493.35	-
1	BOOT BADGE 'RENAULT'	NECESSARY	225.36	225.36
1	BOOT BADGE	NECESSARY	225.36	225.36
1	BOOT STRUT LH	SERVICEABLE	276.08	-
1	BOOT STRUT RH	SERVICEABLE	276.08	-
1	BOOT HINGE LH	BENT	367.84	367.84
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM	SERVICEABLE	586.45	-
1	BOOT SWITCH	TO REPAIR SEE LABOUR	168.13	-
1	BOOT LOCK	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH	SERVICEABLE	74.40	-
2	LICENCE PLATE LAMP	SERVICEABLE	50.52	-

Report Ref No. CC3/CTI19007706/Kka3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	BOOT RUBBER PLUG	SERVICEABLE	221.81	-
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH	SERVICEABLE	543.47	-
1	FENDER PANEL INNER TRIM REAR RH	SERVICEABLE	671.45	-
1	FENDER PANEL REAR LH	BUCKLED	3,299.13	3,299.13
1	WHEELARCH REAR LH	SERVICEABLE	543.47	-
1	TAILLAMP LH	CRACKED	552.55	552.55
1	TAILLAMP PANEL LH	BENT	986.70	986.70
1	TAILLAMP RH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL)	BENT	1,471.77	1,471.77
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM	SERVICEABLE	612.21	-
1	EXHAUST REAR	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR	TO REPAIR SEE LABOUR	230.49	-
	LESS 10% DISCOUNT		-3,487.42	-1,337.41
			31,387.00	12,036.72
1	BOOT WEATHERSTRIP (50%)(SN)	DISTORTED / DENTED	323.05	161.53
	LESS 10% DISCOUNT		-32.31	-
			290.74	161.53
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET REAR BRACKET CTR CLIP (SN)	NECESSARY	33.00	33.00
1	SET REAR BRACKET SIDE CLIP RH RR(SN)	NOT NECESSARY	10.00	-
1	SET REAR RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-

Report Ref No. CC3/CTI19007706/Kka3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR BRACKET SIDE CLIP LH RR(SN)	NOT NECESSARY	10.00	-
1	SET REAR RETAINER LH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	SET BOOT FINISHER CLIP (SN)	NOT NECESSARY	24.20	-
1	REAR BOOT STICKER 'TRANS-CAB' (SN)	NECESSARY	80.00	30.00
1	REAR BOOT STICKER '6555-3333' (SN)	NECESSARY	80.00	30.00
1	SET FENDER WHEELARCH REAR RH CLIP (SN)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN)	NOT NECESSARY	35.00	-
1	FENDER INNER TRIM CLIP RH (SN)	NOT NECESSARY	28.00	-
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP RH (SN)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN)	NECESSARY	5.00	5.00
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	WINDSCREEN MOULDING (SN)	NECESSARY	100.00	100.00
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	30.00
1	SPARE TYRE RIM (ROUE 7J 16H 2547) (SN)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN)	SERVICEABLE	330.00	-
			2,280.02	400.00
LABOUR				
PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.			6,000.00	880.00
PANEL BEATING, KNOCKING AND STRAIGHTEN THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF BUMPER BEAM BRACKET LH REAR, BUMPER BEAM BRACKET RH REAR, BOOT HINGE RH, BOOT SWITCH, BOOT LOCK, FENDER PANEL REAR RH, TAILLAMP PANEL RH, SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL), EXHAUST REAR AND EXHAUST CAP REAR.			6,000.00	1,200.00
TO RUST-PROOFING OF THE AFFECTED AREAS.			170.00	90.00
TO REINSTALL REAR BUMPER PARKING SENSOR.			170.00	60.00
TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.			170.00	60.00

Report Ref No. CC3/CTI19007706/Kka3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.}		170.00	100.00
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.}		170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS, AND CONDUCT WATER SEEPAGE TEST.		170.00	120.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
			14,720.00	2,510.00
	GRAND TOTAL		48,677.76	15,108.25
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			12,050.00

Report Ref No. CC3/CT119007706/Kka3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5600A

INSPECTION

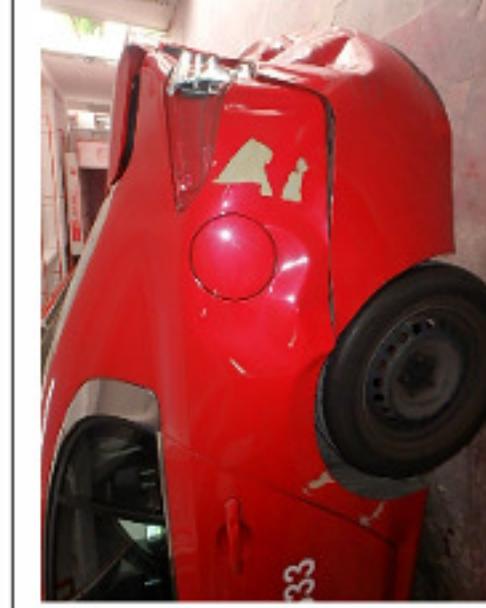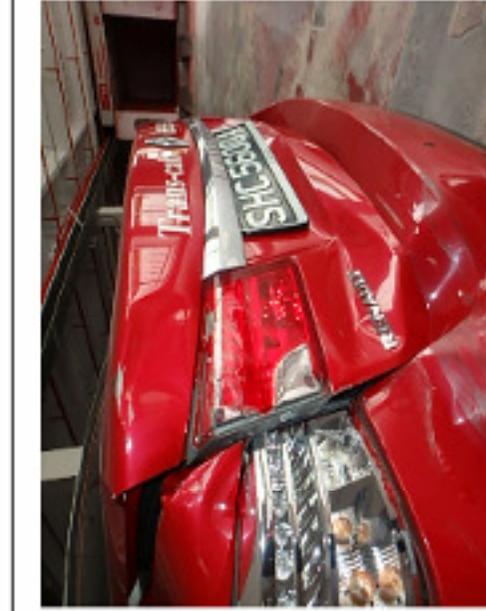



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

