

REF: CS/FCI19007800/Dgd3

112

Special Instructions

Surveyor

Bryun

ASSIGNMENT (Office)

CUS

From/Person

Henry Kuo

of

FCI

Date/Time

12:23pm 3/5/2019

Estimated Cost

Bill to

OD/IR/WS/TP RES/OD RES/EVA/INV/INV/CS

To Inspect Vehicle No:

SHC 8786C

Insured:

SHA 9096P

at Workshop info

chunni Motor

Tel:

85425119

of

BK 10 AMK Autopoint # 01-05/06

Policy No:

Claim No:

019002896 MF64

Sum Insured

Excess:

Make of Veh.
(Client's Record)

D.O.A

30/04/2019

CA / REV / REP / REV 24 HRS

1wp

H.O.D. Endorsement

Date/Time

12:30pm 3/5/19

Person Contacted

Jym

Vehicle

IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SHC 8786C - CC3/7MI/8001457/Klybn2

DOA: 23/9/2018

SHA 9096P - CC3/CTT/8021920/Klha3q2

DOA: 3/12/2018

4/5/19 @ 5:46pm VERSED to Henry Kuo by email.



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19002896MFSH
Our Ref: CS/FCI19007800/Dqd3

Date: 14 May 2019

The Motor Claims Department
MS First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SHC 8786C .

Please be informed that we had conducted the inspection of the abovementioned vehicle on 03/05/2019 at the premises of M/s CHUNNI MOTOR. and have the following to report:-

Workshop Estimate Amount	: S\$ <u>28,123.04</u> .
Revised Estimate Amount	: S\$ <u>17,815.52</u> .
"Check" Items Amount	: S\$ <u>-</u> .
Market Value	: S\$ <u>-</u> .
LTA Reimbursement Value	: S\$ <u>-</u> .
Nett Value	: S\$ <u>-</u> .

Description of Damage:

The vehicle sustained damages
at the front portion.

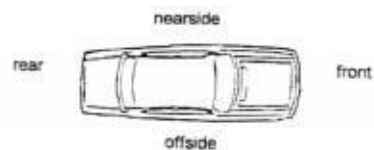

Yours faithfully

Bryan Ang Tani
Motor Surveyor / Investigator

MOTOR SURVEY ASSIGNMENT

Date	02-05-2019	Our Ref No. D19002896MFSH
Accident Date	30-04-2019	Claim Type. Third Party
Insured Vehicle	SHA9096P	Third Party Vehicle. SHC 8786C
Survey Location	AMK AUTOPOINT, SOON HOCK MOTOR, #01-05/06.	
Contact Person.	LYNN OR IRENE - 65421726	
Contact No.	65427162/ 0	Fax No. 65426039
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	CHUNNI MOTOR WORK PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	HENRY KAO	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 14 May 2019 5:46 PM
To: 'CWS Motor Claims'; assignments
Cc: 'Henry Kao Cai Jie'; SUR
Subject: RE: SURVEY ASSESSMENT - D19002896MFSH/1
Attachments: CSFC19007800Dqd3.pdf

Dear Henry,

Enclosed herewith preliminary advice of SHC 8786C.

Best Regards,

Shiau Chan (Ms) | Case Handler
LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Friday, 3 May 2019 12:30 PM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Henry Kao Cai Jie' <HenryKao@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19002896MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Friday, 3 May 2019 12:23 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Henry Kao Cai Jie <HenryKao@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D19002896MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHC 8786C

DATE : 2.05.2019

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

FCI

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Bonnet <i>5ve</i>			\$ 2,265.90	✓
	Bonnet Hinge (LH/RH) <i>HL</i>		\$ 41.00	\$ 82.00	X
	Bonnet Lock <i>1st</i>			\$ 36.90	✓
	Bonnet Insulator <i>HL</i>			\$ 196.50	X
	Bonnet Insulator Clips <i>HL</i>			\$ 8.40	✓
	Radiator Grille <i>broken</i>			\$ 1,110.10	✓
	Radiator Grille H Emblem <i>HL</i>			\$ 120.30	✓
	Front Bumper Cover <i>Dented</i>			\$ 1,052.20	✓
	Front Bumper Sponge <i>tone</i>			\$ 99.20	✓
	Front Bumper Reinforcement <i>Dented</i>			\$ 402.10	✓
	Front Bumper Grille (RH) <i>cut / distorted</i>			\$ 93.60	✓
	Front Bumper Grille Airduct (RH) <i>HL</i>			\$ 26.20	X
	Front Bumper Bracket Top (RH) <i>HL</i>			\$ 22.40	X
	Front Bumper Bracket (RH) <i>broken</i>			\$ 24.60	✓
	Headlamp Support Top Cover <i>broken</i>			\$ 222.60	✓
	Headlamp Support Panel Assy <i>broken (Dented)</i>			\$ 907.40	✓
	Headlamp (LH/RH) <i>mostly broken</i>		\$ 1,388.00	\$ 2,776.00	✓
	Radiator <i>Punctured / 1st</i>			\$ 698.30	✓
	Radiator Fan Blade, Cowling, Motor Assy <i>broken</i>			\$ 792.95	✓
	Radiator Bracket (RH) <i>HL</i>			\$ 6.50	X
	Radiator Hose Upper <i>HL</i>			\$ 105.80	X
	Radiator Hose Lower <i>HL</i>			\$ 52.70	X
	Radiator Expansion Tank <i>HL</i>			\$ 28.30	X
	Radiator Guard, RH <i>HL</i>			\$ 20.00	X
	Horn Unit (LH/RH) <i>broken</i>		\$ 73.80	\$ 147.60	✓
	Horn Wire <i>HL</i>			\$ 156.50	X
	Front Fender (RH) <i>Dented</i>			\$ 663.00	✓
	Front Fender Apron Panel (RH) <i>broken</i>			\$ 637.00	✓
	Front Fender Shield (RH) <i>HL</i>			\$ 174.90	X
	Aircon Condenser <i>1st / punctured</i>			\$ 927.50	✓
	Aircon Suction & Liquid Hose <i>broken</i>			\$ 624.00	✓
	Aircon Discharge Hose <i>broken</i>			\$ 162.60	X
	Aircon Compressor <i>HL</i>			\$ 2,578.00	X
	Wiper Container <i>damaged</i>			\$ 61.90	✓
	Wiper Container Motor <i>HL</i>			\$ 75.00	X
	Inter Cooler <i>Punctured / 1st</i>			\$ 1,032.50	✓
	Inter Cooler Mounting (2 PCS) <i>HL</i>			\$ 25.90	X
	Hose B To Inter Cooler <i>HL</i>			\$ 229.70	X
	Hose C To Inter Cooler Inlet <i>HL</i>			\$ 294.50	X
	Pipe To Inter Cooler <i>HL</i>			\$ 167.05	X
	Pipe To Inter Cooler Outlet <i>HL</i>			\$ 244.55	X
	Front Wheel Rim (RH) <i>HL</i>			\$ 325.30	X
	Front Wheel Hub Cap (RH) <i>HL</i>			\$ 107.10	X
	Front Wheel Bearing <i>HL</i>			\$ 540.50	X
	Front Shock Absorber (Assy) (RH) <i>distorted</i>			\$ 342.20	✓
	Front Shock Absorber Mounting (RH) <i>HL</i>			\$ 108.80	X
	Front Drive Shaft (RH) <i>HL</i>			\$ 1,030.80	X

Amount

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

FAX : 6542 6039

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

NAME
ADDRESS

Home Tel.:

VIN:

Registration: SHC 8786 C

Technician:

Mileage: 464609

Time Printed 4.5.19 9:30 AM

HYUNDAI I40

Front : Left

Actual	BEFORE	Specified Range
-1°24'		-3°00' 3°00'
4°05'		-0°19' 5°41'
0°15'		-1°30' 1°30'
18°33'		
17°10'		

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	BEFORE	Specified Range
-0°07'		-3°00' 3°00'
4°19'		-0°19' 5°41'
1°56'		-1°30' 1°30'
14°50'		
14°43'		

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	BEFORE	Specified Range
-1°17'		-3°00' 3°00'
-0°14'		-3°00' 3°00'
3°43'		-3°00' 3°00'
2°11'		-3°00' 3°00'

Rear : Left

Actual	BEFORE	Specified Range
-1°26'		-3°30' 2°30'
-0°12'		-1°30' 1°30'

Camber
Toe

Rear : Right

Actual	BEFORE	Specified Range
-1°52'		-3°30' 2°30'
0°12'		-1°30' 1°30'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	BEFORE	Specified Range
0°26'		-3°00' 3°00'
0°01'		-3°00' 3°00'
-0°12'		-3°00' 3°00'



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19007800/Dqd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 14-06-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 9096P	Veh. Inspected	SHC 8786C	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19002896MFSH	Excess (\$)	0.00	
Assign From	HENRY KAO	Assign Date	03/05/2019	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI I40	c.c	1685	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	KMHLB41UMGU085442	Colour	BLUE	
Odometer	464608	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	HANKOOK	5 mm	
L/H Front Tyre	205/60 R16	HANKOOK	5 mm	
R/H Rear Tyre	205/60 R16	HANKOOK	5 mm	
L/H Rear Tyre	205/60 R16	HANKOOK	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/04/2019	Inspection Date	03/05/2019	
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND. PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		10 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 8786C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET	BUCKLED	2,265.90	2,265.90
2	BONNET HINGE (LH/RH) @\$41.00	NOT NECESSARY	82.00	-
1	BONNET LOCK	BENT	36.90	36.90
1	BONNET INSULATOR	NOT NECESSARY	196.50	-
1	BONNET INSULATOR CLIPS	NECESSARY	8.40	8.40
1	RADIATOR GRILLE	BROKEN	1,110.10	1,110.10
1	RADIATOR GRILLE H EMBLEM	NECESSARY	120.30	120.30
1	FRONT BUMPER COVER	DENTED	1,052.20	1,052.20
1	FRONT BUMPER SPONGE	TORN	99.20	99.20
1	FRONT BUMPER REINFORCEMENT	DENTED	402.10	402.10
1	FRONT BUMPER GRILLE (RH)	CUT / DISTORTED	93.60	93.60
1	FRONT BUMPER GRILLE AIRDUCT (RH)	NOT NECESSARY	26.20	-
1	FRONT BUMPER BRACKET TOP (RH)	NOT NECESSARY	22.40	-
1	FRONT BUMPER BRACKET (RH)	BROKEN	24.60	24.60
1	HEADLAMP SUPPORT TOP COVER	BROKEN	222.60	222.60
1	HEADLAMP SUPPORT PANEL ASSY	BROKEN / DENTED	907.40	907.40
2	HEADLAMP (LH/RH) @\$1388.00	MOUNTING BROKEN	2,776.00	2,776.00
1	RADIATOR	PUNCTURE / BENT	698.30	698.30
1	RADIATOR FAN BLADE,COWLING,MOTOR ASSY	BROKEN	792.95	792.95
1	RADIATOR BRACKET (RH)	NOT NECESSARY	6.50	-
1	RADIATOR HOSE UPPER	NOT NECESSARY	105.80	-
1	RADIATOR HOSE LOWER	NOT NECESSARY	52.70	-
1	RADIATOR EXPANSION TANK	NOT NECESSARY	28.30	-
1	RADIATOR GUARD,RH	NOT NECESSARY	20.00	-
2	HORN UNIT (LH/RH) @\$73.80	BROKEN	147.60	147.60
1	HORN WIRE	NOT NECESSARY	156.50	-
1	FRONT FENDER (RH)	DENTED	663.00	663.00
1	FRONT FENDER APRON PANEL (RH)	DENTED	637.00	637.00
1	FRONT FENDER SHIELD (RH)	NOT NECESSARY	174.90	-
1	AIRCON CONDENSER	BENT / PUNCTURE	927.50	927.50

Report Ref No. CS/FC119007800/Dqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIRCON SUCTION & LIQUID HOSE	BENT	624.00	624.00
1	AIRCON DISCHARGE HOSE	NOT NECESSARY	162.60	-
1	AIRCON COMPRESSOR	NOT NECESSARY	2,578.00	-
1	WIPER CONTAINER	DEFORMED	61.90	61.90
1	WIPER CONTAINER MOTOR	NOT NECESSARY	75.00	-
1	INTER COOLER	PUNCTURE / BENT	1,032.50	1,032.50
1	INTER COOLER MOUNTING (2 PCS)	NOT NECESSARY	25.90	-
1	HOSE B TO INTER COOLER	NOT NECESSARY	229.70	-
1	HOSE C TO INTER COOLER INLET	NOT NECESSARY	294.50	-
1	PIPE TO INTER COOLER	NOT NECESSARY	167.05	-
1	PIPE TO INTER COOLER OUTLET	NOT NECESSARY	244.55	-
1	FRONT WHEEL RIM (RH)	NOT NECESSARY	325.30	-
1	FRONT WHEEL HUB CAP (RH)	NOT NECESSARY	107.10	-
1	FRONT WHEEL BEARING	NOT NECESSARY	540.50	-
1	FRONT SHOCK ABSORBER (ASSY)(RH)	DISTORTED	342.20	342.20
1	FRONT SHOCK ABSORBER MOUNTING (RH)	NOT NECESSARY	108.80	-
1	FRONT DRIVE SHAFT (RH)	NOT NECESSARY	1,030.80	-
1	RACK & PINION ASSY	NOT NECESSARY	1,191.30	-
1	STG TIE END	NOT NECESSARY	62.60	-
1	STABILIZER BAR	NOT NECESSARY	252.30	-
1	STABILIZER BAR BUSH (RH)	NOT NECESSARY	16.40	-
1	STABILIZER BAR LINK	NOT NECESSARY	61.10	-
1	STABILIZER BRACKET	NOT NECESSARY	24.00	-
1	FRONT SUSPENSION LOWER ARM (RH)	DISTORTED	529.30	529.30
1	KNUCKLE ARM (RH)	NOT NECESSARY	552.00	-
1	ABS SENSOR	NOT NECESSARY	234.00	-
1	ACTUATOR-SWIRL CONTROL	BROKEN	814.60	814.60
1	THROTTLE BODY ASSY	NOT NECESSARY	1,096.60	-
1	INTAKE MANIFOLD ASSY	MOUNTING BROKEN	1,141.10	1,141.10
1	ENGINE CROSSMEMBER (ADDITIONAL)	DISTORTED	2,094.40	2,094.40
	LESS 20% DISCOUNT		-5,975.51	-3,925.13
			23,902.04	15,700.52

Report Ref No. CS/FCI19007800/Dqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NO PLATE TRIM COVER (SN) }	BROKEN	30.00	45.00
1	FRONT NUMBER PLATE (SN) }	BROKEN	25.00	-
1	FRONT FENDER ADVERTISEMENT LOGO (RH)(SN)	NECESSARY	100.00	100.00
1	FRONT TYRE (RH)(SN)	NOT NECESSARY	216.00	-
			371.00	145.00
	<u>LABOUR</u>			
	PANEL BEATING.		1,500.00	1,000.00
	SPRAY PAINTING CHARGE.		1,000.00	700.00
	WIRING CHARGE.		50.00	30.00
	TUFF KOTE.		100.00	40.00
	TOWING CHARGE.	NOT NECESSARY	50.00	-
	REMOVE/REFIX UNDERCARRIAGE (FRT).		200.00	150.00
	FRT WHEEL ALIGNMENT.		120.00	60.00
	RE-SET FRT ABS SYSTEM.	NOT NECESSARY	200.00	-
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	80.00
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.	NOT NECESSARY	480.00	-
			3,850.00	2,060.00
	GRAND TOTAL		28,123.04	17,905.52
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			14,300.00

Report Ref No. CS/FC119007800/Dqd3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.