





Quantum Risk Management (S) Pte Ltd (Co.Reg.No:201415836W)

8 Ubi Road 2, #06-07 Zervex Building
Singapore 408538

Tel: 6444 2112 Fax: 6538 0121 Email: info@quantum-risk.com.sg

VEHICLE DAMAGE INSPECTION REPORT

Our File No: AV-05504
Date: 22/06/2018

REFERENCE

Handling Insurer:	Aviva Ltd	Policy No:	
Claimant Vehicle No :	SJM3500S	Insured Vehicle No :	SJM3513E
Date of Loss:	11/06/2018	Nature of Claim:	TP
		Claim No:	N/A

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJM3500S	Engine No:	EQ474I7070319
Make & Model:	DONGFENG EQ6380, 1.3 (M)	Chassis No:	LGK132K7689139812
Reg. Date:	28/11/2008 (Man. Year: 2008)	Odometer:	128543 km
Colour:	Red		
Engine Capacity:	1310 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Fair	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	Good

CONDITION OF TYRES

Front Tyre Size:	165/70R14	Rear Tyre Size:	165/70R14
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 6 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,518.70	5,294.60	1,224.10	18.78
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,500.00	1,930.00	1,570.00	44.86
Paintwork Labour	0.00	0.00	0.00	
Polishing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,018.70	7,224.60	2,794.10	27.89
Approved Total (Overridden) (S\$)		800.00		
(S\$)	10,018.70	800.00	9,218.70	92.01
+ GST 7.00/7.00% (S\$)	701.31	56.00	645.31	92.01
Nett Amount (S\$)	10,720.01	856.00	9,864.01	92.01

INSPECTION

Date of Assignment:	14/06/2018	
Date Inspected:	18/06/2018	Inspected At: Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	6.0 days	

Adjuster: Paul Thanapal

Manager: QRM Vetting Surveyor

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Incident Details

The driver of the insured vehicle and the driver of the Third Party vehicle (Driver, Chia Meng Hui) collided along Bukit Batok St 33.

Damage Consistency / Extent of Loss

Damage to the Third Party vehicle is consistent with the claim report and relates to a single incident.

Impact damage has been occasioned to the rear portion of the Third Party vehicle, damaging the Rear Bumper, Bumper Attachment, Rear Tailgate, Rear Taillamps, End Panel to cut/bent/cracked. Further damage may be apparent upon dismantling.

The repair time frame would be estimated at approximately 06 days upon commencement of repairs.

Economical Repair Limit and PARF/COE Rebate

The market value of this vehicle is about S\$4,900.00. PARF/COE Rebate is S\$4,089.00. The Economical Repair Limit is about S\$811.00.

Further Comments / Recommendations

As per your instructions, the above Survey has been carried out on a "Without Prejudice" basis and no repairs have been authorised by our office.

Due to the disagreed repair limit, repairer has engaged independent survey for this case and therefore we are sending our report for closure without finalisation confirmation.

We hereby submit our Inspection Report and images for your perusal.

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 22 Jun 2018)

Parts: N/A DONGFENG EQ6380 1.3 (M) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Quantum Risk Management (S) Pte Ltd/SJM3500S/22/06/2018 11:01

Validity: *These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAIL GATE	Bent	1,652.30 F	*1,652.30 F
2	1		*REAR TAIL GATE LOCK	Distorted	268.30 F	*268.30 F
3	1		*REAR TAIL GATE LOCK CATCH	Not Necessary	112.30 F	*- F
4	1		*REAR TAIL GATE RUBBER	Necessary	212.30 F	*212.30 F
5	1		*REAR TAIL GATE ABSORBER @ 258.00	Not Necessary	516.00 F	*- F
6	1		*REAR TAIL GATE INNER BOARD	Necessary	236.30 F	*236.30 F
7	1		*REAR TAIL GATE CENTRE GARISH	Cracked	295.60 F	*295.60 F
8	1		*REAR TAIL GATE EMBLEM (MINI)	Necessary	47.20 F	*47.20 F
9	1		*REAR TAIL GATE EMBLEM (1.3)	Necessary	40.10 F	*40.10 F
10	1		*REAR TAIL GATE WINDSCREEN MLDG	Necessary	125.00 F	*125.00 F
11	1		*REAR END PANEL	Bent	845.20 F	*845.20 F
12	1		*REAR BUMPER	Cut / Deformed	1,230.20 F	*1,230.20 F
13	1		*REAR BUMPER REFLECTOR RH @ 72.10	Cracked	144.20 F	*72.10 F
14	1		*REAR TAIL GATE CENTRE REFLECTOR	Not Necessary	268.70 F	*- F
15	1		*REAR TAIL GATE INNER BOARD CLIPS @ 5.00	Necessary	30.00 F	*30.00 F
16	1		*REAR NUMBER PLATE	Not Necessary	45.00 F	*- F
17	1		*REAR TAIL GATE WINDSCREEN SEALANT	Necessary	100.00 F	*40.00 F
18	1		*REAR REVERSE SENSOR	Necessary	350.00 F	*200.00 F
Total Parts (S\$)					6,518.70	5,294.60

F=Franchise part.

Quantum Risk Management (S) Pte Ltd/SJM3500S/22/06/2018 11:01. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING	New	150.00	30.00
2	TUFF KOTE	New	150.00	40.00
3	REMOVE AND REPLACE REVERSE SENSOR	New	150.00	60.00
4	REMOVE AND REFIX TAIL GATE WINDSCREEN	New	150.00	100.00
5	TO REMOVE AND REPLACE SPARE PART AND PANEL BEATING	New	1,500.00	800.00
6	TO SPRAY PAINTING AND ETC	New	1,400.00	900.00
Gross Labour Cost (S\$)			3,500.00	1,930.00

Quantum Risk Management (S) Pte Ltd/SJM3500S/22/06/2018 11:01. Not valid without Reference section.

< END OF ESTIMATES >

SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)

1/16: REAR CENTRE VIEW



2/16: REAR LEFT VIEW



3/16: REAR RIGHT VIEW

SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)

4/16: REAR GENERAL DAMAGED VIEW 1



5/16: REAR GENERAL DAMAGED VIEW 2




6/16: REAR GENERAL DAMAGED VIEW 3

SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)


7/16: REAR GENERAL DAMAGED VIEW 4



8/16: DISMANTLE DAMAGED PARTS VIEW 1

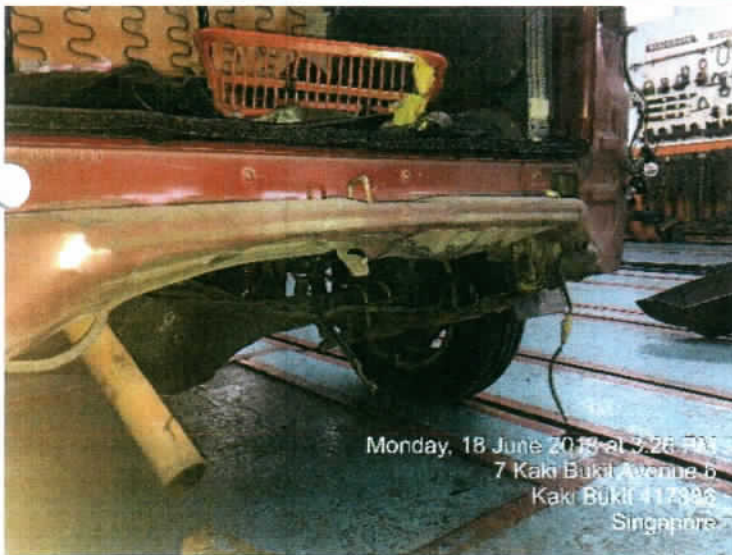


9/16: DISMANTLE DAMAGED PARTS VIEW 2

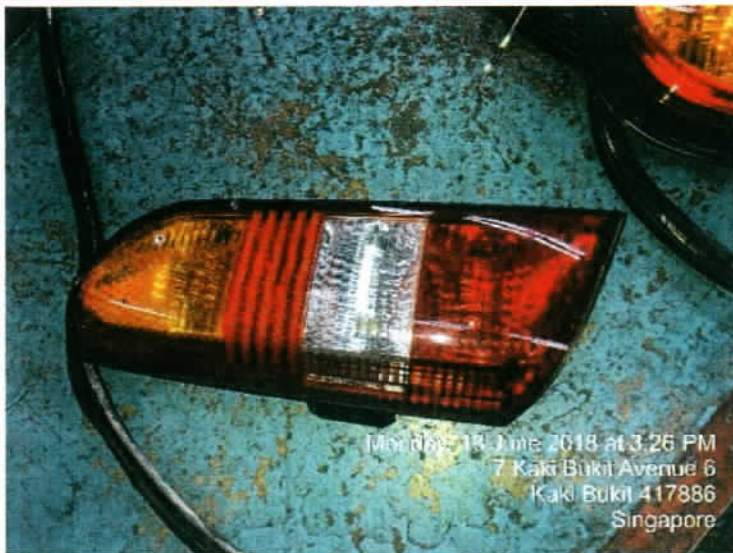SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)

10/16: DISMANTLE DAMAGED PARTS VIEW 3



11/16: DISMANTLE DAMAGED PARTS VIEW 4

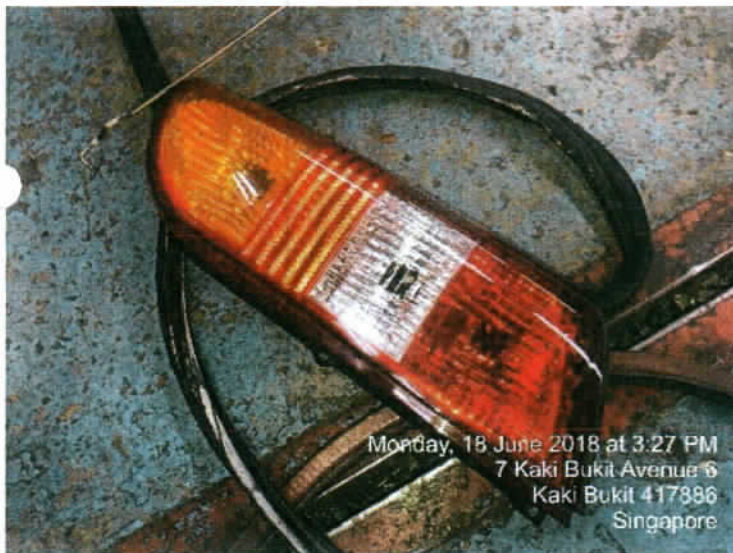

12/16: DISMANTLE DAMAGED PARTS VIEW 5

SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)



13/16: DISMANTLE DAMAGED PARTS VIEW 6



14/16: DISMANTLE DAMAGED PARTS VIEW 7



15/16: ODO METER READING

SJM3500S [SJM3513E] - Submitted by: Quantum Risk Management (S) Pte Ltd (HQ)



16/16: CHASSIS NO

FASTECH AUTO PTE LTD**1 Kaki Bukit Ave 6 #01-48 Autobay****Singapore 417883****Tel No: 67452063 / 67467158 Fax No: 67458520****Tax Reg No: 200006262D**

Date : 26.07.2018

Aviva Insurance Pte Ltd

4 Shenton Way

#01-01 SGX Centre 2

Singapore 068807

Attn: Motor Claims Department

BY AVIVA LTD
GUANG

LOD (TP)

G49405

ACCIDENT INVOLVING VEHICLE: SJM 3500S / SJM 3513E ON 11.06.2018

We are the authorized repair workshop for the owner of motor vehicle no: **SJM 3500S**, which was involved in the captioned accident with your insured vehicle no: **SJM 3513E**. The vehicle owner has requested and authorized us to assist him in presenting his/her claim against the party responsible for the damage to the vehicle.

As the accident was caused by the negligent act of your insured driving, we are submitting these claims for your consideration on behalf of the owner/claimant.

1) Cost of Repair (inclusive of GST)	S	6,206.00
2) Rental	S	1,080.00
3) GIA Search Result	S	2.00
4) Surveyor Report Fee	S	601.00
	S	7,889.00

We enclosed herewith the following documents to support the claims:

- | | |
|-----------------------------------|------------------------------------|
| a) Final Repair Invoice | e) Vehicle Registration Log Card |
| b) I/C & Driving License | f) Letter of Authorisation, etc... |
| c) GIA Report / GIA Search Result | g) Car Rental Invoice / Agreement |
| d) Insurance Certificate | h) Surveyor Report & Invoice |

Kindly look into the matter and let us hear from you on the settlement of our customer's claims as soon as possible.

Please note that it is a condition of any settlement reached that it shall be without prejudice to any personal injury claim (if any) of the owner/claimant.

Thank you.

Yours faithfully,

Jason Tang (jason@fastechauto.com.sg)

FASTECH AUTO PTE LTD