



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2103034
3 ANSON ROAD #16-00	INV Date	29/04/2021
SPRINGLEAF TOWER	Reference	CC6/CTI19011675/Aga3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SLV 3146K
Insured Veh.	SJF 441K
Claim No.	SNM19D203091
Policy No.	DMPCSN3044561900
Accident Date	27/06/2019
Inspection Date	01/07/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI19011675/Aga3q2 Date: 29/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJF 441K	Veh. Inspected	SLV 3146K
Policy No.	DMPCSN3044561900	Coverage (\$)	0.00
Claim No.	SNM19D203091	Excess (\$)	0.00
Assign From		Assign Date	01/07/2019
2. Vehicle Particulars & Condition			
Make & Model	OPEL ASTRA	c.c	999
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	W0LBE8EA7H8097980	Colour	BLACK
Odometer	23984 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
R/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	27/06/2019	Inspection Date	01/07/2019
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLV 3146K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRT BUMPER	NOT NECESSARY	1,994.00	-
15	FRT BUMPER CLIP	NOT NECESSARY	97.50	-
1	FRT FENDER LH	DENTED	682.00	682.00
1	FRT FENDER BRACKET LH	NOT NECESSARY	192.00	-
1	FRT FENDER INNERSHIELD LH	NOT NECESSARY	138.00	-
10	FENDER INNERSHIELD CLIP	NOT NECESSARY	65.00	-
1	LH WING MIRROR ASSY	CUT	588.00	588.00
1	LH WING MIRROR GLASS	NOT NECESSARY	408.00	-
1	LH WING MIRROR COVER	NOT NECESSARY	152.00	-
1	FRT DOOR LH	DENTED	2,166.00	2,166.00
1	FRT DOOR HINGE UPP LH	NOT NECESSARY	148.00	-
1	FRT DOOR HINGE LOW LH	NOT NECESSARY	148.00	-
1	FRT DOOR CHECKER LH-LINK CHECK	NOT NECESSARY	156.00	-
1	FRT DOOR LOCK LH	NOT NECESSARY	240.00	-
1	FRT DOOR LOCK CATCHER LH-STRIKER	NOT NECESSARY	84.00	-
1	FRT DOOR WEATHER STRIP LH	NECESSARY	208.00	208.00
1	FRT DOOR OUTER HANDLE LH	TO REPAIR SEE LABOUR	366.00	-
1	FRT DOOR OUTER HANDLE KNOB LH	TO REPAIR SEE LABOUR	132.00	-
1	FRT DOOR HANDLE INNER BASE-BRACKET	NOT NECESSARY	232.00	-
1	FRT DOOR BLACK STICKER LH	NECESSARY	110.00	110.00
1	FRT DOOR GLASS LH	NOT NECESSARY	368.00	-
1	FRT DOOR GLASS OUTER MLDG LH	DEFORMED	152.00	152.00
1	FRT DOOR GLASS RUNCHANNEL RUBBER BEADING WITH QUARTER GL	NOT NECESSARY	304.00	-
1	FRT DOOR POWER WINDOW REGULATOR ASSY LH	NOT NECESSARY	666.00	-
1	RR DOOR LH	TO REPAIR SEE LABOUR	2,480.00	-
1	FRT WHEEL BEARING LH-WITH HUB	NOT NECESSARY	492.00	-
1	FRT KNUCKLE ARM LH	NOT NECESSARY	414.00	-
1	FRT LOW ARM LH	NOT NECESSARY	867.00	-

Report Ref No. CC6/CTI19011675/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRT SHOCK ABSORBER LH LESS 10% DISCOUNT	NOT NECESSARY	528.00 -1,457.75	- -390.60
			13,119.75	3,515.40
1	FRT RIM LH (SN) LESS 10% DISCOUNT	CUT	1,200.00 -120.00	700.00 -
			1,080.00	700.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRT TYRE LH (SN)	NOT NECESSARY	300.00	-
			300.00	-
	<u>LABOUR</u>			
	TO DISMANTLE/RENEW THE ACCIDENT DAMAGED PORTION.TO PANEL BEATING,RESHAPE,STRAIGHTEN, ORIENTATE AND ALIGN REPAIR/REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF FRT DOOR OUTER HANDLE LH,FRT DOOR OUTER HANDLE KNOB LH AND RR DOOR LH.		1,200.00	400.00
	CARRY OUT SPRAY PAINTING ON AFFECTED AREA,FRT BUMPER,FRT FENDER LH,FRT DOOR LH,RR DOOR LH,LH ROCKER PANEL.		1,600.00	800.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS,RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER REPAIR.		120.00	30.00
	TO REMOVE AND REPLACE LHF UNDER CARRIAGE PARTS.	NOT NECESSARY	300.00	-
	TO CONDUCT 4 WHEEL ALIGNMENT.		160.00	80.00
	TO REMOVE AND REPLACE DASHBOARD SYSTEM AND INTERNAL WIRING.	NOT NECESSARY	500.00	-
	TO CONDUCT TRANSFER FRONT DOOR MECHANISM TO NEW DOOR PANEL.		200.00	80.00
			4,080.00	1,390.00
	GRAND TOTAL		18,579.75	5,605.40



RECOMMENDED COST OF REPAIRS			5,605.40
------------------------------------	--	--	-----------------

Report Ref No. CC6/CT119011675/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 3146K

INSPECTION

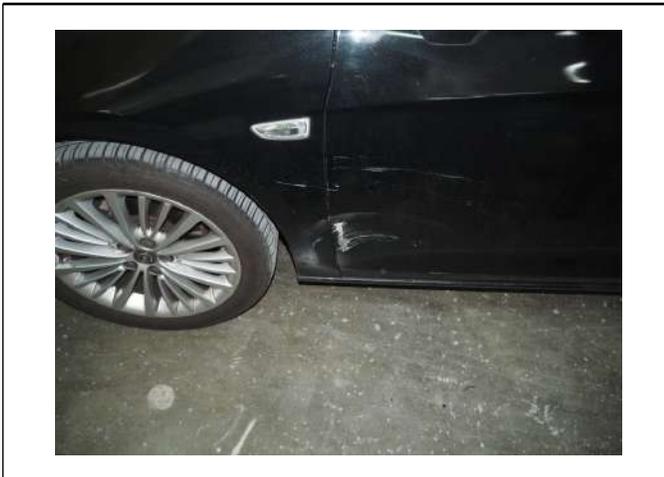




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

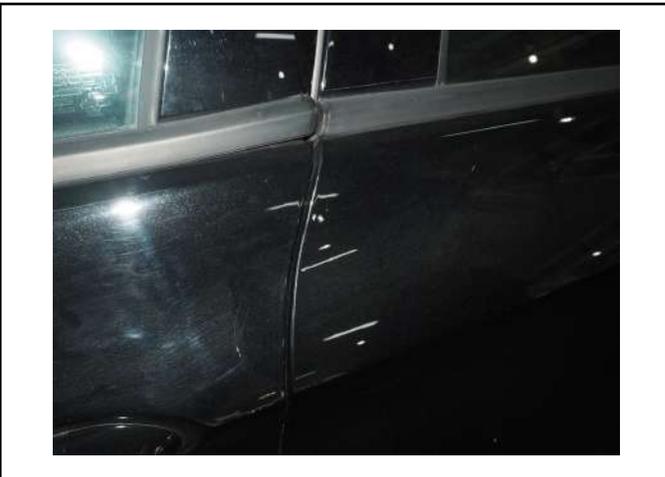



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 3146K

RE-INSPECTION

