



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2007732
INV Date 17/11/2020
Reference CC3/CTI19012130/Kea3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SHC 5774G
Insured Veh. SKK 7099G
Claim No. SNM19D203143
Policy No. DMHCSN3069831800
Accident Date 03/07/2019
Inspection Date 08/07/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC3/CTI19012130/Kea3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Date : 17-11-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKK 7099G	Veh. Inspected	SHC 5774G
Policy No.	DMHCSN3069831800	Coverage (\$)	0.00
Claim No.	SNM19D203143	Excess (\$)	0.00
Assign From		Assign Date	08/07/2019

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	VF1ABL15AUC281616	Colour	METALLIC WHITE / RED
Odometer	574343	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	GITI	8 mm
L/H Front Tyre	215/60 R16	GITI	8 mm
R/H Rear Tyre	215/60 R16	GITI	8 mm
L/H Rear Tyre	215/60 R16	GITI	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	03/07/2019	Inspection Date	08/07/2019
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **2 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5774G

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	BUCKLED / DENTED	1,259.42	1,259.42
1	BUMPER SPOILER FRT	SERVICEABLE	181.75	-
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH	SERVICEABLE	151.41	-
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	472.83	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	266.80	-
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	914.08	-
1	HEADLAMP LH	MTG CRACKED	1,184.43	1,184.43
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	152.15	-
1	FENDER PANEL FRT LH	BENT	783.83	783.83
1	WHEELARCH FRT LH	SERVICEABLE	278.84	-
1	FENDER BRACKET LOWER LH	SERVICEABLE	15.79	-
1	FENDER INSULATOR LH	SERVICEABLE	130.84	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	RADIATOR GRILLE	SERVICEABLE	1,707.78	-
1	RADIATOR GRILLE BADGE "RENAULT"	SERVICEABLE	225.36	-
1	RADIATOR GRILLE FRAME	SERVICEABLE	1,353.75	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	615.90	-
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	89.79	-
1	BONNET	TO REPAIR SEE LABOUR	1,941.63	-
1	BONNET INSULATOR	SERVICEABLE	405.73	-
1	BONNET STRUT LH	SERVICEABLE	88.61	-
1	BONNET STRUT RH	SERVICEABLE	88.61	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	348.31	-

Report Ref No. CC3/CTI19012130/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	348.31	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	305.48	-
1	BONNET CABLE	SERVICEABLE	119.19	-
1	BONNET CABLE COVER	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER	SERVICEABLE	92.36	-
1	BONNET SEAL INNER	SERVICEABLE	157.28	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	1,483.40	-
1	DOOR HARNESS WIRE LH	SERVICEABLE	2,670.00	-
1	ROCKER PANEL INNER GARNISH LH	SERVICEABLE	466.51	-
1	ROCKER PANEL INNER LH	TO REPAIR SEE LABOUR	1,024.79	-
1	ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	1,184.99	-
1	ROCKER PANEL CENTER LH	TO REPAIR SEE LABOUR	990.25	-
	LESS 10% DISCOUNT		-2,632.02	-322.77
			23,688.17	2,904.91
	<u>SPECIAL NETT ITEMS</u>			
1	BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	WHEELARCH CLIP FRT LH (SN)	NOT NECESSARY	30.50	-
1	FRONT LEFT TYRE (SN)	SERVICEABLE	300.00	-
1	FRONT LEFT TYRE RIM (SN)	SERVICEABLE	380.00	-

Report Ref No. CC3/CTI19012130/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	WINDSCREEN SEALANT (SN)	NOT NECESSARY	253.80	-
1	FRONT WINDSCREEN MOULDING (SN)	NOT NECESSARY	120.00	-
1	FRONT WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
6	BONNET INSULATOR CLIP L70Y (SN)	NOT NECESSARY	7.30	-
2	BONNET STRUT L70Y (SN)	NOT NECESSARY	88.61	-
2	BONNET CABLE CLIP L70Y (SN)	NOT NECESSARY	6.31	-
2	BONNET CABLE COVER SCREW L70Y (SN)	NOT NECESSARY	10.85	-
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	52.00	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	FRONT DOOR STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	FRONT DOOR STICKER "CLASSIC" (SN)	NOT NECESSARY	80.00	-
			1,882.87	66.00
	LABOUR			
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT,HEADLAMP PANEL FRT LH,FRONT BRACE PANEL,FRAME FULL SUPPORT BRACKET,BONNET,BONNET HINGE LH,BONNET HINGE RH,BONNET LOCK,DOOR PANEL FRT LH,ROCKER PANEL INNER LH,ROCKER PANEL OUTER LH AND ROCKER PANEL CENTER LH.		6,000.00	400.00
	TO TRANSFER OF FRONT BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF FRONT FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF FRONT WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-

Report Ref No. CC3/CTI19012130/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	440.00
	TO TRANSFER OF BONNET FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
			15,560.00	890.00
	GRAND TOTAL		41,131.04	3,860.91
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,100.00

Report Ref No. CC3/CT119012130/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5774G

INSPECTION

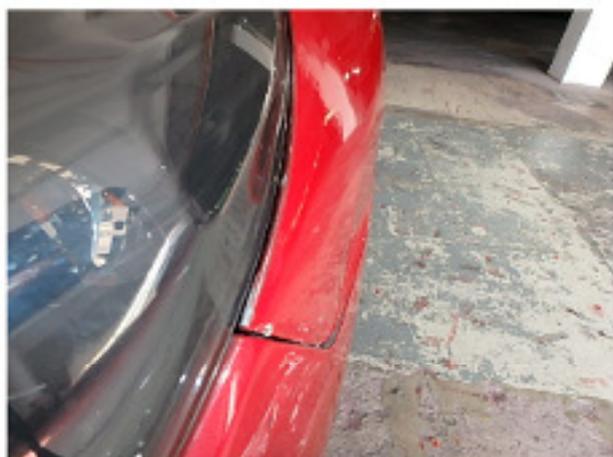



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

