

ASS. REC. BY:

REF: CS/SMO19013016/K+A3ⁿ²

Special Instruction:

Surveyor: Kenneth

ASSIGNMENT (Office)

From (Person): Gnoh Kau Long of SMO

Date/Time: 23.7.19 17.19 p.m

Estimated Cost: _____ Bill to: _____

OD / ~~TP~~ / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SKL 3767H

Insured: GBE 93385

at Workshop m/s Yee Auto

Tel: 64575766

of 160 sin ming drive # 02-17

6457 2625

Policy No: DIG MTPCVE 062875

Claim No: MTD1903517

Sum Insured: _____

Excess: _____

Make of Veh: _____

D.O.A. 21.7.19

(Client's Record)

CA / REV / REP. / REV 24 HRS

mp

H.O.D. Endorsement: _____

Date/Time: 24.7.19 9.07 a.m

Person Contacted: Mr Chan

Vehicle IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	SKL 3767H X
	GBE 93385 NBA/LIP17021507/Y
10/19	11 Emp @ 8000. confirm. (Red: 14074, 63%)

Girrajit

ASSIGNMENT

From: _____ Date: 24.7.2019

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKL 3767H

at Workshop m/s Yue Auto

of 160 sin ming Drive #02-17

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

Veh No: SKL 3767H Yr Regn: 11 10

Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Bmw 318i c.c. 1995

Colour: M. Grey A/C: Insured / Std / NI / NA

Sp. Reading: 153627 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WBAPIF7220A794011

Gen. Cond: Good / Fair / Poor / Burnt


Steering: In order / Jammed / Leaked / Burnt or _____

Brake: In order / Jammed / Leaked / Burnt or _____

Modl: Nil / S/Rim / STD / AIRim or _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

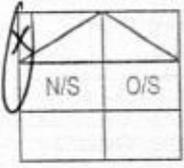

Tyre Size: F: 205/55ZR16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or _____

Front	Rear
R/Bal. <u>4</u> mm	R/Bal. <u>5</u> mm
L/Bal. <u>4</u> mm	L/Bal. <u>5</u> mm
D.O.A. <u>21/7/19</u>	D.O.I. <u>24/7/19</u>

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or N/S FR hood & etc

The U/C / Chassis frame / Body Structure affected due to collision.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / FR Seen: _____ Consistent?: Yes or No

Est. Repairs: 06 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS up

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time	Action / Instruction
	RECEIVED 18 SEP 2019
	RECEIVED 20 SEP 2019

Date/Time, File Pass to? : Preli. Report

1) 18/9 Typist : Final Report

Date/Time, File Return to? _____

2) _____

Report Format: _____

Lump Sum / I.B.I.: (\$) 8000/-

Days Of Repair: 6

Resurvey No. of Trip: 1

Add Fee: : Site Insp (\$)

: Interview (\$)

: Tech. Invs (\$)

: Weekend (\$)

Survey Fee: _____

Transportation: 450

Photos: 11

Others: _____

TOTAL: 461

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	22 Jul 2019		23 Jul 2019 17:19 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	T3 INTERNATIONAL PTE LTD, Co. Reg. No.: 200209175K								
Main Claimant:	PREMIUM AUTOBAHN PTE LTD, Co. Reg. No.: 201700926K								
Vehicle Reg. No.:	SKL3767H	Date of Loss:	21/07/2019 08:00 - :59						
Claim Type:	TP / CMTD1903517	Policy/Cover Note No.:	D18MTPCVE002875 (Comprehensive)						
Vehicle Reg. No. (Insured):	GBE9338S	Policy No. (Claimant):							
		Excess:							
Repairer:	Yee Auto Pte Ltd (HQ) 160 SIN MING DRIVE, #02-17 SIN MING AUTOCITY, 575722 Sin Ming - Tel: 6457 2625								
Handling Insurer:	Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by GNOH PAU LOONG - 63295217]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 01/08/2019]								
Driver/Custodian (Insured):	SHIBLY SADDAM HOSSAIN (), NRIC: G8203966Q, Tel: +6581163255 Email:								
Adj Asg. Remarks:	WS: 6457 5768								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:	Company
Owner ID:	926K

Vehicle Details

Vehicle No.:	SKL3767H
Vehicle to be Exported:	No
Intended Deregistration Date:	10 Sep 2019
Vehicle Make:	B.M.W.
Vehicle Model:	318I 2.0 AT D/AB 2WD 4DR GAS/D SR DRL
Primary Colour:	Brown
Manufacturing Year:	2010
Engine No.:	A496I794N46B20BZ
Chassis No.:	WBAPF72020A794011
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$28,778.00
Original Registration Date:	22 Nov 2010
First Registration Date:	22 Nov 2010
Transfer Count:	1
Actual ARF Paid:	\$28,778.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	21 Nov 2020
PARF Rebate Amount:	\$15,827.00

Intended COE Rebate Details

COE Expiry Date:	21 Nov 2020
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$44,090.00
COE Rebate Amount:	\$5,124.00
Total Rebate Amount:	\$20,951.00

The information contained herein is correct as at 10 Sep 2019

OK

SIN MING AUTOCITY

Order: R006725
 2: YEE AUTO PTE LTD
 se: SKL 3767 H
 24.7.19 15:03

Model: 3 Series - E90/E91 (2005 - 2012) : Sedan / Touring (Wagon) 09/2008- : without AFS (Active Front Steering) :
 Series : 16" Wheel
 4-Wheel Total Alignment

Front : Left

Actual	Before	Specified Range
2°07'		-0°48' 0°12'
0°00'		
-1°27'		0°05' 0°09'
-2°07'		
0°00'		
		-2°10' -1°10'

Camber
 Caster
 Toe
 SAI
 Included Angle
 Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-0°48'		-0°48' 0°12'
0°00'		
0°08'		0°05' 0°09'
0°48'		
0°00'		
		-2°10' -1°10'

Front

Cross Camber
 Cross Caster
 Cross SAI
 Total Toe
 Cross Turn Diff.

Actual	Before	Specified Range
2°55'		-0°30' 0°30'
0°00'		-0°30' 0°30'
-2°55'		
-1°19'		0°02' 0°26'

Rear : Left

Actual	Before	Specified Range
-1°50'		-1°55' -1°05'
0°08'		0°07' 0°11'

Camber
 Toe

Rear : Right

Actual	Before	Specified Range
-1°27'		-1°55' -1°05'
0°10'		0°07' 0°11'

Rear

Cross Camber
 Total Toe
 Thrust Angle

Actual	Before	Specified Range
-0°23'		-0°30' 0°30'
0°19'		0°06' 0°30'
-0°01'		-0°12' 0°12'



YEE AUTO PTE LTD

160 Sin Ming Drive #02-17/#07-12 Sin Ming AutoCity Singapore 575722

Tel: 6457 5768 Fax: 6252 8459 Mobile: 9687 4031

Email: yeeautopteltd@gmail.com

Registration No: 201719251W GST No: 201719251W

M/S : Somp Insurance Singapore Pte Ltd
50 Raffles Place
#03-03 Singapore Land Tower
Singapore 048623

Estimate No: ES1900036

Date: 24 Jul 2019

Policy No:

Veh Reg No: SKL3767H

Make/Model: B.M.W. 318I 2.0 AT
D/AB 2WD 4DR GAS/D
SR DRL

Chassis No: WBAPF72020A794011

Engine No: A4961794N46B20BZ

Reg. Date: 22/11/2010

ATTN: Motor Claim Department

Your Ref No: -

Claim Type: Third Party

Accident Date: 21/07/2019

TP Veh Reg No: GBE9338S

*Not Wharw
11 Sep @ 8000k Max
Accident After Pain
6 days*

Estimate Repair Cost to Vehicle No :SKL3767H

Description	U/Price	Quantity	List Price	Amount
			SS	SS
Spare Parts				
1 FRONT BUMPER	1,855.10	1 PC	1,855.10	✓
2 FRONT BUMPER SIDE RETAINER - LH	162.40	1 PC	162.40	X
3 FRONT BUMPER CLIPS	50.00	1 SET	50.00	✓
4 HEAD LAMP - LH	1,711.20	1 PC	1,711.20	✓
5 FRONT FENDER - LH	898.60	1 PC	898.60	✓
6 FRONT FENDER DUST COVER LH	155.10	1 PC	155.10	✓
7 FRONT FENDER INNER SHIELD CLIPS - LH	80.00	1 PC	80.00	✓
8 FRONT SHOCK ABSORBER - LH	785.90	1 PC	785.90	✓
9 FRONT LOWER ARM - LH	575.10	1 PC	575.10	✓
10 FRONT KNUCKLE ARM - LH	580.00	1 PC	580.00	✓
11 FRONT FENDER INNER SHIELD - LH	258.10	1 PC	258.10	✓
12 FRONT FENDER SIDE LAMP - LH	110.90	1 PC	110.90	✓
13 FRONT WHEEL RIM	800.00	1 PC	800.00	✓
14 FRONT DOOR HANDLE - LH	220.00	1 PC	220.00	X
15 FRONT DOOR - LH	1,940.20	1 PC	1,940.20	✓
16 FRONT DOOR CHANNEL - LH	182.10	1 PC	182.10	X
17 FRONT DOOR CHECKER - LH	238.10	1 PC	238.10	X
18 FRONT DOOR HINGE DOWN - LH	198.10	1 PC	198.10	X
19 FRONT DOOR HINGE UP - LH	198.10	1 PC	198.10	X
20 FRONT DOOR INNER LOCK - LH	655.00	1 PC	655.00	X
21 FRONT DOOR OUTER MOULDING - LH	288.10	1 PC	288.10	X
22 FRONT DOOR REGULATOR GEAR - LH	630.00	1 PC	630.00	X
23 FRONT DOOR REGULATOR GEAR MOTOR - LH	704.00	1 PC	704.00	X
24 FRONT DOOR RIVETS	40.00	1 PC	40.00	✓
25 FRONT DOOR STICKER - LH	60.00	1 PC	60.00	✓
26 FRONT DOOR TRIM BOARD - LH	868.00	1 PC	868.00	X
27 FRONT DOOR WEATHERSTRIP - LH	288.00	1 PC	288.00	X
28 REAR DOOR - LH	1,880.50	1 PC	1,880.50	X
29 ROCKER PANEL GARNISH - LH	568.50	1 PC	568.50	✓
30 ROCKER PANEL GARNISH CLIP	80.00	1 PC	80.00	✓
31 FRONT BUMPER SIDE RETAINER - RH	162.40	1 PC	162.40	X
32 FRONT SIDE MIRROR ASSY - LH	960.50	1 PC	960.50	X
			18,184.00	18,184.00

Labour

108



YEE AUTO PTE LTD

160 Sin Ming Drive #02-17/#07-12 Sin Ming AutoCity Singapore 575722
 Tel: 6457 5768 Fax: 6252 8459 Mobile: 9687 4031
 Email: yeeautopteltd@gmail.com
 Registration No.: 201719251W GST No: 201719251W

M/S : Somp Insurance Singapore Pte Ltd
 50 Raffles Place
 #03-03 Singapore Land Tower
 Singapore 048623

Estimate No: **ES1900036**
 Date: 24 Jul 2019
 Policy No:
 Veh Reg No: **SKL3767H**
 Make/Model: B.M.W. 318I 2.0 AT
 D/AB 2WD 4DR GAS/D
 SR DRL
 Chassis No: WBAPF72020A794011
 Engine No: A4961794N46B20BZ
 Reg. Date: 22/11/2010

ATTN: Motor Claim Department

Your Ref No: -
 Claim Type: Third Party
 Accident Date: 21/07/2019
 TP Veh Reg No: GBE9338S

Estimate Repair Cost to Vehicle No :SKL3767H

Description	U/Price	Quantity	List Price	Amount
			<u>SS</u>	<u>SS</u>
33 TO DISMANTLE & REPLACE DAMAGED PARTS, PANEL BEAT WHERE NECESSARY.	1,500.00	1 JOB	1,500.00	600
34 TO PUTTY, APPLY PRIMER & SPRAY-PAINT ON THE AFFECTED PORTION.	1,400.00	1 JOB	1,400.00	880
35 TO APPLY RUST- PROOFING ON REPAIRED, REPLACED PANEL.	150.00	1 JOB	150.00	60
36 TO CHECK WIRING FUNCTIONS.	120.00	1 JOB	120.00	20
37 TO REMOVE/REPLACE UNDERCARRIAGE LABOUR.	350.00	1 JOB	350.00	200
38 WHEEL ALIGNMENT	120.00	1 T	120.00	60
39 COMPUTER DIAGNOSTIC RESET	250.00	1 PC	250.00	7
			3,890.00	3,890.00
			Total	SS 22,074.00
			Add GST @ 7%	1,545.18
			Total Amount Payable	SS 23,619.18

TOTAL: SINGAPORE DOLLAR TWENTY THREE THOUSAND SIX HUNDRED NINETEEN AND CENTS EIGHTEEN ONLY

For Yee Auto Pte Ltd

AUTHORISED SIGNATURE

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/SMO19013016/KTF3N2

Date: 26/09/2019

REFERENCE

Handling Insurer:	Sompo Insurance Singapore Pte. Ltd.	Policy No:	D18MTPCVE002875
Claimant Vehicle No :	SKL3767H	Insured Vehicle No :	GBE9338S
Date of Loss:	21/07/2019	Nature of Claim:	TP
		Claim No:	CMTD1903517

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKL3767H	Engine No:	A496I794N46B20BZ
Make & Model:	BMW 318i, 1.5 (A)	Chassis No:	WBAPF72020A794011
Reg. Date:	22/11/2010 (Man. Year: 2010)	Odometer:	153627 km
Colour:	Metallic Grey		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/55ZR16	Rear Tyre Size:	205/55ZR16
Front Left Side:	Michelin 4 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	Michelin 4 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	18,184.00	9,493.83	8,690.17	47.79
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,890.00	1,820.00	2,070.00	53.21
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	22,074.00	11,313.83	10,760.17	48.75
Approved Total (Overridden) (S\$)		8,000.00		
(S\$)	22,074.00	8,000.00	14,074.00	63.76
+ GST 7.00/7.00% (S\$)	1,545.18	560.00	985.18	63.76
Nett Amount (S\$)	23,619.18	8,560.00	15,059.18	63.76

INSPECTION

Date of Assignment:	23/07/2019	
Date Inspected:	24/07/2019	Inspected At:
		Yee Auto Pte Ltd (HQ) 160 SIN MING DRIVE, #02-17 SIN MING AUTOCITY Singapore 575722

Estimated Period of Repair: 6.0 days

Adjuster: KENNETH KONG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 25 Sep 2019)
Parts: 143	BMW 318i 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKL3767H)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Buckled	1,855.10 F	*1,855.10 FL
2	1		*FRONT BUMPER SIDE RETAINER-LH	Serviceable	162.40 F	*- FL
3	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 F	*50.00 FL
4	1		*HEAD LAMP-LH	Mtg Cracked	1,711.20 F	*1,711.20 FL
5	1		*FRONT FENDER-LH	Bent	898.60 F	*898.60 FL
6	1		*FRONT FENDER DUST CIVER LH	Cracked	155.10 F	*155.10 FL
7	1		*FRONT FENDER INNER SHIELD CLIPS-LH	Necessary	80.00 F	*80.00 FL
8	1		*FRONT SHOCK ABSORBER-LH	Bent	785.90 F	*785.90 FL
9	1		*FRONT LOWER ARM-LH	Distorted	575.10 F	*575.10 FL
10	1		*FRONT KNUCKLE ARM-LH	Bent	580.00 F	*580.00 FL
11	1		*FRONT FENDER INNER SHIELD-LH	Distorted	258.10 F	*258.10 FL
12	1		*FRONT FENDER SIDE LAMP-LH	Scratched	110.90 F	*110.90 FL
13	1		*FRONT WHEEL RIM	Dented	800.00 F	*800.00 FL
14	1		*FRONT DOOR HANDLE-LH	Repair	220.00 F	*- FL
15	1		*FRONT DOOR-LH	Bent	1,940.20 F	*1,940.20 FL
16	1		*FRONT DOOR CHANNEL-LH	Serviceable	182.10 F	*- FL
17	1		*FRONT DOOR CHECKER-LH	Serviceable	238.10 F	*- FL
18	1		*FRONT DOOR HINGE DOWN-LH	Repair	198.10 F	*- FL
19	1		*FRONT DOOR HINGE TOP-LH	Repair	198.10 F	*- FL
20	1		*FRONT DOOR INNER LOCK-LH	Repair	655.00 F	*- FL
21	1		*FRONT DOOR OUTER MOULDING-LH	Serviceable	288.10 F	*- FL
22	1		*FRONT DOOR REGULATOR GEAR-LH	Serviceable	630.00 F	*- FL
23	1		*FRONT DOOR REGULATOR GEAR MOTOR-LH	Serviceable	704.00 F	*- FL
24	1		*FRONT DOOR RIVETS	Necessary	40.00 F	*40.00 FL
25	1		*FRONT DOOR STICKER-LH	Necessary	60.00 F	*60.00 FL
26	1		*FRONT DOOR TRIM BOARD-LH	Serviceable	868.00 F	*- FL
27	1		*FRONT DOOR WEATHERSTRIP-LH	Serviceable	288.00 F	*- FL
28	1		*REAR DOOR-LH	Repair	1,880.50 F	*- FL
29	1		*ROCKER PANEL GARNISH-LH	Dented	568.50 F	*568.50 FL
30	1		*ROCKER PANEL GARNISH CLIP	Necessary	80.00 F	*80.00 FL
31	1		*FRONT BUMPER SIDE RETAINER-RH	Serviceable	162.40 F	*- FL
32	1		*FRONT SIDE MIRROR ASSY-LH	Serviceable	960.50 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	18,184.00	10,548.70
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	1,054.87
Total Parts (\$\$)	18,184.00	9,493.83

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE & REPLACE DAMAGED PARTS,PANEL BEAT WHERE NECESSARY	New	1,500.00	600.00
2	TO PUTTY,APPLY PRIMER & SPRAY-PAINT ON THE AFFECTED PORTION	New	1,400.00	880.00
3	TO APPLY RUST-PROOFING ON REPAIRED,REPLACED PANEL	New	150.00	60.00
4	TO CHECK WIRING FUNCTIONS	New	120.00	20.00
5	TO REMOVE/REPLACE UNDERCARRIAGE LABOUR	New	350.00	200.00
6	WHEEL ALIGNMENT	New	120.00	60.00
7	COMPUTER DIAGNOSTIC RESET	New	250.00	0.00
Gross Labour Cost (\$\$)			3,890.00	1,820.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >