



INSURED BY:

REF:

Admco

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

<input type="checkbox"/>	<input type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rport: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 14 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: YP2070D Yr Regt: 2016, April

Type: M.Car / M.Cycle / Bus / Van / (Lorry) Taxi / Prime Mover /

Truck / Trailer or

Make: Mit Fuso Canter c.c. 2998

Colour: Silver A/C: Insured / Std / NI / NA

Sp. Reading: 55232 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: FEB50542898

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: (Nil) / S/Rim / STD A/Rim or

Tyre Size: F: 205/75R16

R: 205/75R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO (YOKO) or

Front

Rear

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. \_\_\_\_\_ D.O.I. 25/07/19

Survey held at NHT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP China

\$19500 (Red \$32951.60 / 63%)

MV: 53k

PV: 12.61k

Nett: 40.4k

Date/Time, File Pass to?

Date/Time, File Return to?

Part Prices Check:

Survey Fee:

Date:

1)

2)

IN

OUT

Basic & Add.

3)

4)

S + RS, SI

5)

6)

Photos

Prel Report

Others

Final Report

TOTAL

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Business  
Owner ID: 021J

**Vehicle Details**

Vehicle No.: YP2070D  
Vehicle to be Exported: No  
Intended Deregistration Date: 25 Jul 2019  
Vehicle Make: MITSUBISHI  
Vehicle Model: CANTER 3.0 M  
Primary Colour: Silver  
Manufacturing Year: 2015  
Engine No.: 4P10B92409  
Chassis No.: FEB50542898  
Maximum Power Output: -  
Open Market Value: \$37,154.00  
Original Registration Date: 12 Apr 2016  
First Registration Date: 12 Apr 2016  
Transfer Count: 0  
Actual ARF Paid: \$1,858.00

**Intended PARF Rebate Details**

PARF Eligibility: No  
PARF Eligibility Expiry Date: -  
PARF Rebate Amount: \$0.00

**Intended COE Rebate Details**

COE Expiry Date: 11 Apr 2026  
COE Category: C - Goods Vehicle & Bus  
COE Period(Years): 10  
PQP Paid: \$18,769.00  
COE Rebate Amount: \$12,600.00  
**Total Rebate Amount: \$12,600.00**

The information contained herein is correct as at 25 Jul 2019

OK



# 新福德車廠私人有限公司

## NEW HOCK TECK MOTOR PTE. LTD.

1 Kaki Bukit Ave 6, Blk C #01-43 Autobay@Kaki Bukit, Singapore 417883

Email: admin@nhtmotor.com Website: www.nhtmotor.com

Tel: 6747 9241 Fax: 6741 7276

UEN: 201718370K

30/07/2019

YEO BROTHER PACKING ENTERPRISE

Blk 1 Kaki Bukit Ave 6

# 01-43

Singapore 417883

Tachin  
Jia le

Accident date: 24/07/2019

Estimated repair cost for vehicle no: YP2070D MITSUBISHI FUSO CANTER 3.0 M '16

CHASSIS: FEB50542898

S/n	Qty	Items	U/price	Amount
1	1	Front Bumper Bent.		\$1,218.30
2	2	Front Bumper Side Pad Deformed	\$457.60	\$915.20
3	2	Front Bumper Lamp New	\$289.40	\$578.80
4	2	Front Bumper Bracket Bent	\$143.00	\$286.00
5	1	Front Bumper Number Plate New		\$50.00
6	1	Front Grille cracked		\$698.50
7	8	Front Grille Clip New	\$6.50	\$52.00
8	1	Front Grille Emblem Logo New		\$85.00
9	2	Front Head Lamp cracked.	\$897.00	\$1,794.00
10	2	Front Signal Lamp cracked.	\$286.35	\$572.70
11	2	Front Side Reflector Not Nec	\$86.50	\$173.00
12	2	Front Corner Panel cracked.	\$498.50	\$997.00
13	1	Front Wiper Panel Garnish cracked		\$398.40
14	1	Front Wiper Panel Garnish Clip New	\$6.50	\$6.50
15	1	Front Panel Dented		\$1,223.00
16	1	Front Panel Fuso Logo New		\$180.20
17	1	Front Dashboard New		\$1,450.10
18	1	Front Dashboard Cover New		\$248.20
19	1	Front Air-Con Blower cracked.		\$1,358.80
20	1	Front Air Cleaner cracked.		\$249.80
21	1	Front Air Duct cracked.		\$384.90
22	1	Front Windscreen Seal 3 New		\$85.00
23	1	Front Windscreen Moulding		\$493.50
24	1	Front Cabin Rear Panel Rivet		\$1,655.00
25	1	Front Cabin Rear Windscreen Moulding New		\$289.90
26	1	Front Cabin Lock Lever Dented.		\$288.40
27	1	Front Intake Manifold Pipe Dented.		\$1,427.60

28	1	Front Egr Pipe Cover <i>crushed</i>		\$315.60
29	1	Front Turbo Valve Wire Cover <i>crushed</i>		\$3,220.40
30	2	Rear Taillamp <i>HEM</i>	\$295.40	\$590.80
31	10	U Bolt <i>Bent</i>	\$100.00	\$1,000.00

16908.70  
12681.52

Subtotal :- \$22,286.60

S/n	Qty	Items / Special Nett	U/price	Amount
32	1	Rear Tailgate <i>crushed</i>		\$1,800.00
33	2	Rear Tailgate Center Bracket <i>Bent</i>	\$250.00	\$500.00
34	2	Rear Tailgate Side Bracket <i>Bent</i>	\$280.00	\$560.00
35	1	Rear Tailgate Lower Panel <i>Rypr</i>		\$850.00
36	4	Rear Tailgate Hinge <i>HEM</i>	\$150.00	\$600.00
37	2	Rear Tailgate Side Lock Pin <i>HEM</i>	\$100.00	\$200.00
38	1	Rear Tailgate Advertisement <i>HEM</i>		\$380.00
39	1	Rear Tailgate 60km/H Sticker <i>HEM</i>		\$25.00
40	1	Rear Tailgate Lower Horizontal Wooden Plank <i>HEM</i>		\$850.00
41	1	Rear Tailgate Lower Step Wooden Panel <i>crushed</i>		\$350.00
42	2	Rear Vertical Wooden Chassis Member <i>crushed</i>	\$1,350.00	\$2,700.00
43	5	Rear Deck Horizontal Wooden Member <i>4 pieces bent</i>	\$550.00	\$2,750.00
44	1	Rear Number Plate <i>3mm</i>		\$50.00
45	1	Rear Number Plate Bracket		\$100.00
46	2	Rear Side Gate <i>3mm</i>	\$2,500.00	\$5,000.00
47	1	Rear Side Gate Advertisement	\$350.00	\$350.00

6400

Subtotal :- \$17,065.00

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature: \_\_\_\_\_  
Date: \_\_\_\_\_

its hence notify the following:  
before/after spray painting  
damaged part(s) during resurvey  
subject to confirmation  
is on a "Without Prejudice" basis  
modification(s) is allowed  
item(s) must be resurveyed and is subject to final approval from Insurance Company  
by Repairer

**Labour charges**

To remove & refit front windscreen	<del>\$250.00</del> 120
Gum	\$60.00 ✓
To remove & refit rear windscreen	<del>\$150.00</del> 100
Gum	\$60.00 ✓
To remove & refit dashboard	<del>\$450.00</del> 220
To remove & refit air-con blower	<del>\$380.00</del> 250
To remove rear wooden deck	<del>\$1,600.00</del> 800
To repair & straighten rear chassis frame	<del>\$2,500.00</del> 1000
To varnish rear wooden deck	<del>\$800.00</del> 400
To check wiring	<del>\$150.00</del> 60
Tuff kote	5370 <del>\$200.00</del> 100
Panel beating	<del>\$4,500.00</del> 1000
Spray painting	<del>\$2,000.00</del> 1200

Subtotal :- \$13,100.00

Total:- \$52,451.60

total 24451.52

l/s: 19.5K

14 Days

19.5K

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Assignment

To: New Hock Teck Motor Pte Ltd (Workshop)

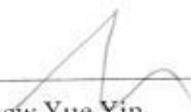
In consideration for your agreement to repair my motor vehicle registration no. YP2070D and to defer demanding for payment of the cost of repair, I/we the undersigned do hereby irrevocably assign absolutely to you all the proceeds of my/our claim(s) including damages, interest, costs and expenses (including legal costs / disbursements payable on a party and party basis which are to be paid to the parties so entitled including solicitors, vehicle appraisers and other experts / consultants).

I/We further confirm that payment to you only or to any person authorised by you to receive payment shall constitute a good and effectual discharge of the obligations by any party of the aforesaid proceeds of my/our claim(s).

I/We authorise you expressly to give notice of this assignment to the party concerned.

I/We confirm that by this assignment, I/we shall not be entitled in law to receive any payment. If a cheque is sent to me/us, I/we shall return same to the sender as I/we am/are precluded from accepting any payment.

Dated this 25 day of 07 2019.

Signature	:	
Name	:	<u>YE OBROTHER PA</u>
ID No.	:	<u>Enterprise</u>
Address	:	<u>52864021J</u>
	:	
Witness Signature	:	
Witness Name	:	<u>Chew Yue Yin</u>
Witness ID	:	<u>S8826618H</u>
Witness Address	:	<u>1 Kaki Bukit Avenue 6 #01-43</u> <u>Singapore 417883</u>





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD		Ref : CC6/CTI19013205/Ada3n2	
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date : 14-11-2019	
		Code : CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
<b>Insured Veh.</b>	PC 4171H	<b>Veh. Inspected</b>	YP 2070D
<b>Policy No.</b>	DMB1SN1745431802	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM19D203492C02	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	25/07/2019
2. Vehicle Particulars & Condition			
<b>Make &amp; Model</b>	mitsubishi canter	<b>c.c</b>	2998
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2016
<b>Chassis No.</b>	FEB50542898	<b>Colour</b>	SILVER
<b>Odometer</b>	55232	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	NIL
<b>General</b>	GOOD		
3. Conditions of Tyres			
	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	205/75 R16	YOKOHAMA	6 mm
<b>L/H Front Tyre</b>	205/75 R16	YOKOHAMA	6 mm
<b>R/H Rear Tyre</b>	205/75 R16	YOKOHAMA	6 mm
<b>L/H Rear Tyre</b>	205/75 R16	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
<b>Accident Date</b>	24/07/2019	<b>Inspection Date</b>	25/07/2019
<b>Survey held at</b>	NEW HOCK TECK MOTOR PTE LTD 1 KAKI BUKIT AVENUE 6 #01-43 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
<b>ESTIMATED NORMAL PERIOD FOR REPAIR:</b>		<b>14 Working Days</b>	



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YP 2070D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	FRONT BUMPER	BENT	1,218.30	1,218.30
2	FRONT BUMPER SIDE PAD @\$457.60	DEFORMED	915.20	915.20
2	FRONT BUMPER LAMP @\$289.40	NOT NECESSARY	578.80	-
2	FRONT BUMPER BRACKET @\$143.00	BENT	286.00	286.00
1	FRONT BUMPER NUMBER PLATE	NOT NECESSARY	50.00	-
1	FRONT GRILLE	CRACKED	698.50	698.50
8	FRONT GRILLE CLIP @\$6.50	NECESSARY	52.00	20.00
1	FRONT GRILLE EMBLEM LOGO	NECESSARY	85.00	85.00
2	FRONT HEAD LAMP @\$897.00	CRACKED	1,794.00	1,794.00
2	FRONT SIGNAL LAMP @\$286.35	CRACKED	572.70	572.70
2	FRONT SIDE REFLECTOR @\$86.50	NOT NECESSARY	173.00	-
2	FRONT CORNER PANEL @\$498.50	CRACKED	997.00	997.00
1	FRONT WIPER PANEL GARNISH	CRACKED	398.40	398.40
1	FRONT WIPER PANEL GARNISH CLIP	NECESSARY	6.50	6.50
1	FRONT PANEL	DENTED	1,223.00	1,223.00
1	FRONT PANEL FUSO LOGO	NECESSARY	180.20	180.20
1	FRONT DASHBOARD	NOT NECESSARY	1,450.10	-
1	FRONT DASHBOARD COVER	NOT NECESSARY	248.20	-
1	FRONT AIR-CON BLOWER	CRACKED	1,358.80	1,358.80
1	FRONT AIR CLEANER	CRACKED	249.80	249.80
1	FRONT AIR DUCT	CRACKED	384.90	384.90
1	FRONT WINDSCREEN SEAL	NECESSARY	85.00	85.00
1	FRONT WINDSCREEN MOULDING	NECESSARY	493.50	493.50
1	FRONT CABIN REAR PANEL	TO REPAIR SEE LABOUR	1,655.00	-
1	FRONT CABIN REAR WINDSCREEN MOULDING	NECESSARY	289.90	289.90
1	FRONT CABIN LOCK LEVER	DAMAGED	288.40	288.40
1	FRONT INTAKE MANIFOLD PIPE	DENTED	1,427.60	1,427.60
1	FRONT EGR PIPE COVER	CRACKED	315.60	315.60
1	FRONT TURBO VALVE WIRE COVER	CRACKED	3,220.40	3,220.40
2	REAR TAILLAMP @\$295.40	NOT NECESSARY	590.80	-

Report Ref No. CC6/CTI19013205/Ada3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	U BOLT @\$100.00	BENT	1,000.00	400.00
	LESS 25% DISCOUNT		-	-4,227.18
			22,286.60	12,681.52
	<b>SPECIAL NETT ITEMS</b>			
1	REAR TAILGATE (SN)	CRACKED	1,800.00	1,300.00
2	REAR TAILGATE CENTER BRACKET @\$250.00 (SN)	BENT	500.00	360.00
2	REAR TAILGATE SIDE BRACKET @\$280.00 (SN)	BENT	560.00	380.00
1	REAR TAILGATE LOWER PANEL (SN)	TO REPAIR SEE LABOUR	850.00	-
4	REAR TAILGATE HINGE @\$150.00 (SN)	NOT NECESSARY	600.00	-
2	REAR TAILGATE SIDE LOCK PIN @\$100.00 (SN)	NOT NECESSARY	200.00	-
1	REAR TAILGATE ADVERTISEMENT (SN)	NECESSARY	380.00	250.00
1	REAR TAILGATE 60KM/H STICKER (SN)	NECESSARY	25.00	10.00
1	REAR TAILGATE LOWER HORIZONTAL WOODEN PLANK (SN)	NOT NECESSARY	850.00	-
1	REAR TAILGATE LOWER STEP WOODEN PANEL (SN)	CRACKED	350.00	300.00
2	REAR VERTICAL WOODEN CHASSIS MEMBER @\$1350.00 (SN)	CRACKED	2,700.00	2,000.00
5	REAR DECK HORIZONTAL WOODEN MEMBER @\$550.00 (SN)	CRACKED (4 PCS ONLY)	2,750.00	1,800.00
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	REAR NUMBER PLATE BRACKET (SN)	NOT NECESSARY	100.00	-
2	REAR SIDE GATE @\$2500.00 (SN)	NOT NECESSARY	5,000.00	-
1	REAR SIDE GATE ADVERTISEMENT (SN)	NOT NECESSARY	350.00	-
			17,065.00	6,400.00
	<b>LABOUR</b>			
	TO REMOVE & REFIT FRONT WINDSCREEN.		250.00	120.00
	TO REMOVE & REFIT REAR WINDSCREEN.		150.00	100.00
	GUM.		120.00	120.00
	TO REMOVE & REFIT DASHBOARD.		450.00	220.00
	TO REMOVE & REFIT AIR-CON BLOWER.		380.00	250.00
	TO REMOVE REAR WOODEN DECK.		1,600.00	800.00
	TO REPAIR & STRAIGHTEN REAR CHASSIS FRAME.		2,500.00	1,000.00
	TO VARNISH REAR WOODEN DECK.		800.00	400.00

Report Ref No. CC6/CTI19013205/Ada3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK WIRING.		150.00	60.00
	TUFF KOTE.		200.00	100.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT CABIN REAR PANEL AND REAR TAILGATE LOWER PANEL.		4,500.00	1,000.00
	SPRAY PAINTING.		2,000.00	1,200.00
			13,100.00	5,370.00
	<b>GRAND TOTAL</b>		<b>52,451.60</b>	<b>24,451.52</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>19,500.00</b>

Report Ref No. CC6/CTI19013205/Ada3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.  
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.