

ASS. REC. BY:

REF:

CS/SPF19014863/Gsd307

Special Instruction:

Surveyor: Anson

ASSIGNMENT (Office)

From (Person): Perry HE

of

SPF

Date/Time:

22/8/2019 @ 2.42pm

Estimated Cost:

Bill to:

① OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

QX759

Insured:

at Workshop m/s

Indeco

Tel:

9787 7084

of

34 Defu June 12

Policy No:

Claim No:

MHA SPF 0300000113

Sum Insured:

Excess:

Make of Veh:

D.O.A.

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

9.45am @ 23/8/19

Person Contacted:

Mike

Vehicle:

IN/OUT

Date/Time

Action/Instruction

Estimate (✓)

QX759-X

27/08/19

@ 09:58 am revert perry via email.

8/11 4276
Anson

ASS. REC. BY:

GR

REF:

SPF

ASSIGNMENT

26/10/2018

From:

Date:

23/8/19

Veh No:

QX75G

Yr Regn:

Estimated Cost:

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV

To Inspect Vehicle No:

QX75G

at Workshop m/s

Indeco

of

39 Defu Lane 12

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:


TBA

(Client's Record)

Make of Veh:

Mike @ 9787 7084

(Policy Condition)

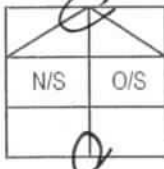 Remark: The veh had commenced its
repair at the time of inspection.


Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Type:

M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Police car

Make:

BMW 325D

c.c.

- 1995

Colour:

white

A/C:

Insured / Std / NI / NA

Sp. Reading

14695

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WBA 8D32060K544901

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

255/40 R18

R:

1/

☒ BS / ☐ DUN / ☐ EXNOVA / ☐ GY / ☐ FS / ☐ LIZA / ☐ MIC / ☐ OHTSU / ☐ PIR / ☐ SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

D.O.I.

23-08-19

Survey held at

w/s

12pm

Des. of Damages: ☒ Frt / ☒ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

23/8

Finalised 65 Hrs. with Anson.

RECEIVED 25 NOV 2019

Send soft Copy to SPF

Date/Time, File Pass to?

25/11/19

1)

Typst

Date/Time, File Return to?

2)



Preli. Report



Final Report

Days Of Repair:

Resurvey No. of Trip:

2

Survey Fee:

180

Transportation:

S + RS. St

Photos

Others

TOTAL

180

Add Fee:



Site Insp (\$)



Interview (\$)



Tech. Invs (\$)



Weekend (\$)

Report Format:

Lump Sum / L&L: (\$)

Re: Appraisal Services for SPF vehicle at INDECO - QX75G**Shirley Hiew (LKK Auto)**

Wed 28/8/2019 11:23 AM

To: Perry HE (SPF) <Perry_HE@spf.gov.sg>**Cc:** Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>

2 attachments (1 MB)

QX 75G.xls; LKK SURVEYOR PHOTO 2.pdf;

Hi Perry,

Unconfirm items updated.

Please refer to the attached.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte LtdPhone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Perry HE (SPF) <Perry_HE@spf.gov.sg>**Sent:** Tuesday, 27 August 2019 10:49 AM**To:** Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>**Cc:** Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>**Subject:** RE: Appraisal Services for SPF vehicle at INDECO - QX75G

Hi Shirley,

Noted, pls update us.

Thanks.

Perry He Junyun

Contract Management Engineer

Capability Sustainment, MHA STG (Forward Deployment to SPF)

DID: (65) 6478 4869 | HP: (65) 9191 5725



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Sent: Tuesday, 27 August 2019 10:48 AM

To: Perry HE (SPF) <Perry_HE@spf.gov.sg>

Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>

Subject: Re: Appraisal Services for SPF vehicle at INDECO - QX75G

Hi Perry,

Attached is the excel file.

According to our surveyor, the unconfirm items we will update you after the resurvey conduct.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Perry HE (SPF) <Perry_HE@spf.gov.sg>

Sent: Tuesday, 27 August 2019 10:36 AM

To: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>

Subject: RE: Appraisal Services for SPF vehicle at INDECO - QX75G

Hi Shirley,

Thanks, able to send the assessment as attached in excel file instead?
Also, noticed many unconfirmed items. Able to confirm it instead?

Perry He Junyun

Contract Management Engineer

Capability Sustainment, MHA STG (Forward Deployment to SPF)

DID: (65) 6478 4869 | HP: (65) 9191 5725



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Sent: Tuesday, 27 August 2019 9:58 AM

To: Perry HE (SPF) <Perry_HE@spf.gov.sg>; Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>

Subject: Re: Appraisal Services for SPF vehicle at INDECO - QX75G

Dear Perry,

⏮ Reply all ⏹ Delete ⏭ Junk Block ...

Re: Appraisal Services for SPF vehicle at INDECO - QX75G

SH

Shirley Hiew (LKK Auto)

Tue 27/8/2019 9:58 AM

Perry HE (SPF) <Perry_HE@spf.gov.sg>; Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg> +3



QX 75G.pdf

39 KB

LKK SURVEYOR PHOTO.pdf

3 MB

2 attachments (3 MB) Download all

Dear Perry,

Please refer attached.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte LtdPhone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto) <admin-d@lkkauto.com>**Sent:** Tuesday, 27 August 2019 9:47 AM**To:** Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>**Subject:** FW: Appraisal Services for SPF vehicle at INDECO - QX75G

Best Regards

G.NIVITHA**LKK Auto Consultants Pte Ltd**Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Perry HE (SPF) [mailto:Perry_HE@spf.gov.sg]**Sent:** Thursday, 22 August 2019 2:42 PM**To:** 'assignments' <assignments@lkkauto.com>**Cc:** Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF)

Nivitha (LKK Auto)

From: Perry HE (SPF) <Perry_HE@spf.gov.sg>
Sent: Thursday, 22 August 2019 2:42 PM
To: 'assignments'
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); 'Denise Tay (LKKAuto)'
Subject: Appraisal Services for SPF vehicle at INDECO - QX75G

Hi Catherine and Ashley,

Please provide Appraisal Service (Parts and Labour-man hours) for the following SPF vehicle at INDECO, with new contractual rate.
Ref: MHASPF0300000113

QX75G

Parts:

REAR BUMPER
REAR BUMPER TRIM 51127384571
REAR BUMPER REINFORCEMENT
REAR BUMPER REINFORCEMENT COVER 51127256921
REAR BUMPER CENTER GUIDE 51127256922
LH PROTECTION 51127400293
RH PROTECTION 51127400294
REAR BUMPER GUIDE LH 51127384465
REAR BUMPER GUIDE RH 51127384466
REAR BUMPER REFLECTOR LH
REAR BUMPER REFLECTOR RH
REAR PARKING SENSOR
REAR PARKING SENSOR RING 66206923000
REAR PARKING SENSOR BRACKET
TOW COVER 51127384417
REAR END PANEL COMPLETE SET
REAR END PANEL GARNISH ASSY
REAR PARKING SENSOR WIRE HARDNESS
TAILLAMP RH
TAILLAMP LH
TAILLAMP LOWER BRACKET ASSY RH
TAILLAMP LOWER BRACKET ASSY LH
EXHAUST MUFFLER
EXHAUST MUFFLER TAIL PIPE CHROME
EXHAUST MUFFLER MOUNTING
BOOT LOCK
BOOT LOCK CATCH
BOOT HINGE RH
BOOT HINGE LH
BOOT LOCK COVER 51247224692
BOOT LID
BOOT LAMP RH
BOOT LAMP LH
REAR NUMBER PLATE HOLDER
BOOT EMBLEM ASSY
LOGO ASSY
BONNET

BONNET HINGE RH
 BONNET HINGE LH
 BONNET LOCK ASSY RH
 BONNET LOCK ASSY LH
 BONNET LOCK CATCH ASSY RH
 BONNET LOCK CATCH ASSY LH
 BONNET LOGO
 HEADLAMP COMPLETE RH
 HEADLAMP COMPLETE LH
 BONNET DAMPER RH
 BONNET DAMPER LH
 BONNET WEATHER STRIP
 BONNET STOPPER
 FRT BUMPER
 FRT BUMPER RETAINER RH 51118062634
 FRT BUMPER RETAINER LH 51118062633
 FRT BUMPER BRACKET RH 51117279712
 FRT BUMPER BRACKET LH 51117279711
 FRT BUMPER LOWER GRILLE ASSY
 FRT NUMBER PLATE HOLDER
 FRT BUMPER SUPPORT 51117296308
 FRT BUMPER SUPPORT 51117296331
 FRT BUMPER LOWER TRIM 51118068130
 FRT BUMPER REVIT ASSY
 FRT BUMPER REINFORCEMENT COMPLETE ASSY
 FRT BUMPER SPONGE COMPLETE
 FRT SUPPORT PANEL COMPLETE ASSY
 BRACE PANEL COMPLETE ASSY
 CONDENSOR
 RADIATOR
 HEADLAMP LOWER BEAM ASSY RH
 HEADLAMP LOWER BEAM ASSY LH
 HEADLAMP ECU COMPLETE SET RH
 HEADLAMP ECU COMPLETE SET LH
 OIL COOLER COMPLETE SET
 AIR CLEANER COMPLETE SET
 FAN MOTOR COMPLETE SET
 FRT BUMPER TOW COVER
 FRT GRILLE ASSY RH
 FRT GRILLE ASSY LH
 TOOLS COMPARTMENT SPONGE COMPLETE SET
 AIR DUCT COMPLETE SET
 FRT NUMBER PLATE
 REAR NUMBER PLATE
 HEADLAMP LED ECU RH
 HEADLAMP LED ECU LH
 HEADLAMP SIGNAL LED ECU RH
 HEADLAMP SIGNAL LED ECU

LABOUR:

Description	Hrs
TO REPLACE AND RESPRAY BOOT LID INCLUDING REFLECTIVE STICKER	8
TO REPLACE AND RESPRAY REAR BUMPER INCLUDING REFLECTIVE STICKER	8
TO REPAIR AND RESPRAY RHR FENDER INCLUDING REFLECTIVE STICKER	8
TO REPLACE AND RESPRAY REAR END PANEL	6

TO REPAIR AND RESPRAY SPARE TYRE WELL	4
TO REPLACE EXHAUST MUFFLER	2
TO REPLACE AND RESPRAY BONNET INCLUDING REFLECTIVE STICKER	8
TO REPLACE AND RESPRAY FRT BUMPER INCLUDING REFLECTIVE STICKER	8
TO REPLACE WIRE HARDNESS, RESET FAULT CODE, CHECK WIRING SYSTEM	2
TO REMOVE AND REFIX UPHOISTERY AND REAR SEAT TO ASSIST WORK	3
TO REPLACE AND RESPRAY SUPPORT PANEL	4
TO REPLACE AND RESPRAY REAR REINFORCEMENT	1
TO REPLACE AND RESPRAY FRT REINFORCEMENT	1
TO REMOVE AND REFIX CONDENSER, RADIATOR AND TOP UP AC GAS	2

Thanks.

Perry He Junyun
Contract Management Engineer
Capability Sustainment, MHA STG (Forward Deployment to SPF)
DID: (65) 6478 4869 | HP: (65) 9191 5725



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereof. Dissemination of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you have received this in error."

Verification of Scope of Work					
Contractor QC		Vetted By:		Approved By:	
Name:	RAZALI B. NAWI	Name:		Name:	
Date:	22/8/19	Date:		Date:	
Sign:		Sign:		Sign:	
Verification of Completed Repairs					
Contractor QC		Home Team QC / Fleet Manager /		Home Team Contract / Fleet Manager	
Name:		Name:		Name:	
Date:		Date:		Date:	
Sign:		Sign:		Sign:	
All completed repairs must be verified by Home Team Contract Manager / Fleet Manager before payment can be made					

Not Authorised.

Excess : TBA

Quo Quam - 82880282

23/8/19.

~~before~~ After repair photos.
before paint photos.


28/8/2019

LINK Asia Consultants hereby notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____



ACCIDENT/DAMAGE REPAIR AND AD HOC WORKS REQUEST FORM

iLMS Notification No	1100030208		
Vehicle No	QX 75G	Division/Unit	TP
Vehicle Type (e.g. FRC, minibus)	EPU	Date	18 Aug 2019
Vehicle Make & Model	BMW	Mileage (km)	14695 km

Description		Pls tick accordingly	State Police Report No & Date of Accident/Incident
NP168	Traffic Accident Report	√	NP 168 T/20190818/2101 On 18 Aug 19
NP299	Damages involve 3 rd Party or Property Damage		
NP299	Discovered Damage		
NP299	Vandalism		
For Ad hoc repair or services, pls specify below			

Description of affected area/required works (e.g. dented, cracked, grazed etc)

PIC 1- QX 75G front portion dented


PIC 2 – QX 75G rear portion dented

Pls mark affected area with **X**

Pic 1



Pic 2

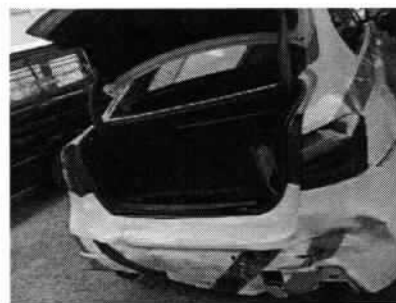

Rank/Name
MX Chew Lye Soon

Signature

[Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle**

Owner ID Type:	Singapore NRIC
Owner ID:	631Z
Vehicle No.:	SMA8993Y
Vehicle to be Exported:	No
Intended Deregistration Date:	25 Aug 2019
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	GLA180 AUTO
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	27091031403874
Chassis No.:	WDC1569422J418415
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$28,534.00
Original Registration Date:	26 Jun 2018
First Registration Date:	26 Jun 2018
Transfer Count:	0
Actual ARF Paid:	\$31,948.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Jun 2028
PARF Rebate Amount:	\$23,961.00
COE Expiry Date:	25 Jun 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$34,110.00
COE Rebate Amount:	\$30,130.00
Total Rebate Amount:	\$54,091.00

The information contained herein is correct as at 25 Aug 2019

OK



Scope Of Work
Home Team Agency

SCOPE OF WORK

I o provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:

CONTRACTOR :	Indeco Engineers Pte Ltd	VEH TYPE :	UNIT :	TP
VEH NO :	QX75G	EPU	REPAIR TYPE:	ACCIDENT
VEH MAKE/MODEL	BMW 325		Mileage:	14695

Reference No.
MHA/SPF/2019/08-0031 1100030208

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
1	Scope Of Repairs					
1.1	REAR BUMPER / <i>Back TV</i>	850.00	1	20%	1020.00	1020.00
1.2	REAR BUMPER TRIM 51127384571 <i>X</i> <i>mis</i>	100.00	1	20%	120.00	120.00
1.3	REAR BUMPER REINFORCEMENT <i>BT</i>	450.00	1	20%	540.00	540.00
1.4	REAR BUMPER REINFORCEMENT COVER 51127256921 <i>MCRA</i>	85.00	1	20%	102.00	102.00
1.5	REAR BUMPER CENTER GUIDE 51127256922 <i>ee</i>	55.00	1	20%	66.00	66.00
1.6	LH PROTECTION 51127400293 <i>SCA</i>	15.00	1	20%	18.00	18.00
1.7	RH PROTECTION 51127400294 <i>SCA</i>	15.00	1	20%	18.00	18.00
1.8	REAR BUMPER GUIDE LH 51127384465	55.00	1	20%	66.00	66.00
1.9	REAR BUMPER GUIDE RH 51127384466 <i>lee</i>	55.00	1	20%	66.00	66.00
1.10	REAR BUMPER REFLECTOR LH <i>SCA</i>	40.00	1	20%	48.00	48.00
1.11	REAR BUMPER REFLECTOR RH <i>SCA</i>	26.00	1	20%	31.20	31.20
1.12	REAR PARKING SENSOR <i>OM</i>	150.00	4	20%	180.00	720.00
1.13	REAR PARKING SENSOR RING 66206923000 <i>LMC</i>	4.00	4	20%	4.80	19.20
1.14	REAR PARKING SENSOR BRACKET	65.00	4	20%	78.00	312.00
1.15	TOW COVER 51127384417 <i>SCA</i>	30.00	1	20%	36.00	36.00
1.16	REAR END PANEL COMPLETE SET <i>pac</i>	550.00	1	20%	660.00	660.00
1.17	REAR END PANEL GARNISH ASSY <i>ee</i>	85.00	1	20%	102.00	102.00
1.18	REAR PARKING SENSOR WIRE HARDNESS <i>Cut</i>	280.00	1	20%	336.00	336.00
1.19	TAILLAMP RH <i>lee</i>	500.00	1	20%	600.00	600.00
1.20	TAILLAMP LH <i>lee</i>	500.00	1	20%	600.00	600.00
1.21	TAILLAMP LOWER BRACKET ASSY RH <i>X</i> <i>NN</i>	30.00	1	20%	36.00	36.00
1.22	TAILLAMP LOWER BRACKET ASSY LH <i>X</i> <i>NN</i>	30.00	1	20%	36.00	36.00
1.23	EXHAUST MUFFLER <i>X</i> <i>DD</i>	1000.00	1	20%	1200.00	1200.00
1.24	EXHAUST MUFFLER TAIL PIPE CHROME <i>X</i> <i>MC</i>	120.00	2	20%	144.00	288.00
1.25	EXHAUST MUFFLER MOUNTING <i>X</i> <i>MC</i>	45.00	2	20%	54.00	108.00
1.26	BOOT LOCK <i>BT</i>	200.00	1	20%	240.00	240.00
1.27	BOOT LOCK CATCH <i>X</i>	40.00	1	20%	48.00	48.00
1.28	BOOT HINGE RH <i>X</i> <i>NN</i>	55.00	1	20%	66.00	66.00
1.29	BOOT HINGE LH <i>X</i>	55.00	1	20%	66.00	66.00
1.30	BOOT LOCK COVER 51247224692 <i>lee</i>	8.00	1	20%	9.60	9.60
1.31	BOOT LID <i>Buc</i>	1150.00	1	20%	1380.00	1380.00
1.32	BOOT LAMP RH <i>SCA</i>	200.00	1	20%	240.00	240.00
1.33	BOOT LAMP LH <i>X</i> <i>NN</i>	240.00	1	20%	288.00	288.00
1.34	REAR NUMBER PLATE HOLDER <i>ee</i>	40.00	1	20%	48.00	48.00
1.35	BOOT EMBLEM ASSY <i>MC</i>	70.00	1	20%	84.00	84.00
1.36	LOGO ASSY <i>X</i> <i>NN</i>	0.00	1	20%	0.00	0.00
1.37	BONNET <i>Buc</i>	1200.00	1	20%	1440.00	1440.00
1.38	BONNET HINGE RH <i>X</i> <i>NN</i>	75.00	1	20%	90.00	90.00
1.39	BONNET HINGE LH <i>X</i> <i>NN</i>	55.00	1	20%	66.00	66.00
1.40	BONNET LOCK ASSY RH <i>X</i>	70.00	1	20%	84.00	84.00
1.41	BONNET LOCK ASSY LH <i>X</i> <i>NN</i>	70.00	1	20%	84.00	84.00
1.42	BONNET LOCK CATCH ASSY RH <i>X</i> <i>NN</i>	20.00	1	20%	24.00	24.00
1.43	BONNET LOCK CATCH ASSY LH <i>X</i>	20.00	1	20%	24.00	24.00
1.44	BONNET LOGO <i>MC</i>	65.00	1	20%	78.00	78.00
1.45	HEADLAMP COMPLETE RH <i>lee</i>	3000.00	1	20%	3600.00	3600.00
1.46	HEADLAMP COMPLETE LH <i>lee</i>	3000.00	1	20%	3600.00	3600.00
1.47	BONNET DAMPER RH <i>X</i>	110.00	1	20%	132.00	132.00
1.48	BONNET DAMPER LH <i>X</i> <i>NN</i>	110.00	1	20%	132.00	132.00
1.49	BONNET WEATHER STRIP <i>X</i> <i>NN</i>	40.00	1	20%	48.00	48.00
1.50	BONNET STOPPER <i>X</i>	12.00	2	20%	14.40	28.80
1.51	FRT BUMPER <i>SCA</i>	1150.00	1	20%	1380.00	1380.00
1.52	FRT BUMPER RETAINER RH 51118062634 <i>lee</i>	45.00	1	20%	54.00	54.00
1.53	FRT BUMPER RETAINER LH 51118062633 <i>NN</i>	45.00	1	20%	54.00	54.00
1.54	FRT BUMPER BRACKET RH 51117279712 <i>lee</i>	18.00	1	20%	21.60	21.60
1.55	FRT BUMPER BRACKET LH 51117279711 <i>lee</i>	18.00	1	20%	21.60	21.60

1.56	FRT BUMPER LOWER GRILLE ASSY	80.00	1	20%	96.00	96.00
1.57	FRT NUMBER PLATE HOLDER	55.00	1	20%	66.00	66.00
1.58	FRT BUMPER SUPPORT 51117296308	10.00	1	20%	12.00	12.00
1.59	FRT BUMPER SUPPORT 51117296331	6.00	1	20%	7.20	7.20
1.60	FRT BUMPER LOWER TRIM 51118068130	40.00	1	20%	48.00	48.00
1.61	FRT BUMPER REVIT ASSY	1.50	20	20%	1.80	36.00
1.62	FRT BUMPER REINFORCEMENT COMPLETE ASSY	300.00	1	20%	360.00	360.00
1.63	FRT BUMPER SPONGE COMPLETE	40.00	1	20%	48.00	48.00
1.64	FRT SUPPORT PANEL COMPLETE ASSY	160.00	1	20%	192.00	192.00
1.65	BRACE PANEL COMPLETE ASSY	110.00	1	20%	132.00	132.00
1.66	CONDENSOR	1000.00	1	20%	1200.00	1200.00
1.67	RADIATOR	400.00	1	20%	480.00	480.00
1.68	HEADLAMP LOWER BEAM ASSY RH	130.00	1	20%	156.00	156.00
1.69	HEADLAMP LOWER BEAM ASSY LH	130.00	1	20%	156.00	156.00
1.70	HEADLAMP ECU COMPLETE SET RH	850.00	1	20%	1020.00	1020.00
1.71	HEADLAMP ECU COMPLETE SET LH	850.00	1	20%	1020.00	1020.00
1.72	OIL COOLER COMPLETE SET	730.00	1	20%	876.00	876.00
1.73	AIR CLEANER COMPLETE SET	360.00	1	20%	432.00	432.00
1.74	FAN MOTOR COMPLETE SET	700.00	1	20%	840.00	840.00
1.75	FRT BUMPER TOW COVER	50.00	1	20%	60.00	60.00
1.76	FRT GRILLE ASSY RH	80.00	1	20%	96.00	96.00
1.77	FRT GRILLE ASSY LH	80.00	1	20%	96.00	96.00
1.78	TOOLS COMPARTMENT SPONGE COMPLETE SET	120.00	1	20%	144.00	144.00
1.79	AIR DUCT COMPLETE SET	80.00	1	20%	96.00	96.00
1.80	FRT NUMBER PLATE	20.00	1	20%	24.00	24.00
1.81	REAR NUMBER PLATE	20.00	1	20%	24.00	24.00
1.82	HEADLAMP LED ECU RH	130.00	1	20%	156.00	156.00
1.83	HEADLAMP LED ECU LH	130.00	1	20%	156.00	156.00
1.84	HEADLAMP SIGNAL LED ECU RH	550.00	1	20%	660.00	660.00
1.85	HEADLAMP SIGNAL LED ECU	550.00	1	20%	660.00	660.00
2	Additional Services					
Remarks:		SUBJECT TO PARTS AVAILABILTY * BY AIR 2 TO 3 WEEK			Parts Total:	\$ 29,929.20

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour	Total Man-Hour Cost
1				
Scope Of Repairs				
1.1	TO REPLACE AND RESPRAY BOOT LID INCLUDING REFLECTIVE STICKER	61.80	8	494.40
1.2	TO REPLACE AND RESPRAY REAR BUMPER INCLUDING REFLECTIVE STICKER	61.80	8	494.40
1.3	TO REPAIR AND RESPRAY RHR FENDER INCLUDING REFLECTIVE STICKER	61.80	8	494.40
1.4	TO REPLACE AND RESPRAY REAR END PANEL	61.80	6	370.80
1.5	TO REPAIR AND RESPRAY SPARE TYRE WELL	61.80	4	247.20
1.6	TO REPLACE EXHAUST MUFFLER	61.80	2	123.60
1.7	TO REPLACE AND RESPRAY BONNET INCLUDING REFLECTIVE STICKER	61.80	8	494.40
1.8	TO REPLACE AND RESPRAY FRT BUMPER INCLUDING REFLECTIVE STICKER	61.80	8	494.40
1.9	TO REPLACE WIRE HARDNESS, RESET FAULT CODE, CHECK WIRING SYSTEM	61.80	2	123.60
1.10	TO REMOVE AND REFIX UPHOISTERY AND REAR SEAT TO ASSIST WORK	61.80	3	185.40
1.11	TO REPLACE AND RESPRAY SUPPORT PANEL	61.80	4	247.20
1.12	TO REPLACE AND RESPRAY REAR REINFORCEMENT	61.80	1	61.80
1.13	TO REPLACE AND RESPRAY FRT REINFORCEMENT	61.80	1	61.80
1.14	TO REMOVE AND REFIX CONDENSER, RADIATOR AND TOP UP AC GAS	61.80	2	123.60
2				
Additional Services				
2.1	AFTER REPAIR, VEHICLE WILL NEED TO SEND IN TO AGENT FOR PROGRAMMING, WILL SUBMIT ADDITIONAL SOW FOR THIS	61.80	0	0.00
Labour Total:				\$ 4,017.00
GRAND TOTAL :				\$ 33,946.20
Contractor shall complete the entire repair within <u>40</u> working days upon quotation approved date.				

Registration No. QX 75G

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	REAR BUMPER	1	TORN	\$ 1,020.00	\$ 1,020.00	
1.2	REAR BUMPER TRIM 51127384571	1	MISSING	\$ 120.00	\$ 120.00	
1.3	REAR BUMPER REINFORCEMENT	1	BENT	\$ 540.00	\$ 540.00	
1.4	REAR BUMPER REINFORCEMENT COVER 51127256921	1	CRACKED	\$ 102.00	\$ 102.00	
1.5	REAR BUMPER CENTER GUIDE 51127256922	1	DEFORMED	\$ 66.00	\$ 66.00	
1.6	LH PROTECTION 51127400293	1	CUT	\$ 18.00	\$ 18.00	
1.7	RH PROTECTION 51127400294	1	CUT	\$ 18.00	\$ 18.00	
1.8	REAR BUMPER GUIDE LH 51127384465	1	DEFORMED	\$ 66.00	\$ 66.00	
1.9	REAR BUMPER GUIDE RH 51127384466	1	DEFORMED	\$ 66.00	\$ 66.00	
1.10	REAR BUMPER REFLECTOR LH	1	CUT	\$ 48.00	\$ 48.00	
1.11	REAR BUMPER REFLECTOR RH	1	CUT	\$ 31.20	\$ 31.20	
1.12	REAR PARKING SENSOR	4	DAMAGED	\$ 180.00	\$ 720.00	
1.13	REAR PARKING SENSOR RING 66206923000	4	NECESSARY	\$ 4.80	\$ 19.20	
1.14	REAR PARKING SENSOR BRACKET	4	NECESSARY	\$ 78.00	\$ 312.00	
1.15	TOW COVER 51127384417	1	CUT	\$ 36.00	\$ 36.00	
1.16	REAR END PANEL COMPLETE SET	1	BUCKLED	\$ 660.00	\$ 660.00	
1.17	REAR END PANEL GARNISH ASSY	1	DEFORMED	\$ 102.00	\$ 102.00	
1.18	REAR PARKING SENSOR WIRE HARDNESS	1	CUT	\$ 336.00	\$ 336.00	
1.19	TAILLAMP RH	1	SCRATCHED	\$ 600.00	\$ 600.00	
1.20	TAILLAMP LH	1	SCRATCHED	\$ 600.00	\$ 600.00	
1.21	TAILLAMP LOWER BRACKET ASSY RH	1	NOT NECESSARY	\$ 36.00		
1.22	TAILLAMP LOWER BRACKET ASSY LH	1	NOT NECESSARY	\$ 36.00		
1.23	EXHAUST MUFFLER	1	DENTED	\$ 1,200.00	\$ 1,200.00	
1.24	EXHAUST MUFFLER TAIL PIPE CHROME	2	NECESSARY	\$ 144.00	\$ 288.00	
1.25	EXHAUST MUFFLER MOUNTING	2	NOT NECESSARY	\$ 54.00		

1.26	BOOT LOCK	1	BENT	\$ 240.00	\$ 240.00	
1.27	BOOT LOCK CATCH	1	NOT NECESSARY	\$ 48.00		
1.28	BOOT HINGE RH	1	NOT NECESSARY	\$ 66.00		
1.29	BOOT HINGE LH	1	NOT NECESSARY	\$ 66.00		
1.30	BOOT LOCK COVER 51247224692	1	SCRATCHED	\$ 9.60	\$ 9.60	
1.31	BOOT LID	1	BUCKLED	\$ 1,380.00	\$ 1,380.00	
1.32	BOOT LAMP RH	1	CUT	\$ 240.00	\$ 240.00	
1.33	BOOT LAMP LH	1	NOT NECESSARY	\$ 288.00		
1.34	REAR BUMPER PLATE HOLDER	1	DEFORMED	\$ 48.00	\$ 48.00	
1.35	BOOT EMBLEM ASSY	1	NECESSARY	\$ 84.00	\$ 84.00	
1.36	LOGO ASSY	1	NOT NECESSARY	\$ -	\$ -	
1.37	BONNET	1	BUCKLED	\$ 1,440.00	\$ 1,440.00	
1.38	BONNET HINGE RH	1	NOT NECESSARY	\$ 90.00		
1.39	BONNET HINGE LH	1	NOT NECESSARY	\$ 66.00		
1.40	BONNET LOCK ASSY RH	1	NOT NECESSARY	\$ 84.00		
1.41	BONNET LOCK ASSY LH	1	NOT NECESSARY	\$ 84.00		
1.42	BONNET LOCK CATCH ASSY RH	1	NOT NECESSARY	\$ 24.00		
1.43	BONNET LOCK CATCH ASSY LH	1	NOT NECESSARY	\$ 24.00		
1.44	BONNET LOGO	1	NECESSARY	\$ 78.00	\$ 78.00	
1.45	HEADLAMP COMPLETE RH	1	SMASHED	\$ 3,600.00	\$ 3,600.00	
1.46	HEADLAMP COMPLETE LH	1	SMASHED	\$ 3,600.00	\$ 3,600.00	
1.47	BONNET DAMPER RH	1	NOT NECESSARY	\$ 132.00		
1.48	BONNET DAMPER LH	1	NOT NECESSARY	\$ 132.00		
1.49	BONNET WEATHER STRIP	1	NOT NECESSARY	\$ 48.00		
1.50	BONNET STOPPER	2	NOT NECESSARY	\$ 14.40		
1.51	FRT BUMPER	1	CRACKED	\$ 1,380.00	\$ 1,380.00	
1.52	FRT BUMPER RETAINER RH 51118062634	1	DEFORMED	\$ 54.00	\$ 54.00	
1.53	FRT BUMPER RETAINER LH 51118062633	1	NOT NECESSARY	\$ 54.00		
1.54	FRT BUMPER BRACKET RH 51117279712	1	DEFORMED	\$ 21.60	\$ 21.60	
1.55	FRT BUMPER BRACKET LH 51117279711	1	DEFORMED	\$ 21.60	\$ 21.60	
1.56	FRT BUMPER LOWER GRILLE ASSY	1	DEFORMED	\$ 96.00	\$ 96.00	
1.57	FRT NUMBER PLATE HOLDER	1	MISSING	\$ 66.00	\$ 66.00	
1.58	FRT BUMPER SUPPORT 51117296308	1	NECESSARY	\$ 12.00	\$ 12.00	

1.59	FRT BUMPER SUPPORT 51117296331	1	NECESSARY	\$	7.20	\$	7.20	
1.60	FRT BUMPER LOWER TRIM 51118068130	1	NOT NECESSARY	\$	48.00			
1.61	FRT BUMPER REVIT ASSY	20	NECESSARY	\$	1.80	\$	36.00	
1.62	FRT BUMPER REINFORCEMENT COMPLETE ASSY	1	BENT	\$	360.00	\$	360.00	
1.63	FRT BUMPER SPONGE COMPLETE	1	CRACKED	\$	48.00	\$	48.00	
1.64	FRT SUPPORT PANEL COMPLETE ASSY	1	BENT	\$	192.00	\$	192.00	
1.65	BRACE PANEL COMPLETE ASSY	1	BROKEN	\$	132.00	\$	132.00	
1.66	CONDENSOR	1	CUT	\$	1,200.00	\$	1,200.00	
1.67	RADIATOR	1	BENT	\$	480.00	\$	480.00	
1.68	HEADLAMP LOWER BEAM ASSY RH	1	MISSING	\$	156.00	\$	156.00	
1.69	HEADLAMP LOWER BEAM ASSY LH	1	MISSING	\$	156.00	\$	156.00	
1.70	HEADLAMP ECU COMPLETE SET RH	1	NOT NECESSARY	\$	1,020.00			
1.71	HEADLAMP ECU COMPLETE SET LH	1	NOT NECESSARY	\$	1,020.00			
1.72	OIL COOLER COMPLETE SET	1	CUT	\$	876.00	\$	876.00	
1.73	AIR CLEANER COMPLETE SET	1	CRACKED	\$	432.00	\$	432.00	
1.74	FAN MOTOR COMPLETE SET	1	DAMAGED	\$	840.00	\$	840.00	
1.75	FRT BUMPER TOW COVER	1	MISSING	\$	60.00	\$	60.00	
1.76	FRT GRILLE ASSY RH	1	DISTORTED	\$	96.00	\$	96.00	
1.77	FRT GRILLE ASSY LH	1	DISTORTED	\$	96.00	\$	96.00	
1.78	TOOLS COMPARTMENT SPONGE COMPLETE SET	1	NOT NECESSARY	\$	144.00			
1.79	AIR DUCT COMPLETE SET	1	DENTED	\$	96.00	\$	96.00	
1.80	FRT NUMBER PLATE	1	MISSING	\$	24.00	\$	24.00	
1.81	REAR NUMBER PLATE	1	CUT	\$	24.00	\$	24.00	
1.82	HEADLAMP LED ECU RH	1	NOT NECESSARY	\$	156.00			
1.83	HEADLAMP LED ECU LH	1	NOT NECESSARY	\$	156.00			
1.84	HEADLAMP SIGNAL LED EUC RH	1	NOT NECESSARY	\$	660.00			
1.85	HEADLAMP SIGNAL LED ECU	1	NOT NECESSARY	\$	660.00			
	LABOUR DESCRIPTION							
1	SCOPE OF REPAIRS							
1.1	TO REPLACE AND RESPRAY BOOT LID INCLUDING REFLECTIVE STICKER							8

1.2	TO REPLACE AND RESPRAY REAR BUMPER INCLUDING REFLECTIVE STICKER						8
1.3	TO REPLACE AND RESPRAY RHR FENDER INCLUDING REFLECTIVE STICKER						8
1.4	TO REPLACE AND RESPRAY REAR END PANEL						6
1.5	TO REPAIR AND RESPRAY SPARE TYRE WELL						4
1.6	TO REPLACE EXHAUST MUFFLER						2
1.7	TO REPLACE AND RESPRAY BONNET INCLUDING REFLECTIVE STICKER						8
1.8	TO REPLACE AND RESPRAY FRT BUMPER INCLUDING REFLECTIVE STICKER						8
1.9	TO REPLACE WIRE HARDNESS, RESET FAULT CODE, CHECK WIRING SYSTEM						2
1.10	TO REMOVE AND REFIX UPOLISTERY AND REAR SEAT TO ASSIST WORK						3
1.11	TO REPLACE AND RESPRAY SUPPORT PANEL						4
1.12	TO REPLACE AND RESPRAY REAR REINFORCEMENT						1
1.13	TO REPLACE AND RESPRAY FRT REINFORCEMENT						1
1.14	TO REMOVE AND REFIX CONDENSER, RADIATOR AND TOP UP AC GAS						2
2	ADDITIONAL SERVICES						
2.1	AFTER REPAIR, VEHICLE WILL NEED TO SEND IN TO AGENT FOR PROGRAMMING, WILL SUBMIT ADDITIONAL SOW FOR THIS						0
COSTING						TOTAL PARTS COST	\$24,650.40
						TOTAL MAN-HOUR	65



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTOMOTIVE ENGINEERING & MGT DIVISION			Ref : CS/SPF19014863/Gsd3e2	
CONTRACT MANAGEMENT SECTION(SPORE POLICE FORCE)1 MOUNT PLEASANT ROAD LK 8 OLD POLICE ACADEMYSINGAPORE 298333 ATTN : PERRY HE			Date : 05-12-2019 Code : SPF3	
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.		Veh. Inspected		QX 75G
Policy No.		Coverage (\$)		0.00
Claim No.	MHASPF0300000113	Excess (\$)		0.00
Assign From	PERRY HE	Assign Date		23/08/2019
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. 325D	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	WBA8D32060K544901	Colour	WHITE	
Odometer	14695	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	255/40 R18	BRIDGESTONE	6 mm	
L/H Front Tyre	255/40 R18	BRIDGESTONE	6 mm	
R/H Rear Tyre	255/40 R18	BRIDGESTONE	6 mm	
L/H Rear Tyre	255/40 R18	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date		Inspection Date 23/08/2019		
Survey held at		INDECO ENGINEERS PTE LTD 39 DEFU LANE 12 . SINGAPORE 539139		
5a. Remarks				



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. QX 75G

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	REAR BUMPER	1	TORN	\$ 1,020.00	\$ 1,020.00	
1.2	REAR BUMPER TRIM 51127384571	1	MISSING	\$ 120.00	\$ 120.00	
1.3	REAR BUMPER REINFORCEMENT	1	BENT	\$ 540.00	\$ 540.00	
1.4	REAR BUMPER REINFORCEMENT COVER 51127256921	1	CRACKED	\$ 102.00	\$ 102.00	
1.5	REAR BUMPER CENTER GUIDE 51127256922	1	DEFORMED	\$ 66.00	\$ 66.00	
1.6	LH PROTECTION 51127400293	1	CUT	\$ 18.00	\$ 18.00	
1.7	RH PROTECTION 51127400294	1	CUT	\$ 18.00	\$ 18.00	
1.8	REAR BUMPER GUIDE LH 51127384465	1	DEFORMED	\$ 66.00	\$ 66.00	
1.9	REAR BUMPER GUIDE RH 51127384466	1	DEFORMED	\$ 66.00	\$ 66.00	
1.10	REAR BUMPER REFLECTOR LH	1	CUT	\$ 48.00	\$ 48.00	
1.11	REAR BUMPER REFLECTOR RH	1	CUT	\$ 31.20	\$ 31.20	
1.12	REAR PARKING SENSOR	4	DAMAGED	\$ 180.00	\$ 720.00	
1.13	REAR PARKING SENSOR RING 66206923000	4	NECESSARY	\$ 4.80	\$ 19.20	
1.14	REAR PARKING SENSOR BRACKET	4	NECESSARY	\$ 78.00	\$ 312.00	
1.15	TOW COVER 51127384417	1	CUT	\$ 36.00	\$ 36.00	
1.16	REAR END PANEL COMPLETE SET	1	BUCKLED	\$ 660.00	\$ 660.00	
1.17	REAR END PANEL GARNISH ASSY	1	DEFORMED	\$ 102.00	\$ 102.00	
1.18	REAR PARKING SENSOR WIRE HARDNESS	1	CUT	\$ 336.00	\$ 336.00	
1.19	TAILLAMP RH	1	SCRATCHED	\$ 600.00	\$ 600.00	
1.20	TAILLAMP LH	1	SCRATCHED	\$ 600.00	\$ 600.00	
1.21	TAILLAMP LOWER BRACKET ASSY RH	1	NOT NECESSARY	\$ 36.00		
1.22	TAILLAMP LOWER BRACKET ASSY LH	1	NOT NECESSARY	\$ 36.00		
1.23	EXHAUST MUFFLER	1	DENTED	\$ 1,200.00	\$ 1,200.00	
1.24	EXHAUST MUFFLER TAIL PIPE CHROME	2	NECESSARY	\$ 144.00	\$ 288.00	
1.25	EXHAUST MUFFLER MOUNTING	2	NOT NECESSARY	\$ 54.00		
1.26	BOOT LOCK	1	BENT	\$ 240.00	\$ 240.00	
1.27	BOOT LOCK CATCH	1	NOT NECESSARY	\$ 48.00		
1.28	BOOT HINGE RH	1	NOT NECESSARY	\$ 66.00		

1.29	BOOT HINGE LH	1	NOT NECESSARY	\$ 66.00		
1.30	BOOT LOCK COVER 51247224692	1	SCRATCHED	\$ 9.60	\$ 9.60	
1.31	BOOT LID	1	BUCKLED	\$ 1,380.00	\$ 1,380.00	
1.32	BOOT LAMP RH	1	CUT	\$ 240.00	\$ 240.00	
1.33	BOOT LAMP LH	1	NOT NECESSARY	\$ 288.00		
1.34	REAR BUMPER PLATE HOLDER	1	DEFORMED	\$ 48.00	\$ 48.00	
1.35	BOOT EMBLEM ASSY	1	NECESSARY	\$ 84.00	\$ 84.00	
1.36	LOGO ASSY	1	NOT NECESSARY	\$ -	\$ -	
1.37	BONNET	1	BUCKLED	\$ 1,440.00	\$ 1,440.00	
1.38	BONNET HINGE RH	1	NOT NECESSARY	\$ 90.00		
1.39	BONNET HINGE LH	1	NOT NECESSARY	\$ 66.00		
1.40	BONNET LOCK ASSY RH	1	NOT NECESSARY	\$ 84.00		
1.41	BONNET LOCK ASSY LH	1	NOT NECESSARY	\$ 84.00		
1.42	BONNET LOCK CATCH ASSY RH	1	NOT NECESSARY	\$ 24.00		
1.43	BONNET LOCK CATCH ASSY LH	1	NOT NECESSARY	\$ 24.00		
1.44	BONNET LOGO	1	NECESSARY	\$ 78.00	\$ 78.00	
1.45	HEADLAMP COMPLETE RH	1	SMASHED	\$ 3,600.00	\$ 3,600.00	
1.46	HEADLAMP COMPLETE LH	1	SMASHED	\$ 3,600.00	\$ 3,600.00	
1.47	BONNET DAMPER RH	1	NOT NECESSARY	\$ 132.00		
1.48	BONNET DAMPER LH	1	NOT NECESSARY	\$ 132.00		
1.49	BONNET WEATHER STRIP	1	NOT NECESSARY	\$ 48.00		
1.50	BONNET STOPPER	2	NOT NECESSARY	\$ 14.40		
1.51	FRT BUMPER	1	CRACKED	\$ 1,380.00	\$ 1,380.00	
1.52	FRT BUMPER RETAINER RH 51118062634	1	DEFORMED	\$ 54.00	\$ 54.00	
1.53	FRT BUMPER RETAINER LH 51118062633	1	NOT NECESSARY	\$ 54.00		
1.54	FRT BUMPER BRACKET RH 51117279712	1	DEFORMED	\$ 21.60	\$ 21.60	
1.55	FRT BUMPER BRACKET LH 51117279711	1	DEFORMED	\$ 21.60	\$ 21.60	
1.56	FRT BUMPER LOWER GRILLE ASSY	1	DEFORMED	\$ 96.00	\$ 96.00	
1.57	FRT NUMBER PLATE HOLDER	1	MISSING	\$ 66.00	\$ 66.00	
1.58	FRT BUMPER SUPPORT 51117296308	1	NECESSARY	\$ 12.00	\$ 12.00	
1.59	FRT BUMPER SUPPORT 51117296331	1	NECESSARY	\$ 7.20	\$ 7.20	
1.60	FRT BUMPER LOWER TRIM 51118068130	1	NOT NECESSARY	\$ 48.00		
1.61	FRT BUMPER REVIT ASSY	20	NECESSARY	\$ 1.80	\$ 36.00	
1.62	FRT BUMPER REINFORCEMENT COMPLETE ASSY	1	BENT	\$ 360.00	\$ 360.00	
1.63	FRT BUMPER SPONGE COMPLETE	1	CRACKED	\$ 48.00	\$ 48.00	
1.64	FRT SUPPORT PANEL COMPLETE ASSY	1	BENT	\$ 192.00	\$ 192.00	
1.65	BRACE PANEL COMPLETE ASSY	1	BROKEN	\$ 132.00	\$ 132.00	
1.66	CONDENSOR	1	CUT	\$ 1,200.00	\$ 1,200.00	
1.67	RADIATOR	1	BENT	\$ 480.00	\$ 480.00	
1.68	HEADLAMP LOWER BEAM ASSY RH	1	MISSING	\$ 156.00	\$ 156.00	

1.69	HEADLAMP LOWER BEAM ASSY LH	1	MISSING	\$ 156.00	\$ 156.00	
1.70	HEADLAMP ECU COMPLETE SET RH	1	NOT NECESSARY	\$ 1,020.00		
1.71	HEADLAMP ECU COMPLETE SET LH	1	NOT NECESSARY	\$ 1,020.00		
1.72	OIL COOLER COMPLETE SET	1	CUT	\$ 876.00	\$ 876.00	
1.73	AIR CLEANER COMPLETE SET	1	CRACKED	\$ 432.00	\$ 432.00	
1.74	FAN MOTOR COMPLETE SET	1	DAMAGED	\$ 840.00	\$ 840.00	
1.75	FRT BUMPER TOW COVER	1	MISSING	\$ 60.00	\$ 60.00	
1.76	FRT GRILLE ASSY RH	1	DISTORTED	\$ 96.00	\$ 96.00	
1.77	FRT GRILLE ASSY LH	1	DISTORTED	\$ 96.00	\$ 96.00	
1.78	TOOLS COMPARTMENT SPONGE COMPLETE SET	1	NOT NECESSARY	\$ 144.00		
1.79	AIR DUCT COMPLETE SET	1	DEFORMED	\$ 96.00	\$ 96.00	
1.80	FRT NUMBER PLATE	1	MISSING	\$ 24.00	\$ 24.00	
1.81	REAR NUMBER PLATE	1	CUT	\$ 24.00	\$ 24.00	
1.82	HEADLAMP LED ECU RH	1	NOT NECESSARY	\$ 156.00		
1.83	HEADLAMP LED ECU LH	1	NOT NECESSARY	\$ 156.00		
1.84	HEADLAMP SIGNAL LED ECU RH	1	NOT NECESSARY	\$ 660.00		
1.85	HEADLAMP SIGNAL LED ECU	1	NOT NECESSARY	\$ 660.00		
LABOUR DESCRIPTION						
1	SCOPE OF REPAIRS					
1.1	TO REPLACE AND RESPRAY BOOT LID INCLUDING REFLECTIVE STICKER					8
1.2	TO REPLACE AND RESPRAY REAR BUMPER INCLUDING REFLECTIVE STICKER					8
1.3	TO REPLACE AND RESPRAY RHR FENDER INCLUDING REFLECTIVE STICKER					8
1.4	TO REPLACE AND RESPRAY REAR END PANEL					6
1.5	TO REPAIR AND RESPRAY SPARE TYRE WELL					4
1.6	TO REPLACE EXHAUST MUFFLER					2
1.7	TO REPLACE AND RESPRAY BONNET INCLUDING REFLECTIVE STICKER					8
1.8	TO REPLACE AND RESPRAY FRT BUMPER INCLUDING REFLECTIVE STICKER					8
1.9	TO REPLACE WIRE HARDNESS, RESET FAULT CODE, CHECK WIRING SYSTEM					2
1.10	TO REMOVE AND REFIX UPHOLSTERY AND REAR SEAT TO ASSIST WORK					3
1.11	TO REPLACE AND RESPRAY SUPPORT PANEL					4
1.12	TO REPLACE AND RESPRAY REAR REINFORCEMENT					1
1.13	TO REPLACE AND RESPRAY FRT REINFORCEMENT					1

1.14	TO REMOVE AND REFIX CONDENSER, RADIATOR AND TOP UP AC GAS					2
2	ADDITIONAL SERVICES					
2.1	AFTER REPAIR, VEHICLE WILL NEED TO SEND IN TO AGENT FOR PROGRAMMING, WILL SUBMIT ADDITIONAL SOW FOR THIS					0
COSTING		TOTAL PARTS COST			\$24,650.40	
		TOTAL MAN-HOUR				65

Registration No. QX 75G

Vehicle Inspected By

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.