

08/11/19

Surveyor

REF: CS/TP/19015790/01f3n2


ASSIGNMENT

COE Dec 2028

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

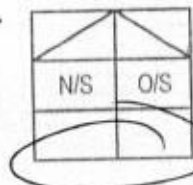

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 18 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SMF 7140Y Yr Regn: 2009, June
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Nissan GT-R c.c. 3790
 Colour: White A/C: Insured / Std / NI / NA
 Sp. Reading: 129412 T/Radio: Insured / Std / NI / NA
 Eng/No: VR38 006460A
 C/No: R35004560
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 255 / 40 R20
 R: 285 / 35 R20
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Michelin
 Front Rear
 R/Bal. S mm R/Bal. S mm
 L/Bal. S mm L/Bal. S mm
 D.O.A. 10/05/2019 D.O.I. 21/05/2019
 Survey held at Teamwork Page Ubi
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Rear
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Independent vehicle renewed COE in Dec 2018 abt 6 mths before accident.
	MV 170K LIA 73K (with PARF as accident before 10 yrs) HL 97K

RECEIVED 23 SEP 2019

23/09/19 To submit L/S 58000/- with 18 days of rev

Date/Time, File Pass to? ☐ : Preli. Report1) 23/9 Typst ☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 18Resurvey No. of Trip: 2Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Report Format :

Lump Sum / I.B.I. (\$) 58000/-

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

) 11200) 05P) 27/9/19

83x15 = 1245

170+1245

50

50+50

328

80

1973

CS/TP190157801 D+83

teamwork.

(0.0.2)

SINGAPORE ACCIDENT STATEMENT

Independent 21/05/2019

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	10/05/2019 16:14
Date Of Accident	10/05/2019 11:55
Exact Location Of Accident	PIE (CHANGI) BEFORE JALAN EUNOS EXIT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMF7140Y
Insured/Policyholder	
Name Of Registered Owner	ALEX LIAN TECK HUAT
NRIC No	S7226867I
Email Address	ERICHEE_@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-90691121
Alternative Phone No	OTHERS-90691121

Vehicle Particulars

Manufacturer	NISSAN
Model	GTR
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	ETIQA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	MA003199
Cover Note Number	

Driver

Name of Driver	HEE QING XUN
NRIC No	S9670570J
Date Of Birth	21/10/1996
Occupation	INDOOR
Date Of Driving Pass	28/02/2015
Driving Experience	4 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-82828103
Fax Number	
Contact Number	
Email Address	ERICHEE_@HOTMAIL.COM

Address	APT BLK 740 PASIR RIS STREET 71 #09-59 S 540740
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	FRIEND
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLIDED INTO MOTORCYCLIST
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : VICTOR WONG WAI LOK
	GENDER: : MALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO THE ATTACHED.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YP9975Y
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLC1006U
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	ALEX LIAN TECK HUAT
Approximate Age	
Injuries Sustain	NIL
Injured person in which vehicle?	SMF7140Y
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	APT BLK 740 PASIR RIS STREET 71 #09-59
Postcode	540740

DETAILS OF INJURED PERSON 2

Name	VICTOR WONG WAI LOK
Approximate Age	
Injuries Sustain	NIL
Injured person in which vehicle?	SMF7140Y
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	NIL NIL
Postcode	NIL


SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) Investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:



Driver's Signature
(If driver is not the policyholder)
Date & Time:



Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Accident Sketch Plan Pg. 1

SKETCH PLAN

PEE toward changi airport before Jalan Eunos exit.



Vehicle A: SMF7140X

Vehicle B: YP9975Y

Vehicle C: SLC1006U

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was travelling along PEE toward changi airport before Jalan Eunos exit. The car in front of me stopped so I began to slow down and stop. Suddenly I felt a huge impact from the rear of my vehicle. I got down and realised I was involved in a 3 car collision.

ETIDA	
SMF7140X	10.5.2019
<input type="checkbox"/> Give Damages Claim <input checked="" type="checkbox"/> Police Report Claim <input checked="" type="checkbox"/> Other Vehicle Claim TBA	

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



Pte Ltd

Teamwork Garage Pte Ltd

53 Ubi Avenue 1 #01-23/24 Spore 408934

Paya Ubi Industrial Park

Tel : 6844 2475

E-mail : claims@teamworkgarage.com

ROC number : 201015366H

REPAIR PERFORMA INVOICE

LIBERTY INSURANCE PTE LTD

Vehicle number	SMF7140Y
Make / Model	NISSAN GTR
Chassis number	VR38006460A
Accident date	10/5/19
Reference	1905-26

Qty Particulars Unit Price - SGD \$

PARTS REPLACEMENT - LIST ITEMS		
1	REAR BUMPER <i>Dented</i>	4320.00 ✓
2	REAR BUMPER RETAINER <i>SVC</i>	156.00 X
1	REAR BUMPER REINFORCEMENT <i>broken</i>	1358.27 ✓
2	REAR BUMPER REINFORCEMENT BRACKET <i>bst</i>	241.28 ✓
1	REAR BUMPER SPONGE <i>ton</i>	325.00 ✓
1	REAR BUMPER LOWER GARNISH <i>broken</i>	1380.00 ✓
1	REAR BUMPER DIFFUSAL (CARBON FIBRE) <i>broken</i>	4512.03 ✓
2	REAR BUMPER REFLECTOR <i>broken & broken</i>	150.80 150.80 ✓
2	REAR CARPLATE LAMP <i>broken & broken</i>	93.60 ✓
2	TAILLAMP <i>broken</i>	4140.00 ✓
2	TAILLAMP PANEL <i>Buc</i>	2099.90 ✓
1	BOOTLID <i>Buc</i>	3816.00 ✓
1	BOOTLID SPOILER <i>broken</i>	2881.20 ✓
1	BOOTLID INNER TRIM <i>bst / crumpled</i>	463.45 ✓
1	BOOTLID LOCK <i>Don</i>	179.01 ✓
2	BOOTLID HINGE <i>bst</i>	206.70 ✓
1	BOOTLID WEATHERSTRIP <i>deformed</i>	312.91 ✓
2	REAR FENDER <i>Dented</i>	6672.30 ✓
2	REAR FENDER RETAINER <i>bst</i>	40.25 ✓
2	REAR FENDER INNER SHEILD <i>deformed / torn</i>	108.16 ✓
2	REAR FENDER INNER TRIM (UPPER/LOWER) <i>bst / crumpled</i>	655.96 ✓
1	SPEAKER TOP BOARD <i>new</i>	520.39 X
1	SPARE TYRE TOP BOARD <i>new</i>	1000.50 X
1	FLOOR PANEL <i>Buc</i>	1073.54 ✓
1	END PANEL <i>Buc</i>	1185.73 ✓
1	END PANEL TOP GARNISH <i>deformed</i>	154.18 ✓
1	REAR RH WHEEL HOUSE <i>Buc</i>	1010.85 ✓
1	REAR RH CHASSIS MEMBER <i>Dented</i>	5087.60 ✓
2	REAR QUARTER GLASS <i>new</i>	540.80 ✓
1	PETROL COVER <i>new</i>	708.40 X
1	EXHAUST SILENCER <i>Dented / bst</i>	7187.50 ✓
1	EXHAUST MID PIPE <i>Dented</i>	6717.15 ✓

56914.17

1	REAR CROSSMEMBER <i>Dendral</i> <i>1st</i>	4829.08	✓
1	REAR RH LOWER ARM <i>distorted</i>	328.64	✓
1	REAR RH UPPER ARM <i>st</i>	1255.41	✓
1	REAR RH CONTROL ARM <i>1st</i>	328.64	✓
1	REAR RH KNUCKLE ARM <i>distorted</i>	1066.52	✓
1	REAR RH KNUCKLE ARM BEARING <i>Down</i>	803.27	✓
1	REAR RH SHOCK ABSORBER <i>distorted</i>	2674.33	✓
1	REAR WINDSCREEN <i>broken</i>	2208.00	✓
1	EXHAUST DOWNPIPE <i>HN</i>	7187.50	X
1	EXHAUST HEATSHIELD <i>crumpled</i>	529.00	✓
2	EXHAUST MOUNTING <i>1st</i>	285.20	✓
1	REAR BUMPER UNDERCOVER <i>broken</i>	1058.00	✓
1	REAR BACKSEAT <i>HN</i>	9211.50	X
1	SPEAKER TOP PANEL <i>Dendral</i>	956.80	✓
		72793.35	
	Less 10%		
	Subtotal		
	Balance C/F		
	<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>		
	Balance B/F		
1 SET	REAR BUMPER CLIP <i>HN</i>	100.00	30/-
1 SET	REAR FENDER INNER TRIM CLIP <i>HN</i>	80.00	20/-
1 SET	BOOTLID INNER TRIM CLIP <i>HN</i>	80.00	20/-
1	COOLANT <i>HN</i>	50.00	X
1	BRAKE FULID <i>HN</i>	50.00	X
1	REVERSE CAMERA <i>shorted</i>	800.00	300/-
1 SET	REVERSE SENSOR <i>HN</i>	400.00	X
	Subtotal	1560.00	
	Balance C/F	1560.00	
S/No	<u>LABOUR AND MISCELLANEOUS CHARGES</u>		
	Balance B/F		
	CHECK WIRING AND LIGHTNING SYSTEM	80.00	30/-
	REMOVE AND FIT FUEL TANK	500.00	HN
	REMOVE AND REFIT REAR WINDSCREEN	150.00	120/-
	REMOVE AND REFIT REAR EXHUAST	300.00	150/-
	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT	500.00	150/-
	TRANSFER PARTS, ATTACHMENRT FROM OLD BOOTLID TO NEW	200.00	80/-
	CHECK FRONT AND REAR WHEEL ALIGNMENT	250.00	80/-
	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS	300.00	180/-
	PANEL BEATING ON AFFECTED AREAS	2500.00	2000/-
	SPARY PAINTING ON AFFECTED AREAS	1800.00	1400/-
	APPLY ANTI RUST ON AFFECTED AREAS	200.00	80/-
	21/05/2019 @ 1500ms		
	Subtotal	6780.00	

16322.89

73237.06

65913.35

370.00

4270.00

93657.14

92021.35

Not Antimal
L/smm 18 days.

2 KK And

70553.35

Supp 2396.17 L/s 58000/-
72949.52



Pte Ltd

Teamwork Garage Pte Ltd

53 Ubi Avenue 1 #01-23/24 Spore 408934

Paya Ubi Industrial Park

Tel : 6844 2475

E-mail : claims@teamworkgarage.com

ROC number : 201015366H

REPAIR PERFORMA INVOICE SUPPLEMENTAR

LIBERTY INSURANCE PTE LTD

Vehicle number	SMF7140Y
Make / Model	NISSAN GTR
Chassis number	VR38006460A
Accident date	10/5/19
Reference	1905-26

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	BOOTLID LOCK CATCH <i>bst</i>	69.00 ✓
1	REAR SEAT CENTRE CONSOLE (UPPER) <i>cut</i>	288.42 ✓
1	REAR SEAT CENTRE CONSOLE (LOWER) <i>cut</i>	1263.62 ✓
1	REAR BUMPER BRACKET RH <i>NH</i>	113.05 X
1	REAR RH AIRDUCT <i>broken</i>	78.20 ✓
1	KEYLESS SENSOR WITH BRACKET <i>broken</i>	266.80 ✓
2	REAR INNER UPPER TRIM <i>cut</i>	327.98 ✓
2	TAILLAMP BRACKET <i>broken</i>	149.50 ✓
2	BOOTLID ABSORBER <i>Dem</i>	218.90 ✓
		2775.47
		Less 10%
		Subtotal

2662.42
2396.17

277.55
2497.92




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
TEAMWORK GARAGE PTE LTD		Ref : CS/TP19015780/Dtf3n2	
53 UBI AVENUE 1 #01-24 SINGAPORE 408934		Date : 23-09-2019	
ON BEHALF OF ALEX LIAN TECK HUAT		Code : TP376	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	Veh. Inspected		SMF 7140Y
Policy No.	Coverage (\$)		0.00
Claim No.	Excess (\$)		0.00
Assign From	Assign Date		21/05/2019
2. Vehicle Particulars & Condition			
Make & Model	NISSAN GT-R	c.c	3790
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	R35004560	Colour	WHITE
Odometer	129412	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	255/40 R20	MICHELIN	5 mm
L/H Front Tyre	255/40 R20	MICHELIN	5 mm
R/H Rear Tyre	285/35 R20	MICHELIN	5 mm
L/H Rear Tyre	285/35 R20	MICHELIN	5 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	10/05/2019	Inspection Date	21/05/2019
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		18 Working Days	




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
TEAMWORK GARAGE PTE LTD		Ref : CS/TP19015780/Dtf3n2		
53 UBI AVENUE 1 #01-24SINGAPORE 408934		Date : 23-09-2019		
ON BEHALF OF ALEX LIAN TECK HUAT		Code : TP376		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	Veh. Inspected		SMF 7140Y	
Policy No.	Coverage (\$)		0.00	
Claim No.	Excess (\$)		0.00	
Assign From	Assign Date		21/05/2019	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN GT-R	c.c	3790	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	R35004560	Colour	WHITE	
Odometer	129412	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	255/40 R20	MICHELIN	5 mm	
L/H Front Tyre	255/40 R20	MICHELIN	5 mm	
R/H Rear Tyre	285/35 R20	MICHELIN	5 mm	
L/H Rear Tyre	285/35 R20	MICHELIN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	10/05/2019	Inspection Date	21/05/2019	
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		18 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMF 7140Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER	DENTED	4,320.00	4,320.00
2	REAR BUMPER RETAINER	SERVICEABLE	156.00	-
1	REAR BUMPER REINFORCEMENT	BROKEN	1,358.27	1,358.27
2	REAR BUMPER REINFORCEMENT BRACKET	BENT	241.28	241.28
1	REAR BUMPER SPONGE	TORN	325.00	325.00
1	REAR BUMPER LOWER GARNISH	BROKEN	1,380.00	1,380.00
1	REAR BUMPER DIFFUSAL (CARBON FIBRE)	BROKEN	4,512.03	4,512.03
2	REAR BUMPER REFLECTOR	BROKEN	150.80	150.80
2	REAR CARPLATE LAMP	MOUNTING BROKEN	93.60	93.60
2	TAILLAMP	BROKEN	4,140.00	4,140.00
2	TAILLAMP PANEL	BUCKLED	2,099.90	2,099.90
1	BOOTLID	BUCKLED	3,816.00	3,816.00
1	BOOTLID SPOILER	BROKEN	2,881.20	2,881.20
1	BOOTLID INNER TRIM	BENT / CRUMPLED	463.45	463.45
1	BOOTLID LOCK	DAMAGED	179.01	179.01
2	BOOTLID HINGE	BENT	206.70	206.70
1	BOOTLID WEATHERSTRIP	DEFORMED	312.91	312.91
2	REAR FENDER	DENTED	6,672.30	6,672.30
2	REAR FENDER RETAINER	BENT	40.25	40.25
2	REAR FENDER INNER SHIELD	DEFORMED / TORN	108.16	108.16
2	REAR FENDER INNER TRIM (UPPER/LOWER)	BENT / CRUMPLED	655.96	655.96
1	SPEAKER TOP BOARD	NOT NECESSARY	520.39	-
1	SPARE TYRE TOP BOARD	NOT NECESSARY	1,000.50	-
1	FLOOR PANEL	BUCKLED	1,073.54	1,073.54
1	END PANEL	BUCKLED	1,185.73	1,185.73
1	END PANEL TOP GARNISH	DEFORMED	154.18	154.18
1	REAR RH WHEEL HOUSE	BUCKLED	1,010.85	1,010.85
1	REAR RH CHASSIS MEMBER	DENTED	5,087.60	5,087.60
2	REAR QUARTER GLASS	NECESSARY	540.80	540.80
1	PETROL COVER	NOT NECESSARY	708.40	-
1	EXHAUST SILENCER	DENTED / BENT	7,187.50	7,187.50
1	EXHAUST MID PIPE	DENTED	6,717.15	6,717.15
1	REAR CROSSMEMBER	DENTED / BENT	4,829.08	4,829.08

Report Ref No. CS/TP19015780/Dtf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR RH LOWER ARM	DISTORTED	328.64	328.64
1	REAR RH UPPER ARM	BENT	1,255.41	1,255.41
1	REAR RH CONTROL ARM	BENT	328.64	328.64
1	REAR RH KNUCKLE ARM	DISTORTED	1,066.52	1,066.52
1	REAR RH KNUCKLE ARM BEARING	DAMAGED	803.27	803.27
1	REAR RH SHOCK ABSORBER	DISTORTED	2,674.33	2,674.33
1	REAR WINDSCREEN	BROKEN	2,208.00	2,208.00
1	EXHAUST DOWNPIPE	NOT NECESSARY	7,187.50	-
1	EXHAUST HEATSHIELD	CRUMPLED	529.00	529.00
2	EXHAUST MOUNTING	BENT	285.20	285.20
1	REAR BUMPER UNDERCOVER	BROKEN	1,058.00	1,058.00
1	REAR BACKSEAT	NOT NECESSARY	9,211.50	-
1	SPEAKER TOP PANEL	DENTED	956.80	956.80
1	BOOTLID LOCK CATCH	BENT	69.00	69.00
1	REAR SEAT CENTRE CONSOLE (UPPER)	CUT	288.42	288.42
1	REAR SEAT CENTRE CONSOLE (LOWER)	CUT	1,263.62	1,263.62
1	REAR BUMPER BRACKET RH	NOT NECESSARY	113.05	-
1	REAR RH AIRDUCT	BROKEN	78.20	78.20
1	KEYLESS SENSOR	BROKEN	266.80	266.80
2	REAR INNER UPPER TRIM	CUT	327.98	327.98
2	TAILLAMP BRACKET	BROKEN	149.50	149.50
2	BOOTLID ABSORBER	DAMAGED	218.90	218.90
	LESS 10% DISCOUNT		-9,479.68	-7,589.95
			85,317.14	68,309.53
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER CLIP (SN)	NECESSARY	100.00	30.00
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	80.00	20.00
1	SET BOOTLID INNER TRIM CLIP (SN)	NECESSARY	80.00	20.00
1	COOLANT (SN)	NOT NECESSARY	50.00	-
1	BRAKE FLUID (SN)	NOT NECESSARY	50.00	-
1	REVERSE CAMERA (SN)	SHORTED	800.00	300.00
1	SET REVERSE SENSOR (SN)	NO SUCH PARTS	400.00	-
			1,560.00	370.00
	LABOUR			
	CHECK WIRING AND LIGHTING SYSTEM.		80.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND FIT FUEL TANK.	NOT NECESSARY	500.00	-
	REMOVE AND REFIT REAR WINDSCREEN.		150.00	120.00
	REMOVE AND REFIT REAR EXHAUST.		300.00	150.00
	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT.		500.00	150.00
	TRANSFER PARTS, ATTACHMENT FROM OLD BOOTLID TO NEW.		200.00	80.00
	CHECK FRONT AND REAR WHEEL ALIGNMENT.		250.00	80.00
	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS.		300.00	180.00
	PANEL BEATING ON AFFECTED AREAS.		2,500.00	2,000.00
	SPRAY PAINTING ON AFFECTED AREAS.		1,800.00	1,400.00
	APPLY ANTI RUST ON AFFECTED AREAS.		200.00	80.00
			6,780.00	4,270.00
GRAND TOTAL			93,657.14	72,949.53
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				58,000.00

Report Ref No. CS/TP19015780/Dtf3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMF 7140Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER	DENTED	4,320.00	4,320.00
2	REAR BUMPER RETAINER	SERVICEABLE	156.00	-
1	REAR BUMPER REINFORCEMENT	BROKEN	1,358.27	1,358.27
2	REAR BUMPER REINFORCEMENT BRACKET	BENT	241.28	241.28
1	REAR BUMPER SPONGE	TORN	325.00	325.00
1	REAR BUMPER LOWER GARNISH	BROKEN	1,380.00	1,380.00
1	REAR BUMPER DIFFUSAL (CARBON FIBRE)	BROKEN	4,512.03	4,512.03
2	REAR BUMPER REFLECTOR	BROKEN	150.80	150.80
2	REAR CARPLATE LAMP	MOUNTING BROKEN	93.60	93.60
2	TAILLAMP	BROKEN	4,140.00	4,140.00
2	TAILLAMP PANEL	BUCKLED	2,099.90	2,099.90
1	BOOTLID	BUCKLED	3,816.00	3,816.00
1	BOOTLID SPOILER	BROKEN	2,881.20	2,881.20
1	BOOTLID INNER TRIM	BENT / CRUMPLED	463.45	463.45
1	BOOTLID LOCK	DAMAGED	179.01	179.01
2	BOOTLID HINGE	BENT	206.70	206.70
1	BOOTLID WEATHERSTRIP	DEFORMED	312.91	312.91
2	REAR FENDER	DENTED	6,672.30	6,672.30
2	REAR FENDER RETAINER	BENT	40.25	40.25
2	REAR FENDER INNER SHIELD	DEFORMED / TORN	108.16	108.16
2	REAR FENDER INNER TRIM (UPPER/LOWER)	BENT / CRUMPLED	655.96	655.96
1	SPEAKER TOP BOARD	NOT NECESSARY	520.39	-
1	SPARE TYRE TOP BOARD	NOT NECESSARY	1,000.50	-
1	FLOOR PANEL	BUCKLED	1,073.54	1,073.54
1	END PANEL	BUCKLED	1,185.73	1,185.73
1	END PANEL TOP GARNISH	DEFORMED	154.18	154.18
1	REAR RH WHEEL HOUSE	BUCKLED	1,010.85	1,010.85
1	REAR RH CHASSIS MEMBER	DENTED	5,087.60	5,087.60
2	REAR QUARTER GLASS	NECESSARY	540.80	540.80
1	PETROL COVER	NOT NECESSARY	708.40	-
1	EXHAUST SILENCER	DENTED / BENT	7,187.50	7,187.50
1	EXHAUST MID PIPE	DENTED	6,717.15	6,717.15
1	REAR CROSSMEMBER	DENTED / BENT	4,829.08	4,829.08

Report Ref No. CS/TP19015780/Dtf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR RH LOWER ARM	DISTORTED	328.64	328.64
1	REAR RH UPPER ARM	BENT	1,255.41	1,255.41
1	REAR RH CONTROL ARM	BENT	328.64	328.64
1	REAR RH KNUCKLE ARM	DISTORTED	1,066.52	1,066.52
1	REAR RH KNUCKLE ARM BEARING	DAMAGED	803.27	803.27
1	REAR RH SHOCK ABSORBER	DISTORTED	2,674.33	2,674.33
1	REAR WINDSCREEN	BROKEN	2,208.00	2,208.00
1	EXHAUST DOWNPIPE	NOT NECESSARY	7,187.50	-
1	EXHAUST HEATSHIELD	CRUMPLED	529.00	529.00
2	EXHAUST MOUNTING	BENT	285.20	285.20
1	REAR BUMPER UNDERCOVER	BROKEN	1,058.00	1,058.00
1	REAR BACKSEAT	NOT NECESSARY	9,211.50	-
1	SPEAKER TOP PANEL	DENTED	956.80	956.80
1	BOOTLID LOCK CATCH	BENT	69.00	69.00
1	REAR SEAT CENTRE CONSOLE (UPPER)	CUT	288.42	288.42
1	REAR SEAT CENTRE CONSOLE (LOWER)	CUT	1,263.62	1,263.62
1	REAR BUMPER BRACKET RH	NOT NECESSARY	113.05	-
1	REAR RH AIRDUCT	BROKEN	78.20	78.20
1	KEYLESS SENSOR	BROKEN	266.80	266.80
2	REAR INNER UPPER TRIM	CUT	327.98	327.98
2	TAILLAMP BRACKET	BROKEN	149.50	149.50
2	BOOTLID ABSORBER	DAMAGED	218.90	218.90
	LESS 10% DISCOUNT		-9,479.68	-7,589.95
			85,317.14	68,309.53
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER CLIP (SN)	NECESSARY	100.00	30.00
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	80.00	20.00
1	SET BOOTLID INNER TRIM CLIP (SN)	NECESSARY	80.00	20.00
1	COOLANT (SN)	NOT NECESSARY	50.00	-
1	BRAKE FLUID (SN)	NOT NECESSARY	50.00	-
1	REVERSE CAMERA (SN)	SHORTED	800.00	300.00
1	SET REVERSE SENSOR (SN)	NO SUCH PARTS	400.00	-
			1,560.00	370.00
	LABOUR			
	CHECK WIRING AND LIGHTING SYSTEM.		80.00	30.00

Report Ref No. CS/TP19015780/Dtf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND FIT FUEL TANK.	NOT NECESSARY	500.00	-
	REMOVE AND REFIT REAR WINDSCREEN.		150.00	120.00
	REMOVE AND REFIT REAR EXHAUST.		300.00	150.00
	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT.		500.00	150.00
	TRANSFER PARTS, ATTACHMENT FROM OLD BOOTLID TO NEW.		200.00	80.00
	CHECK FRONT AND REAR WHEEL ALIGNMENT.		250.00	80.00
	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS.		300.00	180.00
	PANEL BEATING ON AFFECTED AREAS.		2,500.00	2,000.00
	SPRAY PAINTING ON AFFECTED AREAS.		1,800.00	1,400.00
	APPLY ANTI RUST ON AFFECTED AREAS.		200.00	80.00
			6,780.00	4,270.00
GRAND TOTAL			93,657.14	72,949.53
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				58,000.00

Report Ref No. CS/TP19015780/Dtf3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.