

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWER

SINGAPORE 079909

INV No. AC2003885

INV Date 14/05/2020

Reference CC3/CTI19016044/K1ds3n2

Code CT



Vehicle No. SHD 1379K

Insured Veh. YP 8184U

Claim No. SNM19D204275C02/4

Policy No. DMCVSN3039811901

Accident Date 05/09/2019

Inspection Date 09/09/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

HYN



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile							
CHIN	HINA TAIPING INSURANCE (S) PTE LTD Ref : CC3/CTI19016044/K1ds3n2							
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date: 14-05-2020 Code: CTI						
1.	1. Policy Particulars :- THIRD PARTY CLAIM							
	Insured Veh.	YP 8184U	Veh. Inspected	SHD 1379K				
	Policy No.	DMCVSN3039811901	Coverage (\$)	0.00				
	Claim No.	SNM19D204275C02/4	Excess (\$)	0.00				
	Assign From		Assign Date	09/09/2019				
2.		Vehicle Partic	culars & Condition					
	Make & Model	HYUNDAI I30	c.c	1582				
	Engine No.	HIDDEN	Year of Reg.	2017				
	Chassis No.	TMAD281UVHJ127998	Colour	SILVER				
	Odometer	109795	Steering	IN ORDER				
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM				
	General	FAIR						
3.		Condition	ons of Tyres					
		Size	Make	Balance				
	R/H Front Tyre	195/65 R15	MAXXIS	7 mm				
	L/H Front Tyre	195/65 R15	MAXXIS	7 mm				
	R/H Rear Tyre	195/65 R15	MAXXIS	7 mm				
	L/H Rear Tyre	195/65 R15	MAXXIS	7 mm				
4.		•	on of Damages					
	THE VEHICLE SU	STAINED DAMAGES AT THE REA	AR O/S PORTION.					
	DAMAGES SEE D	ETAILS.						
5.		General	Information					
	Accident Date	05/09/2019	Inspection Date	09/09/2019				
	Survey held at PREMIER AUTOMOTIVE SERVICES PTE LTD							
	23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443							
5a.			emarks					
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.							
5b.	,	Estimate Days of Repair						
	ESTIMATED NOR	MAL PERIOD FOR REPAIR:	3 Working Days					
	•							



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 1379K

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	EMBLEM I30	NECESSARY	27.80	27.80
1	EMBLEM CRDI	NECESSARY	29.40	29.40
1	EMBLEM HYUNDAI	NECESSARY	29.40	29.40
1	REAR BUMPER	DEFORMED	811.11	811.11
1	REAR BUMPER SPONGE	SERVICEABLE	79.20	-
1	REAR BUMPER REINFORCEMENT	SERVICEABLE	815.64	-
1	REAR BUMPER REINFORCEMENT CENTRE	SERVICEABLE	79.20	-
2	REAR BUMPER N/S & O/S SIDE BRACKET @\$52.20	SERVICEABLE	104.40	-
1	TAILGATE LOWER GARNISH	CRACKED	362.61	362.61
1	TAILGATE	BUCKLED	2,292.30	2,292.30
1	REAR WINDSCREEN MOULDING	NECESSARY	64.10	64.10
2	TAILGATE LICENSE LAMP @\$18.60	SERVICEABLE	37.20	-
1	HANDLE ASSY-TWIN SWING	SERVICEABLE	36.80	-
	LESS 20% DISCOUNT		-953.83	-723.34
			3,815.33	2,893.38
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
1	SET REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR NO.PLATE (SN)	SERVICEABLE	50.00	-
1	SET TAILGATE STICKERS (SN)	NECESSARY	100.00	100.00
1	SET TAILGATE LOWER GARNISH CLIPS (SN)	NECESSARY	28.00	28.00
1	SUNDRY (SN)	NECESSARY	50.00	20.00
			556.00	396.00
	<u>LABOUR</u>			
	TO REPLACE THE REAR WINDSCREEN INTO NEW SHELL TAILGATE.		120.00	100.00
	TO DISMANTLE AND REFIT THE INNER COMPONENT INTO NEW TAILGATE, TEST WIPER MOTOR AND WATER ETC.		80.00	50.00
	TO DISMANTLE AND REPLACE REVERSE SENSOR AND TEST SYSTEM.		80.00	30.00

Report Ref No. CC3/CTI19016044/K1ds3n2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

3,550.00

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.INCLUDING TO KNOCKOUT, STRAIGHTEM, REPAIR RESHAPE OF THE TAILGATE, END PANEL, ETC.		600.00	400.00
	TO PUTTY AND SPRAY PAINTING ON THE REAR BUMPER ,TAILGATE ,TAILGATE LOWER GARNISH ,END PANEL.		800.00	540.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		120.00	30.00
			1,800.00	1,150.00
	GRAND TOTAL		6,171.33	4,439.38

Report Ref No. CC3/CTI19016044/K1ds3n2

RECOMMENDED COST OF LUMP SUM REPAIRS

(TO ITS PRE-ACCIDENT CONDITION)

KALVIN ANG WEI KUN

Automotive Assessor / Investigator

(()

HO LEONG CHUAN

Automotive Assessor



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1379K

INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

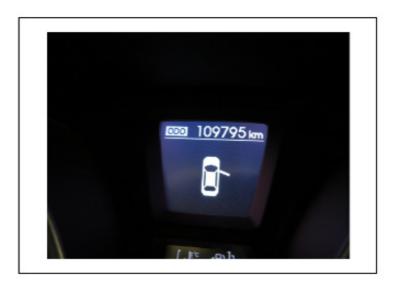



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1379K

RE-INSPECTION









