

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo




Accident Photo



Accident Photo



Accident Photo

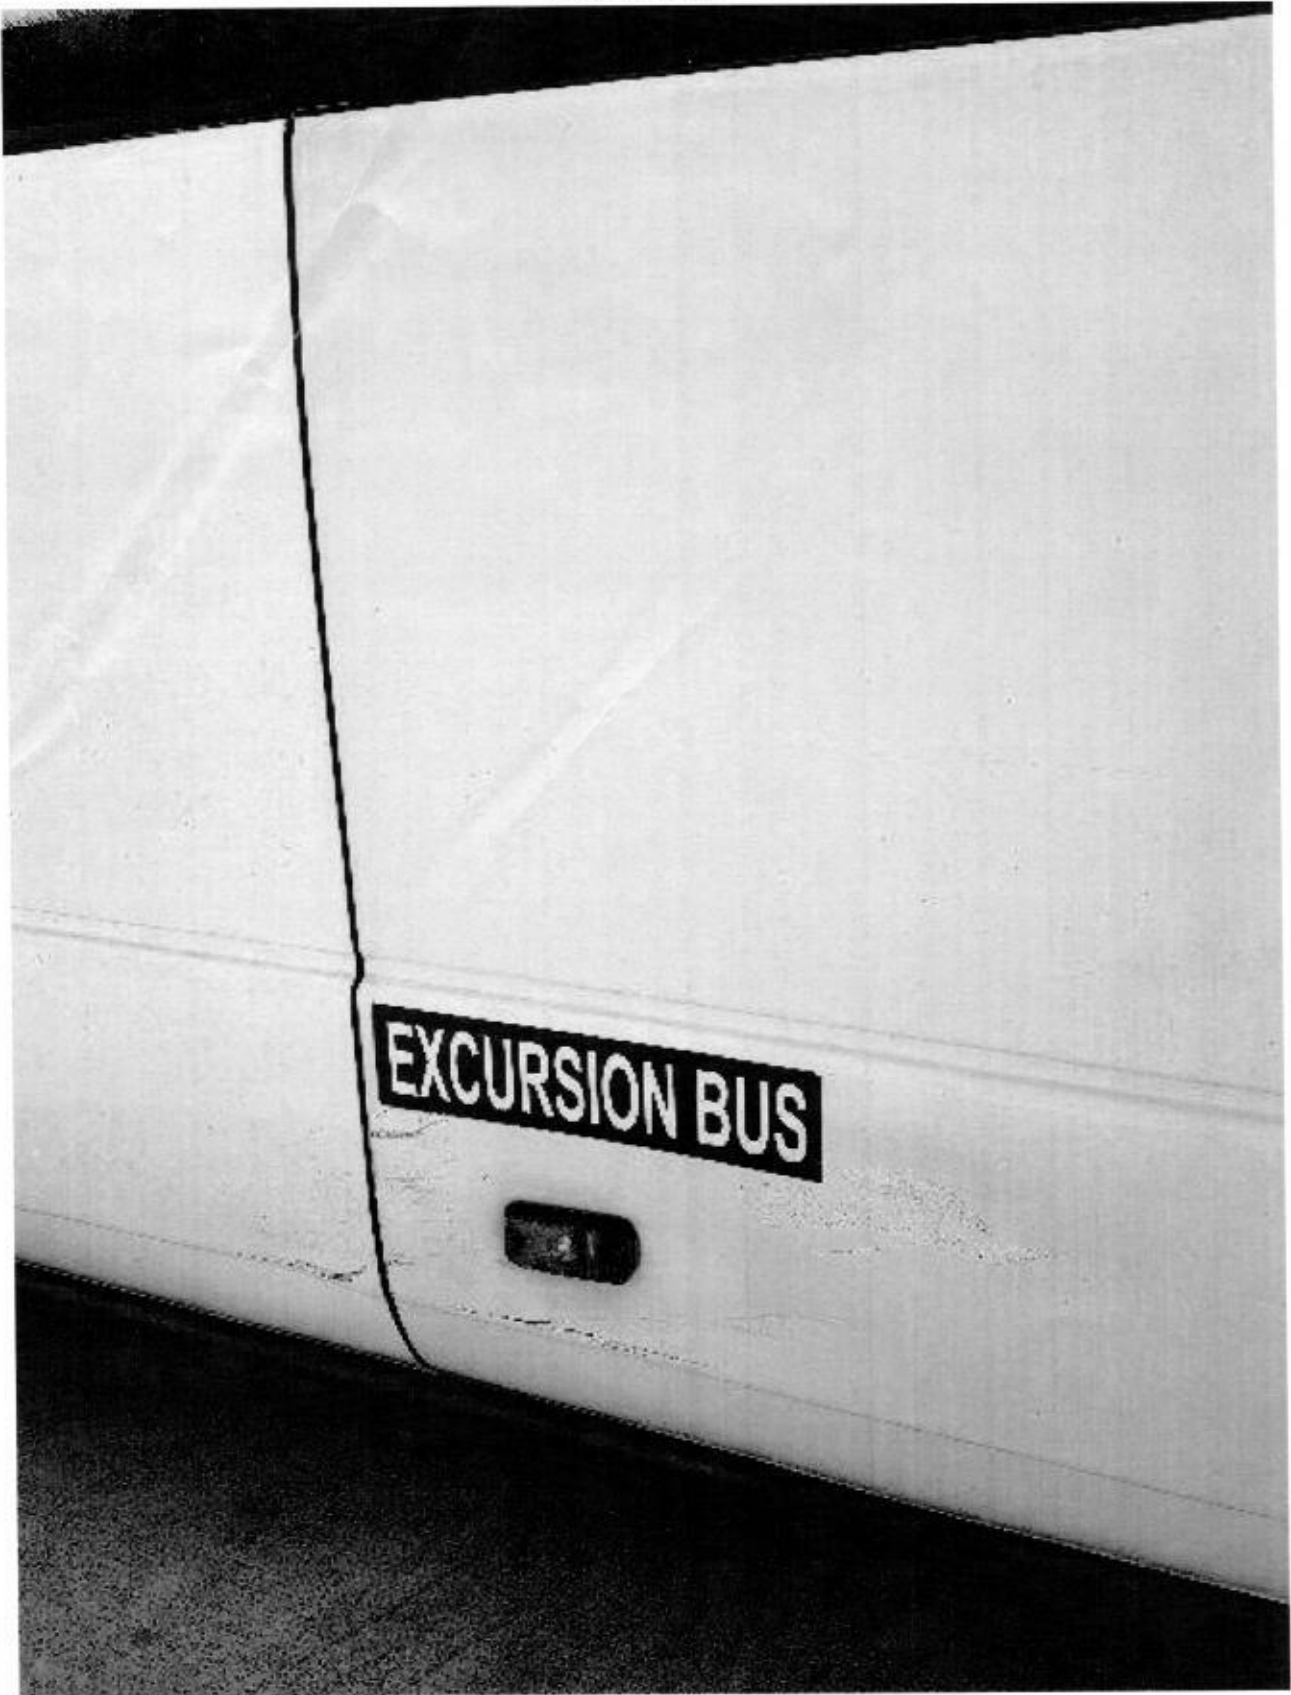

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 8 Kaki Bukit Ave 4 #06-21 Premier @ Kaki Bukit Singapore 415875
Handphone No. : +65 9146 1186 Email : unitedappraisal@live.com.sg
Business Registration Nos. : 200817301N

INVOICE

To : Liew Choon Seng

Date : 03 Dec 2018

c/o : Safe Auto

1 Kaki Bukit Ave 6

Invoice No. : 8093056

Kaki Bukit Autobay Blk C #01-52

Singapore 417883

DESCRIPTION	AMOUNT
Service rendered for appraisal / inspection report :	
Professional inspection fees	SGD 521.00
Photographs 42 pcs	
Transport fees	
Re-inspection fees (work in progress, post repair inspection)	
Total	SGD 521.00
Singapore dollar : FIVE HUNDRED TWENTY ONE ONLY.	
Registration no. : SGH1396B	
Make/Model : Proton Wira 1.5M	
Our reference : UAM18.11.06-AK-STP-SAF-SGH1396B	
<i>All payments made payee to:-</i> " UNITED APPRAISAL & MANAGEMENT PTE LTD "	



for UNITED APPRAISAL & MANAGEMENT PTE LTD

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 8 Kaki Bukit Ave 4 #06-21 Premier @ Kaki Bukit Singapore 415875
Handphone No. : +65 9146 1186 Email : united.appraisal@live.com.sg
Business Registration Nos. : 200817301N

Our ref. : UAM18.11.06-AK-STP-SAF-SGH1396B

Date : 03 Dec 2018

Liew Choon Seng

WITHOUT PREJUDICE

Dear Sir,

Re : Third Party Claim For Vehicle Registration No. SGH1396B

We refer to your instruction to appraise the above-mentioned vehicle on 12 November 2018

A static inspection was carried out and our report is enclosed for your perusal. The estimated cost of repair submitted by Messrs. Safe Auto for SGD 6,726.40 as per our attached schedule has been inspected thoroughly by us against the actual damages sustained on the above-mentioned vehicle and we recommend the replacement and rectification accordingly.

Our revised quotation for the repair is SGD 5,896.76. In our opinion, it to be excessive. Therefore, we recommend a contract lump-sum repair cost. This is more economical than to have the above-mentioned vehicle repaired on parts by/for parts basis. Invariably, the repairer has the prerogative/option for the recommended replacement parts to either be repaired or be replaced.

We have negotiated with the repairer and they have agreed to repair the above-mentioned vehicle for SGD 4,700.00 NETT. Which, in our opinion is fair and reasonable.

The repairer has agreed to undertake the repairs to your requirement at the recommended contract lump-sum. However, we have not given any instruction and authorisation to the repairer to proceed with the repairs.


Under normal circumstances, the entire repair of the damaged vehicle should be completed within a reasonable period of 4 (Four) days.

We are reverting the matter to you for a decision, and enclosed is our vehicle inspection report, appraisal schedule and invoice for services rendered.

Please do not hesitate to contact us if you have any queries on this matter.

Yours faithfully,

United Appraisal & Management Pte Ltd


Ananda K. Biswas Marc
Motor Vehicle Appraiser

Encls. :

The information contained in these document may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you received this document by error, please contact us immediately to arrange for its return.

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 8 Kaki Bukit Ave 4 #06-21 Premier @ Kaki Bukit Singapore 415875
Handphone No. : +65 9146 1186 Email : united.appraisal@live.com.sg
Business Registration Nos. : 200817301N

VEHICLE INSPECTION REPORT

To : Liew Choon Seng

Our ref. : UAM18.11.06-AK-STP-SAF-SGH1396B

Date : 03 Dec 2018

REFERENCE

Assign by	: Liew Choon Seng	Insured	: To be advice
Assign on	: 12 Nov 2018	Policy no.	: To be advice
Inspection on	: 12 Nov 2018	Claim no.	: To be advice
Accident on	: 09 Nov 2018	Sum insured	: To be advice
Workshop name	: Safe Auto	Excess	: Not applicable
Inspection at	: 1 Kaki Bukit Ave 6	3rd party Veh.	: To be advice
	Kaki Bukit Autobay Blk C #01-52	3rd party ins.	: To be advice
	Singapore 417883		

PARTICULARS OF DAMAGED VEHICLE

Registration no.	: SGH1396B	Odometer	: 288159 km
Make / Model	: Proton Wira 1.5M	Chassis no.	: PL1C97SNR6B148748
Regn. date	: 31 May 2006	Engine no.	: 4G15PMX2904
Body colour	: Champagne Gold	Engine cap.	: 1468 cc

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)

Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

TYRE CONDITION ON VEHICLE


	Make	Size	Tread depth	Type of road wheel
Front N/S	: Bridgestone	175/70R13	70%	Alloy
Front O/S	: Bridgestone	175/70R13	70%*	Alloy*
Rear N/S	: Goodyear	175/70R13	70%	Alloy
Rear O/S	: Goodyear	175/70R13	70%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

* Denotes damaged component/s

POINT OF IMPACT

On the off side front in the direction from right to left.

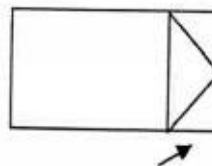**SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT**

The impact of the collision has damaged / affected the bonnet, front bumper, o/s headlamp, front fender, front undercarriage and etc...

Please refer to Annex A (Appraisal Schedule) for a detailed account of the damages and photographs taken.

Note: Reinspection vehicle on 13 Nov 2018 for repair in progress.

RECOMMENDATION

The estimate cost of repair submitted by Messrs Safe Auto as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 4,700.00 to carry out the repairs. Please refer to Annex A (Appraisal Schedule) for a detailed account of the cost estimates.

REMARKS

We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 4 (Four) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,
United Appraisal & Management Pte Ltd



Ananda K. Biswas Marc
Motor Vehicle Appraiser

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SGH1396B

Our reference : UAM18.11.06-AK-STP-SAF-SGH1396B

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
-----	-----	-------------	---------------------	-----------------------	------------------

LIST ITEMS

1	1	Bonnet	Refer To Labour	0.00	0.00 X
2	1	Front grille	Cracked	116.00	116.00 ✓
3	1	Front grille logo	Necessary	32.00	32.00 ✓
4	1set	Front grille clips	* Necessary	30.00	30.00 ✓
5	1	Front bumper	Deformed	428.00	428.00 ✓
6	1set	Front bumper clips	* Necessary	60.00	60.00 ✓
7	1	Front bumper side retainer o/s	* Distorted	98.00	98.00 ✓
8	1	Headlamp o/s	Cracked	432.00	432.00 ✓
9	1	Front side lamp o/s	Cracked	274.00	274.00 ✓
10	1	Front fender o/s	Dented	422.40	422.40 ✓
11	1	Front fender inner shield o/s	Torn	92.00	92.00 ✓
12	1set	Front fender inner shield clips o/s	Necessary	30.00	30.00 ✓
13	1	Air resonator	Deformed	135.00	135.00 ✓
14	1	Front shock absorber o/s (can't see dye)	Affected N/A	276.00	276.00 X
15	1	Front shock absorber mounting o/s (can't see dye)	Affected N/A	92.00	92.00 X
16	1	Front lower arm o/s (can't see dye)	Affected N/A	302.00	302.00 X
17	1	Front knuckle arm o/s (can't see dye)	Affected N/A	373.00	373.00 X
18	1	Front knuckle arm bearing o/s (can't see dye)	Affected N/A	204.00	204.00 X
				3396.40	3396.40
Less 0% / 10%				0.00	339.64
				3396.40	3056.76

SPECIAL NETT ITEMS

1	1	Sundries	Necessary N/A	60.00	40.00 X
2	1	Front alloy rim o/s (can't see dye)	Deep Grazed N/A	500.00	460.00 X
3	1	Front alloy rim cap o/s (can't see dye)	Deep Grazed N/A	40.00	40.00 X
4	1	Front tyre o/s (can't see dye)	Cut N/A	250.00	220.00 X
				850.00	760.00
TOTAL				4246.40	3816.76

2096.40
102
1886.76

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SGH1396B
 Our reference : UAM18.11.06-AK-STP-SAF-SGH1396B

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
<u>LABOUR & MISC CHARGES</u>			Balance C/F	4246.40	3816.76
1		To dismantle / renew the accident damaged portion. To panel beating, reshape, straighten, orientate and align repair / replacement parts.	*	800.00	600.00
2		To disconnect wire harness of electrical component to facilitate repairs, reconnect and check functions.		80.00	60.00 30
3		To remove and refit o/s front undercarriage for replacement of part.	^ ^	300.00	280.00 X
4		To remove and refit o/s tyre to replace o/s rims To perform tyre balancing.	^ ^	80.00	60.00 X
5		To conduct computerize full wheel alignment.	^ ^	120.00	100.00 X
6		To apply undercoating on the accident repair and replaced panel for rust protection.	*	100.00	80.00 40
7		Supply spray paint material and necessary items to respray bonnet, front grille, front bumper, o/s front fender and other affected area / panel.	*	1000.00	900.00 800
TOTAL				2480.00	2080.00
Total Parts and Labour Cost of Repair				6726.40	5896.76
Less (Lumpsum repair adjustment)					1196.76
Adjustment Parts and Labour Cost of Repair					4700.00

3356.76
 2681

AUTOMOBILE INSPECTION SERVICES PTE LTD

Postal Address : BLK 146 , POTONG PASIR AVE 1 , #02-145 SINGAPORE 350146

Reg. No. 200005790R TEL NO : 62860155 (3 LINES) FAX : 62841539

SURVEY/ADJUSTING DAMAGES ON MOTOR VEHICLE , LICENSED APPRAISERS.

VEHICLE DAMAGE INSPECTION REPORT

Our File No: IIIA/0010/19

Date: 19/02/2019

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D18MFL0001888
Claimant Vehicle No: SGH1396B Insured Vehicle No: PC3779L
Date of Loss: 08/11/2018 Nature of Claim: TP Claim No: MFL2018D0000172

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SGH1396B
Make & Model: PROTON WIRA, 1.5 (M) Engine No: 4G15PMX2904
Reg. Date: 31/05/2006 (Man. Year: 2006) Chassis No: PL1C97SNR6B148748
Colour: Beige Odometer: 288159 km
Engine Capacity: 1468 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Average

CONDITION OF TYRES

Front Tyre Size: 175/70R13 Rear Tyre Size: 175/70R13
Front Left Side: Bridgestone 4 mm Rear Left Side: Bridgestone 4 mm
Front Right Side: Bridgestone 4 mm Rear Right Side: Bridgestone 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	3,816.76	1,820.16	1,996.60	52.31
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,080.00	955.00	1,125.00	54.09
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	5,896.76	2,775.16	3,121.60	52.94
Approved Total (Overridden) (S\$)		2,200.00		
Nett Amount (S\$)	5,896.76	2,200.00	3,696.76	62.69

INSPECTION

Date of Assignment: 12/11/2018
Date Inspected: 12/11/2018, 13/11/2018, 15/11/2018 Inspected At: Safe Auto (KAKI BUKIT)
1 KAKI BUKIT AVENUE 6, AUTOBAY , #
01-52
Singapore 417883
Estimated Period of Repair: 4.0 days

Adjuster: LOOI

Manager: SOPHIA VA
(Administrator)

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

DESCRIPTION OF DAMAGES

DAMAGE TO THE RH FRONT PORTION. (PLEASE REFER TO PHOTOS ATTACHED)

PRS

AT THE TIME OF INSPECTION, NO ESTIMATE WAS PROVIDED AND REPAIRER IS ENGAGING THEIR OWN SURVEYOR.(PRS ON 12/11/2018)

PAPER RE-SURVERY

AS PER YOUR INSTRUCTIONS ON 26/01/2019, TO CONDUCT A PAPER RE-SURVEY.

BASED ON THE DOCUMENTS PROVIDED, AFTER OUR ASSESSMENT, A LUMP SUM OF \$2,200.00 AND 4 DAYS IS SUFFICIENT FOR THE REPAIRS.

THE ABOVE IS ONLY OUR OPINION & SERVES AS A GUIDELINE FOR YOUR EASY SETTLEMENT.

LUMP SUM REPAIR RECOMMENDED BY THEIR SURVEYOR WAS \$4,700.00.

WE NOW LEAVE THE MATTER FOR YOUR FURTHER PERUSAL.

SPECIAL REMARKS

THIS SURVEY WAS CONDUCTED STRICTLY ON A "WITHOUT PREJUDICE" BASIS.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 19 Feb 2019)
Parts: 143	PROTON WIRA 1.5 (M) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: Automobile Inspection Services Pte Ltd/SGH1396B/19/02/2019 17:42	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT GRILLE	NECESSARY	116.00 FL	*116.00 FL
2	1		*FRONT GRILLE LOGO	NECESSARY	32.00 FL	*32.00 FL
3	1		*FRONT GRILLE CLIPS - SET	NECESSARY	30.00 FL	*6.00 FL
4	1		*FRONT BUMPER	NECESSARY	428.00 FL	*428.00 FL
5	1		*FRONT BUMPER CLIPS - SET	NECESSARY	60.00 FL	*20.00 FL
6	1		*FRONT BUMPER SIDE RETAINER RH (Price incorrect)	NECESSARY	98.00 FL	*45.00 FL
7	1		*HEADLAMP RH	NECESSARY	432.00 FL	*432.00 FL
8	1		*FRONT SIDE LAMP RH	NECESSARY	274.00 FL	*274.00 FL
9	1		*FRONT FENDER RH	NECESSARY	422.40 FL	*422.40 FL
10	1		*FRONT FENDER INNER SHIELD RH	NECESSARY	92.00 FL	*92.00 FL
11	1		*FRONT FENDER INNER SHIELD RH - SET	NECESSARY	30.00 FL	*20.00 FL
12	1		*AIR RESONATOR	NECESSARY	135.00 FL	*135.00 FL
13	1		*FRONT SHOCK ABSORBER RH	NOT NECESSARY	276.00 FL	*-FL
14	1		*FRONT SHOCK ABSORBER MOUNTING RH	NOT NECESSARY	92.00 FL	*-FL
15	1		*FRONT LOWER ARM RH	NOT NECESSARY	302.00 FL	*-FL
16	1		*FRONT KNUCKLE ARM	NOT NECESSARY	373.00 FL	*-FL
17	1		*FRONT KNUCKLE ARM BEARING RH	NOT NECESSARY	204.00 FL	*-FL
18	1		*SUNDRIES	NOT NECESSARY	40.00 FS	*-FS
19	1		*FRONT ALLOY RIM RH	NOT NECESSARY	460.00 FS	*-FS
20	1		*FRONT ALLOY RIM CAP RH	NOT NECESSARY	40.00 FS	*-FS
21	1		*FRONT TYRE RH	NOT NECESSARY	220.00 FS	*-FS

F=Franchise part, S=SpcNett, L=ListItemDisc.

Sub Total (\$\$)	4,156.40	2,022.40
- List Item Discount on L Items 10.00/10.00% (\$\$)	339.64	202.24
Total Parts (\$\$)	3,816.76	1,820.16

Automobile Inspection Services Pte Ltd/SGH1396B/19/02/2019 17:42. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE/ RENEW THE ACCIDENT DAMAGED PORTION. TO PANEL BEATING, RESHAPE, STRAIGHTEN, ORIENTATE & ALIGN REPAIR/ REPLACEMENT PARTS.	New	600.00	400.00
2	TO DISCONNECT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS, RECONNECT & CHECK FUNCTIONS.	New	60.00	30.00
3	TO REMOVE & REFIT RH FRONT UNDERCARRIAGE FOR REPLACEMENT OF PART.	New	280.00	0.00
4	TO REMOVE & REFIT RH TYRE, TO REPLACE RH RIMS & TO PERFORM TYRE BALANCING.	New	60.00	0.00
5	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT.	New	100.00	0.00
6	TO APPLY UNDERCOATING ON THE ACCIDENT AREA. REPAIR & REPLACED PANEL FOR RUST PROTECTION.	New	80.00	25.00
7	SUPPLY SPRAY PAINT MATERIAL & NECESSARY ITEMS TO RESPRAY BONNET, FRONT GRILLE, FRONT BUMPER, RH FRONT FENDER & OTHER AFFECTED AREA/ PANEL.	New	900.00	500.00
Gross Labour Cost (\$\$)			2,080.00	955.00

Automobile Inspection Services Pte Ltd/SGH1396B/19/02/2019 17:42. Not valid without Reference section.

< END OF ESTIMATES >



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

INDIA INTERNATIONAL INSURANCE PL

Ref : CS/LAW19017009/Uqd3s2

c/o TAN KOK QUAN PARTNERSHIP
1 WALLICH STREET #07-02
GUOCO TOWERS SINGAPORE 07881

Date : 11-11-2019



Code : III2

1. Policy Particulars :- THIRD PARTY CLAIM (RESURVEY INSPECTION)

Insured Veh.	PC 3779L	Veh. Inspected	SGH 1396B
Policy No.	CF.YHL.so.0507.18-iii	Coverage (\$)	0.00
Claim No.	MFL2018D0000172(TPD)	Excess (\$)	0.00
Assign From	LEE YING HUI	Assign Date	22/09/2019

2. Vehicle Particulars & Condition

Make & Model	PROTON WIRA (M)	c.c	1468
Engine No.	HIDDEN	Year of Reg.	2006
Chassis No.	PL1C97SNR6B148748	Colour	GOLD
Odometer	313596	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	175/70 R13	GOODYEAR	5 mm
L/H Front Tyre	175/70 R13	GOODYEAR	5 mm
R/H Rear Tyre	175/70 R13	GOODYEAR	5 mm
L/H Rear Tyre	175/70 R13	GOODYEAR	5 mm

4. Description of Damages

THE VEHICLE HAD COMPLETED ITS REPAIR WORKS. REPAIR CONDITION SEE DETAILS.
--

5. General Information

Accident Date	09/11/2018	Inspection Date	01/10/2019
Survey held at	SAFE AUTO 1 KAKI BUKIT AVE 6 #01-52 AUTOBAY KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGH 1396B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET (NPA)	REPAIRED SEE LABOUR	-	-
1	FRONT GRILLE	REPLACED	116.00	116.00
1	FRONT GRILLE LOGO	REPLACED	32.00	32.00
1	SET FRONT GRILLE CLIPS	REPLACED	30.00	30.00
1	FRONT BUMPER	REPLACED	428.00	428.00
1	SET FRONT BUMPER CLIPS	REPLACED	60.00	60.00
1	FRONT BUMPER SIDE RETAINER O/S	REPLACED	98.00	45.00
1	HEADLAMP O/S	REPLACED	432.00	432.00
1	FRONT SIDE LAMP O/S	REPLACED	274.00	274.00
1	FRONT FENDER O/S	REPLACED	422.40	422.40
1	FRONT FENDER INNER SHIELD O/S	REPLACED	92.00	92.00
1	SET FRONT FENDER INNER SHIELD CLIPS O/S	REPLACED	30.00	30.00
1	AIR RESONATOR	REPLACED	135.00	135.00
1	FRONT SHOCK ABSORBER O/S (CAN'T SEE DAMAGE)	NOT CHANGED	276.00	-
1	FRONT SHOCK ABSORBER MOUNTING O/S (CAN'T SEE DAMAGE)	NOT CHANGED	92.00	-
1	FRONT LOWER ARM O/S (CAN'T SEE DAMAGE)	NOT CHANGED	302.00	-
1	FRONT KNUCKLE ARM O/S (CAN'T SEE DAMAGE)	NOT CHANGED	373.00	-
1	FRONT KNUCKLE ARM BEARING O/S (CAN'T SEE DAMAGE)	NOT CHANGED	204.00	-
	LESS 10% DISCOUNT		-	-209.64
			3,396.40	1,886.76
SPECIAL NETT ITEMS				
1	SUNDRIES (SN)	NOT CHANGED	60.00	-
1	FRONT ALLOY RIM O/S (CAN'T SEE DAMAGE) (SN)	NOT CHANGED	500.00	-
1	FRONT ALLOY RIM CAP O/S (CAN'T SEE DAMAGE) (SN)	NOT CHANGED	40.00	-
1	FRONT TYRE O/S (CAN'T SEE DAMAGE) (SN)	NOT CHANGED	250.00	-
			850.00	-

Report Ref No. CS/LAW19017009/Uqd3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE / RENEW THE ACCIDENT DAMAGED PORTION. TO PANEL BEATING, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF BONNET.		800.00	600.00
	TO DISCONNECT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS, RECONNECT AND CHECK FUNCTIONS.		80.00	30.00
	TO REMOVE AND REFIT O/S FRONT UNDERCARRIAGE FOR REPLACEMENT OF PART.	NOT NECESSARY	300.00	-
	TO REMOVE AND REFIT O/S TYRE TO REPLACE O/S RIMS TO PERFORM TYRE BALANCING.	NOT NECESSARY	80.00	-
	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO APPLY UNDERCOATING ON THE ACCIDENT REPAIR AND REPLACED PANEL FOR RUST PROTECTION.		100.00	40.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESRAY BONNET, FRONT GRILLE, FRONT BUMPER, O/S FRONT FENDER AND OTHER AFFECTED AREA / PANEL.		1,000.00	800.00
			2,480.00	1,470.00
	GRAND TOTAL		6,726.40	3,356.76
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,700.00

Report Ref No. CS/LAW19017009/Uqd3s2

CHUA KANG SENG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.