

22/5/2003

ASS. REC. BY:

Surveyor: Bryon

REF:

CS/FCI 190/8785/Dyd302

Special Instruction:

ASSIGNMENT (Office)

From (Person):

Jodanne Yong

of

FCI

Date/Time:

5:43pm @ 22/10/19

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To inspect Vehicle No:

SHC 8564B

Insured:

SHC 88874

at Workshop m/s

chunni Motor

Tel:

65425119

of

Amk Autopoint # 01-05/06

Policy No:

Claim No:

D19006694MFSH

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

20/10/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

10:33am @ 23/10/19

Person Contacted:

Lynn

Vehicle

IN/OUT

Date/Time	Action/Instruction	Estimated
	SHC 8564B - C3 / AXA 13016 824 / Ycm3c3	DOA: 7/9/2013
	SHC 88874 - C8 / FCI 160/2956 / Uth3c2	DOA: 7/7/2016


REG BY

SLP

ASSIGNMENT

COE 2023 Dec

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To inspect Vehicle No: _____
at Workshop no: _____
of _____
Insured: _____
Policy No: _____
Claims No: _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

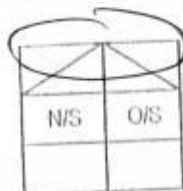

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____

GIA / PR Seen: _____

Est. Repair: _____

Lim Sum: _____

Consistent? : Yes or No

Consistent? : Yes or No

12 days Res: Yes or No

20 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SAC 8564 B Regn: 2015 Dec
Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: Hyundai I40 C.C: 1685
Colour: Blue A/C: Insured / Std / NI / NA
Sp. Reading: 573899 T/Radio: Insured / Std / NI / NA
Eng/No: D4FDEU495789
C/No: KMHLB41UMGU080670
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 205/60 R16
R: — 11 —
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or Hankook

Front: _____ Rear: _____
R/Bal: S mm R/Bal: S mm
L/Bal: S mm L/Bal: S mm
D.O.A: 20/10/2019 D.O.I: 23/10/2019
Survey held at: Chunni MK
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Runt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time: 5/11/19 Action / Instruction: First report sent Preli by email

13/11/2019 found 2/5 20000/- with 12 days 70% (Red \$36075-96 64%)

RECEIVED 18 NOV 2019

Date/Time, File Pass to: ☐ : Preli. Report

1) ☐ : Final Report

Date/Time, File Return to: 18/11/19 Typist

Report Form: Comp Sum. R.P.R. \$20,000/-

Days Of Repair: 12

Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Invs (\$)
☐ : Weekend (\$)

Survey Fee: _____
Transportation: _____

S + PS: \$1

Phone: 580

Others: 850

Total: 18/11/19

46x15=690
170+690
50
50+50
200
1210



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19006694MFSH

Date: 05 Nov 2019

Our Ref: CS/FCI19018785/Dyf3

The Motor Claims Department
MS First Capital Insurance Ltd

Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SHC8564B


Please be informed that we had conducted the inspection of the abovementioned vehicle on 23/10/2019 at the premises of M/s CHUNNI MOTOR, and have the following to report:-

Workshop Estimate Amount
Revised Estimate Amount
"Check" Items Amount
Market Value
LTA Reimbursement Value
Nett Value

: S\$	<u>56,075.96</u>	.
: S\$	<u>24,881.92</u>	.
: S\$	<u>-</u>	.
: S\$	<u>-</u>	.
: S\$	<u>-</u>	.
: S\$	<u>-</u>	.

Description of Damage:

The vehicle sustained damages
at the FRONT PORTION.

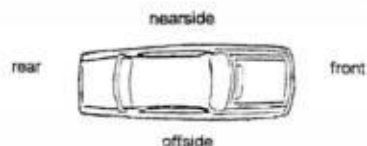

Yours faithfully

Bryan Ang
Licensed Appraiser

MOTOR SURVEY ASSIGNMENT

Date	21-10-2019	Our Ref No. D19006694MFSH
Accident Date	20-10-2019	Claim Type. Third Party
Insured Vehicle	SHC8887U	Third Party Vehicle. SHC8564B
Survey Location	AMK AUTOPOINT, SOON HOCK MOTOR, #01-05/06.	
Contact Person.	LYNN OR IRENE - 65421726	
Contact No.	65427162/ 0	Fax No. 65426039
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	CHUNNI MOTOR WORK PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	JOANNEY	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.

This is a computer generated letter, no signature required.

Yvonne Wong (LKK Auto)

From: Yvonne Wong (LKK Auto)
Sent: Tuesday, November 05, 2019 5:17 PM
To: 'CWS Motor Claims'
Cc: 'Joanne Yong'; SUR
Subject: SURVEY ASSESSMENT - D19006694MFSH/1
Attachments: SHC8564B DOA 20102019 REVERT.pdf

Dear Sir/ Madam

Enclosed preliminary revised of vehicle SHC8564B
Date of survey : 23/10/2019
Number of days : 12 days
Thank you.

Best Regards,

Yvonne Wong (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: yvonne.wong@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Best Regards,

Yvonne Wong (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: yvonne.wong@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)

Sent: Wednesday, October 23, 2019 10:34 AM

To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>

Cc: 'Joanne Yong' <Joanne.yong@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>

Subject: RE: SURVEY ASSESSMENT - D19006694MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [mailto:cwsmotorclaims@msfirstcapital.com.sg]

Sent: Tuesday, 22 October 2019 5:43 PM

To: ASSIGNMENTS@LKKAUTO.COM

Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Joanne Yong <Joaneyong@msfirstcapital.com.sg>

Subject: PRI: SURVEY ASSESSMENT - D19006694MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Note: All the accident reports are uploaded into CWS for your perusal.

Best Regards,

Admin Team

Claim Workflow System


Motor Claims Department

MS First Capital Insurance Limited

Tel : 6507 3848

Fax : 6507 3849

PS: This is a system generated mail. Please do not reply to this mail.

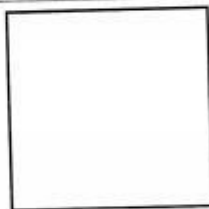

This email has been checked for viruses by AVG antivirus software.
www.avg.com

CHUNNI MOTOR WORK PTE LTD**REPAIR ESTIMATE***

VEHICLE NO : SHC 8564B

DATE : 21.10.2019

MAKE :

TEL : 6542 5119

MODEL : HYUNDAI i40

FAX : 6542 6039

FCI

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Bonnet <i>new</i>			\$ 2,265.90
	Bonnet Hinge (LH/RH) <i>new</i>	\$	41.00	\$ 82.00
	Bonnet Lock <i>new</i>			\$ 36.90
	Bonnet Absorber <i>new</i>	\$	58.10	\$ 116.20
	Bonnet Insulator <i>new</i> / <i>crumpled</i>			\$ 196.50
	Bonnet Insulator Clips <i>new</i>			\$ 8.40
	Radiator Grille <i>broken</i>			\$ 1,110.10
	Radiator Grille H Emblem <i>broken</i>			\$ 39.50
	Front Bumper Cover <i>new</i>			\$ 1,052.20
	Front Bumper Sponge <i>new</i>			\$ 99.20
	Front Bumper Reinforcement <i>broken</i>			\$ 402.10
	Front Bumper Grille (LH) <i>broken</i> / <i>destroyed</i>			\$ 93.60
	Front Bumper Grille Airduct (LH) <i>broken</i> / <i>destroyed</i>			\$ 26.20
	Front Bumper Lip <i>new</i>			\$ 54.90
	Front Bumper Bracket Top (LH/RH) <i>new</i>	\$	22.40	\$ 44.80
	Front Bumper Bracket (LH/RH) <i>new</i> / <i>broken</i> / <i>new</i>	\$	24.60	\$ 49.20
	Headlamp Support Top Cover <i>new</i>			\$ 222.60
	Headlamp Support Panel Assy <i>broken</i>			\$ 907.40
	Headlamp (LH/RH) <i>broken</i> / <i>new</i> / <i>broken</i>	\$	1,388.00	\$ 2,776.00
	Headlamp Halogen Bulb (RH) <i>new</i>			\$ 14.40
	Radiator <i>new</i> / <i>punctured</i> / <i>new</i>			\$ 698.30
	Radiator Fan Blade, Cowling, Motor Assy <i>broken</i>			\$ 792.95
	Radiator Bracket (RH/LH) <i>new</i>	\$	6.50	\$ 13.00
	Radiator Hose Upper <i>new</i>			\$ 36.50
	Radiator Hose Lower <i>new</i>			\$ 36.50
	Radiator Expansion Tank <i>new</i>			\$ 28.30
	Radiator Guard <i>new</i>	\$	20.00	\$ 40.00
	Horn Unit (LH/RH) <i>new</i> / <i>broken</i> / <i>new</i>	\$	73.80	\$ 147.60
	Horn Wire <i>new</i>			\$ 156.50
	Front Fender (RH) <i>new</i>			\$ 566.30
	Front Fender Apron Panel (RH) <i>new</i>			\$ 637.00
	Front Fender Shield (LH/RH) <i>new</i> / <i>destroyed</i> / <i>new</i>	\$	174.90	\$ 349.80
	Air Duct <i>new</i>			\$ 134.60
	Aircon Condenser <i>new</i> / <i>punctured</i> / <i>new</i>			\$ 927.50
	Aircon Suction & Liquid Hose <i>new</i> / <i>new</i>			\$ 624.00
	Aircon Discharge Hose <i>new</i> / <i>new</i>			\$ 162.60
	Aircon Compressor <i>new</i> / <i>destroyed</i>			\$ 2,578.00
	Frt Safety Belt (Assy) (LH/RH) <i>new</i>	\$	475.40	\$ 950.80
	Wiper Container <i>broken</i>			\$ 61.90
	Wiper Container Motor <i>new</i>			\$ 75.00
	Front Wheel Rim (RH) <i>new</i>			\$ 325.30
	Front Wheel Hub Cap (RH) <i>new</i>			\$ 107.10
	Front Wheel Bearing <i>new</i>			\$ 540.50
	Front Shock Absorber (Assy) (RH) <i>new</i>			\$ 342.20
	Front Shock Absorber Mounting (RH) <i>new</i>			\$ 108.80
	Front Drive Shaft (RH) <i>new</i>			\$ 1,030.80

17584.25

Amount

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Rack & Pinion Assy NH			\$ 969.60 X
	STG Tie End NH			\$ 62.60 X
	Stabilizer Bar NH			\$ 252.30 X
	Stabilizer Bar Bush (RH) HH			\$ 16.40 X
	Stabilizer Bar Link HH			\$ 61.10 X
	Stabilizer Bracket NH			\$ 24.00 X
	Front Suspension Lower Arm (RH) HH			\$ 529.30 X
	Front Chasis Member SMC O/S			\$ 1,060.70 ✓
	Knuckle Arm (RH) HH			\$ 552.00 X
	Fan Belt from 50% SM			\$ 116.20 ✓ 58.10
	Fan Belt Tensioner 3 NH			\$ 263.40 X
	Engine Mounting 2x 1/2			\$ 456.30 ✓
	Engine Under Cover from destroyed			\$ 334.60 ✓
	Engine Crossmember NH			\$ 2,094.40 X
	Inter Cooler HH			\$ 1,032.50 X
	Inter Cooler Mounting (2 PCS) HH			\$ 25.90 X
	Hose B To Inter Cooler NH			\$ 229.70 X
	Hose C To Inter Cooler Inlet HH			\$ 294.50 X
	Pipe To Inter Cooler HH			\$ 167.05 X
	Pipe To Inter Cooler Outlet HH			\$ 244.55 X
	ABS Sensor HH			\$ 234.00 X
	Wiring-ECM HH			\$ 3,243.00 X
	Wiring-FEM,RH HH			\$ 168.00 X
	Actuator - Swirl Control broken		9065.70	\$ 814.60 ✓
	Intake Manifold Assy NH			\$ 1,141.10 X
	Airbag Complete Activated			\$ 2,948.50 ✓
	Airbag Control Module Activated			\$ 1,140.40 ✓
	Steering Angle Assy 1/2 Down			\$ 1,150.60 X ✓
	Sensor Assy Impact -Frt Impact HH			\$ 198.30 X
	Airbag Sensor 2 Activated		\$ 580.00	\$ 1,160.00 ✓
	Electric Power Steering NH			\$ 3,641.00 X
	Gearbox NH			\$ 14,808.00 X
	Gearbox Mounting HH			\$ 215.40 X
			26649.95	
			21319.96	
				\$ 60,719.95
				\$ 12,143.99
				\$ 48,575.96
	Front Number Plate broken / destroyed			\$ 25.00 Nett ✓
	Front No Plate Trim Cover broken			\$ 30.00 Nett ✓
	Front Fender Advertisement Logo (LH/RH) O/S NH m/s NH		\$ 100.00	\$ 200.00 Nett ✓
	Front Door Comfort Logo (RH) NH			\$ 75.00 Nett X
	Front Door Advertisement Logo (RH) NH			\$ 100.00 Nett X
	Front Tyre (RH) NH		203.10	\$ 216.00 Nett X
				\$ 646.00

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Labour Charge			
	Panel Beating			\$ 1,800.00
	Spray Painting Charge			\$ 1,750.00
	Wiring Charge			\$ 100.00
	Tuff Kote			\$ 150.00
	Towing Charge			\$ 50.00
	Front Chassis Alignment Charge			\$ 400.00
	Remove/Refix Undercarriage (FRT)			\$ 200.00
	FRT Wheel Alignment			\$ 120.00
	Remove/Refix Aircon & Refill Gas		3280.00	\$ 150.00
	Remove/Refix Engine/Gearbox			\$ 650.00
	Re-set Frt ABS System			\$ 200.00
	R/Refix Air Bag/Steering Wheel/Dashboard/Seat			\$ 550.00
	Diagnostic & Resetting To Erase Fault Code			\$ 480.00
	TOTAL LABOUR			\$ 6,600.00
	ESTIMATE TOTAL			\$ 55,821.96
				56075.96
	23/10/2019 @ 1400 hrs N/A Actual L/Sum 12 dgs. <i>(Signature)</i> d.k.k. Andri	Spr L/S	24803.06 254.00 25057.06 20000/-	

LK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:
Signature: _____
Date: _____

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Radiator Hose Upper Support Bracket <i>broken</i>			\$ 128.00
	Idle Pulley <i>broken</i>			\$ 189.50
	SUB TOTAL			\$ 317.50
	LESS 20%			\$ 63.50
	DISCOUNTED TOTAL			\$ 254.00
	<i>01/11/2019</i> <i>Ryan</i> <i>2 KK Auto</i> 			

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19018785/Dyd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 19-11-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 8887U	Veh. Inspected	SHC 8564B	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19006694MFSH	Excess (\$)	0.00	
Assign From	JOANNE YONG	Assign Date	22/10/2019	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI I40	c.c	1685	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	KMHLB41UMGU080670	Colour	BLUE	
Odometer	573899	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	HANKOOK	5 mm	
L/H Front Tyre	205/60 R16	HANKOOK	5 mm	
R/H Rear Tyre	205/60 R16	HANKOOK	5 mm	
L/H Rear Tyre	205/60 R16	HANKOOK	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	20/10/2019	Inspection Date	23/10/2019	
Survey held at	CHUNNI MOTOR WORK PTE LTD BLK 10 ANG MO KIO IND. PARK 2A, #03-19 AMK AUTOPOINT SINGAPORE 568047.			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			12 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 8564B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET	BUCKLED	2,265.90	2,265.90
2	BONNET HINGE (LH/RH) @\$41.00	TO REPAIR SEE LABOUR	82.00	-
1	BONNET LOCK	BENT	36.90	36.90
2	BONNET ABSORBER @\$58.10	NOT NECESSARY	116.20	-
1	BONNET INSULATOR	BENT / CRUMPLED	196.50	196.50
1	BONNET INSULATOR CLIPS	NECESSARY	8.40	8.40
1	RADIATOR GRILLE	BROKEN	1,110.10	1,110.10
1	RADIATOR GRILLE H EMBLEM	NECESSARY	39.50	39.50
1	FRONT BUMPER COVER	TORN	1,052.20	1,052.20
1	FRONT BUMPER SPONGE	TORN	99.20	99.20
1	FRONT BUMPER REINFORCEMENT	BROKEN	402.10	402.10
1	FRONT BUMPER GRILLE (LH)	BROKEN / DISLODGE	93.60	93.60
1	FRONT BUMPER GRILLE AIRDUCT (LH)	BROKEN / DISLODGE	26.20	26.20
1	FRONT BUMPER LIP	NOT NECESSARY	54.90	-
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$22.40	NOT NECESSARY	44.80	-
2	FRONT BUMPER BRACKET (LH/RH) @\$24.60	O/S BROKEN / N/S NOT NECESSARY	49.20	24.60
1	HEADLAMP SUPPORT TOP COVER	CRACKED	222.60	222.60
1	HEADLAMP SUPPORT PANEL ASSY	BROKEN	907.40	907.40
2	HEADLAMP (LH/RH) @\$1388.00	BROKEN / MOUNTING BROKEN	2,776.00	2,776.00
1	HEADLAMP HALOGEN BULB (RH)	NOT NECESSARY	14.40	-
1	RADIATOR	PUNCTURE / BENT	698.30	698.30
1	RADIATOR FAN BLADE,COWLING,MOTOR ASSY	BROKEN	792.95	792.95
2	RADIATOR BRACKET (RH/LH) @\$6.50	NOT NECESSARY	13.00	-
1	RADIATOR HOSE UPPER	NOT NECESSARY	36.50	-
1	RADIATOR HOSE LOWER	NOT NECESSARY	36.50	-
1	RADIATOR EXPANSION TANK	NOT NECESSARY	28.30	-
2	RADIATOR GUARD @\$20.00	NOT NECESSARY	40.00	-

Report Ref No. CS/FCI19018785/Dyd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	HORN UNIT (LH/RH) @\$73.80	O/S BROKEN / N/S NOT NECESSARY	147.60	73.80
1	HORN WIRE	NOT NECESSARY	156.50	-
1	FRONT FENDER (RH)	DENTED	566.30	566.30
1	FRONT FENDER APRON PANEL (RH)	DENTED	637.00	637.00
2	FRONT FENDER SHIELD (LH/RH) @\$174.90	O/S DISLODGE / N/S NOT NECESSARY	349.80	174.90
1	AIR DUCT	NOT NECESSARY	134.60	-
1	AIRCON CONDENSER	PUNCTURE / BENT	927.50	927.50
1	AIRCON SUCTION & LIQUID HOSE	BENT	624.00	624.00
1	AIRCON DISCHARGE HOSE	BENT	162.60	162.60
1	AIRCON COMPRESSOR	DISTORTED	2,578.00	2,578.00
2	FRT SAFETY BELT (ASSY)(LH/RH) @\$475.40	ACTIVATED	950.80	950.80
1	WIPER CONTAINER	BROKEN	61.90	61.90
1	WIPER CONTAINER MOTOR	DAMAGED	75.00	75.00
1	FRONT WHEEL RIM (RH)	NOT NECESSARY	325.30	-
1	FRONT WHEEL HUB CAP (RH)	NOT NECESSARY	107.10	-
1	FRONT WHEEL BEARING	NOT NECESSARY	540.50	-
1	FRONT SHOCK ABSORBER (ASSY)(RH)	NOT NECESSARY	342.20	-
1	FRONT SHOCK ABSORBER MOUNTING (RH)	NOT NECESSARY	108.80	-
1	FRONT DRIVE SHAFT (RH)	NOT NECESSARY	1,030.80	-
1	RACK & PINION ASSY	NOT NECESSARY	969.60	-
1	STG TIE END	NOT NECESSARY	62.60	-
1	STABILIZER BAR	NOT NECESSARY	252.30	-
1	STABILIZER BAR BUSH (RH)	NOT NECESSARY	16.40	-
1	STABILIZER BAR LINK	NOT NECESSARY	61.10	-
1	STABILIZER BRACKET	NOT NECESSARY	24.00	-
1	FRONT SUSPENSION LOWER ARM (RH)	NOT NECESSARY	529.30	-
1	FRONT CHASSIS MEMBER O/S	BUCKLED	1,060.70	1,060.70
1	KNUCKLE ARM (RH)	NOT NECESSARY	552.00	-
1	FAN BELT TENSIONER	NOT NECESSARY	263.40	-
1	ENGINE MOUNTING	BENT	456.30	456.30
1	ENGINE UNDER COVER	TORN / DISLODGE	334.60	334.60

Report Ref No. CS/FCI19018785/Dyd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE CROSSMEMBER	NOT NECESSARY	2,094.40	-
1	INTER COOLER	NOT NECESSARY	1,032.50	-
1	INTER COOLER MOUNTING (2 PCS)	NOT NECESSARY	25.90	-
1	HOSE B TO INTER COOLER	NOT NECESSARY	229.70	-
1	HOSE C TO INTER COOLER INLET	NOT NECESSARY	294.50	-
1	PIPE TO INTER COOLER	NOT NECESSARY	167.05	-
1	PIPE TO INTER COOLER OUTLET	NOT NECESSARY	244.55	-
1	ABS SENSOR	NOT NECESSARY	234.00	-
1	WIRING-ECM	NOT NECESSARY	3,243.00	-
1	WIRING-FEM,RH	NOT NECESSARY	168.00	-
1	ACTUATOR-SWIRL CONTROL	BROKEN	814.60	814.60
1	INTAKE MANIFOLD ASSY	NOT NECESSARY	1,141.10	-
1	AIRBAG COMPLETE	ACTIVATED	2,948.50	2,948.50
1	AIRBAG CONTROL MODULE	ACTIVATED	1,140.40	1,140.40
1	STEERING ANGLE ASSY	DAMAGED	1,150.60	1,150.60
1	SENSOR ASSY IMPACT-FRT INPACT	NOT NECESSARY	198.30	-
2	AIRBAG SENSOR @\$580.00	ACTIVATED	1,160.00	1,160.00
1	ELECTRIC POWER STEERING	NOT NECESSARY	3,641.00	-
1	GEARBOX	NOT NECESSARY	14,808.00	-
1	GEARBOX MOUNTING	NOT NECESSARY	215.40	-
1	RADIATOR HOSE UPPER SUPPORT BRACKET (ADDITIONAL)	BROKEN	128.00	128.00
1	IDLE PULLEY (ADDITIONAL)	BROKEN	189.50	189.50
	LESS 20% DISCOUNT		-12,184.25	-5,393.49
			48,737.00	21,573.96
1	FAN BELT (50%)(SN)	TORN	116.20	58.10
	LESS 20% DISCOUNT		-23.24	-
			92.96	58.10
	SPECIAL NETT ITEMS			
1	FRONT NO PLATE TRIM COVER (SN) }	BROKEN	30.00	45.00
1	FRONT NUMBER PLATE (SN) }	BROKEN / DISLODGE	25.00	-

Report Ref No. CS/FCI19018785/Dyd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	O/S NECESSARY / N/S NOT NECESSARY	200.00	100.00
1	FRONT DOOR COMFORT LOGO (RH)(SN)	NOT NECESSARY	75.00	-
1	FRONT DOOR ADVERTISEMENT LOGO (RH)(SN)	NOT NECESSARY	100.00	-
1	FRONT TYRE (RH)(SN)	NOT NECESSARY	216.00	-
			646.00	145.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BONNET HINGE (LH/RH).		1,800.00	1,200.00
	SPRAY PAINTING CHARGE.		1,750.00	1,000.00
	WIRING CHARGE.		100.00	30.00
	TUFF KOTE.		150.00	40.00
	TOWING CHARGE.	NOT NECESSARY	50.00	-
	FRONT CHASSIS ALIGNMENT CHARGE.		400.00	150.00
	REMOVE/REFIX UNDERCARRIAGE (FRT).		200.00	150.00
	FRT WHEEL ALIGNMENT.		120.00	60.00
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	80.00
	REMOVE/REFIX ENGINE/GEARBOX.		650.00	250.00
	R/REFIX AIR BAG/STEERING WHEEL/DASHBOARD/SEAT. }		550.00	320.00
	DIAGNOSTIC & RESETING TO ERASE FAULR CODE. }		480.00	-
	RE-SET FRT ABS SENSOR. }		200.00	-
			6,600.00	3,280.00
	GRAND TOTAL		56,075.96	25,057.06
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			20,000.00

Report Ref No. CS/FCI19018785/Dyd3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.