

ASS. REC. BY:

REF: CS/CT1 19018843/K/P312

Special Instruction:

Survivor: Kenneth

ASSIGNMENT (Office)

From (Person): Irene Tay Jui Ping

of CT1

Date/Time: 20.10.19 9.199m

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To inspect Vehicle No: GBJ 87304

Insured: GBH 57114

at Workshop m/a Lai Hual

Tel: 64538110

of 160 Sin Ming Drive #04-01

Policy No: DM CV SN 3043 0619000

Claim No: SN/M 190705006 C02

Sum Insured:

Excess:

Make of Veh:

D.O.A. 20.10.2019

(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 20.10.19 9.29a.m

Person Contacted:

H.O.D. Endorsement:

Vehicle IN / OUT

Date/Time

Action/Instruction () Estimate

GBJ 87304 - X

GBH 57114 - X

9/12 @ 2852.09 email & confirm
(Red: 339,11%)

REF: C91

ASS. REG. BY:

ASSIGNMENT

From: Date: 24.10.2019

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: GBJ 8730J

at Workshop m/s Lai Huat

of 160 Sin Ming Drive #04-01/02

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:


(Client's Record)

Make of Veh:

4p.m. Owner's report

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

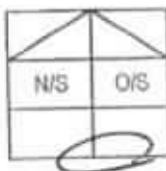

Bal. or Market Value:

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 05 days Res.: Yes or No

Turn Sum: 1.31 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No: GBJ 8730J Yr Regn: 09, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota / Hiace

c.c.

2982

Colour:

white

A/C: Insured / Std / NI / NA

Sp. Reading:

4357

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTFH T02P000249457

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195R15X8

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

20/10/19

D.O.I.

24/10/19


Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 18 DEC 2019

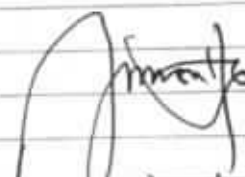

17/12/2019

Date/Time, File Pass in?

18/12/2019

Date/Time, File Return to?

2

Rep. Form:

Emp. Sum / U.C. / 2852.09

☐ : Prel. Report☒ : Final Report

Days Of Repair: 5

Resurvey No. of Trip:

Add Fee:

☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Wheel end (\$

Survey Fee:

Transportation:

S + PS = \$

Photos

10000

TOTAL

220

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	23 Oct 2019 Sendback Est	23 Oct 2019 14:48 S\$2,911.09	24 Oct 2019 09:19 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	ID: -								
Main Claimant:	YONG'S FOOD INDUSTRIES PTE LTD, Co. Reg. No.: 200208563W								
Vehicle Reg. No.:	GBJ8730Y	Date of Loss:	20/10/2019 10:00 - :59 [1 Months and 9 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / SNM19D205006C02	Policy/Cover Note No.:	DMCVSN30430619000						
Vehicle Reg. No. (Insured):	GBH5711H	Policy No. (Claimant):	61720013						
		Excess:	S\$0.00						
Repairer:	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming) 160 Sin Ming Drive #04-01, Sin Ming AutoCity, 575722 Sin Ming - Tel: 64538110								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Irene Tay Hui Ping - 638986192]								
Claimant's Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 05/11/2019]								
Adj Asg. Remarks:	PLEASE SURVEY AND REVERT								
ASSOCIATED MAIL RECEIVED									
			View All	Compose Case Mail					
There are no mail for this case.									
ALL ASSOCIATED TASKS									
		View All	Search Tasks	Create New Task	Complete				
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: TP-GBH 5711H
 Repairer Reference: 70965
 Date calculated: 23/10/2019 2:36 PM

Full Report
 Registration: GBJ 8730Y
 Printed: 23/10/2019 2:36 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	TP-GBH 5711H	Date of Incident:	20/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	TOYOTA		
Model:	HIACE		
Sub Model:	BASE MODEL		
Model Sheet Number:	70 E4 01		
Registration:	GBJ 8730Y		
VIN number:			
Odometer:			
Model Specs			
FROM 01/2017	AIR CONDITIONING	LED HEADLAMP	FOG LAMPS
3.0 LTR 100/106 KW	WHEELBASE 2570MM	TWO COAT METALLIC	PREPARE OFF VEHICLE

*Not Authorised
 Primary 84pm
 5 days*

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290	RENEW REAR END PANEL		36.0	151.20
B390	RENEW TAILGATE		25.0	105.00
	INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS			
	DOES NOT INCLUDE: R + R REAR WINDOW			
G040	R + R TAILGATE REAR SCREEN		23.0	96.60
B410	R + R REAR BUMPER		4.0	16.80
1005	STAINLESS SHEET PNL REMOVE + REFIT		10.0*	42.00
1008	REV CAMERA+PARK SEN REMOVE + REFIT		10	20.0* ✓ 84.00
2741	OUTER PANEL REINF REPAIR		30	40.0* ? 168.00
3901	REAR FLOOR PANEL REPAIR		20	30.0* ? 126.00
Labour Cost				
Panel / Mechanical Labour				
Total of Labour				
		Hrs	WU	
		18.80	188.0	789.60
				789.60

LKK Auto Consultants hence notify the Repairer of the following:

- To survey before/after spray painting
- To display damaged parts during survey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary items must be surveyed and is subject to final approval from Insurance Company

Authorised by Repairer

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR PANEL NEW PART PAINTING	15.0
	BOOTLID/TAILGATE NEW PART PAINTING	27.0
	OUTER PANEL REINF SURFACE PAINT	5.0
	REAR FLOOR PANEL SURFACE PAINT	10.0

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	14.30
2931	BOOTLID/TAILGATE NEW PART PAINTING	91.85
2741	OUTER PANEL REINF SURFACE PAINT	7.47
3901	REAR FLOOR PANEL SURFACE PAINT	31.37

Labour Cost - Paint

	Factor	42.00 SGD/h	Hrs	WU	Price SGD
	Time Paint			57.0	
	Preparation Main Work Metal		2.50	25.0	105.00
Total		10 WU/h	8.20	82.0	344.40

Material Cost - Paint

	Price SGD
New Part Painting	106.15
Surface-/Blend Paint	38.84
Material-constant Metal Preparation	28.60
Total	173.59

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01/01	Price SGD
2711	REAR PANEL	57069 26120		B ₁	135.00 ✓
2931	BOOTLID/TAILGATE	67005 26G11		B ₁	650.00 ✓
2977	BOOT/TAILGATE LOCK	69350 26122		N ₁	80.00 ✓
3015	BADGE TOYOTA	90975 02064		N ₁	20.00 ✓
3020	BADGE MODEL	75441 26241		N ₁	18.00 ✓
3160	REAR SCREEN BOND KIT	PZ49I 00C1131		N ₁	0.00 ✓
1000	TAILGATE STAINLESS	SHEET RIVETS		N ₁	60.00 ✓
1001	RR BPR LWR CLIPS	RENEW		N ₁ B ₁	3.00 ✓
f: OEM Parts	Savings				0.00
n: Non-OEM Parts	Subtotal				966.00
u: Used parts	Total				966.00

Extras

Code	Description	Price SGD
------	-------------	-----------

Code	Description	Price SGD	
1002	REAR NUMBER PLATE SN	25.00*	X
1003	70KM/H STICKER SN	2.50*	—
1004	W/S SEALANT SN	40.00*	—
1006	COMPANY BODY DECAL SN	450.00*	7
1007	TUFF COAT SN	120.00*	60
	Total Extras	637.50	

Final Calculation

	SGD	SGD
Parts	966.00	
Total Parts		966.00
Labour Time Base 10 WU/h		
Total 188.0 WU X 42.00 SGD/h	789.60 (67.60)	
Total of Labour		789.60
Total Of Extras		637.50
Paint Work Time Base 10 WU/h		
Labour Cost 82.0 WU X 42.00 SGD/h	344.40	
Material Cost	173.59	
Total Paint Including Material		517.99
Repair Cost Excludes GST		2,911.09
GST (+7.0%)		203.78
Repair Cost Included GST		3,114.87

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

3191.09

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: TP-GBH 5711H
 Repairer Reference: 70965
 Date calculated: 29/11/2019 3:37 PM

Full Report
Registration: GBJ 8730Y
Printed: 29/11/2019 3:37 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	TP-GBH 5711H	Date of Incident:	20/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer: TOYOTA
 Model: HIACE
 Sub Model: BASE MODEL
 Model Sheet Number: 70 E4 01
 Registration: GBJ 8730Y
 VIN number:
 Odometer:

Model Specs

FROM 01/2017	AIR CONDITIONING	LED HEADLAMP	FOG LAMPS
3.0 LTR 100/106 KW	WHEELBASE 2570MM	TWO COAT METALLIC	PREPARE OFF VEHICLE

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290	RENEW REAR END PANEL		36.0	151.20
B390	RENEW TAILGATE		25.0	105.00
	INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS			
	DOES NOT INCLUDE: R + R REAR WINDOW			
G040	R + R TAILGATE REAR SCREEN		23.0	96.60
B410	R + R REAR BUMPER		4.0	16.80
1005	STAINLESS SHEET PNL REMOVE + REFIT		10.0*	42.00
1008	REV CAMERA+PARK SEN REMOVE + REFIT		10.0*	42.00
2741	OUTER PANEL REINF REPAIR		30 40.0*	168.00 126
3901	REAR FLOOR PANEL REPAIR		20.0*	84.00
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		16.80	168.0	705.60
Total of Labour				705.60

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC		WU	Price SGD
	REAR PANEL NEW PART PAINTING		15.0	
	BOOTLID/TAILGATE NEW PART PAINTING		27.0	
	OUTER PANEL REINF SURFACE PAINT		5.0	
	REAR FLOOR PANEL SURFACE PAINT		10.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	14.30
2931	BOOTLID/TAILGATE NEW PART PAINTING	91.85
2741	OUTER PANEL REINF SURFACE PAINT	7.47
3901	REAR FLOOR PANEL SURFACE PAINT	31.37

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			57.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	8.20	82.0	344.40

Material Cost - Paint

	Price SGD
New Part Painting	106.15
Surface-/Blend Paint	38.84
Material-constant Metal Preparation	28.60
Total	173.59

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01/01	Price SGD
2711	REAR PANEL	57069 26120			135.00
2931	BOOTLID/TAILGATE	67005 26G11			650.00
2977	BOOT/TAILGATE LOCK	69350 26122			80.00
3015	BADGE TOYOTA	90975 02064			20.00
3020	BADGE MODEL	75441 26241			18.00
3160	REAR SCREEN BOND KIT PZ49I 00C1131				0.00
1000	TAILGATE STAINLESS SHEET RIVETS				60.00
f: OEM Parts	Savings				0.00
n: Non-OEM Parts	Subtotal				963.00
u: Used parts	Fixed Sundry Parts Price				100.00
	Total				1,063.00

Extras

Code	Description	Price SGD
------	-------------	-----------

Code	Description	Price SGD
1002	REAR NUMBER PLATE SN	25.00*
1003	70KM/H STICKER SN	2.50*
1004	W/S SEALANT SN	40.00*
1006	COMPANY BODY DECAL SN	200.00*
1007	TUFF COAT SN	60.00*
1009	T/GATE ST-LESS SHEET FABRICATE	280.00*
	Total Extras	607.50

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	963.00	
Total Parts	100.00	1,063.00
Labour Time Base 10 WU/h		
Total 168.0 WU X 42.00 SGD/h	705.60	
Total of Labour		705.60
Total Of Extras		607.50
Paint Work Time Base 10 WU/h		
Labour Cost 82.0 WU X 42.00 SGD/h	344.40	
Material Cost	173.59	
Total Paint Including Material		517.99
Repair Cost Excludes GST	2852.09	2,894.09
GST (+7.0%)		202.59
Repair Cost Included GST		3,096.68

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference: TP-GBH 5711H
Repairer Reference: 70965
Date calculated: 17/12/2019 5:00 PM

Full Report
Registration: GBJ 8730Y
Printed: 17/12/2019 5:00 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:	TP-GBH 5711H	Date of Incident:	20/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details


Vehicle			
Manufacturer:	TOYOTA		
Model:	HIACE		
Sub Model:	BASE MODEL		
Model Sheet Number:	70 E4 01		
Registration:	GBJ 8730Y		
VIN number:			
Odometer:			
Model Specs			
FROM 01/2017	AIR CONDITIONING	LED HEADLAMP	FOG LAMPS
3.0 LTR 100/106 KW	WHEELBASE 2570MM	TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status
Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

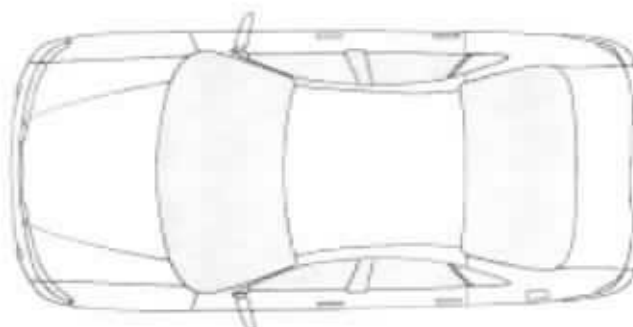

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290	RENEW REAR END PANEL		36.0	151.20
B390	RENEW TAILGATE		25.0	105.00
	INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS			
	DOES NOT INCLUDE: R + R REAR WINDOW			
G040	R + R TAILGATE REAR SCREEN		23.0	96.60
B410	R + R REAR BUMPER		4.0	16.80
1005	STAINLESS SHEET PNL REMOVE + REFIT		10.0*	42.00
1008	REV CAMERA+PARK SEN REMOVE + REFIT		10.0*	42.00
2741	OUTER PANEL REINF REPAIR		30.0*	126.00
3901	REAR FLOOR PANEL REPAIR		20.0*	84.00
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		15.80	158.0	663.60
Total of Labour				663.60

Paint

Code	Description - TWO COAT METALLIC	Time Basis 10 WU/h	WU	Price SGD
	REAR PANEL NEW PART PAINTING		15.0	
	BOOTLID/TAILGATE NEW PART PAINTING		27.0	
	OUTER PANEL REINF SURFACE PAINT		5.0	
	REAR FLOOR PANEL SURFACE PAINT		10.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	14.30
2931	BOOTLID/TAILGATE NEW PART PAINTING	91.85
2741	OUTER PANEL REINF SURFACE PAINT	7.47
3901	REAR FLOOR PANEL SURFACE PAINT	31.37

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			57.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	8.20	82.0	344.40

Material Cost - Paint

New Part Painting	Price SGD
Surface-/Blend Paint	106.15
Material-constant Metal Preparation	38.84
Total	28.60
	173.59

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Supplier	Price SGD
2711	REAR PANEL	57069 26120		135.00
2931	BOOTLID/TAILGATE	67005 26G11		650.00
2977	BOOT/TAILGATE LOCK	69350 26122		80.00
3015	BADGE TOYOTA	90975 02064		20.00
3020	BADGE MODEL	75441 26241		18.00
3160	REAR SCREEN BOND KIT	PZ49I 00C1131		0.00
1000	TAILGATE STAINLESS	SHEET RIVETS		60.00
f: OEM Parts				0.00
n: Non-OEM Parts				963.00
u: Used parts				100.00
Savings				
Subtotal				
Fixed Sundry Parts Price				
Total				1,063.00

Extras

Code	Description	Price SGD
1002	REAR NUMBER PLATE SN	25.00*
1003	70KM/H STICKER SN	2.50*
1004	W/S SEALANT SN	40.00*
1006	COMPANY BODY DECAL SN	200.00*
1007	TUFF COAT SN	60.00*
1009	T/GATE ST-LESS SHEET FABRICATE	280.00*
Total Extras		607.50

Final Calculation

	SGD	SGD
Parts	963.00	
Fixed Sundry Parts Price	100.00	
Total Parts		1,063.00
Labour Time Base 10 WU/h		
Total 158.0 WU X 42.00 SGD/h	663.60	
Total of Labour		663.60
Total Of Extras		607.50
Paint Work Time Base 10 WU/h		
Labour Cost 82.0 WU X 42.00 SGD/h	344.40	
Material Cost	173.59	
Total Paint Including Material		517.99
Repair Cost Excludes GST		2,852.09
GST (+7.0%)		199.65
Repair Cost Included GST		3,051.74

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI19018843/KTF3N2
Date: 24/12/2019

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSN30430619000
 Claimant Vehicle No: GBJ8730Y Insured Vehicle No: GBH5711H
 Date of Loss: 20/10/2019 Nature of Claim: TP Claim No: SNM19D205006C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **GBJ8730Y**
 Make & Model: TOYOTA HIACE, 3.0 D TURBO 5 DR (M) Engine No: 1KD2862372
 Reg. Date: 11/09/2019 (Man. Year: 2019) Chassis No: JTFHT02P000249457
 Colour: White Odometer: 4357 km
 Engine Capacity: 2982 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195 R15X8 Rear Tyre Size: 195 R15X8
 Front Left Side: Bridgestone 9 mm Rear Left Side: Bridgestone 9 mm
 Front Right Side: Bridgestone 9 mm Rear Right Side: Bridgestone 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	966.00	963.00	3.00	0.31
Miscellaneous Items	1,017.50	707.50	310.00	30.47
Labour	789.60	663.60	126.00	15.96
Paintwork Labour	517.99	517.99	0.00	0.00
Towing	0.00	0.00	0.00	
Gross Total (S\$)	3,291.09	2,852.09	439.00	13.34
+ GST 7.00/7.00% (S\$)	230.38	199.65	30.73	13.34
Nett Amount (S\$)	3,521.47	3,051.74	469.73	13.34

INSPECTION

Date of Assignment: 24/10/2019 Present Location: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)
 Date Inspected: 24/10/2019 Inspected At: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)
 160 Sin Ming Drive #04-01, Sin Ming AutoCity
 Singapore 575722
 Estimated Period of Repair: 5.0 days

Adjuster: KENNETH KONG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 24 Dec 2019)
Parts:	213	TOYOTA HIACE 3.0 D TURBO 5 DR (M) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBJ8730Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*Spare Parts		966.00 F	*963.00 F
			F=Franchise part.			
Total Parts (S\$)					966.00	963.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	70KM/H STICKER (NECESSARY)	2.50	2.50
2	1	COMPANY BODY DECAL (NECESSARY)	450.00	200.00
3	1	REAR NUMBER PLATE (DENTED)	25.00	25.00
4	1	TUFF COAT	120.00	60.00
5	1	W/S SEALANT (NECESSARY)	40.00	40.00
Supplementary #1				
6	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
7	1	TAILGATE STAINLESS SHEET (FABRICATE) (NECESSARY)	280.00	280.00
Sub Total (S\$)			1,017.50	707.50

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Paintwork Labour				
1	Total Paint Including Material	New	517.99	517.99
Labour Items				
2	Total of Labour	New	789.60	663.60
Gross Labour Cost (S\$)			1,307.59	1,181.59

Report was unsubmitted during this print-out.

< END OF ESTIMATES >