



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2008183
INV Date 08/12/2020
Reference CC6/LPC19020663/Aba3q2
Code LPC2



PROFESSIONAL SERVICE FEE

Vehicle No. SMF 4771X
Insured Veh. GBG 567X
Claim No. 19/19/19/VC05/022678
Policy No. Z19VC05002606
Accident Date 20/11/2019
Inspection Date 21/11/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

Ref : CC6/LPC19020663/Aba3q2

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Date : 08-12-2020



Code : LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBG 567X	Veh. Inspected	SMF 4771X
Policy No.	Z19VC05002606	Coverage (\$)	0.00
Claim No.	19/19/19/VC05/022678	Excess (\$)	0.00
Assign From		Assign Date	21/11/2019

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI ELANTRA	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	KMHD841CMHU143486	Colour	WHITE
Odometer	58154	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/45 R17	YOKOHAMA	6 mm
L/H Front Tyre	225/45 R17	YOKOHAMA	6 mm
R/H Rear Tyre	225/45 R17	YOKOHAMA	6 mm
L/H Rear Tyre	225/45 R17	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	20/11/2019	Inspection Date	21/11/2019
Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMF 4771X

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	DENTED	1,720.40	1,720.40
1	BOOTLID SMART KEY ANTENNA	CRACKED	265.30	265.30
1	BOOTLID BOOT RELEASE ANTENNA	NOT NECESSARY	276.20	-
1	BOOTLID INNER TRIM	NOT NECESSARY	406.20	-
2	BOOTLID REFLECTORS @\$689.70	N/S CUT	1,379.40	689.70
1	BOOTLID EMBLEM 'ELANTRA'	NECESSARY	95.30	95.30
1	BOOTLID EMBLEM 'ELITE'	NECESSARY	89.60	89.60
1	BOOTLID LOGO	NECESSARY	95.40	95.40
1	BOOTLID INNER LOCK	DAMAGED	298.70	298.70
1	BOOTLID LOWER LATCH	NOT NECESSARY	45.20	-
1	BOOTLID WEATHERSTRIP	NOT NECESSARY	301.20	-
1	REAR BUMPER	DEFORMED	645.30	645.30
2	REAR BUMPER REFLECTORS @\$102.50	N/S CRACKED	205.00	102.50
2	REAR BUMPER RETAINERS @\$92.30	NECESSARY	184.60	184.60
1	REAR BUMPER REINFORCEMENT	BENT	378.10	378.10
1	REAR BUMPER REINFORCEMENT BRACKETS @\$89.70	NOT NECESSARY	179.40	-
2	REAR MUDGUARDS @\$90.60	NOT NECESSARY	181.20	-
2	REAR BUMPER COVERS @\$154.80	NOT NECESSARY	309.60	-
2	TAILLAMPS @\$889.60	N/S CUT	1,779.20	889.60
2	TAILLAMPS PANELS @\$498.60	NOT NECESSARY	997.20	-
2	REAR FENDER INNER TRIM @\$376.80	NOT NECESSARY	753.60	-
2	REAR FENDER INNER COWLING @\$189.20	NOT NECESSARY	378.40	-
1	REAR END PANEL	DENTED	585.90	585.90
1	REAR END PANEL TOP GARNISH	DEFORMED	235.80	235.80
	LESS 20% DISCOUNT		-2,357.24	-1,255.24
			9,428.96	5,020.96
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	30.00	10.00

Report Ref No. CC6/LPC19020663/Aba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	REAR BOOTLID SPOILER (SN)	CRACKED	450.00	450.00
1	REAR LOWER LIP (ACCESSORIES) (SN)	DEFORMED	650.00	500.00
1	REAR LOWER LIP CENTRE LAMP (SN)	CUT	200.00	200.00
2	REAR LOWER LIP EXHAUST GARNISH @\$180.00 (SN)	NOT NECESSARY	360.00	-
2	SET REAR FENDER INNER COWLING (SN)	NOT NECESSARY	60.00	-
2	SET REAR FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	60.00	-
2	END PANEL INSULATOR SEAL (SN)	NECESSARY	80.00	60.00
			2,220.00	1,450.00
	LABOUR			
	TO RENEW DAMAGED PARTS ,REPLACE ,BEAT ,WELD ,REALIGN AND ALIGNE ALL PARTS.		2,000.00	800.00
	TO RESPRAY AFFECTED AREAS.		2,000.00	800.00
	TO TUFFCOAT AFFECTED AREA.		200.00	60.00
	TO REMOVE/REFIT INTERIOR UPHOLSTERY.		150.00	80.00
	TO APPLY SEALANT AND UNDERCOATING TO THE AFFECTED AREAS.		280.00	60.00
	TO REMOVE/REFIT WIRING CHECKS FOR REAR TAILAMPS.		120.00	30.00
	TO CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	150.00	-
	TO REMOVE/REPLACE REVERSE SENSORS AND DISTANCE SETTLING.		150.00	50.00
	TO REMOVE/REFIT REVERSE CAMERA.		150.00	50.00
	TO REMOVE AND REPLACE BOOTLID MECHANISM .	NOT NECESSARY	120.00	-
			5,320.00	1,930.00
GRAND TOTAL			16,968.96	8,400.96
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,700.00

Report Ref No. CC6/LPC19020663/Aba3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

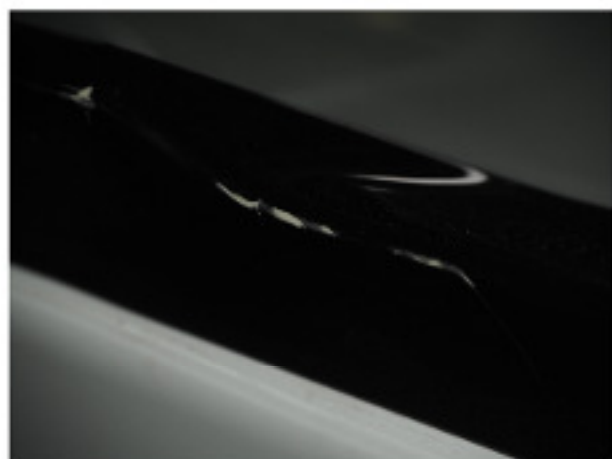



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMF 4771X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

