



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2003671  
INV Date 05/05/2020  
Reference CC6/LPC19020672/Aea3n2  
Code LPC2



### PROFESSIONAL SERVICE FEE

Vehicle No. PC 4239Y  
Insured Veh. GBC 243B  
Claim No. 18/19/19/VC05/022651  
Policy No. Z18VC05001477  
Accident Date 14/11/2019  
Inspection Date 20/11/2019

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD		Ref : CC6/LPC19020672/Aea3n2		
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Date : 05-05-2020		
		Code : LPC2		
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	GBC 243B	Veh. Inspected	PC 4239Y	
Policy No.	Z18VC05001477	Coverage (\$)	0.00	
Claim No.	18/19/19/VC05/022651	Excess (\$)	0.00	
Assign From		Assign Date	20/11/2019	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	KDH2230023720	Colour	SILVER	
Odometer	187025	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	195 R15C	MICHELIN	6 mm	
L/H Front Tyre	195 R15C	MICHELIN	6 mm	
R/H Rear Tyre	195 R15C	MICHELIN	6 mm	
L/H Rear Tyre	195 R15C	MICHELIN	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	14/11/2019	Inspection Date	20/11/2019	
Survey held at	HUA MENG SPRAY PAINTING WORKSHOP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417883			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>		



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PC 4239Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR TAILGATE	DENTED	2,259.70	2,259.70
2	REAR TAILGATE HINGES @\$71.50	NOT NECESSARY	143.00	-
1	REAR TAILGATE UPPER LOCK	DAMAGED	288.50	288.50
1	REAR TAILGATE LOWER LOCK	NOT NECESSARY	107.90	-
2	REAR TAILGATE SHOCK ABSORBER @\$353.40	NOT NECESSARY	706.80	-
1	REAR TAILGATE WEATHERSTRIP	CUT	416.80	358.00
1	REAR TAILGATE INNER BOARD	NOT NECESSARY	288.50	-
1	REAR TAILGATE HANDLE	NOT NECESSARY	149.60	-
1	REAR TAILGATE HIACE EMBLEM	NECESSARY	30.80	30.80
1	REAR TAILGATE GL EMBLEM	NECESSARY	52.80	52.80
1	REAR TAILGATE CENTRE LOGO	NECESSARY	78.80	78.80
1	REAR END INNER PANEL	TO REPAIR SEE LABOUR	1,739.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	114.20	-
1	REAR BUMPER	DEFORMED	440.00	440.00
2	REAR BUMPER SIDE HOLDER @\$24.40	NECESSARY	48.80	48.80
4	REAR BUMPER LOWER BRACKET @\$24.20	BENT (2 PCS ONLY)	96.80	48.40
1	REAR END OUTER PANEL	DENTED	484.60	484.60
	LESS 25% DISCOUNT		-1,861.65	-1,022.60
			5,584.95	3,067.80
1	REAR TAILGATE 70KM STICKER (SN)	NECESSARY	27.30	10.00
1	REAR BUMPER TOP PROTECTOR (SN)	DEFORMED	700.00	400.00
	LESS 25% DISCOUNT		-181.83	-
			545.47	410.00
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	380.00	200.00
			380.00	200.00
<b><u>LABOUR</u></b>				
	TO SUPPLY REAR WINDSCREEN SEALANT.		50.00	50.00

Report Ref No. CC6/LPC19020672/Aea3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REINSTALL REAR WINDSCREEN.		150.00	120.00
	REMOVE & REINSTALL REVERSE SENSOR .		150.00	60.00
	REMOVE,REPLACE & REPAIR CONSISTENT TO THE ACCIDENT.INCLUSIVE OF THE REPAIR OF REAR END INNER PANEL .		1,800.00	800.00
	RESPRAY PAINTING.		1,300.00	800.00
	TUFF KOTE.		150.00	80.00
	REMOVE AND REINSTALL REAR CAMERA.		100.00	60.00
			3,700.00	1,970.00
<b>GRAND TOTAL</b>			<b>10,210.42</b>	<b>5,647.80</b>

<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>4,500.00</b>
---	--	--	-----------------

Report Ref No. CC6/LPC19020672/Aea3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. PC 4239Y

### INSPECTION






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

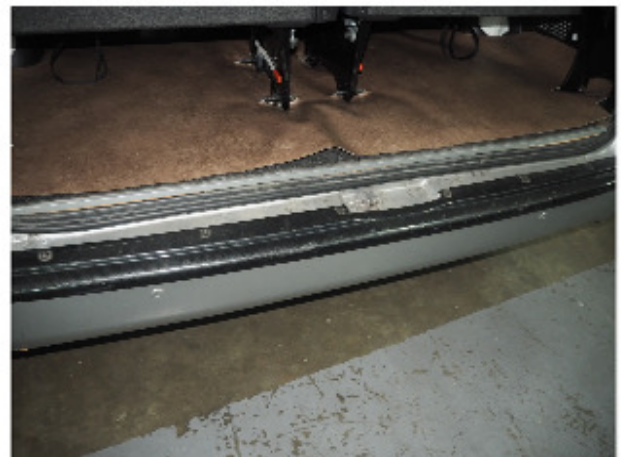





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 4239Y

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

