

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### **TAX INVOICE**

AUTO & GENERAL INSURANCE (S) PL (BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRE SINGAPORE 239924 INV No. AC2003308

INV Date 20/04/2020

Reference CS/AGI19020789/Uvf3n2

Code AGI

#### PROFESSIONAL SERVICE FEE

Vehicle No. XE 3659U

Insured Veh. SJJ 5633U

Claim No. C10004678/JM

Policy No.

Accident Date 20/11/2019

Inspection Date 17/01/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

**LKK Auto Consultants Pte Ltd** 

HYN



5b.

ESTIMATED NORMAL PERIOD FOR REPAIR:

# **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

	Reg. No: 199607198R GST Reg. No. 19-9607198-R							
	Affiliated to Federation Internationale Des Experts En Automobile							
AUT	AUTO & GENERAL INSURANCE (S) PL Ref : CS/AGI19020789/Uvf3n2							
190 (			Date: 20-04-2020					
			Code: AGI					
1.	1. Policy Particulars :- THIRD PARTY CLAIM							
	Insured Veh.	SJJ 5633U	Veh. Inspected	XE 3659U				
	Policy No.		Coverage (\$)	0.00				
	Claim No.	C10004678/JM	Excess (\$)	0.00				
	Assign From	IVY RATILLA	Assign Date	25/11/2019				
2.		Vehicle Partic	culars & Condition					
	Make & Model	MITSUBISHI FUSO FV51 (M)	c.c	11967				
	Engine No.	HIDDEN	Year of Reg.	2017				
	Chassis No.	FV51SJA20281	Colour	WHITE				
	Odometer	77793	Steering	IN ORDER				
	Brakes	IN ORDER	Modification	NIL				
	General	GOOD						
3.	_	Condition	ons of Tyres					
		Size	Make	Balance				
	R/H Front Tyre	295/80 R22.5	YOKOHAMA	6 mm				
	L/H Front Tyre	295/80 R22.5	YOKOHAMA	6 mm				
	R/H Rear Tyre	295/80 R22.5 (D/D)	YOKOHAMA	6/6 6/6 mm				
	L/H Rear Tyre	295/80 R22.5 (D/D)	YOKOHAMA	6/6 6/6 mm				
4.		Description	on of Damages					
	THE VEHICLE SU	STAINED DAMAGES AT THE N/S	FRONT PORTION.					
	DAMAGES SEE DETAILS.							
5.		General	Information					
	Accident Date	20/11/2019	Inspection Date	17/01/2020				
	Survey held at	MAH LIAN MOTOR VEHICLE RE	EPAIRER					
		38 DEFU LANE 9 SINGAPORE 539278						
5a.		Re	emarks					
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.							
	En Catimata Dava of Banair							

Estimate Days of Repair

3 Working Days



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

#### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. XE 3659U

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	DENTED / BENT	2,259.31	2,200.83
1	FRONT BUMPER COVER-LH TOP	DISTORTED	305.89	305.89
1	FRONT BUMPER SIDE-LH	TWISTED	140.29	140.29
1	FRONT CENTER BUMPER SIDE REINFORCEMENT-LH	TO REPAIR SEE LABOUR	226.06	-
1	FRONT CENTER BUMPER SIDE PANEL-LH	TO REPAIR SEE LABOUR	193.04	-
1	HEADLAMP ASSY-LH	CRACKED	1,286.45	1,286.45
1	HEADLAMP RIM ASSY-LH	CRACKED	181.18	181.18
1	FOG LAMP ASSY-LH	SERVICEABLE	293.25	-
1	FOG LAMP RIM-LH	SERVICEABLE	186.05	-
	LESS 25% DISCOUNT		-1,267.88	-1,028.66
			3,803.64	3,085.98
	<u>LABOUR</u>			
	LABOUR TO REMOVE & REFIT HEADLAMP CABLE & SYSTEM & CHECK WIRING & REFOCUS ALL LIGHT.		150.00	30.00
	LABOUR CHARGE TO CUT & WELD & DISMANTLE & REMOVE & REFIT ALL ABOVE PARTS.INCLUSIVE OF THE REPAIR OF FRONT CENTER BUMPER SIDE REINFORCEMENT-LH AND FRONT CENTER BUMPER SIDE PANEL-LH.		780.00	500.00
	TO SPRAY & PAINTING ALL ACCIDENT AFFECTED AREA.		850.00	400.00
	TO RUST PROOFING ON AFFECTED AREA.	NOT NECESSARY	280.00	
			2,060.00	930.00
	GRAND TOTAL		5,863.64	4,015.98

RECOMMENDED COST OF LUMP SUM REPAIRS		3,200.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/AGI19020789/Uvf3n2

**CHUA KANG SENG** 

**Licensed Appraiser** 




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### PHOTOGRAPHS FOR VEHICLE NO. XE 3659U

INSPECTION

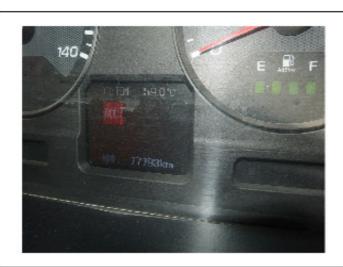













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### PHOTOGRAPHS FOR VEHICLE NO. XE 3659U

RE-INSPECTION









