



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2005666
INV Date 18/08/2020
Reference CC3/EQI19022187/Qpa3s2
Code EQI



PROFESSIONAL SERVICE FEE

Vehicle No. SHB 5285G
Insured Veh. GBJ 7330A
Claim No. DM19HO03330
Policy No. DMCFHQ19000084
Accident Date 13/12/2019
Inspection Date 16/12/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD		Ref : CC3/EQI19022187/Qpa3s2		
5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Date : 18-08-2020		
		Code : EQI		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBJ 7330A	Veh. Inspected	SHB 5285G	
Policy No.	DMCFHQ19000084	Coverage (\$)	0.00	
Claim No.	DM19HO03330	Excess (\$)	0.00	
Assign From		Assign Date	16/12/2019	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FU703561535	Colour	MAROON	
Odometer	368492	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	13/12/2019	Inspection Date	16/12/2019	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5285G

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	PANEL SUB-ASSY, FRONT DOOR LH (DISC 25%)	DENTED	1,249.60	937.20
1	DOOR OUTER HANDLE FRONT, LH (DISC 25%)	SCRATCHED	378.90	284.18
1	PANEL SUB-ASSY, REAR DOOR, LH (DISC 25%)	DENTED	1,243.90	932.93
1	DOOR FRAME INNER HANDLE FRONT, LH (DISC 25%) (ADDITIONAL)	NECESSARY	187.70	140.78
1	LOCK ASSY, FRONT DOOR LH (DISC 10%)	JAMMED	544.70	490.23
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	DOOR FRONT WINDOW REGULATOR SUB-ASSY (SN)	JAMMED	230.80	173.10
2	PIXEL STICKER @ \$60.00 (SN)	NECESSARY	120.00	120.00
1	WHEEL, DISC	SERVICEABLE	1,555.10	-
1	TYRE	SERVICEABLE	126.74	-
1	WHEEL, DISC	SERVICEABLE	1,555.10	-
1	TYRE	SERVICEABLE	126.74	-
1	HUB & BEARINGASSY, RH & LH	SERVICEABLE	554.20	-
1	HUB & BEARINGASSY, RH & LH	SERVICEABLE	554.20	-
1	CHECK ASSY, FRONT DOOR	SERVICEABLE	153.50	-
1	HINGE ASSY, FRONT DOOR, UPPER LH	SERVICEABLE	82.10	-
1	HINGE ASSY, FRONT DOOR, LOWER LH	SERVICEABLE	92.10	-
1	MIRROR ASSY, OUTER REAR VIEW, LH	SERVICEABLE	1,283.90	-
1	DOOR LOCK STRIKER	SERVICEABLE	38.00	-
1	DOOR FRONT MOTOR ASSY, POWER WINDOW	SERVICEABLE	768.60	-
1	COVER, FR BUMPER	SERVICEABLE	495.50	-
1	SUPPORT, FR BUMPER RH	SERVICEABLE	76.90	-
1	SUPPORT, FR BUMPER LH	SERVICEABLE	82.30	-
1	GRILLE, RADIATOR	SERVICEABLE	165.00	-
1	CLIPS, FRT & RR BUMPER	SERVICEABLE	1.50	-
1	COVER ASSY, ENGINE	SERVICEABLE	180.10	-
1	COVER ASSY, ENGINE UNDER CENTER SET	SERVICEABLE	452.80	-
1	COVER ENGINE UNDER CENTER	SERVICEABLE	94.50	-
1	GRILLE SUB-ASSY	SERVICEABLE	335.60	-
1	CLIPS PIECE, FRT & RR BUMPER	SERVICEABLE	1.50	-

Report Ref No. CC3/EQI19022187/Qpa3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER REINFORCEMENT	SERVICEABLE	318.80	-
1	SEAL, RR BUMPER ARM, RH & LH	SERVICEABLE	11.00	-
1	PAD, RR BUMPER, RH & LH, 1	SERVICEABLE	3.80	-
1	PAD, RR BUMPER, RH & LH, 2	SERVICEABLE	3.80	-
1	PAD, RR BUMPER, RH & LH, 1	SERVICEABLE	3.80	-
1	RETAINER, RR BUMPER, RH	SERVICEABLE	112.70	-
1	RETAINER, RR BUMPER, LH	SERVICEABLE	111.50	-
1	SEAL, RR BUMPER, RH	SERVICEABLE	85.20	-
1	SEAL, RR BUMPER, LH	SERVICEABLE	85.20	-
1	SENSOR REVERSE	SERVICEABLE	180.00	-
1	GUARD, RR BUMPER, LOWER	SERVICEABLE	558.30	-
1	FILLER, RR BUMPER, RH	SERVICEABLE	119.90	-
1	FILLER, RR BUMPER, LH	SERVICEABLE	119.90	-
1	LENS & BODY, REAR COMBINATION LAMP, LH	SERVICEABLE	438.10	-
1	LENS & BODY ASSY, RR BUMPER, LH	SERVICEABLE	486.80	-
1	FENDER SUB-ASSY, FR LH	SERVICEABLE	933.10	-
1	LINER, FR FENDER, LH	SERVICEABLE	194.30	-
1	PAD, FR WHEEL LH	SERVICEABLE	57.70	-
1	MOULDING ASSY, BODY ROCKER PANEL, LH	NOT NECESSARY	576.00	-
1	PANEL SUB-ASSY, FENDER REAR LH	TO REPAIR SEE LABOUR	824.80	-
1	COVER, OUTER MIRROR, LH	TO REPAIR SEE LABOUR	89.50	-
1	COVER, RR BUMPER ASSY	TO REPAIR SEE LABOUR	423.90	-
			18,529.68	3,138.42
	LABOUR			
	PANEL BEATING & BODYWORK. INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY, FENDER REAR LH; COVER, OUTER MIRROR, LH AND COVER, RR BUMPER ASSY.		676.00	500.00
	SPRAY PAINT.		3,348.00	880.00
	TO TRANSFER DOOR MECHANISM.		120.00	60.00
	TO REMOVE AND REFIX WING MIRROR.		120.00	20.00

Report Ref No. CC3/EQ119022187/Qpa3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).	NOT NECESSARY	120.00	-
	TO DO WHEEL ALIGNMENT / TYRE BALANCING.	NOT NECESSARY	120.00	-
	TO REPLACE SUNDRY PARTS.		100.00	20.00
	TO CHECK WIRING AND SYSTEM FUNCTION.		80.00	20.00
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			4,744.00	1,500.00
GRAND TOTAL			23,273.68	4,638.42

RECOMMENDED COST OF REPAIRS				4,638.42
------------------------------------	--	--	--	-----------------

Report Ref No. CC3/EQI19022187/Qpa3s2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5285G

INSPECTION

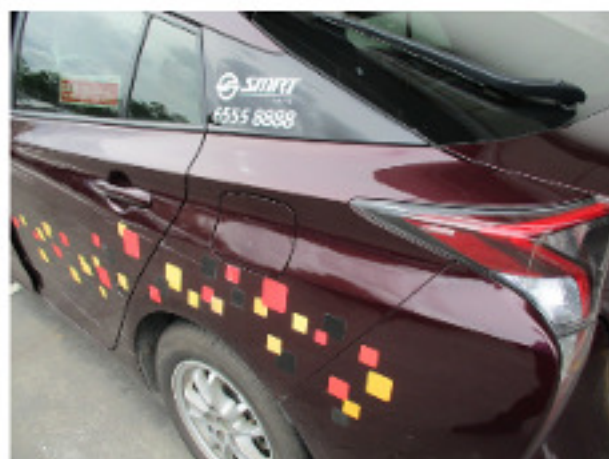



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5285G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

