



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100031

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/01/2021
Reference CC4/FCI20000130/T1ba3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLD 1710P
Insured Veh. SHD 3576U
Claim No. D20000062MFSH
Policy No. D-19092580MFSH
Accident Date 27/12/2019
Inspection Date 02/01/2020

Description	Total
Survey Inspection	827.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Less: Discount	-247.00
Subtotal	580.00
GST (7%)	40.60
Grand Total	620.60

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20000130/T1ba3q2	
			Date: 05/01/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 3576U	Veh. Inspected	SLD 1710P	
Policy No.	D-19092580MFSH	Coverage (\$)	0.00	
Claim No.	D20000062MFSH	Excess (\$)	0.00	
Assign From	CHRIS	Assign Date	31/12/2009	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN LATIO	c.c	1498	
Engine No.	HIDDEN	Year of Reg.	2006	
Chassis No.	JN1BAAC11Z0001310	Colour	BEIGE	
Odometer	181710 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	GOODYEAR	6 mm	
L/H Front Tyre	185/65 R15	GOODYEAR	6 mm	
R/H Rear Tyre	185/65 R15	GOODYEAR	6 mm	
L/H Rear Tyre	185/65 R15	GOODYEAR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS				
5. General Information				
Accident Date	27/12/2019	Inspection Date	02/01/2020	
Survey held at	RICO 60 AUTO SERVICES PTE LTD 8 KAKI BUKIT AVENUE 4 #02-24 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 1710P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	NOT NECESSARY	891.20	-
1	BONNET LOCK	NOT NECESSARY	201.40	-
1	BONNET LOCK CATCH	NOT NECESSARY	90.10	-
1	BONNET INSULATOR	NOT NECESSARY	272.50	-
2	BONNET HINGE (L+R)	NOT NECESSARY	188.20	-
2	BONNET RUBBER STRIP (L+R)	NOT NECESSARY	196.40	-
2	HEADLAMP (L+R)	N/S CRACKED / O/S NOT NECESSARY	1,963.60	450.00
2	HEADLAMP BRACKET (L+R)	N/S CRACKED / O/S NOT NECESSARY	192.80	96.40
1	FRONT BUMPER	DEFORMED	687.50	456.00
1	FRONT BUMPER LOGO (NISSNA)	NECESSARY	69.00	69.00
2	FRONT BUMPER RETAINER (L+R)	N/S NECESSARY / O/S NOT NECESSARY	123.80	61.90
1	FRONT BUMPER REINFORCEMENT BAR	NOT NECESSARY	544.90	-
2	FRONT GRILLE (L+R)	NOT NECESSARY	377.60	-
2	FRONT BUMPER BRACKET (L+R)	NOT NECESSARY	378.80	-
1	FRONT BUMPER BEAM (NPA)	NOT NECESSARY	-	-
1	FRONT BUMPER SPONGE	CRACKED	287.20	287.20
1	FRONT BUMPER TOW COVER	NOT NECESSARY	60.00	-
1	FRONT BUMPER GRILLE	NOT NECESSARY	345.10	-
2	FRONT BUMPER FOG LAMP GARNISH (L+R)	N/S CUT	210.60	105.30
1	FRONT BUMPER UNDERCOVER	NOT NECESSARY	287.50	-
2	FRONT FENDER (L+R)	N/S BENT / O/S NOT NECESSARY	1,304.20	620.00
2	FRONT FENDER INNER PANEL (L+R)	NOT NECESSARY	1,680.20	-
2	FRONT FENDER SIGNAL LAMP (L+R)	NOT NECESSARY	201.80	-
2	FRONT FENDER QUARTER WINDOW MOULDING (L+R)	NOT NECESSARY	224.00	-
2	FRONT FENDER TOP GARNISH (L+R)	NOT NECESSARY	156.80	-
2	FRONT FENDER COWLING (L+R)	N/S DEFORMED / O/S NOT NECESSARY	224.40	112.20

Report Ref No. CC4/FCI20000130/T1ba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT SUPPORT PANEL	NOT NECESSARY	795.80	-
2	FRONT SUPPORT SIDE PANEL (L+R)	NOT NECESSARY	642.00	-
1	FRONT SUPPORT PANEL TOP GARNISH	CRACKED	258.70	258.70
1	AIRCON CONDENSER	NOT NECESSARY	554.80	-
1	HIGH PRESSURE HOSE	NOT NECESSARY	270.60	-
1	LOW PRESSURE HOSE	NOT NECESSARY	256.50	-
1	RADIATOR	NOT NECESSARY	596.30	-
1	SUCTION PIPE	NOT NECESSARY	194.50	-
1	DISCHARGE PIPE	NOT NECESSARY	210.90	-
1	RADIATOR FAN COWLING	NOT NECESSARY	237.20	-
1	RADIATOR FAN BLADE	NOT NECESSARY	93.20	-
1	RADIATOR FAN MOTOR	NOT NECESSARY	303.60	-
1	FUSE BOX	NOT NECESSARY	423.70	-
2	FRONT ABSORBER (L+R)	NOT NECESSARY	864.20	-
2	FRONT LOWER ARM (L+R)	NOT NECESSARY	397.80	-
2	FRONT KNUCKLE (L+R)	NOT NECESSARY	753.60	-
2	FRONT KNUCKLE BEARING (L+R)	NOT NECESSARY	699.80	-
2	FRONT BEARING HUB (L+R)	NOT NECESSARY	464.00	-
1	FRONT CROSSMEMBER	NOT NECESSARY	1,438.60	-
1	FRONT STEERING RACK AND PINION ASSY	NOT NECESSARY	1,525.80	-
2	FRONT DRIVE SHAFT (L+R)	NOT NECESSARY	1,950.40	-
2	FRONT TIE ROD (L+R)	NOT NECESSARY	682.40	-
2	FRONT TIE ROD END (L+R)	NOT NECESSARY	357.20	-
1	FRONT STABILIZER BAR	NOT NECESSARY	724.50	-
2	FRONT STABILIZER LINK (L+R)	NOT NECESSARY	300.20	-
	LESS 10% DISCOUNT		-	-251.67
			26,155.90	2,265.03
	<u>SPECIAL NETT ITEMS</u>			
10	BONNET INSULATOR CLIPS (SN)	NOT NECESSARY	100.00	-
10	FRONT BUMPER CLIPS (SN)	NECESSARY	100.00	30.00
1	FRONT CARPLATE (SN)	NOT NECESSARY	120.00	-
1	FRONT CARPLATE FRAME (SN)	NOT NECESSARY	120.00	-
1	FRONT FENDER INNER PANEL SEALANT (SN)	NOT NECESSARY	120.00	-

Report Ref No. CC4/FCI20000130/T1ba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT FENDER QUARTER WINDOW SEALANT (SN)	NOT NECESSARY	120.00	-
20	FRONT FENDER COWLING CLIPS (SN)	NECESSARY	300.00	20.00
10	FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NECESSARY	100.00	10.00
1	RADIATOR COOLANT (SN)	NOT NECESSARY	80.00	-
2	SET FRONT TYRE (SN)	NOT NECESSARY	2,000.00	-
2	SET FRONT RIM (SN)	NOT NECESSARY	4,000.00	-
			7,160.00	60.00
	LABOUR			
	TO RNR ACCIDENT DAMAGED PARTS ,CUT /WELD ,KNOCK & REALIGN.		2,100.00	400.00
	TO PUTTY AND RESPRAY ACCIDENT AFFECTED AREA.		2,100.00	400.00
	TO RUST PROOF ACCIDENT AFFECTED AREA.		250.00	30.00
	TO RNR UPHOLSTERY ,GARNISH AND ATTACHMENT PARTS.	NOT NECESSARY	400.00	-
	TO RNR UNDERCARRIAGE SYSTEM.	NOT NECESSARY	250.00	-
	TO CHECK WHEEL ALIGNMENT.	NOT NECESSARY	250.00	-
	TO RNR A/C CONDENSOR ASSY AND REFILL GAS.	NOT NECESSARY	250.00	-
	TO CHECK WIRING LAYOUT AND HEADLAMP FOCUS.		150.00	30.00
	TO RNR TYRE AND WHEEL BALANCING.	NOT NECESSARY	250.00	-
	TO DO DIAGNOSIS AND RESET ,REPROGRAM OR CODING FAULT CODE.	NOT NECESSARY	400.00	-
	TO DO WATER LEAK TEST.	NOT NECESSARY	80.00	-
	TO RNR RADIATOR ASSY AND HOSES TO ASSIST WORK LOAD.	NOT NECESSARY	250.00	-
			6,730.00	860.00
GRAND TOTAL			40,045.90	3,185.03
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,000.00

Report Ref No. CC4/FCI20000130/T1ba3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1710P

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

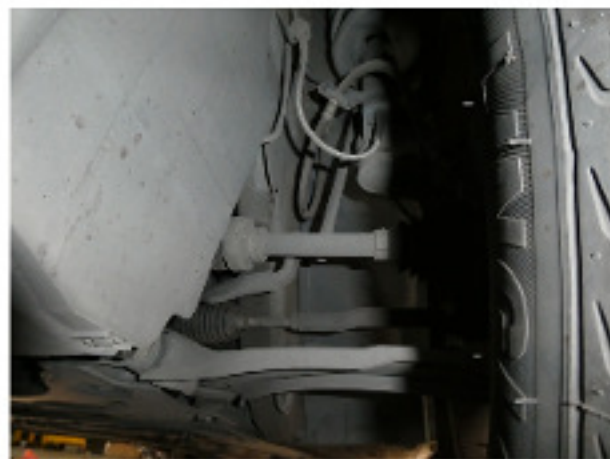



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1710P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1710P

RE-INSPECTION

