

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**INV** Date

#### TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No.

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSE

SINGAPORE 189556

ATTN: CHRYLLIS

AC2003499

28/04/2020

Reference CS/INC20000305/Qqd3n2

Code II

#### PROFESSIONAL SERVICE FEE

Vehicle No. SKN 7952C

Insured Veh. SKC 6103B

Claim No. MT/1062729-002

Policy No.

Accident Date 14/09/2019

Inspection Date 07/01/2020

| Description         | Total  |
|---------------------|--------|
| Damage Assessment   | 250.00 |
| Resurvey Inspection |        |
| Digital Photographs |        |
| Transportation      |        |
| Subtotal            | 250.00 |
| GST (7%)            | 17.50  |
| Grand Total         | 267.50 |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

**LKK Auto Consultants Pte Ltd** 

HYN



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC20000305/Qqd3n2

| #05- | 3 BRAS BASAH ROAD<br>05-01 NTUC TRADE UNION HOUSESINGAPORE<br>89556   |  | Date: 28-04-2020    |                         |  |  |  |  |  |
|------|---|--|---------------------|-------------------------|--|--|--|--|--|
| ITTA | N: CHRYLLIS   |  | Code: INC           |                         |  |  |  |  |  |
| 1.   | . Policy Particulars :- THIRD PARTY CLAIM   |  |                     |                         |  |  |  |  |  |
|      | Insured Veh.  | SKC 6103B                                  | Veh. Inspected      | SKN 7952C               |  |  |  |  |  |
|      | Policy No.  |  | Coverage (\$)       | 0.00                    |  |  |  |  |  |
|      | Claim No.   | MT/1062729-002                             | Excess (\$)         | 0.00                    |  |  |  |  |  |
|      | Assign From   | THERESA VIMALA                             | Assign Date         | 06/01/2020              |  |  |  |  |  |
| 2.   |   | Vehicle Partic                             | culars & Condition  |                         |  |  |  |  |  |
|      | Make & Model  | MAZDA BIANTE 5-DOOR                        | c.c                 | 1998                    |  |  |  |  |  |
|      | Engine No.  | HIDDEN                                     | Year of Reg.        | 2014                    |  |  |  |  |  |
|      | Chassis No.   | JM6CC1071E0105973                          | Colour              | GREY                    |  |  |  |  |  |
|      | Odometer  | 252705 KM                                  | Steering            | IN ORDER                |  |  |  |  |  |
|      | Brakes  | IN ORDER                                   | Modification        | SPORTS RIM              |  |  |  |  |  |
|      | General   | FAIR                                       |                     |                         |  |  |  |  |  |
| 3.   |   | Conditi                                    | ons of Tyres        |                         |  |  |  |  |  |
|      |   | Size                                       | Make                | Balance                 |  |  |  |  |  |
|      | R/H Front Tyre  | 205/60 R16                                 | WEST LAKE           | 5 mm                    |  |  |  |  |  |
|      | L/H Front Tyre  | 205/60 R16                                 | WEST LAKE           | 5 mm                    |  |  |  |  |  |
|      | R/H Rear Tyre   | 205/60 R16                                 | WEST LAKE           | 5 mm                    |  |  |  |  |  |
|      | L/H Rear Tyre   | 205/60 R16                                 | WEST LAKE           | 5 mm                    |  |  |  |  |  |
| 4.   | Description of Damages  |  |                     |                         |  |  |  |  |  |
|      | THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.   |  |                     |                         |  |  |  |  |  |
|      | DAMAGES SEE D   | ETAILS.                                    |                     |                         |  |  |  |  |  |
| 5.   |   | General                                    | I Information       |                         |  |  |  |  |  |
|      | Accident Date   | 14/09/2019                                 | Inspect Date / Time | 07/01/2020 ( 02:02 PM ) |  |  |  |  |  |
|      | Survey held at  | HUA HONG PTE LTD                           |                     |                         |  |  |  |  |  |
|      |   | 25D SUNGEI KADUT STREET 1 SINGAPORE 729332 |                     |                         |  |  |  |  |  |
| 5a.  | Remarks   |  |                     |                         |  |  |  |  |  |
|      | A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |  |                     |                         |  |  |  |  |  |
| 5b.  | D. Estimate Days of Repair  |  |                     |                         |  |  |  |  |  |
|      |   |  |                     |                         |  |  |  |  |  |

3 Working Days

ESTIMATED NORMAL PERIOD FOR REPAIR:



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

#### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKN 7952C

| Qty | Description of Parts   | Condition             | Estimate By Workshop (\$)) | Our Adjusted (\$) |
|-----|--|-----------------------|----------------------------|-------------------|
|     | REPLACEMENT OF PARTS   |                       |                            |                   |
| 1   | FRONT BUMPER   | CRUMPLED              | 1,023.10                   | 1,023.10          |
| 10  | FRONT BUMPER CLIP @\$4.50  | NECESSARY             | 45.00                      | 30.00             |
| 2   | FRONT BUMPER RETAINER (LH/RH) @\$38.80   | BROKEN (1 PC<br>ONLY) | 77.60                      | 38.80             |
| 2   | FRONT BUMPER CHROME MOULDING (LH/RH) @\$543.70   | SERVICEABLE           | 1,087.40                   | -                 |
| 1   | FRONT GRILLE   | CRACKED               | 2,131.30                   | 2,131.30          |
| 1   | EMBLEM   | SERVICEABLE           | 69.90                      | -                 |
| 2   | FRONT HEADLAMP (LH/RH) @\$2613.70  | SERVICEABLE           | 5,227.40                   | -                 |
| 2   | FRONT HEADLAMP BRACKET (LH/RH) @\$127.10   | SERVICEABLE           | 254.20                     | -                 |
| 1   | FRONT SUPPORT PANEL  | SERVICEABLE           | 463.10                     | -                 |
| 1   | FRONT BRACE PANEL  | SERVICEABLE           | 36.70                      | -                 |
| 1   | FRONT REINFORCEMENT  | SERVICEABLE           | 667.70                     | -                 |
|     | LESS 20% DISCOUNT  |                       | -2,216.68                  | -644.64           |
|     |  |                       | 8,866.72                   | 2,578.56          |
|     | SPECIAL NETT ITEMS   |                       |                            |                   |
| 1   | FRONT NUMBER PLATE (SN)  | CRUMPLED              | 35.00                      | 35.00             |
|     |  |                       | 35.00                      | 35.00             |
|     | <u>LABOUR</u>  |                       |                            |                   |
|     | TO DISMANTLE &CHANGE FRONT BUMPER,FRONT<br>GRILLE,FRONT REINFORCEMENT,FRONT SUPPORT<br>PANEL,FRONT LH/RH HEADLAMP,KNOCKING & PULL<br>STRAIGH FRONT CHASSIS FRAME AND ALL AREA<br>AFFECTED BY ACCIDENT. |                       | 800.00                     | 200.00            |
|     | TO PERFORM WIRE CHECKING.  |                       | 20.00                      | 20.00             |
|     | TO SPRAY FRONT BUMPER,FRONT REINFORCEMENT<br>AND FRONT CHASSIS FRAME.  |                       | 800.00                     | 200.00            |
|     |  |                       | 1,620.00                   | 420.00            |
|     | GRAND TOTAL  |                       | 10,521.72                  | 3,033.56          |
|     | RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)   |                       |                            | 2,450.00          |

Report Ref No. CS/INC20000305/Qqd3n2





Report Ref No. CS/INC20000305/Qqd3n2

Ja

OI SUN PIN

**Asst. Automotive Assessor** 



K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### PHOTOGRAPHS FOR VEHICLE NO. SKN 7952C

INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315







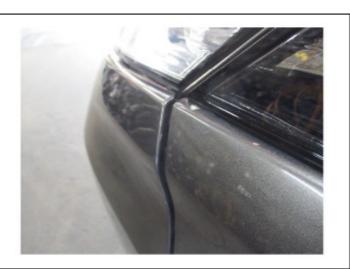







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

#### PHOTOGRAPHS FOR VEHICLE NO. SKN 7952C

#### RE-INSPECTION







